Want to get going? Go to the Quickstart (p. 37) section.



## Guarantee

This equipment is guaranteed against defects in materials and workmanship. We will repair or replace products which prove to be defective during the guarantee period as detailed on your invoice, provided they are returned to us prepaid. The guarantee will not apply to:

- Equipment which has been modified or altered in any way without the written permission of Campbell Scientific
- Batteries
- Any product which has been subjected to misuse, neglect, acts of God or damage in transit.

Campbell Scientific will return guaranteed equipment by surface carrier prepaid. Campbell Scientific will not reimburse the claimant for costs incurred in removing and/or reinstalling equipment. This guarantee and the Company's obligation thereunder is in lieu of all other guarantees, expressed or implied, including those of suitability and fitness for a particular purpose. Campbell Scientific is not liable for consequential damage.

Please inform us before returning equipment and obtain a Repair Reference Number whether the repair is under guarantee or not. Please state the faults as clearly as possible, and if the product is out of the guarantee period it should be accompanied by a purchase order. Quotations for repairs can be given on request. It is the policy of Campbell Scientific to protect the health of its employees and provide a safe working environment, in support of this policy a "Declaration of Hazardous Material and Decontamination" form will be issued for completion.

When returning equipment, the Repair Reference Number must be clearly marked on the outside of the package. Complete the "Declaration of Hazardous Material and Decontamination" form and ensure a completed copy is returned with your goods. Please note your Repair may not be processed if you do not include a copy of this form and Campbell Scientific Ltd reserves the right to return goods at the customers' expense.

Note that goods sent air freight are subject to Customs clearance fees which Campbell Scientific will charge to customers. In many cases, these charges are greater than the cost of the repair.



Campbell Scientific Ltd, 80 Hathern Road, Shepshed, Loughborough, LE12 9GX, UK Tel: +44 (0) 1509 601141 Fax: +44 (0) 1509 270924

Email: support@campbellsci.co.uk www.campbellsci.co.uk

## PLEASE READ FIRST

#### About this manual

Please note that this manual was originally produced by Campbell Scientific Inc. primarily for the North American market. Some spellings, weights and measures may reflect this origin.

Some useful conversion factors:

**Area:**  $1 \text{ in}^2 \text{ (square inch)} = 645 \text{ mm}^2$  **Mass:** 1 oz. (ounce) = 28.35 g

1 lb (pound weight) = 0.454 kg

**Length:** 1 in. (inch) = 25.4 mm

1 ft (foot) = 304.8 mm **Pressure:** 1 psi (lb/in<sup>2</sup>) = 68.95 mb

1 yard = 0.914 m1 mile = 1.609 km **Volume:** 1 UK pint = 568.3 ml

> 1 UK gallon = 4.546 litres 1 US gallon = 3.785 litres

In addition, while most of the information in the manual is correct for all countries, certain information is specific to the North American market and so may not be applicable to European users.

Differences include the U.S standard external power supply details where some information (for example the AC transformer input voltage) will not be applicable for British/European use. *Please note, however, that when a power supply adapter is ordered it will be suitable for use in your country.* 

Reference to some radio transmitters, digital cell phones and aerials may also not be applicable according to your locality.

Some brackets, shields and enclosure options, including wiring, are not sold as standard items in the European market; in some cases alternatives are offered. Details of the alternatives will be covered in separate manuals.

Part numbers prefixed with a "#" symbol are special order parts for use with non-EU variants or for special installations. Please quote the full part number with the # when ordering.

#### **Recycling information**



At the end of this product's life it should not be put in commercial or domestic refuse but sent for recycling. Any batteries contained within the product or used during the products life should be removed from the product and also be sent to an appropriate recycling facility.

Campbell Scientific Ltd can advise on the recycling of the equipment and in some cases arrange collection and the correct disposal of it, although charges may apply for some items or territories.

For further advice or support, please contact Campbell Scientific Ltd, or your local agent.



## **Precautions**

DANGER — MANY HAZARDS ARE ASSOCIATED WITH INSTALLING, USING, MAINTAINING, AND WORKING ON OR AROUND **TRIPODS, TOWERS, AND ANY ATTACHMENTS TO TRIPODS AND TOWERS SUCH AS SENSORS, CROSSARMS, ENCLOSURES, ANTENNAS, ETC.** FAILURE TO PROPERLY AND COMPLETELY ASSEMBLE, INSTALL, OPERATE, USE, AND MAINTAIN TRIPODS, TOWERS, AND ATTACHMENTS, AND FAILURE TO HEED WARNINGS, INCREASES THE RISK OF DEATH, ACCIDENT, SERIOUS INJURY, PROPERTY DAMAGE, AND PRODUCT FAILURE. TAKE ALL REASONABLE PRECAUTIONS TO AVOID THESE HAZARDS. CHECK WITH YOUR ORGANIZATION'S SAFETY COORDINATOR (OR POLICY) FOR PROCEDURES AND REQUIRED PROTECTIVE EQUIPMENT PRIOR TO PERFORMING ANY WORK.

Use tripods, towers, and attachments to tripods and towers only for purposes for which they are designed. Do not exceed design limits. Be familiar and comply with all instructions provided in product manuals. Manuals are available at www.campbellsci.eu or by telephoning +44(0) 1509 828 888 (UK). You are responsible for conformance with governing codes and regulations, including safety regulations, and the integrity and location of structures or land to which towers, tripods, and any attachments are attached. Installation sites should be evaluated and approved by a qualified engineer. If questions or concerns arise regarding installation, use, or maintenance of tripods, towers, attachments, or electrical connections, consult with a licensed and qualified engineer or electrician.

#### General

- Prior to performing site or installation work, obtain required approvals and permits. Comply with all
  governing structure-height regulations, such as those of the FAA in the USA.
- Use only qualified personnel for installation, use, and maintenance of tripods and towers, and any attachments to tripods and towers. The use of licensed and qualified contractors is highly recommended.
- Read all applicable instructions carefully and understand procedures thoroughly before beginning work.
- Wear a hardhat and eye protection, and take other appropriate safety precautions while working on or around tripods and towers.
- **Do not climb** tripods or towers at any time, and prohibit climbing by other persons. Take reasonable precautions to secure tripod and tower sites from trespassers.
- Use only manufacturer recommended parts, materials, and tools.

#### **Utility and Electrical**

- You can be killed or sustain serious bodily injury if the tripod, tower, or attachments you are installing, constructing, using, or maintaining, or a tool, stake, or anchor, come in contact with overhead or underground utility lines.
- Maintain a distance of at least one-and-one-half times structure height, or 20 feet, or the distance required by applicable law, whichever is greater, between overhead utility lines and the structure (tripod, tower, attachments, or tools).
- Prior to performing site or installation work, inform all utility companies and have all underground utilities marked.
- Comply with all electrical codes. Electrical equipment and related grounding devices should be installed by a licensed and qualified electrician.

#### **Elevated Work and Weather**

- Exercise extreme caution when performing elevated work.
- Use appropriate equipment and safety practices.
- During installation and maintenance, keep tower and tripod sites clear of un-trained or non-essential personnel. Take precautions to prevent elevated tools and objects from dropping.
- Do not perform any work in inclement weather, including wind, rain, snow, lightning, etc.

#### Maintenance

- Periodically (at least yearly) check for wear and damage, including corrosion, stress cracks, frayed cables, loose cable clamps, cable tightness, etc. and take necessary corrective actions.
- Periodically (at least yearly) check electrical ground connections.

WHILE EVERY ATTEMPT IS MADE TO EMBODY THE HIGHEST DEGREE OF SAFETY IN ALL CAMPBELL SCIENTIFIC PRODUCTS, THE CUSTOMER ASSUMES ALL RISK FROM ANY INJURY RESULTING FROM IMPROPER INSTALLATION, USE, OR MAINTENANCE OF TRIPODS, TOWERS, OR ATTACHMENTS TO TRIPODS AND TOWERS SUCH AS SENSORS, CROSSARMS, ENCLOSURES, ANTENNAS, ETC.

# **Table of Contents**

1.	Introduction	31
	1.1 HELLO	31
	1.2 Typography	
	1.3 Capturing CRBasic Code	32
2.	Precautions	33
3.	Initial Inspection	35
-		
4.	Quickstart	37
	4.1 Sensors — Quickstart	37
	4.2 Datalogger — Quickstart	
	4.2.1 CR3000 Module	
	4.2.1.1 Wiring Panel — Quickstart	
	4.3 Power Supplies — Quickstart	
	4.3.1 Internal Battery — Quickstart	
	4.4 Data Retrieval and Comms — Quickstart	40
	4.5 Datalogger Support Software — Quickstart	
	4.6 Tutorial: Measuring a Thermocouple	42
	4.6.1 What You Will Need	
	4.6.2 Hardware Setup	
	4.6.2.1 Connect Internal Power Supply	
	4.6.2.2 Connect External Power Supply	
	4.6.2.3 Connect Comms	
	4.6.3 PC200W Software Setup	
	4.6.4 Write CRBasic Program with Short Cut	
	4.6.4.1 Procedure: (Short Cut Steps 1 to 5)	
	4.6.4.2 Procedure: (Short Cut Steps 6 to 7)	
	4.6.4.3 Procedure: (Short Cut Step 8)	
	4.6.4.4 Procedure: (Short Cut Steps 9 to 12)	
	4.6.4.5 Procedure: (Short Cut Steps 13 to 14)	
	4.6.5 Send Program and Collect Data	49
	4.6.5.1 Procedure: (PC200W Step 1)	
	4.6.5.2 Procedure: (PC200W Steps 2 to 4)	
	4.6.5.4 Procedure: (PC200W Step 5)	
	4.6.5.4 Procedure: (PC200W Step 6)	
	4.6.5.6 Procedure: (PC200W Steps 11 to 12)	
	4.6.5.7 Procedure: (PC200W Steps 11 to 12)	
	4.7 Data Acquisition Systems — Quickstart	
	4.7 Data Acquistion Systems — Quickstart	33
5.	Overview	57
	5.1 Datalogger — Overview	58
	5.1.1 Wiring Panel — Overview	
	5.1.1.1 Switched Voltage Output — Overview	62
	5.1.1.2 Voltage and Current Excitation — Overview	
	5.1.1.3 Power Terminals	
	5.1.1.3.1 Power In Terminals	63

	5.1.1.3.2 Power Out Terminals	
	5.1.1.4 Communication Ports — Overview	64
	5.1.1.4.1 CS I/O Port	65
	5.1.1.4.2 RS-232 Ports	65
	5.1.1.4.3 Peripheral Port	65
	5.1.1.4.4 SDI-12 Ports	
	5.1.1.4.5 SDM Port	
	5.1.1.4.6 CPI Port and CDM Devices — Overview	66
	5.1.1.4.7 Ethernet Port	66
	5.1.1.5 Grounding — Overview	66
5.2	Measurements — Overview	67
	5.2.1 Time Keeping — Overview	. 67
	5.2.2 Analog Measurements — Overview	
	5.2.2.1 Voltage Measurements — Overview	
	5.2.2.1.1 Single-Ended Measurements — Overview	. 70
	5.2.2.1.2 Differential Measurements — Overview	. 71
	5.2.2.2 Current Measurements — Overview	
	5.2.2.3 Resistance Measurements — Overview	
	5.2.2.3.1 Voltage Excitation	
	5.2.2.3.2 Current Excitation	
	5.2.2.4 Strain Measurements — Overview	
	5.2.3 Pulse Measurements — Overview	
	5.2.3.1 Pulses Measured	
	5.2.3.2 Pulse Input Channels	
	5.2.3.3 Pulse Sensor Wiring	
	5.2.4 Period Averaging — Overview	76
	5.2.5 Vibrating Wire Measurements — Overview	77
	5.2.5 Vibrating wire Measurements — Overview	. / /
	5.2.6 Reading Smart Sensors — Overview	
	5.2.6.1 SDI-12 Sensor Support — Overview	
	5.2.6.2 RS-232 — Overview	. 78
	5.2.7 Field Calibration — Overview	
	5.2.8 Cabling Effects — Overview	. 79
	5.2.9 Synchronizing Measurements — Overview	. 79
	5.2.9.1 Synchronizing Measurements in the CR3000 — Overview	90
		. 00
	5.2.9.2 Synchronizing Measurements in a Datalogger  Network — Overview	90
<i>5</i> 2		
5.3		
	5.3.1 Data File Formats in CR3000 Memory	
	5.3.2 Data Format on Computer	
	5.3.3 Mass-Storage Device	
	5.3.4 Memory Card (CRD: Drive) — Overview	
	5.3.4.1 Comms	
	5.3.4.2 Direct with Adapter to PC	
	5.3.5 Comms Protocols	
	5.3.5.1 PakBus Comms — Overview	
	5.3.6 Alternate Comms Protocols — Overview	
	5.3.6.1 Modbus — Overview	
	5.3.6.2 DNP3 — Overview	
	5.3.6.3 TCP/IP — Overview	
	5.3.7 Comms Hardware — Overview	84
	5.3.8 Keyboard/Display — Overview	
	5.3.8.1 Integrated Keyboard/Display	
	5.3.8.2 Character Set	
	5.3.8.3 Custom Menus — Overview	85

	5.4 Measurement and Control Peripherals — Overview	
	5.5 Power Supplies — Overview	
	5.6 CR3000 Setup — Overview	
	5.7 CRBasic Programming — Overview	
	5.8 Security — Overview	
	5.9 Maintenance — Overview	
	5.9.1 Protection from Moisture — Overview	
	5.9.2 Protection from Voltage Transients — Overview	
	5.9.3 Factory Calibration — Overview	
	5.9.4 Internal Battery — Overview	
	5.11 PLC Control — Overview	
	5.12 Auto Self-Calibration — Overview	91
	5.13 Memory — Overview	
	5.15 Michief — Overview	)3
6.	Specifications	05
0.	Specifications	33
_	1 4 11 41	
7.	Installation	97
	7.1 Enclosures — Details	97
	7.2 Power Supplies — Details	
	7.2.1 CR3000 Power Requirement	
	7.2.2 Calculating Power Consumption	
	7.2.3 Power Sources	
	7.2.3.1 Vehicle Power Connections	
	7.2.4 Uninterruptable Power Supply (UPS)	
	7.2.5 External Power Supply Installation	
	7.2.6 External Alkaline Power Supply	
	7.2.7 Integrated Batteries	101
	7.2.7.1 Alkaline-Battery Base	102
	7.2.7.2 Sealed Rechargeable-Battery Base	
	7.2.7.3 Low Profile (No Battery) Base	
	7.3 Grounding — Details	
	7.3.1 ESD Protection	
	7.3.1.1 Lightning Protection	
	7.3.2 Single-Ended Measurement Reference	
	7.3.3 Ground Potential Differences	
	7.3.3.1 Soil Temperature Thermocouple	
	7.3.3.2 External Signal Conditioner	
	7.3.4 Ground Looping in Ionic Measurements	
	7.4 Protection from Moisture — Details	
	7.5.1 Tools — Setup	
	7.5.1.1 DevConfig — Setup Tools	
	7.5.1.1 Develoing — Setup Tools	
	7.5.1.2.1 Overview — Network Planner	
	7.5.1.2.2 Basics — Network Planner	
	7.5.1.3 Info Tables and Settings — Setup Tools	
	7.5.1.4 CRBasic Program — Setup Tools	
	7.5.1.5 Executable CPU: Files — Setup Tools	
	7.5.1.5.1 Default.cr3 File	
	7.5.1.5.2 "Include" File	
	7.5.1.5.3 Executable File Run Priorities	

		Tasks	
	7.5.2.1	Operating System (OS) — Details	
	7.5.2.	1 &	
	7.5.2.	1.2 OS Update with File Control	125
	7.5.2.	1.3 OS Update with Send Program Command	126
	7.5.2.		
		PowerUp.ini File	127
	7.5.2.2	Factory Defaults — Installation	
	7.5.2.3	Saving and Restoring Configurations — Installation	128
7.6	CRBasic Pr	ogramming — Details	129
,.0		n Structure	
		g and Editing Programs	
	7.6.2.1	Short Cut Programming Wizard	132
		CRBasic Editor	
	7.6.2.2		
	7.6.2.2		
		8 8	
		nming Syntax	
		Program Statements	
	7.6.3.		
	7.6.3.1	1	
		Single-Statement Declarations	
		Declaring Variables	
	7.6.3.3	Ç 71	
	7.6.3.3	$oldsymbol{arepsilon}$	
	7.6.3.3		
	7.6.3.3	6 6	
		Using Variable Pointers	
		Declaring Arrays	
	7.6.3.	· J	
		Declaring Local and Global Variables	
		nitializing Variables	
		Declaring Constants	
	7.6.3.8		
		Declaring Aliases and Units	
		Numerical Formats	
		Multi-Statement Declarations	
	7.6.3.	<u> </u>	
	7.6.3.	11.2 Declaring Subroutines	158
	7.6.3.	11.3 Declaring Subroutines	
	7.6.3.		
	7.6.3.12	Execution and Task Priority	160
	7.6.3.	12.1 Pipeline Mode	161
	7.6.3.	12.2 Sequential Mode	162
	7.6.3.13	Execution Timing	163
	7.6.3.	13.1 Scan() / NextScan	163
	7.6.3.	13.2 SlowSequence / EndSequence	164
	7.6.3.	13.3 SubScan() / NextSubScan	165
	7.6.3.		
	7.6.3.14	Programming Instructions	
	7.6.3.		
	7.6.3.		
	7.6.3.		
		Expressions in Arguments	
		Programming Expression Types	
	7.6.3.		
		_	

		1 7 1
	7.6.3.16.2 Arithmetic Operations	
	7.6.3.16.3 Expressions with Numeric Data Types	
	7.6.3.16.4 Logical Expressions	
	7.6.3.16.5 String Expressions	
	7.6.3.17 Programming Access to Data Tables	
	7.6.3.18 Programming to Use Signatures	
	7.6.3.19 Functions (with a capital F)	
	7.6.4 Sending CRBasic Programs	
	7.6.4.1 Preserving Data at Program Send	180
7.7	Programming Resource Library	181
	7.7.1 Advanced Programming Techniques	181
	7.7.1.1 Capturing Events	
	7.7.1.2 Conditional Output	
	7.7.1.3 Groundwater Pump Test	
	7.7.1.4 Miscellaneous Features	
	7.7.1.5 PulseCountReset Instruction	
	7.7.1.6 Scaling Array	
	7.7.1.7 Signatures: Example Programs	
	7.7.1.7.1 Text Signature	
	7.7.1.7.2 Binary Runtime Signature	
	7.7.1.7.2 Binary Runtime Signature	
	7.7.1.8 Use of Multiple Scans	102
	7.7.2 Data Input: Loading Large Data Sets	
	7.7.3 Data Input: Array-Assigned Expression	
	7.7.4 Data Output: Calculating Running Average	
	7.7.5 Data Output: Two Intervals in One Data Table	
	7.7.6 Data Output: Triggers and Omitting Samples	
	7.7.7 Data Output: Using Data Type Bool8	
	7.7.8 Data Output: Using Data Type NSEC	
	7.7.8.1 NSEC Options	
	7.7.9 Data Output: Wind Vector	211
	7.7.9.1 OutputOpt Parameters	212
	7.7.9.2 Wind Vector Processing	212
	7.7.9.2.1 Measured Raw Data	213
	7.7.9.2.2 Calculations	
	7.7.10 Data Output: Writing High-Frequency Data to Memory	
	Cards	217
	7.7.10.1 TableFile() with Option 64	
	7.7.10.2 TableFile() with Option 64 Replaces CardOut()	
	7.7.10.3 TableFile() with Option 64 Programming	
	7.7.10.4 Converting TOB3 Files with CardConvert	
	7.7.10.5 TableFile() with Option 64 Q & A	
	7.7.11 Displaying Data: Custom Menus — Details	220
	7.7.11 Displaying Data. Custom Metus — Details	
	7.7.12 Field Calibration CAL Files	
	7.7.12.2 Field Calibration Programming	
	7.7.12.3 Field Calibration Wizard Overview	
	7.7.12.4 Field Calibration Numeric Monitor Procedures	
	7.7.12.4.1 One-Point Calibrations (Zero or Offset)	
	7.7.12.4.2 Two-Point Calibrations (gain and offset)	
	7.7.12.4.3 Zero Basis Point Calibration	
	7.7.12.5 Field Calibration Examples	
	7.7.12.5.1 FieldCal() Zero or Tare (Opt 0) Example	
	7.7.12.5.2 FieldCal() Offset (Opt 1) Example	235

7.7.12.5.3 FieldCal() Slope and Offset (Opt 2) Example	. 238
7.7.12.5.4 FieldCal() Slope (Opt 3) Example	
7.7.12.5.5 FieldCal() Zero Basis (Opt 4) Example	
7.7.12.6 Field Calibration Strain Examples	
7.7.12.6.1 FieldCalStrain() Shunt Calibration Concepts	
7.7.12.6.2 FieldCalStrain() Shunt Calibration Example	
7.7.12.6.3 FieldCalStrain() Quarter-Bridge Shunt	
Example	. 246
7.7.12.6.4 FieldCalStrain() Quarter-Bridge Zero	
7.7.13 Measurement: Fast Analog Voltage	
7.7.13.1 Tips — Fast Analog Voltage	
7.7.14 Measurement: Excite, Delay, Measure	
7.7.15 Serial I/O: SDI-12 Sensor Support — Details	
7.7.15.1 SDI-12 Transparent Mode	
7.7.15.1.1 SDI-12 Transparent Mode Commands	. 256
7.7.15.2 SDI-12 Recorder Mode	
7.7.15.2.1 Alternate Start Concurrent Measurement	0 1
Command	263
7.7.15.2.2 SDI-12 Extended Command Support	
7.7.15.3 SDI-12 Sensor Mode	
7.7.15.4 SDI-12 Power Considerations	
7.7.16 Compiling: Conditional Code	
7.7.17 Measurement: RTD, PRT, PT100, PT1000	
7.7.17.1 Measurement Theory (PRT)	
7.7.17.2 General Procedure (PRT)	
7.7.17.3 Example: $100 \Omega PRT$ in Four-Wire Half Bridge with	. 213
Voltage Excitation (PT100 / BrHalf4W())	277
7.7.17.4 Example: $100 \Omega$ PRT in Three-Wire Half Bridge with	. 211
Voltage Excitation (PT100 / BrHalf3W())	281
7.7.17.5 Example: $100 \Omega$ PRT in Four-Wire Full Bridge with	. 201
Voltage Excitation (PT100 / BrFull())	285
7.7.17.6 Example: 100 Ω PRT in Four-Wire Basic Circuit	. 203
(PT100 / Basic Resistance())	290
7.7.17.7 Example: $100 \Omega$ PRT in Four-Wire Full Bridge with	. 270
Current Excitation (PT100 / Full-Bridge	
Resistance())	296
7.7.17.8 PRT Callendar-Van Dusen Coefficients	
7.7.17.9 Self-Heating and Resolution	
7.7.18 Serial I/O: Capturing Serial Data	
7.7.18.1 Introduction	
7.7.18.2 I/O Ports	
7.7.18.3 Protocols	
7.7.18.4 Glossary of Serial I/O Terms	
7.7.18.5 Serial I/O CRBasic Programming	
7.7.18.5.1 Serial I/O Programming Basics	
7.7.18.5.2 Serial I/O Input Programming Basics	
7.7.18.5.3 Serial I/O Output Programming Basics	
7.7.18.5.4 Serial I/O Translating Bytes	
7.7.18.5.5 Serial I/O Memory Considerations	
7.7.18.5.6 Serial I/O Example I	
7.7.18.6 Serial I/O Application Testing	
7.7.18.6.1 Configure HyperTerminal	316
7.7.18.6.2 Create Send-Text File	310
7.7.18.6.3 Create Text-Capture File	
7.7.18.6.4 Serial I/O Example II	
7.7.10.0.7 Serial I/O Example II	. 117

	7.7.18.7 Serial I/O Q & A	325
	7.7.19 String Operations	
	7.7.19.1 String Operators	
	7.7.19.2 String Concatenation	
	7.7.19.3 String NULL Character	
	7.7.19.4 Inserting String Characters	
	7.7.20 Subroutines	332
8.	Operation3	35
Ο.	-	
	8.1 Measurements — Details	
	8.1.1 Time Keeping — Details	
	8.1.1.1 Time Stamps	
	8.1.2 Analog Measurements — Details	
	8.1.2.1 Voltage Measurement Quality	
	8.1.2.2 Thermocouple Measurements — Details	
	8.1.2.2.1 Thermocouple Error Analysis	
	8.1.2.3 Resistance Measurements — Details	
	8.1.2.3.1 Ac Excitation	
	8.1.2.3.2 Accuracy — Resistance Measurements	
	8.1.2.4 Auto Self-Calibration — Details	
	8.1.2.4.1 Auto Self-Calibration Process	
	8.1.2.5 Strain Measurements — Details	
	8.1.2.6 Current Measurements — Details	
	8.1.2.7 Voltage Measurements — Details	
	8.1.2.7.1 Voltage Measurement Limitations	
	8.1.2.7.2 Voltage Measurement Mechanics	383
	8.1.2.7.3 Voltage Measurement Quality	
	8.1.3 Pulse Measurements — Details	
	8.1.3.1 Pulse Measurement Terminals	
	8.1.3.2 Low-Level Ac Measurements — Details	407
	8.1.3.3 High-Frequency Measurements	
	8.1.3.3.1 Frequency Resolution	
	8.1.3.3.2 Frequency Measurement Q & A	
	8.1.3.4 Switch Closure and Open-Collector Measurements	
	8.1.3.5 Edge Timing	
	8.1.3.6 Edge Counting	
	8.1.3.7 Timer Input on I/O NAN Conditions	
	8.1.3.8 Pulse Measurement Tips	
	8.1.3.8.1 Pay Attention to Specifications	
	8.1.3.8.2 Input Filters and Signal Attenuation	
	8.1.4 Vibrating Wire Measurements — Details	
	8.1.5 Period Averaging — Details	
	8.1.6 Reading Smart Sensors — Details	
	8.1.6.1 RS-232 and TTL — Details	
	8.1.6.2 SDI-12 Sensor Support — Details	
	8.1.7 Field Calibration — Overview	420
	8.1.8 Cabling Effects — Details	421
	8.1.8.1 Analog Sensor Cabling	
	8.1.8.2 Current Excitation Cabling	
	8.1.8.3 Pulse Sensor Cabling	
	8.1.8.4 RS-232 Sensor Cabling	

		and the second s
	8.1.8.5	SDI-12 Sensor Cabling
		nronizing Measurements — Details
	8.1.9.1	Synchronizing Measurement in the CR3000 —
		Details
	8.1.9.2	Synchronizing Measurements in a Datalogger
		Network — Details
8.2	Switched-	Voltage Output — Details
	8.2.1 Switc	hed-Voltage Excitation
	8.2.2 Switc	hed-Current Excitation (IX Terminals)
		nuous-Regulated (5V Terminal)426
		nuous-Analog Out (CAO Terminal)426
		nuous-Unregulated Voltage (12V Terminal)
		hed-Unregulated Voltage (SW12 Terminal)
8.3		rol — Details
0.5		inals Configured for Control
8.4		nent and Control Peripherals — Details
о.т		og Input Modules
		og Output Modules
		Control Modules — Overview
		Relays and Relay Drivers430
	0.4.3.1	Relays and Relay Drivers430
		Component-Built Relays
		Input Modules 431
	8.4.4.1	Low-Level Ac Input Modules — Overview
		I/O Modules — Details
		inal-Input Modules
		ting Wire Modules
8.5	Datalogge	r Support Software — Details
8.6	Program a	and OS File Compression Q and A
8.7		– Details
		erabilities
	8.7.2 Pass-	Code Lockout
	8.7.3 Passv	vords
	8.7.3.1	.csipasswd
	8.7.3.2	PakBus Instructions
	8.7.3.3	TCP/IP Instructions
	8.7.3.4	Settings — Passwords
	8.7.4 File E	Encryption440
		nunication Encryption
		g Files
		tures
		Only Variables441
8.8		— Details
0.0		ge Media
	8.8.1.1	
	8.8.1	
		1.1.2 CPU: Drive
		1.1.3 USR: Drive
		1.1.4 USB: Drive
	0.0	Memory Card (CRD: Drive)
	8.8.1.2	
		File Formats
		ory Cards and Record Numbers
		ting the CR3000
	8.8.4.1	Full Memory Reset
	8.8.4.2	Program Send Reset
	8813	Manual Data-Table Reset 455

	4=-
8.8.4.4 Formatting Drives	
8.8.5 File Management in CR3000 Memory	
8.8.5.1 File Attributes	
8.8.5.2 Files Manager	
8.8.5.3 Data Preservation	
8.8.5.4 Powerup.ini File — Details	
8.8.5.4.1 Creating and Editing Powerup.ini	
8.8.5.5 File Management Q & A	
8.8.6 File Names	
8.8.7 File System Errors	
8.8.8 Memory Q & A	
3.9 Data Retrieval and Comms — Details	
8.9.1 Protocols	
8.9.2 Conserving Bandwidth	466
8.9.3 Initiating Comms (Callback)	467
3.10 Alternate Comms Protocols	
8.10.1 TCP/IP — Details	
8.10.1.1 FYIs — OS2; OS28	469
8.10.1.2 DHCP	
8.10.1.3 DNS	469
8.10.1.4 FTP Server	469
8.10.1.5 FTP Client	470
8.10.1.6 HTTP Web Server	470
8.10.1.6.1 Default HTTP Web Server	470
8.10.1.6.2 Custom HTTP Web Server	471
8.10.1.7 Micro-Serial Server	
8.10.1.8 Modbus TCP/IP	
8.10.1.9 PakBus Over TCP/IP and Callback	
8.10.1.10 Ping (IP)	
8.10.1.11 SNMP	
8.10.1.12 Telnet	
8.10.1.13 SMTP	
8.10.1.14 Web API	
8.10.1.15 Web API — Details	
8.10.2 DNP3 — Details	
8.10.3 Modbus — Details	
8.10.3.1 Modbus Terminology	
8.10.3.1.1 Glossary of Modbus Terms	
8.10.3.2 Programming for Modbus	
8.10.3.2.1 Declarations (Modbus Programming)	
8.10.3.2.2 CRBasic Instructions (Modbus)	
8.10.3.2.3 Addressing (ModbusAddr)	
8.10.3.2.4 Supported Modbus Function Codes	
8.10.3.2.5 Reading Inverse Format Modbus Registers	
8.10.3.2.6 Timing	
8.10.3.3 Troubleshooting (Modbus)	480
8.10.3.4 Modbus over IP	
8.10.3.5 Modbus Security	
8.10.3.6 Modbus Over RS-232 7/E/1	
8.10.3.7 Converting Modbus 16-Bit to 32-Bit Longs	
8.11 Keyboard/Display — Details	483
8.11.1 Character Set	
8.11.2 Data Display	
8.11.2.1 Real-Time Tables and Graphs	
0.11.2.1 Rear-Time Tables and Oraphs	TOU

	8.11.2.2 Real-Time Custom	
	8.11.2.3 Final-Storage Data	488
	8.11.3 Run/Stop Program	
	8.11.4 File Management	
	8.11.4.1 File Edit	
	8.11.5 PCCard (Memory Card) Management	
	8.11.6 Port Status and Status Table	
	8.11.7 Settings	
	8.11.7.1 CR1000KD: Set Time / Date	
	8.11.7.2 CR1000KD: PakBus Settings	
	8.11.8 Configure Display 8.12 CPI Port and CDM Devices — Details	
	8.12 CF1 Fort and CDIVI Devices — Details	494
9.	Maintenance — Details	497
	9.1 Protection from Moisture — Details	407
	9.1 Protection from Wolsture — Details	
	9.3 Factory Calibration or Repair Procedure	
	7.5 Tactory Cantilation of Repair Procedure	500
10	Troubleshooting	503
10.	_	
	10.1 Troubleshooting — Essential Tools	503
	10.2 Troubleshooting — Basic Procedure	
	10.3 Troubleshooting — Error Sources	
	10.4 Troubleshooting — Status Table	
	10.5 Troubleshooting — CRBasic Programs	
	10.5.1 Program Does Not Compile	
	10.5.2 Program Compiles / Does Not Run Correctly	
	10.5.3 NAN and ±INF	
	10.5.3.1 Measurements and NAN	
	10.5.3.1.1 Voltage Measurements	
	10.5.3.1.2 SDI-12 Measurements	
	10.5.3.2 Floating-Folit Math, NAN, and ±INF	507
	10.5.3.4 Output Processing and NAN	
	10.5.4 Status Table as Debug Resource	
	10.5.4.1 CompileResults	
	10.5.4.2 SkippedScan	
	10.5.4.3 SkippedSystemScan	
	10.5.4.4 SkippedRecord	
	10.5.4.5 ProgErrors	
	10.5.4.6 MemoryFree	513
	10.5.4.7 VarOutOfBounds	513
	10.5.4.8 Watchdog Errors	
	10.5.4.8.1 Status Table WatchdogErrors	
	10.5.4.8.2 Watchdoginfo.txt File	
	10.6 Troubleshooting — Operating Systems	515
	10.7 Troubleshooting — Auto Self-Calibration Errors	515
	10.8 Troubleshooting — Communications	516
	10.8.1 RS-232	
	10.8.2 Communicating with Multiple PCs	
	10.8.3 Comms Memory Errors	
	10.9 Troubleshooting — Power Supplies — Overview	
	10.9.1 Troubleshooting Power Supplies — Overview	
	10.7.2 Hodoreshooting I ower puppines — Lampies	210

	10.9.3 Troubleshooting Power Supplies — Procedures	518
	10.9.3.1 Battery Test	518
	10.9.3.2 Charging Regulator with Solar Panel Test	
	10.9.3.3 Charging Regulator with Transformer Test	
	10.9.3.4 Adjusting Charging Voltage	522
	10.10 Troubleshooting — Using Terminal Mode	
	10.10.1 Serial Talk Through and Comms Watch	526
	10.11 Troubleshooting — Using Logs	526
	10.12 Troubleshooting — Data Recovery	526
	10.13 Troubleshooting — Miscellaneous Errors	
	10.13.1 Voltage Calibration Error!	
	10.14 Troubleshooting — Rebooting	528
11	Glocomy	<b>5</b> 20
	. Glossary	. 525
	11.1 Terms	529
	11.2 Concepts	563
	11.2.1 Accuracy, Precision, and Resolution	563
12	Attributions	EGE
14.	. Attributions	. ၁၀၁
1 n	nondioos	
Aρ	ppendices	
Δ	Info Tables and Settings	567
Α.		
	A.1 Info Tables and Settings Directories	
	A.1.1.1 Info Tables and Settings: Frequently Used	
	A.1.1.2 Info Tables and Settings: Keywords	570
	A.1.1.3 Info Tables and Settings: Accessed by Keyboard/	
	Display	
	A.1.1.4 Info Tables and Settings: Communications	
	A.1.1.5 Info Tables and Settings: Programming	
	A.1.1.6 Info Tables and Settings: Other	
	A.2 Info Tables and Settings Descriptions	576
В.	Serial Port Pinouts	. 595
	B.1 CS I/O Communication Port	
	B.2.1 Pin Outs B.2.2 Power States	
	5.2.2 Tower states	557
C.	FP2 Data Format	. 599
D.	Endianness	. 601
=	Supporting Products — List	603
۵.	•	
	E.1 Dataloggers — List	
	E.2 Measurement and Control Peripherals — List	
	E.3 Sensor-Input Modules — List	
	F 3.1 Analog Input Modules — List	604

Б	2.2 D.1 I -4M 1.1 I'4	(0.4
	3.2 Pulse Input Modules — List	604
	3.3 Serial I/O Modules — List	605
	3.4 Vibrating Wire Input Modules — List	
E.	3.5 Passive Signal Conditioners — List	
	E.3.5.1 Resistive-Bridge TIM Modules — List	
	E.3.5.2 Voltage Divider Modules — List	
	E.3.5.3 Current-Shunt Modules — List	
Г	E.3.5.4 Transient Voltage Suppressors — List	
	3.6 Terminal Strip Covers — List	
E.4	PLC Control Modules — Lists	
	4.1 Digital-I/O Modules — List	60 /
	4.2 Continuous-Analog Output (CAO) Modules — List	607
	4.3 Relay-Drivers — List	
<del>-</del> -	4.4 Current-Excitation Modules — List	
E.5	Sensors — Lists	
	5.1 Wired-Sensor Types — List	
	5.2 Wireless-Network Sensors — List	
E.6	Cameras — List	
E.7	Data Retrieval and Comms Peripherals — List	
	7.1 Keyboard/Display — List	
	7.2 Hardwire, Single-Connection Comms Devices — List	
	7.3 Hardwire, Networking Devices — List	
	7.4 TCP/IP Links — List	
	7.5 Telephone Modems — List	612
	7.6 Private-Network Radios — List	
	7.7 Satellite Transceivers — List	
E.8	Data Storage Devices — List	
E.9	Datalogger Support Software — List	
	9.1 Starter Software — List	
E.	9.2 Datalogger Support Software — List	
г	E.9.2.1 LoggerNet Suite — List	
	9.3 Software Tools — List	
	9.4 Software Development Kits — List	
	Power Supplies — List	
E.	10.1 Battery / Regulator Combinations — List	618
E.	10.2 Batteries — List	
E	E.10.2.1 CR3000 Battery Bases — List	
	10.4 P	
	10.4 Primary Power Sources — List	
	10.5 24 Vdc Power Supply Kits — List	
E.11	Enclosures — List	
E.12	Tripods, Towers, and Mounts — List	
E.13	Protection from Moisture — List	622
11 .		005
ınaex		625
List of Figur	es	
FIGUI	RE 1: Wiring Panel	39
	RE 2: Connect Power and Comms (Internal-Power Supply)	
	RE 3: Connect Power and Comms (External-Power Supply)	
	RE 4: PC200W Main Window	
	RE 5: Short Cut Temperature Sensor Folder	
	RE 6: Short Cut Outputs Tab	
	<del>-</del>	

FIGURE 7: Short Cut Compile Confirmation Window and Results Tab	
FIGURE 8: PC200W Main Window	
FIGURE 9: PC200W Monitor Data Tab – Public Table	
FIGURE 10: PC200W Monitor Data Tab — Public and OneMin Tables	. 52
FIGURE 11: PC200W Collect Data Tab	. 52
FIGURE 12: PC200W View Data Utility	. 53
FIGURE 13: PC200W View Data Table	. 54
FIGURE 14: PC200W View Line Graph	. 55
FIGURE 15: Data Acquisition System Components	. 56
FIGURE 16: Data Acquisition System — Overview	
FIGURE 17: Wiring Panel	
FIGURE 18: Control and Monitoring with C terminals	
FIGURE 19: Analog Sensor Wired to Single-Ended Channel #1	
FIGURE 20: Analog Sensor Wired to Differential Channel #1	
FIGURE 21: Half-Bridge Wiring Example — Wind Vane Potentiometer	
FIGURE 22: Full-Bridge Wiring Example — Pressure Transducer	
FIGURE 23: Pulse Sensor Output Signal Types	
FIGURE 24: Pulse Input Wiring Example — Anemometer	
FIGURE 25: Terminals Configurable for RS-232 Input	
FIGURE 26: Use of RS-232 and Digital I/O when Reading RS-232	
Devices	. 79
FIGURE 27: Custom Menu Example	
FIGURE 28: Enclosure	
FIGURE 29: Connecting to Vehicle Power Supply	
FIGURE 30: Alkaline Battery Orientation	
FIGURE 31: Sealed-Rechargeable Battery Wiring	
FIGURE 32: Schematic of Grounds	
FIGURE 33: Lightning Protection Scheme	
FIGURE 34: Model of a Ground Loop with a Resistive Sensor	
FIGURE 35: Device Configuration Utility (DevConfig)	114
FIGURE 36: Network Planner Setup	
FIGURE 37: "Include" File Settings With DevConfig	120
FIGURE 38: "Include" File Settings With PakBusGraph	121
FIGURE 39: Summary of CR3000 Configuration	129
FIGURE 40: Sequential-Mode Scan Priority Flow Diagrams	167
FIGURE 41: CRBasic Editor Program Send File Control window	181
FIGURE 42: Running-Average Frequency Response	200
FIGURE 43: Running-Average Signal Attenuation	200
FIGURE 44: Data from TrigVar Program	203
FIGURE 45: Alarms Toggled in Bit Shift Example	205
FIGURE 46: Bool8 Data from Bit Shift Example (Numeric Monitor)	
FIGURE 47: Bool8 Data from Bit Shift Example (PC Data File)	206
FIGURE 48: Input Sample Vectors	214
FIGURE 49: Mean Wind-Vector Graph	215
FIGURE 50: Standard Deviation of Direction	216
FIGURE 51: Standard Deviation of Direction	216
FIGURE 52: Custom Menu Example — Home Screen	224
FIGURE 53: Custom Menu Example — View Data Window	224
FIGURE 54: Custom Menu Example — Make Notes Sub Menu	224
FIGURE 55: Custom Menu Example — Predefined Notes Pick List	
FIGURE 56: Custom Menu Example — Free Entry Notes Window	
FIGURE 57: Custom Menu Example — Accept / Clear Notes Window	
FIGURE 58: Custom Menu Example — Control Sub Menu	
FIGURE 59: Custom Menu Example — Control LED Pick List	

FIGURE 60: Custom Menu Example — Control LED Boolean Pick List .	
FIGURE 61: Quarter-Bridge Strain Gage with RC Resistor Shunt	245
FIGURE 62: Strain Gage Shunt Calibration Start	246
FIGURE 63: Strain Gage Shunt Calibration Finish	247
FIGURE 64: Zero Procedure Start	247
FIGURE 65: Zero Procedure Finish	247
FIGURE 66: Entering SDI-12 Transparent Mode	256
FIGURE 67: PT100 BrHalf4W() Four-Wire Half-Bridge Schematic	
FIGURE 68: PT100 BrHalf3W() Three-Wire Half-Bridge Schematic	281
FIGURE 69: PT100 BrFull() Four-Wire Full-Bridge Schematic	285
FIGURE 70: PT100 Resistance() Basic-Circuit Schematic	291
FIGURE 71: PT100 Resistance() Basic-Circuit Series Schematic	295
FIGURE 72: PT100 Resistance() Four-Wire Full-Bridge Schematic	
FIGURE 73: HyperTerminal New Connection Description	
FIGURE 74: HyperTerminal Connect-To Settings	
FIGURE 75: HyperTerminal COM Port Settings Tab: Click File	
Properties   Settings   ASCII Setup and set as shown	318
FIGURE 76: HyperTerminal ASCII Setup	
FIGURE 77: HyperTerminal Send-Text File Example	
FIGURE 78: HyperTerminal Text-Capture File Example	
FIGURE 79: Ac Power Noise Rejection Techniques	
FIGURE 80: Input voltage rise and transient decay	
FIGURE 81: Settling Time for Pressure Transducer	
FIGURE 82: Example voltage measurement accuracy band, including	
the effects of percent of reading and offset, for a differential	
measurement with input reversal at a temperature between 0 to	
40 °C.	354
FIGURE 83: Panel Temperature Error Summary	
FIGURE 84: Panel Temperature Gradients (low temperature to high)	
FIGURE 85: Panel Temperature Gradients (high temperature to low)	
FIGURE 86: Input Error Calculation	
FIGURE 87: Diagram of a Thermocouple Junction Box	
FIGURE 88: PGIA with Input Signal Decomposition	
FIGURE 89: Simplified voltage measurement sequence.	
FIGURE 90: Programmable Gain Input Amplifier (PGIA): H to V+, L to	505
V-, VH to V+, VL to V- correspond to text	384
FIGURE 91: Ac Power Noise Rejection Techniques	
FIGURE 92: Input voltage rise and transient decay	
FIGURE 93: Settling Time for Pressure Transducer	
FIGURE 94: Example voltage measurement accuracy band, including	5,5
the effects of percent of reading and offset, for a differential	
measurement with input reversal at a temperature between 0 to	
40 °C.	403
FIGURE 95: Pulse Sensor Output Signal Types	
FIGURE 96: Switch Closure Pulse Sensor	
FIGURE 97: Terminals Configurable for Pulse Input	
FIGURE 98: Amplitude reduction of pulse count waveform (before and	100
after 1 µs µs time-constant filter)	416
FIGURE 99: Vibrating Wire Sensor	
FIGURE 100: Input Conditioning Circuit for Period Averaging	
FIGURE 101: Circuit to Limit C Terminal Input to 5 Vdc	
FIGURE 101: Circuit to Limit C Terminal input to 3 vdc	
FIGURE 102: Current sourcing from C terminals configured for control	
FIGURE 103: Current sourcing from C terminals configured for control  FIGURE 104: Relay Driver Circuit with Relay	
FIGURE 104: Relay Driver Circuit with Relay	
TIGURE 103. FOWER SWITCHING WITHOUT RELAY	431

FIGURE 106: Preconfigured HTML Home Page	
FIGURE 107: Home Page Created Using WebPageBegin() Instruction	471
FIGURE 108: Customized Numeric-Monitor Web Page	472
FIGURE 109: Keyboard and Display: Navigation	484
FIGURE 110: Keyboard and Display: Displaying Data	
FIGURE 111: CR1000KD Real-Time Tables and Graphs	
FIGURE 112: CR1000KD Real-Time Custom	
FIGURE 113: Keyboard and Display: Final Storage Data	
FIGURE 114: Keyboard and Display: Run/Stop Program	
FIGURE 115: Keyboard and Display: File Management	
FIGURE 116: Keyboard and Display: File Edit	
FIGURE 117: Keyboard and Display: PCCard (Memory Card)	
Management	492
FIGURE 118: Keyboard and Display: Port Status and Status Table	
FIGURE 119: Keyboard and Display: Settings	
FIGURE 120: Keyboard and Display: Configure Display	
FIGURE 121: Loosen Thumbscrews	
FIGURE 122: Remove Back Cover Retainer Screw	
FIGURE 123: Remove and Replace Battery	
FIGURE 124: Potentiometer R3 on PS100 and CH100 Charger /	500
Regulator	523
FIGURE 125: DevConfig Terminal Tab	
FIGURE 125: Develoing Terminal TabFIGURE 126: Relationships of Accuracy, Precision, and Resolution	
lint of Tables	
List of Tables	
TABLE 1: PC200W EZSetup Wizard Prompts	45
TABLE 2: CR3000 Wiring Panel Terminal Definitions, 1	
TABLE 3: CR3000 Wiring Panel Terminal Definitions, 2	
TABLE 4: Differential and Single-Ended Input Terminals	
TABLE 5: Pulse Input Terminals and Measurements	
TABLE 6: Alkaline Battery Temperatures and Service	
TABLE 7: CR3000 Base Sealed-Rechargeable Battery Specifications	
TABLE 8: CR3000 Ac-Transformer Specifications	
TABLE 9: Info Tables and Settings Interfaces	
TABLE 10: Common Configuration Actions and Tools	
TABLE 11: Program Send Command Locations	
TABLE 12: CRBasic Program Structure	
TABLE 13: Data Types in Variable Memory	
TABLE 14: Data Types in Final-Storage Memory	
TABLE 15: Formats for Entering Numbers in CRBasic	
TABLE 16: Typical Data Table	
TABLE 17: TOA5 Environment Line	
TABLE 17. TOAS Environment LineTABLE 18: DataInterval() Lapse Parameter Options	
TABLE 19: Program Tasks	
TABLE 19. Flogram TasksTABLE 20: Program Timing Instructions	
TABLE 21: Rules for NamesTABLE 22: Binary Conditions of TRUE and FALSE	
TABLE 23: Logical Expression Examples	
TABLE 24: Data Process Abbreviations TABLE 25: Program Send Options That Reset Memory <sup>1</sup>	
TABLE 26: WindVector() OutputOpt Options	
TABLE 27: FieldCal() CodesTABLE 28: Calibration Report for Relative Humidity Sensor	
I ADLE 28. Candration Report for Relative Humidity Sensor	255

TABLE 29: Calibration Report for Salinity Sensor	236
TABLE 30: Calibration Report for Flow Meter	
TABLE 31: Calibration Report for Water Content Sensor	
TABLE 32: Maximum Measurement Speeds Using VoltSE()	
TABLE 32: Waximum Measurement Instruction Parameters for Dwell	Z <b>4</b> 0
	252
Burst	
TABLE 34: SDI-12 Commands for Transparent Mode	
TABLE 35: SDI-12 Commands for Programmed (SDIRecorder()) Mode . 2	
TABLE 36: SDI-12 Sensor Configuration CRBasic Example — Results	270
TABLE 37: Example Power Usage Profile for a Network of SDI-12	
Probes	
TABLE 38: PRT Measurement Circuit Overview	275
TABLE 39: PT100 Temperature and ideal resistances (RS); $\alpha =$	
$0.00385^1$	276
TABLE 40: Callandar-Van Dusen Coefficients for PT100, $\alpha = 0.00385 \dots$	
TABLE 41: Input Ranges (mV)	
TABLE 42: Input Limits (mV)	
TABLE 43: Excitation Ranges	
TABLE 44: BrHalf4W() Four-Wire Half-Bridge Equations	
TABLE 45: Bridge Resistor Values (m $\Omega$ )	
TABLE 46: BrHalf3W() Three-Wire Half-Bridge Equations	
TABLE 47: Bridge Resistor Values ( $m\Omega$ )	
TABLE 48: Resistance() Basic Circuit Equation	
TABLE 49: Number of PT100	
TABLE 50: Four-Wire Half-Bridge Equations for PRT Example	
TABLE 51: Bridge Resistor Values (mΩ)	296
TABLE 52: Resistance() Four-Wire Full-Bridge Bridge-Resistance (RB)	
Values	
TABLE 53: PRTCalc() PRTType = 1, $\alpha = 0.00385^{1}$	301
TABLE 54: PRTCalc() PRTType = 2, $\alpha = 0.00392^{1}$	301
TABLE 55: PRTCalc() PRTType = 3, $\alpha = 0.00391^{1}$	302
TABLE 56: PRTCalc() PRTType = $4$ , $\alpha = 0.003916^1$	
TABLE 57: PRTCalc() PRTType = $5$ , $\alpha = 0.00375^1$	302
TABLE 58: PRTCalc() PRTType = $6$ , $\alpha = 0.003926^1$	
TABLE 59: ASCII / ANSI Equivalents	
TABLE 60: CR3000 Serial Ports	
TABLE 61: String Operators	
TABLE 62: String Concatenation Examples	
TABLE 63: String NULL Character Examples	
TABLE 64: Analog Measurement Integration	340
TARIF 65: Ac Noise Rejection on Small Signals <sup>1</sup>	341
TABLE 65: Ac Noise Rejection on Small Signals <sup>1</sup>	3/11
TABLE 67: CRBasic Measurement Settling Times	
TABLE 68: First Six Values of Settling Time Data	
TABLE 69: Range-Code Option C Over-Voltages	
TABLE 70: Offset Voltage Compensation Options	
TABLE 71: Analog Voltage Measurement Accuracy <sup>1</sup>	
TABLE 72: Analog Voltage Measurement Offsets	352
TABLE 73: Analog Voltage Measurement Resolution	
TABLE 74: Limits of Error for Thermocouple Wire (Reference Junction	
at 0°C)	353
	<ul><li>353</li><li>360</li></ul>
TABLE 75: Voltage Range for Maximum Thermocouple Resolution <sup>1</sup>	353 360 361
TABLE 75: Voltage Range for Maximum Thermocouple Resolution <sup>1</sup> TABLE 76: Limits of Error on CR3000 Thermocouple Polynomials	353 360 361 364
TABLE 75: Voltage Range for Maximum Thermocouple Resolution <sup>1</sup>	353 360 361 364 365

TABLE 79: Resistive-Bridge Circuits with Voltage Excitation	368
TABLE 80: Resistive-Bridge Circuits with Current Excitation <sup>1</sup>	370
TABLE 81: Ratiometric-Resistance Measurement Accuracy	
TABLE 82: CalGain() Field Descriptions	
TABLE 83: CalSeOffset() Field Descriptions	
TABLE 84: CalDiffOffset() Field Descriptions	
TABLE 85: Calibrate() Instruction Results	
TABLE 86: StrainCalc() Instruction Equations	
TABLE 87: Analog Voltage Input Ranges and Options	
TABLE 88: Parameters that Control Measurement Sequence and	501
Timing	385
TABLE 89: Analog Measurement Integration	
TABLE 99: Ac Noise Rejection on Small Signals <sup>1</sup>	
TABLE 91: Ac Noise Rejection on Large Signals <sup>1</sup>	201
TABLE 92: CRBasic Measurement Settling Times	
TABLE 93: First Six Values of Settling Time Data	
TABLE 94: Range-Code Option C Over-Voltages	
TABLE 95: Offset Voltage Compensation Options	399
TABLE 96: Analog Voltage Measurement Accuracy <sup>1</sup>	
TABLE 97: Analog Voltage Measurement Offsets	
TABLE 98: Analog Voltage Measurement Resolution	
TABLE 99: Pulse Measurements: Terminals and Programming	
TABLE 100: Example: E for a 10 Hz input signal	
TABLE 101: Frequency Resolution Comparison	
TABLE 102: Switch Closures and Open Collectors on P Terminals	
TABLE 103: Switch Closures and Open Collectors	413
TABLE 104: Three Specifications Differing Between P and C	
Terminals	415
TABLE 105: Time Constants (τ)	416
TABLE 106: Low-Level Ac Pules Input Ranges	416
TABLE 107: Current Source and Sink Limits	424
TABLE 108: Typical Gzip File Compression Results	
TABLE 109: CR3000 Memory Allocation	
TABLE 110: CR3000 SRAM Memory	
TABLE 111: CR3000 Memory Drives	
TABLE 112: Memory Card States	
TABLE 113: TableFile() Instruction Data File Formats	449
TABLE 114: File Control Functions	456
TABLE 115: CR3000 File Attributes	
TABLE 116: Powerup.ini Script Commands and Applications	
TABLE 117: File System Error Codes	
TABLE 118: Modbus to Campbell Scientific Equivalents	
TABLE 119: Modbus Registers: CRBasic Port, Flag, and Variable	4/0
	170
Equivalents	
TABLE 120: Supported Modbus Function Codes	
TABLE 121: Special Keyboard/Display Key Functions	
TABLE 122: Internal Lithium Battery Specifications	
TABLE 123: Math Expressions and CRBasic Results	208
TABLE 124: Variable and Final-Storage Data Types with NAN and	<b>5</b> 00
±INF	
TABLE 125: Warning Message Examples	
TABLE 126: CR3000 Terminal Commands	
TABLE 127: Log Locations	
TABLE 128: Program Send Command	551

TABLE 129: Info Tables and Settings Interfaces	567
TABLE 130: Info Tables and Settings: Directories	569
TABLE 131: Info Tables and Settings: Frequently Used	569
TABLE 132: Info Tables and Settings: Keywords	570
TABLE 133: Info Tables and Settings: KD Settings   Datalogger	572
TABLE 134: Info Tables and Settings: KD Settings   Comports	
TABLE 135: Info Tables and Settings: KD Settings   Ethernet	
TABLE 136: Info Tables and Settings: KD Settings   PPP	
TABLE 137: Info Tables and Settings: KD Settings   CS I/O IP	
TABLE 138: Info Tables and Settings: KD Settings (TCP/IP) on	
CR1000KD Keyboard/Display	572
TABLE 139: Info Tables and Settings: KD Settings   Advanced	
TABLE 140: Info Tables and Settings: KD Status Table Fields	
TABLE 141: Info Tables and Settings: Settings Only in Settings Editor	
TABLE 142: Info Tables and Settings: Communications, General	
TABLE 143: Info Tables and Settings: Communications, PakBus	
TABLE 144: Info Tables and Settings: Communications, TCP IP I	
TABLE 145: Info Tables and Settings: Communications, TCP IP II	
TABLE 146: Info Tables and Settings: Communications, TCP_IP III	
TABLE 147: Info Tables and Settings: CRBasic Program I	
TABLE 148: Info Tables and Settings: CRBasic Program II	
TABLE 149: Info Tables and Settings: Auto Self-Calibration	
TABLE 150: Info Tables and Settings: Data	3/3
TABLE 151: Info Tables and Settings: Data Table Information Table	<i>-7-</i>
(DTI) Keywords	
TABLE 152: Info Tables and Settings: Memory	
TABLE 153: Info Tables and Settings: Miscellaneous	
TABLE 154: Info Tables and Settings: Obsolete	
TABLE 155: Info Tables and Settings: OS and Hardware Versioning	
TABLE 156: Info Tables and Settings: Power Monitors	
TABLE 157: Info Tables and Settings: Security	
TABLE 158: Info Tables and Settings: Signatures	
TABLE 159: Info Tables and Settings: B	577
TABLE 160: Info Tables and Settings: C	577
TABLE 161: Info Tables and Settings: D	
TABLE 162: Info Tables and Settings: E	
TABLE 163: Info Tables and Settings: F	
TABLE 164: Info Tables and Settings: H	
TABLE 165: Info Tables and Settings: I	
TABLE 166: Info Tables and Settings: L	
TABLE 167: Info Tables and Settings: M	584
TABLE 168: Info Tables and Settings: N	585
TABLE 169: Info Tables and Settings: O	586
TABLE 170: Info Tables and Settings: P	
TABLE 171: Info Tables and Settings: R	
TABLE 172: Info Tables and Settings: S	589
TABLE 173: Info Tables and Settings: T	
TABLE 174: Info Tables and Settings: U	
TABLE 175: Info Tables and Settings: V	592
TABLE 176: Info Tables and Settings: W	593
TABLE 177: Pinout of CR3000 CS I/O D-Type Connector Port	
TABLE 178: Pin Out of CR3000 RS-232 D-Type Connector Port	
TABLE 179: Standard Null-Modem Cable Pin Out	
TABLE 180: FP2 Data-Format Bit Descriptions	
TABLE 181: FP2 Decimal Locater Bits	

TABLE 182: Endianness in Campbell Scientific Instruments	601
TABLE 183: Dataloggers	
TABLE 184: Analog Input Modules	604
TABLE 185: Pulse Input Modules	
TABLE 186: Serial I/O Modules List	
TABLE 187: Vibrating Wire Input Modules	
TABLE 188: Resistive Bridge TIM <sup>1</sup> Modules	
TABLE 189: Voltage Divider Modules	
TABLE 190; Current-Shunt Modules	
TABLE 191: Transient Voltage Suppressors	
TABLE 192: Terminal-Strip Covers	
TABLE 193: Digital I/O Modules	
TABLE 194: Continuous-Analog Output (CAO) Modules	608
TABLE 195: Relay-Drivers — Products	
TABLE 196: Current-Excitation Modules	
TABLE 197: Wired Sensor Types	
TABLE 198: Wireless Sensor Modules	
TABLE 199: Sensors Types Available for Connection to CWS900	
TABLE 200: Cameras	
TABLE 201: Datalogger Keyboard/Displays <sup>1</sup>	611
TABLE 202: Hardwire, Single-Connection Comms Devices	611
TABLE 203: Hardwire, Networking Devices	
TABLE 204: TCP/IP Links — List	
TABLE 205: Telephone Modems	
TABLE 206: Private-Network Radios	
TABLE 207: Satellite Transceivers	
TABLE 208: Mass-Storage Devices	
TABLE 209: CF Card Storage Module	
TABLE 210: Starter Software	
TABLE 211: Datalogger Support Software	
TABLE 212: LoggerNet Suite — List <sup>1,2</sup>	
TABLE 213: Software Tools	
TABLE 214: Software Development Kits	
TABLE 216: Battery / Regulator Combinations	
TABLE 216: Batteries	
TABLE 217: CR3000 Battery Bases	
TABLE 218: Regulators	
•	
TABLE 220: 24 Vdc Power Supply Kits	
TABLE 221: Eliciosates — Floddets  TABLE 222: Prewired Enclosures	
TABLE 222: Trewited Enclosures  TABLE 223: Tripods, Towers, and Mounts	
TABLE 223: Tripods, Towers, and Mounts	
TABLE 224, Protection from Worsture — Products	022
List of CRBasic Examples	
CRBasic EXAMPLE 1: Simple Default.cr3 File to Control SW12	
Terminal	119
CRBasic EXAMPLE 2: Using an "Include" File	
CRBasic EXAMPLE 3: 'Include' File to Control SW12 Terminal	
CRBasic EXAMPLE 4: Inserting Comments	
CRBasic EXAMPLE 5: Data Type Declarations	
CRBasic EXAMPLE 6: Using Variable Array Dimension Indices	
CRBasic EXAMPLE 7: Flag Declaration and Use	
	5

CRBasic EXAMPLE 8: Using a Variable Array in Calculations	1/15
CRBasic EXAMPLE 9; Initializing Variables	
CRBasic EXAMPLE 9, Illustrating Variables	
CRBasic EXAMPLE 11: Load binary information into a variable	
CRBasic EXAMPLE 12: Declaration and Use of a Data Table	
	. 138
CRBasic EXAMPLE 14: BeginProg / Scan() / NextScan / EndProg	1.7.1
Syntax	. 164
CRBasic EXAMPLE 15: Measurement Instruction Syntax	
CRBasic EXAMPLE 16: Use of Move() to Conserve Code Space	. 171
CRBasic EXAMPLE 17: Use of Variable Arrays to Conserve Code	
Space	. 171
CRBasic EXAMPLE 18: Conversion of FLOAT / LONG to Boolean	
CRBasic EXAMPLE 19: Evaluation of Integers	. 173
CRBasic EXAMPLE 20: Constants to LONGs or FLOATs	
CRBasic EXAMPLE 21: String and Variable Concatenation	. 176
CRBasic EXAMPLE 22: BeginProg / Scan / NextScan / EndProg	
Syntax	
CRBasic EXAMPLE 23: Conditional Output	. 183
CRBasic EXAMPLE 24: Groundwater Pump Test	. 184
CRBasic EXAMPLE 25: Miscellaneous Program Features	. 186
CRBasic EXAMPLE 26: Scaling Array	. 189
CRBasic EXAMPLE 27: Program Signatures	. 191
CRBasic EXAMPLE 28: Use of Multiple Scans	
CRBasic EXAMPLE 29: Loading Large Data Sets	. 193
CRBasic EXAMPLE 30: Array Assigned Expression: Sum Columns	
and Rows	. 195
and NOws	
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an	
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array  CRBasic EXAMPLE 32: Array Assigned Expression: Comparison / Boolean Evaluation	. 195
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array  CRBasic EXAMPLE 32: Array Assigned Expression: Comparison / Boolean Evaluation  CRBasic EXAMPLE 33: Array Assigned Expression: Fill Array	. 195 . 196
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197 . 201
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197 . 201 . 203
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197 . 201 . 203 . 206
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197 . 201 . 203 . 206 . 209
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197 . 201 . 203 . 206 . 209
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197 . 201 . 203 . 206 . 209
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197 . 201 . 203 . 206 . 209
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array  CRBasic EXAMPLE 32: Array Assigned Expression: Comparison / Boolean Evaluation	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array  CRBasic EXAMPLE 32: Array Assigned Expression: Comparison / Boolean Evaluation	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210 . 211
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array  CRBasic EXAMPLE 32: Array Assigned Expression: Comparison / Boolean Evaluation	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210 . 211
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array  CRBasic EXAMPLE 32: Array Assigned Expression: Comparison / Boolean Evaluation  CRBasic EXAMPLE 33: Array Assigned Expression: Fill Array Dimension  CRBasic EXAMPLE 34: Two Data-Output Intervals in One Data Table . CRBasic EXAMPLE 35: Using TrigVar to Trigger Data Storage	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210 . 211 . 219 . 227
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array  CRBasic EXAMPLE 32: Array Assigned Expression: Comparison / Boolean Evaluation  CRBasic EXAMPLE 33: Array Assigned Expression: Fill Array Dimension  CRBasic EXAMPLE 34: Two Data-Output Intervals in One Data Table . CRBasic EXAMPLE 35: Using TrigVar to Trigger Data Storage	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210 . 211 . 219 . 227 . 234
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210 . 211 . 219 . 227 . 234 . 237
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210 . 211 . 227 . 234 . 237 . 239
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210 . 211 . 219 . 227 . 234 . 237 . 239 . 242
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array  CRBasic EXAMPLE 32: Array Assigned Expression: Comparison / Boolean Evaluation  CRBasic EXAMPLE 33: Array Assigned Expression: Fill Array Dimension  CRBasic EXAMPLE 34: Two Data-Output Intervals in One Data Table .  CRBasic EXAMPLE 35: Using TrigVar to Trigger Data Storage  CRBasic EXAMPLE 36: Bool8 and a Bit Shift Operator  CRBasic EXAMPLE 37: NSEC — One Element Time Array  CRBasic EXAMPLE 38: NSEC — Two Element Time Array  CRBasic EXAMPLE 39: NSEC — Seven and Nine Element Time Arrays  CRBasic EXAMPLE 40: NSEC —Convert Timestamp to Universal Time.  CRBasic EXAMPLE 41: Using TableFile() with Option 64 with Memory Card  CRBasic EXAMPLE 42: Custom Menus  CRBasic EXAMPLE 43: FieldCal() Zero  CRBasic EXAMPLE 44: FieldCal() Offset  CRBasic EXAMPLE 45: FieldCal() Two-Point Slope and Offset  CRBasic EXAMPLE 46: FieldCal() Multiplier  CRBasic EXAMPLE 47: FieldCalStrain() Calibration	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210 . 211 . 219 . 227 . 234 . 237 . 239 . 242
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array  CRBasic EXAMPLE 32: Array Assigned Expression: Comparison / Boolean Evaluation  CRBasic EXAMPLE 33: Array Assigned Expression: Fill Array Dimension  CRBasic EXAMPLE 34: Two Data-Output Intervals in One Data Table . CRBasic EXAMPLE 35: Using TrigVar to Trigger Data Storage  CRBasic EXAMPLE 36: Bool8 and a Bit Shift Operator  CRBasic EXAMPLE 37: NSEC — One Element Time Array  CRBasic EXAMPLE 38: NSEC — Two Element Time Array  CRBasic EXAMPLE 39: NSEC — Seven and Nine Element Time Arrays  CRBasic EXAMPLE 40: NSEC — Convert Timestamp to Universal Time  CRBasic EXAMPLE 41: Using TableFile() with Option 64 with Memory Card  CRBasic EXAMPLE 42: Custom Menus  CRBasic EXAMPLE 43: FieldCal() Zero  CRBasic EXAMPLE 44: FieldCal() Offset  CRBasic EXAMPLE 45: FieldCal() Multiplier  CRBasic EXAMPLE 46: FieldCal() Multiplier  CRBasic EXAMPLE 47: FieldCalStrain() Calibration  CRBasic EXAMPLE 48: Fast Analog Voltage Measurement: Fast	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210 . 211 . 219 . 227 . 234 . 237 . 239 . 242 . 245
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210 . 211 . 219 . 227 . 234 . 237 . 242 . 245
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array  CRBasic EXAMPLE 32: Array Assigned Expression: Comparison / Boolean Evaluation  CRBasic EXAMPLE 33: Array Assigned Expression: Fill Array Dimension  CRBasic EXAMPLE 34: Two Data-Output Intervals in One Data Table . CRBasic EXAMPLE 35: Using TrigVar to Trigger Data Storage	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210 . 211 . 219 . 227 . 234 . 237 . 242 . 245
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array	. 195 . 196 . 197 . 201 . 203 . 206 . 209 . 210 . 211 . 213 . 227 . 234 . 237 . 242 . 245 . 249 . 250

CRBasic EXAMPLE 52: Using SDI12Sensor() to Test Cv Command	
CRBasic EXAMPLE 53: Using Alternate Concurrent Command (aC)	
CRBasic EXAMPLE 54: Using an SDI-12 Extended Command	
CRBasic EXAMPLE 55: SDI-12 Sensor Setup	. 269
CRBasic EXAMPLE 56: Conditional Code	. 272
CRBasic EXAMPLE 57: PT100 BrHalf4W() Four-Wire Half-Bridge	
Calibration	. 280
CRBasic EXAMPLE 58: PT100 BrHalf4W() Four-Wire Half-Bridge	
Measurement	. 280
CRBasic EXAMPLE 59: PT100 BrHalf3W() Three-Wire Half-Bridge	
Calibration	. 284
CRBasic EXAMPLE 60: PT100 BrHalf3W() Three-Wire Half-Bridge	
Measurement	. 284
CRBasic EXAMPLE 61: PT100 BrFull() Four-Wire Full-Bridge	
Calibration	. 287
CRBasic EXAMPLE 62: PT100 BrFull() Four-Wire Full-Bridge	
Calibration	. 288
CRBasic EXAMPLE 63: PT100 BrFull() Four-Wire Full-Bridge	
	. 289
CRBasic EXAMPLE 64: PT100 Resistance() Basic-Circuit Calibration	. 293
CRBasic EXAMPLE 65: PT100 Resistance() Basic-Circuit	
Measurement	. 293
CRBasic EXAMPLE 66: PT100 Resistance() Basic-Circuit	
Measurement	. 295
CRBasic EXAMPLE 67: PT100 Resistance() Four-Wire Full-Bridge	
Calibration	. 299
CRBasic EXAMPLE 68: PT100 Resistance() Four-Wire Full-Bridge	
Measurement	. 299
CRBasic EXAMPLE 69: Receiving an RS-232 String	. 315
CRBasic EXAMPLE 70: Measure Sensors / Send RS-232 Data	. 320
CRBasic EXAMPLE 71: Concatenation of Numbers and Strings	. 329
CRBasic EXAMPLE 72: Subroutine with Global and Local Variables	. 333
CRBasic EXAMPLE 73: Time Stamping with System Time	. 336
CRBasic EXAMPLE 74: Measuring Settling Time	. 344
CRBasic EXAMPLE 75: Four-Wire Full-Bridge Measurement and	
Processing	. 371
CRBasic EXAMPLE 76: Measuring Settling Time	
CRBasic EXAMPLE 77: Custom Web Page HTML	. 472
CRBasic EXAMPLE 78: Concatenating Modbus Long Variables	
CRBasic EXAMPLE 79: Using NAN to Filter Data	
CRBasic EXAMPLE 80: Reboot under program control with Restart	
instruction	. 528
CRBasic EXAMPLE 81: Reboot under program control with	
FileManage() instruction:	528

### 1. Introduction

#### 1.1 HELLO

Whether in extreme cold in Antarctica, scorching heat in Death Valley, salt spray from the Pacific, micro-gravity in space, or the harsh environment of your office, Campbell Scientific dataloggers support research and operations all over the world. Our customers work a spectrum of applications, from those more complex than any of us imagined, to those simpler than any of us thought practical. The limits of the CR3000 are defined by our customers. Our intent with this operator's manual is to guide you to the tools you need to explore the limits of your application.

You can take advantage of the advanced CR3000 analog and digital measurement features by spending a few minutes working through the **Quickstart** (p. 37) and the **Overview** (p. 57). For more demanding applications, the remainder of the manual and other Campbell Scientific publications are available. If you are programming with CRBasic, you will need the extensive help available with the *CRBasic Editor* software. Formal CR3000 training is also available from Campbell Scientific.

This manual is organized to take you progressively deeper into the complexity of CR3000 functions. You may not find it necessary to progress beyond the **Quickstart** or **Overview**. **Quickstart** is a cursory view of CR3000 data-acquisition and walks you through a procedure to set up a simple system. Overview reviews salient topics that are covered in-depth in subsequent sections and appendices.

Review the exhaustive table of contents to learn how the manual is organized, and, when looking for a topic, use the index and PDF reader search.

More in-depth study requires other Campbell Scientific publications, most of which are available on-line at *www.campbellsci.com*. Generally, if a particular feature of the CR3000 requires a peripheral hardware device, more information is available in the manual written for that device.

Don't forget the **Glossary** (p. 529) when you run across a term that is unfamiliar. Many specialized terms are hyperlinked in this manual to a glossary entry.

If you are unable to find the information you need, need assistance with ordering, or just wish to speak with one of our many product experts about your application, please call us:

Technical Support	(435) 227-9100
Sales and Application Engineering	(435) 227-9120
Orders	(435) 227-9090
Accounts Receivable	(435) 227-9092
Repairs	(435) 227-9105
General Inquiries	(435) 227-9000

In earlier days, Campbell Scientific dataloggers greeted our customers with a cheery HELLO at the flip of the ON switch. While the user interface of the CR3000 datalogger has advanced beyond those simpler days, you can still hear the cheery HELLO echoed in voices you hear at Campbell Scientific.

## 1.2 Typography

The following type faces are used throughout the CR3000 Operator's Manual. Type color other than black on white does not appear in printed versions of the manual:

- <u>Underscore</u> information specifically flagged as unverified. Usually found only in a draft or a preliminary released version.
- Capitalization beginning of sentences, phrases, titles, names, Campbell Scientific product model numbers.
- Bold CRBasic instructions within the body text, input commands, output responses, GUI commands, text on product labels, names of data tables.
- *Italic* glossary entries and titles of publications, software, sections, tables, figures, and examples.
- **Bold italic** CRBasic instruction parameters and arguments within the body text.
- 8 pt blue cross reference page numbers. In the PDF version of the manual, click on the page number to jump to the cross referenced page.
- Lucida Sans Typewriter blocks of CRBasic code. Type colors are as follows:
- instruction
- 'comments
- o all other code

## 1.3 Capturing CRBasic Code

Many examples of CRBasic code are found throughout this manual. The manual is designed to make using this code as easy as possible. Keep the following in mind when copying code from this manual into *CRBasic Editor*:

If an example crosses pages, select and copy only the contents of one page at a time. Doing so will help avoid unwanted characters that may originate from page headings, page numbers, and hidden characters.

## 2. Precautions

- DANGER: Fire, explosion, and severe-burn hazard. Misuse or improper installation of the internal lithium battery can cause severe injury. Do not recharge, disassemble, heat above 100 °C (212 °F), solder directly to the cell, incinerate, or expose contents to water. Dispose of spent lithium batteries properly.
- WARNING:
  - Protect from over-voltage
  - Protect from water
  - o Protect from ESD (p. 107)
- IMPORTANT: Note the following about the internal battery:
  - O When primary power is continuously connected to the CR3000, the battery will last up to 10 years or more.
  - When primary power is NOT connected to the CR3000, the battery will last about three years.

0

- O See section Internal Battery Details (p. 497) for more information.
- IMPORTANT: Maintain a level of calibration appropriate to the application. Campbell Scientific recommends factory recalibration of the CR3000 every three years.

## 3. Initial Inspection

- Check the Ships With tab at http://www.campbellsci.com/CR3000 for a list of items shipped with the CR3000. Among other things, the following are provided for immediate use:
  - Screwdriver to connect wires to terminals
  - O Type-T thermocouple for use in the Quickstart (p. 37) tutorial
  - A datalogger program pre-loaded into the CR3000 that measures power-supply voltage and wiring-panel temperature.
  - A serial communication cable to connect the CR3000 to a PC
  - A ResourceDVD that contains product manuals and the following starter software:
  - Short Cut
  - PC200W
  - DevConfig
- Upon receipt of the CR3000, inspect the packaging and contents for damage. File damage claims with the shipping company.
- Immediately check package contents. Thoroughly check all packaging material for product that may be concealed. Check model numbers, part numbers, and product descriptions against the shipping documents. Model or part numbers are found on each product. On cabled items, the number is often found at the end of the cable that connects to the measurement device. The Campbell Scientific number may differ from the part or model number printed on the sensor by the sensor vendor. Ensure that the you received the expected cable lengths. Contact Campbell Scientific immediately about discrepancies.
- Check the operating system version in the CR3000 as outlined in the Operating System (OS) Installation (p. 123) and update as needed.

# 4. Quickstart

The following tutorial introduces the CR3000 by walking you through a programming and data retrieval exercise.

## 4.1 Sensors — Quickstart

#### Related Topics:

- Sensors Quickstart (p. 37)
- Measurements Overview (p. 67)
- Measurements Details (p. 335)
- Sensors Lists (p. 609)

Sensors transduce phenomena into measurable electrical forms by modulating voltage, current, resistance, status, or pulse output signals. Suitable sensors do this *accurately and precisely (p. 563)*. Smart sensors have internal measurement and processing components and simply output a digital value in binary, hexadecimal, or ASCII character form. The CR3000, sometimes with the assistance of various peripheral devices, can measure or read nearly all electronic sensor output types.

Sensor types supported include:

- Analog
  - Voltage
  - o Current
  - o Thermocouples
  - o Resistive bridges
- Pulse
  - High frequency
  - Switch closure
  - Low-level ac
- Period average
- Vibrating wire
- Smart sensors
  - o SDI-12
  - o RS-232

- Modbus
- o DNP3
- o RS-485

Refer to the *Sensors — Lists (p. 609)* for a list of specific sensors available from Campbell Scientific. This list may not be comprehensive. A library of sensor manuals and application notes are available at *www.campbellsci.com* to assist in measuring many sensor types.

# 4.2 Datalogger — Quickstart

#### Related Topics:

- Datalogger Quickstart (p. 38)
- Datalogger Overview (p. 58)
- Dataloggers List (p. 603)

The CR3000 can measure almost any sensor with an electrical response. The CR3000 measures electrical signals and converts the measurement to engineering units, performs calculations and reduces data to statistical values. Most applications do not require that every measurement be stored. Instead, individual measurements can be combined into statistical or computational summaries. The CR3000 will store data in memory to await transfer to the PC with an external storage devices or telecommunication device.

### 4.2.1 CR3000 Module

The CR3000 module integrates measurement electronics with an integrated keyboard and multi-line display.


## 4.2.1.1 Wiring Panel — Quickstart

#### **Related Topics**

- Wiring Panel Quickstart (p. 38)
- Wiring Panel Overview (p. 59)
- Measurement and Control Peripherals (p. 429)

As shown in figure *Wiring Panel (p. 39)*, the CR3000 wiring panel provides terminals for connecting sensors, power, and communication devices. Surge protection is incorporated internally in most wiring panel connectors. Terminal strips can be disconnected from the CR3000 wiring panel when necessary for maintenance or troubleshooting operations.

FIGURE 1: Wiring Panel

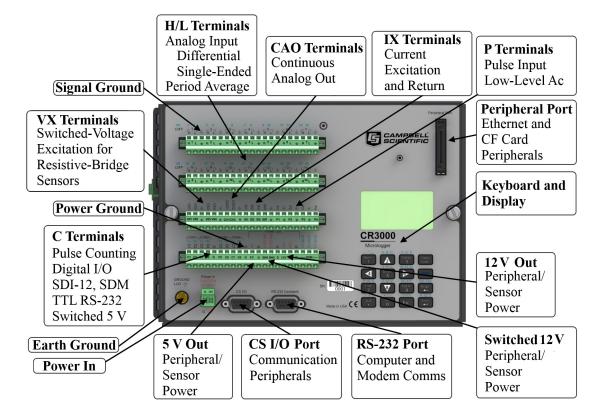

# 4.3 Power Supplies — Quickstart

### Related Topics:

- · Power Input Terminals Specifications
- Power Supplies Quickstart (p. 39)
- Power Supplies Overview (p. 86)
- Power Supplies Details (p. 98)
- Power Supplies Products (p. 618)
- Power Sources (p. 99)
- Troubleshooting Power Supplies (p. 517)

The CR3000 requires a power supply. Be sure that power supply components match the specifications of the device to which they are connected. When connecting power, first switch off the power supply, make the connection, then turn the power supply on.

The CR3000 operates with power from 10 to 16 Vdc applied at the **POWER IN** terminals of the green connector on the face of the wiring panel, or at the power input receptacle on the underside of the CR3000 module, which is reserved for interated power supplies.

CR3000s may be ordered with an integrated power supply base. Power to a power supply base is controlled by a manual switch on the right side of the case, below the keyboard display.

Power connects through the green **POWER IN** connector on the face of the CR3000. The positive power lead connects to **12V**. The negative lead connects to **G**. The connection is internally reverse-polarity protected.

The CR3000 is internally protected against accidental polarity reversal on the power inputs.

## 4.3.1 Internal Battery — Quickstart

Related Topics:

- Internal Battery Quickstart (p. 40)
- Internal Battery Details (p. 497)

**Warning** Misuse or improper installation of the internal lithium battery can cause severe injury. Fire, explosion, and severe burns can result. Do not recharge, disassemble, heat above 100 °C (212 °F), solder directly to the cell, incinerate, or expose contents to water. Dispose of spent lithium batteries properly.

A lithium battery backs up the CR3000 clock, program, and memory.

### 4.4 Data Retrieval and Comms — Quickstart

Related Topics:

- Data Retrieval and Comms Quickstart (p. 40)
- Data Retrieval and Comms Overview (p. 80)
- Data Retrieval and Comms Details (p. 466)
- Data Retrieval and Comms Peripherals Lists (p. 610)

If the CR3000 datalogger sits near a PC, direct-connect serial communication is usually the best solution. In the field, direct serial, a data storage device, can be used during a site visit. A remote comms option (or a combination of comms options) allows you to collect data from your CR3000 over long distances. It also allows you to discover system problems early.

A Campbell Scientific sales engineer can help you make a shopping list for any of these comms options:

- Standard
  - RS-232 serial

- Options
  - Ethernet
  - CompactFlash, Mass Storage
  - o Cellular, Telephone
  - o iOS, Android
  - o PDA
  - o Multidrop, Fiber Optic
  - o Radio, Satellite

Some comms options can be combined.

# 4.5 Datalogger Support Software — Quickstart

#### Related Topics:

- Datalogger Support Software Quickstart (p. 41)
- Datalogger Support Software Overview (p. 91)
- Datalogger Support Software Details (p. 432)
- Datalogger Support Software Lists (p. 614)

Campbell Scientific datalogger support software is PC or Linux software that facilitates comms between the computer and the CR3000. A wide array of software are available. This section focuses on the following:

- Short Cut Program Generator for Windows (SCWin)
- PC200W Datalogger Starter Software for Windows
- LoggerLink Mobile Datalogger Starter software for iOS and Android

A CRBasic program must be loaded into the CR3000 to enable it to make measurements, read sensors, and store data. Use *Short Cut* to write simple CRBasic programs without the need to learn the CRBasic programming language. *Short Cut* is an easy-to-use wizard that steps you through the program building process.

After the CRBasic program is written, it is loaded onto the CR3000. Then, after sufficient time has elapsed for measurements to be made and data to be stored, data are retrieved to a computer. These functions are supported by *PC200W* and *LoggerLink Mobile*.

Short Cut and PC200W are available at no charge at www.campbellsci.com/downloads.

**Note** More information about software available from Campbell Scientific can be found at *www.campbellsci.com*.

## 4.6 Tutorial: Measuring a Thermocouple

This exercise guides you through the following:

- Attaching a sensor to the CR3000
- Creating a program for the CR3000 to measure the sensor
- Making a simple measurement
- Storing measurement data on the CR3000
- Collecting data from the CR3000 with a PC
- Viewing real-time and historical data with the PC

## 4.6.1 What You Will Need

The following items are used in this exercise. If you do not have all of these items, you can provide suitable substitutes. If you have questions about compatible power supplies or serial cables, review and *Power Supplies* — *Details* (p. 98) or contact Campbell Scientific.

- CR3000 datalogger
- Power supply with an output between 10 to 16 Vdc
- Thermocouple, 4 to 5 inches long; one is shipped with the CR3000
- Personal computer (PC) with an available nine-pin RS-232 serial port, or with a USB port and a USB-to-RS-232 adapter
- Nine-pin female to nine-pin male RS-232 cable; one is shipped with the CR3000.
- PC200W software, which is available on the Campbell Scientific resource DVD or thumb drive, or at www.campbellsci.com.

# 4.6.2 Hardware Setup

**Note** The thermocouple is attached to the CR3000 later in this exercise.

## 4.6.2.1 Connect Internal Power Supply

With reference to figure *Connect Power and Serial Comms* (p. 43) some CR3000 dataloggers are shipped with a power supply internal to the removable base. This internal power supply may use alkaline batteries or sealed-rechargeable batteries. For more information and installation procedures, refer to *Alkaline-Battery Base* (p. 102) or *Sealed Rechargeable-Battery Base* (p. 103).

When the base is in place, move the **ON/OFF** switch on the side of the CR3000 base to **ON**. If using the sealed-rechargeable battery base, do not to leave the CR3000 running without the primary power source connected.

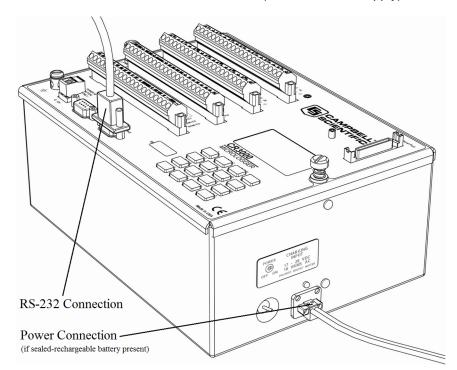


FIGURE 2: Connect Power and Comms (Internal-Power Supply)

# 4.6.2.2 Connect External Power Supply

With reference to FIGURE: Connect Power and Serial Comms (external power supply) (p. 43), proceed as follows:

- 1. Remove the green power connector from the CR3000 wiring panel.
- 2. Switch power supply to **OFF**.
- 3. Connect the positive lead of the power supply to the **12V** terminal of the green power connector. Connect the negative (ground) lead of the power supply to the **G** terminal of the green connector.
- 4. Confirm the power supply connections have the correct polarity then insert the green power connector into its receptacle on the CR3000 wiring panel.

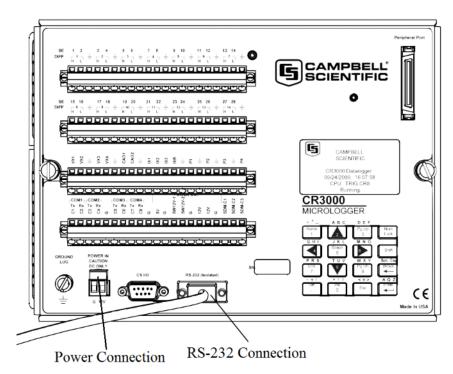


FIGURE 3: Connect Power and Comms (External-Power Supply)

### 4.6.2.3 Connect Comms

Connect the serial cable between the **RS-232** port on the CR3000 and the RS-232 port on the PC.

Switch the power supply **ON**.

# 4.6.3 PC200W Software Setup

- 1. Install *PC200W* software onto the PC. Follow on-screen prompts during the installation process. Use the default folders.
- 2. Open PC200W. Your PC should display a window similar to figure PC200W Main Window (p. 45). When PC200W is first run, the EZSetup Wizard will run automatically in a new window. This will configure the software to communicate with the CR3000 datalogger. The table PC200W EZSetup Wizard Prompts (p. 45) indicates what information to enter on each screen of the wizard. Click Next at the lower portion of the window to advance.

**Note** A video tutorial is available at https://www.campbellsci.com/videos?video=80 (https://www.campbellsci.com/videos?video=80). Other video tutorials are available at www.campbellsci.com/videos.

After exiting the wizard, the main *PC200W* window becomes visible. This window has several tabs. The **Clock/Program** tab displays clock and program

information. **Monitor Data** and **Collect Data** tabs are also available. Icons across the top of the window access additional functions.

FIGURE 4: PC200W Main Window

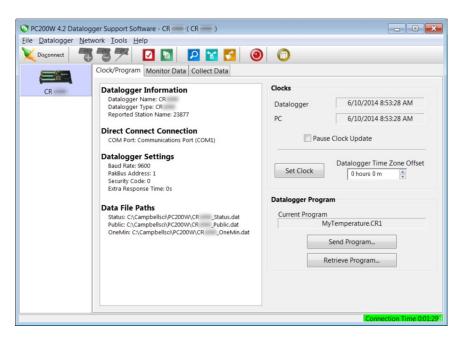


TABLE 1: PC200W EZ	Setup Wizard Prompts
Screen Name	Information Needed
Introduction	Provides an introduction to the <i>EZSetup Wizard</i> along with instructions on how to navigate through the wizard.
Datalogger Type and Name	Select the CR3000 from the list box. Accept the default name of CR3000.
	Select the correct PC COM port for the serial connection. Typically, this will be COM1, but other COM numbers are possible, especially when using a USB cable.  Leave COM Port Communication Delay at 00 seconds.
COM Port Selection	Note When using USB serial cables, the COM number may change if the cable is moved to a different USB port. This will prevent data transfer between the software and CR3000. Should this occur, simply move the cable back to the original port. If this is not possible, close then reopen the <i>PC200W</i> software to refresh the available COM ports. Click on Edit Datalogger Setup and change the COM port to the new port number.

TABLE 1: PC200W EZSetup Wizard Prompts												
Screen Name	Information Needed											
<b>Datalogger Settings</b>	Configures how the CR3000 communicates with the PC. For this tutorial, accept the default settings.											
Datalogger Settings — Security	For this tutorial, <b>Security Code</b> should be set to <b>0</b> and <b>PakBus Encryption Key</b> should be left blank.											
Communication Setup Summary	Summary of settings in previous screens. No changes are needed for this tutorial. Press <b>Finish</b> to exit the wizard.											

# 4.6.4 Write CRBasic Program with Short Cut

Following are the objectives for this *Short Cut* programming exercise:

- Create a program to measure the voltage of the CR3000 power supply, temperature of the CR3000 wiring panel, and ambient air temperature using a thermocouple.
- When the program is downloaded to the CR3000, it will take samples once per second and store averages of the samples at one-minute intervals.

**NOTE** A video tutorial is available at <a href="https://www.campbellsci.com/videos?video=80">https://www.campbellsci.com/videos?video=80</a> Other video resources are available at <a href="https://www.campbellsci.com/videos">www.campbellsci.com/videos</a>.


### 4.6.4.1 Procedure: (Short Cut Steps 1 to 5)

- 1. Click on the *Short Cut* icon in the upper-right corner of the *PC200W* window. The icon resembles a clock face.
- 2. The *Short Cut* window is shown. Click **New Program**.
- 3. In the Datalogger Model drop-down list, select CR3000.
- 4. In the **Scan Interval** box, enter **1** and select **Seconds** in the drop-down list box. Click **Next**.

**Note** The first time *Short Cut* is run, a prompt will appear asking for a choice of ac noise rejection. Select **60 Hz** for the United States and other areas using 60 Hz ac voltage. Select **50 Hz** for most of Europe and other areas that operate at 50 Hz. A second prompt lists sensor support options. **Campbell Scientific, Inc. (US)** is probably the best fit if you are outside Europe.

5. The next window displays **Available Sensors and Devices** as shown in the following figure. Expand the **Sensors** folder by clicking on the symbol. This shows several sub-folders. Expand the **Temperature** folder to view available sensors. Note that a wiring panel temperature (**PTemp\_C** in the **Selected** column) is selected by default.

FIGURE 5: Short Cut Temperature Sensor Folder

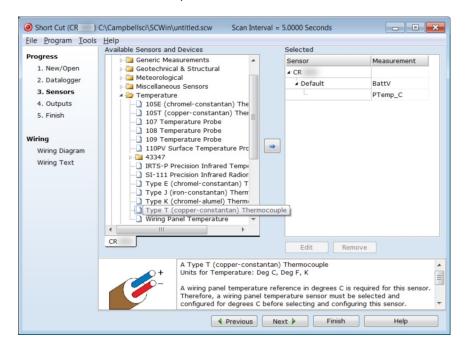

## 4.6.4.2 Procedure: (Short Cut Steps 6 to 7)

6. Double-click **Type T (copper-constantan) Thermocouple** to add it into the **Selected** column. A dialog window is presented with several fields. By immediately clicking **OK**, you accept default options that include selection of **1** sensor and **PTemp C** as the reference temperature measurement.

**Note BattV** (battery voltage) and **PTempC** (wiring panel temperature) are default measurements. During normal operations, battery and temperature can be recorded at least daily to assist in monitoring system status.

7. In the left pane of the main *Short Cut* window, click **Wiring Diagram**. Attach the physical type-T thermocouple to the CR3000 as shown in the diagram. Click on **3. Sensors** in the left pane to return to the sensor selection screen.

### 4.6.4.3 Procedure: (Short Cut Step 8)

8. As shown in the following figure, click **Next** to advance to the **Outputs** tab, which displays the list **Selected Sensors** to the left and data storage tables to the right under **Selected Outputs**.

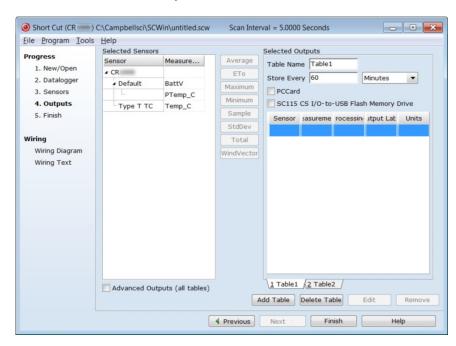


FIGURE 6: Short Cut Outputs Tab

## 4.6.4.4 Procedure: (Short Cut Steps 9 to 12)

- 9. As shown in the right-most pane of the previous figure, two output tables (1 Table1 and 2 Table2 tabs) are initially configured. Both tables have a Store Every field and a drop-down list from which to select the time units. These are used to set the time intervals when data are stored.
- 10. Only one table is needed for this tutorial, so remove **Table 2**. Click **2 Table2** tab, then click **Delete Table**.
- 11. Change the name of the remaining table from **Table1** to **OneMin**, and then change the **Store Every** interval to **1 Minutes**.
- 12. Add measurements to the table by selecting **BattV** under **Selected Sensors** in the center pane. Click **Average** in the center column of buttons. Repeat this procedure for **PTemp C** and **Temp C**.

# 4.6.4.5 Procedure: (Short Cut Steps 13 to 14)

13. Click **Finish** at the bottom of the *Short Cut* window to compile the program. At the prompt, name the program **MyTemperature**. A summary screen, like the one in the following figure, will appear showing the pre-compiler results. Pre-compile errors, if any, are displayed here.

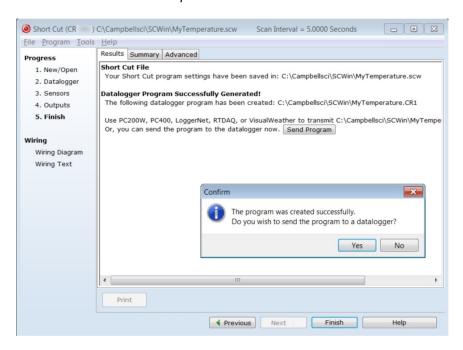


FIGURE 7: Short Cut Compile Confirmation Window and Results Tab

14. Close this window by clicking on **X** in the upper right corner.

## 4.6.5 Send Program and Collect Data

PC200W Datalogger Support Software objectives:

- Send the CRBasic program created by *Short Cut* in the previous procedure to the CR3000.
- Collect data from the CR3000.
- Store the data on the PC.

## 4.6.5.1 Procedure: (PC200W Step 1)

1. From the *PC200W* Clock/Program tab, click on Connect (upper left) to connect the CR3000 to the PC. As shown in the following figure, when connected, the Connect button changes to **Disconnect**.

**CAUTION** This procedure assumes there are no data already on the CR3000. If there are data that you want to keep on the CR3000, you should collect it before proceeding to the next step.

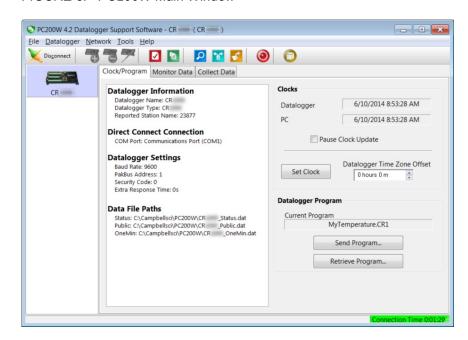


FIGURE 8: PC200W Main Window

## 4.6.5.2 Procedure: (PC200W Steps 2 to 4)

- 2. Click **Set Clock** (right pane, center) to synchronize the CR3000 clock with the computer clock.
- 3. Click **Send Program...** (right pane, bottom). A warning appears that data on the datalogger will be erased. Click **Yes**. A dialog box will open. Browse to the *C:\CampbellSci\SCWin* folder. Select the **MyTemperature.cr3** file. Click **Open**. A status bar will appear while the program is sent to the CR3000 followed by a confirmation that the transfer was successful. Click **OK** to close the confirmation.
- 4. After sending a program to the CR3000, a good practice is to monitor the measurements to ensure they are reasonable. Select the **Monitor Data** tab. As shown in the following figure, *PC200W* now displays data found in the CR3000 **Public** table.

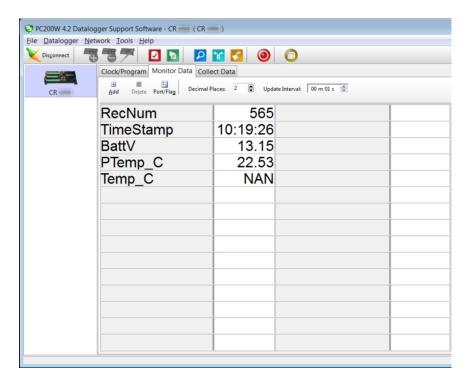


FIGURE 9: PC200W Monitor Data Tab – Public Table

# 4.6.5.3 Procedure: (PC200W Step 5)

 To view the OneMin table, select an empty cell in the display area. Click Add. In the Add Selection window Tables field, click on OneMin, then click Paste. The OneMin table is now displayed.


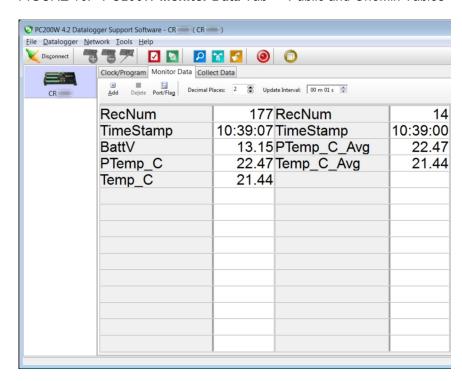


FIGURE 10: PC200W Monitor Data Tab — Public and OneMin Tables

# 4.6.5.4 Procedure: (PC200W Step 6)

6. Click on the **Collect Data** tab and select data to be collected and the storage location on the PC.


FIGURE 11: PC200W Collect Data Tab

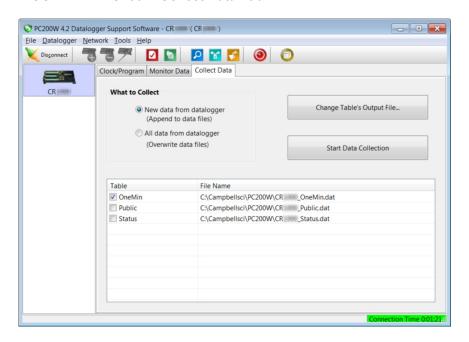


## 4.6.5.5 Procedure: (PC200W Steps 7 to 10)

- 7. Click the **OneMin** box so a check mark appears in the box. Under **What to Collect**, select **New data from datalogger**.
- 8. Click on a table in the list to highlight it, then click **Change Table's Output File...** to change the name of the destination file.
- 9. Click on Collect. A progress bar will appear as data are collected, followed by a Collection Complete message. Click OK to continue.
- 10. To view data, click the icon at the top of the *PC200W* window to open the *View* utility.

FIGURE 12: PC200W View Data Utility

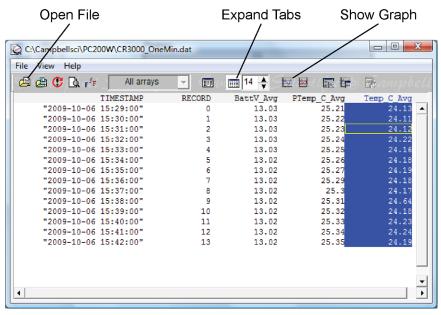


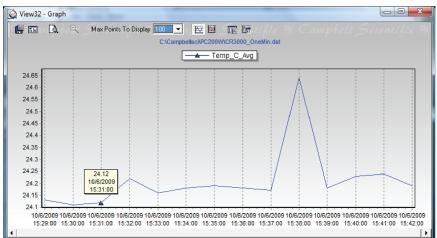

## 4.6.5.6 Procedure: (PC200W Steps 11 to 12)

- 11. Click on to open a file for viewing. In the dialog box, select the CR3000\_OneMin.dat file and click Open.
- 12. The collected data are now shown.

FIGURE 13: PC200W View Data Table

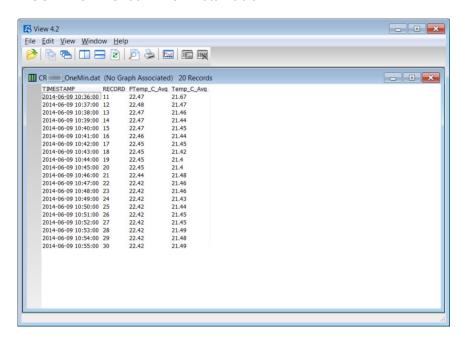

## 4.6.5.7 Procedure: (PC200W Steps 13 to 14)

- 13. Click the heading of any data column. To display the data in that column in a line graph, click the icon.
- 14. Close the **Graph** and **View** windows, and then close the *PC200W* program.

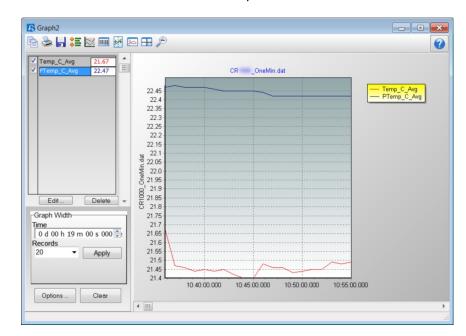


FIGURE 14: PC200W View Line Graph

## 4.7 Data Acquisition Systems — Quickstart

### Related Topics:

- Data Acquisition Systems Quickstart (p. 55)
- Data Acquisition Systems Overview (p. 58)

Acquiring data with a CR3000 datalogger requires integration of the following into a data acquisition system:


- Electronic sensor technology
- CR3000 datalogger
- Comms link
- Datalogger support software (p. 91)

A failure in any part of the system can lead to *bad* data or no data. The concept of a data acquisition system is illustrated in figure *Data Acquisition System Components* (p. 56) Following is a list of typical system components:

- Sensors (p. 37) Electronic sensors convert the state of a phenomenon to an electrical signal.
- Datalogger (p. 38) The CR3000 measures electrical signals or reads serial characters. It converts the measurement or reading to engineering units, performs calculations, and reduces data to statistical values. Data are stored in memory to await transfer to a PC by way of an external storage device or a comms link.

- Data Retrieval and Comms (p. 40) Data are copied (not moved) from the CR3000, usually to a PC, by one or more methods using datalogger support software. Most of these comms options are bi-directional, which allows programs and settings to be sent to the CR3000.
- Datalogger Support Software (p. 41) Software retrieves data and sends programs and settings. The software manages the comms link and has options for data display.
- Programmable Logic Control (p. 91) Some data acquisition systems require the control of external devices to facilitate a measurement or to control a device based on measurements. The CR3000 is adept at programmable logic control.
- *Measurement and Control Peripherals* (p. 86) Sometimes, system requirements exceed the capacity of the CR3000. The excess can usually be handled by addition of input and output expansion modules.

FIGURE 15: Data Acquisition System Components

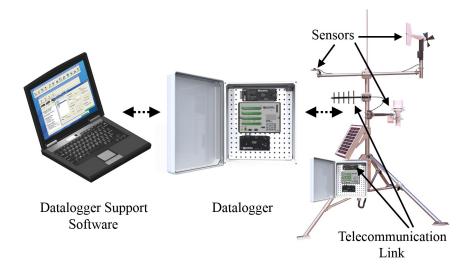

# 5. Overview

You have just received a big box (or several big boxes) from Campbell Scientific, opened it, spread its contents across the floor, and now you sit wondering what to do.

Well, that depends.

Probably, the first thing you should understand is the basic architecture of a data acquisition system. Once that framework is in mind, you can begin to conceptualize what to do next. So, job one, is to go back to the *Quickstart (p. 37)* section of this manual and work through the tutorial. When you have done that, and then read the following, you should have the needed framework.

A Campbell Scientific data acquisition system is made up of the following five basic components:

- Sensors
- Datalogger, which includes:
  - Clock
  - o Measurement and control circuitry
  - Memory
  - o Hardware and firmware to communicate with comms devices
  - o User-entered CRBasic program
- Power supply
- Comms link or external storage device
- Datalogger support software (p. 535)

The figure *Data Acquisition Systems* — *Overview (p. 58)* illustrates a common CR3000-based data acquisition system.

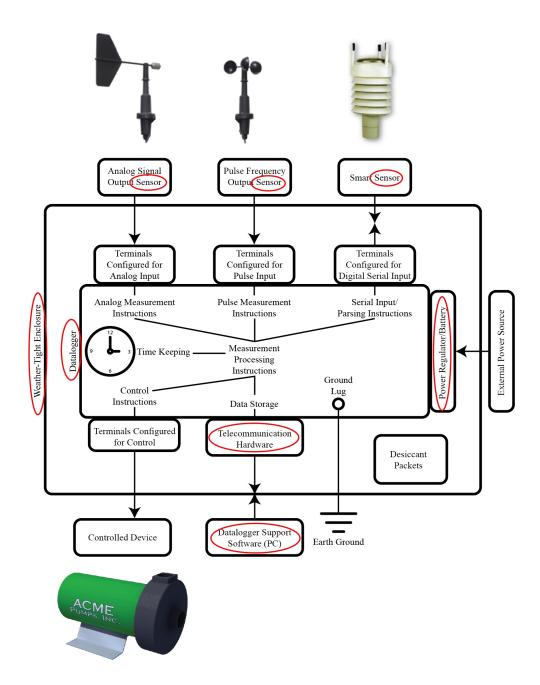


FIGURE 16: Data Acquisition System — Overview

# 5.1 Datalogger — Overview

The CR3000 datalogger is the main part of the system. It is a precision instrument designed to withstand demanding environments and to use the smallest amount of power possible. It has a central-processing unit (CPU), analog and digital measurement inputs, analog and digital outputs, and memory. An operating system (firmware) coordinates the functions of these parts in conjunction with the on-board clock and the CRBasic application program.

The application program is written in CRBasic, which is a programming language that includes measurement, data processing, and analysis routines and the standard BASIC instruction set. For simpler applications, *Short Cut (p. 555)*, a user-friendly program generator, can be used to write the progam. For more demanding programs, use *CRBasic Editor (p. 534)*.

After measurements are made, data are stored in non-volatile memory. Most applications do not require that every measurement be recorded. Instead, the program usually combines several measurements into computational or statistical summaries, such as averages and standard deviations.


Programs are run by the CR3000 in either *sequential mode* (p. 554) or the more efficient *pipeline mode* (p. 549). In sequential mode, each instruction is executed sequentially in the order it appears in the program. In pipeline mode, the CR3000 determines the order of instruction execution.

# 5.1.1 Wiring Panel — Overview

In the following figure, the CR3000 wiring panel is illustrated. The wiring panel is the interface to most CR3000 functions so studying it is a good way to get acquainted with the CR3000. Functions of the terminals are broken down into the following categories. The wiring terminals on some CR3000s are removable. For applications wherein shock or vibration is expected, or where strain may exist on the wiring harness, be sure to lock down the terminals with the screws provided at each end of the blocks.

- Analog input
- Analog output
- Pulse counting
- Digital I/O input
- Digital I/O output
- Digital I/O communications
- Dedicated power output terminal
- Power input terminal
- Ground terminals

FIGURE 17: Wiring Panel

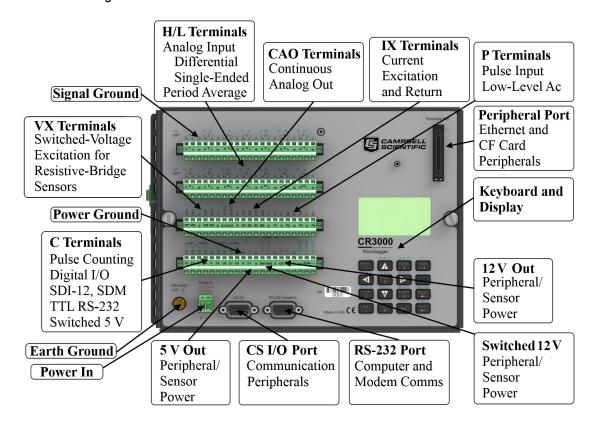

TA	BLE 2: CR3000	Wir	ing	Pai	nel '	Ter	min	al E	)efii	nitio	ons,	1																	
	SE	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28
Labels	DIFF	<sub>F</sub> 1	l٦	F 2	-	г3	-		1 -	F.5	5 7	<sub>-6</sub>	7	F7	, ,	L 8	3 -	_ p	-	r 10	0 ¬	<sub>F</sub> 1	1 ¬	r 13	2 ¬	r 1:	3 ¬	r 14	4 7
La		н	L	Н,	L		L		L		L	н		Н		Н			L		L	Н	Ĺ	Н	Ĺ	Н	L		L
	Analog Input																												
	Single-ended	✓	<b>√</b>	<b>√</b>	✓	✓	<b>√</b>	✓	✓	✓	✓	✓	✓	✓	<b>√</b>	<b>√</b>	✓	<b>√</b>	✓	<b>√</b>	✓	✓	✓	✓	✓	✓	✓	✓	✓
	Differential (high/low)	~	/	~	,	~	,		/	v	/	~		~	/	~	/	~	,	~	/	~	,	~	,	~	,	<b>✓</b>	′
	Analog period average	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
	Vibrating wire <sup>2</sup>	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
	Analog Output																												
	Switched Precision Voltage																												
	Switched Precision Current																												
	Continuous Voltage																												
	Pulse Counting																												
_	Switch closure																												
tion	High frequency																												
Function	Low-level Vac																												
_	Digital I/O																												
	Control																										Ш		
	Status																												
	General I/O (TX,RX)																												
	Pulse-width modulation																										Ш		
	Timer I/O																										Ш		
	Interrupt						<u> </u>								<u> </u>	<u> </u>				<u> </u>							Ш	Ш	
	Continuous Regulated <sup>3</sup>																												
	5 Vdc	_		<u> </u>			<u> </u>								<u> </u>	<u> </u>				<u> </u>							لــــا		
	Continuous Unregulated <sup>3</sup>																												
	12 Vdc																												

Switched Regulated <sup>3</sup>														
5 Vdc														
Switched Unregulated <sup>3</sup>														
12 Vdc														
UART														
True RS-232 (TX/RX)														
TTL RS-232 (TX/RX)														
SDI-12														
SDM (Data/Clock/Enable)														

<sup>&</sup>lt;sup>1</sup> Terminal expansion modules are available. See section Measurement and Control Peripherals — Overview (p. 86).
<sup>2</sup> Static, time domain measurement. Obsolete. See section Vibrating Wire Measurements — Overview (p. 77).
<sup>3</sup> Check the table Current Source and Sink Limits (p. 424).
<sup>4</sup> Requires an interfacing device for sensor input. See section Data Retrieval and Comms Peripherals — Lists (p. 610).

BLE 3: CR3000	Wir	ing ]	Pan	el T	erm	inal	Def	initi	ons.	. 2																			
		<b>8</b>			[	[					[			CO	M1	CO	M2	CO	M3	CO	M4		<u> </u>						Т
																													ı
														1 1	ICA	1 1	ICA	1 1 1	IXX	1 1 1	ICA								ı
																									-	-2			
	Į.	Z Z	2	¥.	5	2	3	101	402			_	_	_	67		_	10	٠,	7	~		Α	>	V12V	V12V	S-232	0/18	l
Analog Input	<u> </u>	S	\$	5		ΙΞ		ŭ	C.	- I	2	F3	P4	C	೮	ິບ	ŭ	Ü	<u> </u>	Ċ	<u> </u>	5	12	12	S	SI	R	ű	ł
· .			П	Г	Π						Π	Π	l		Π	Г			Π		Π			П	Г				t
																													t
																													t
																													t
																													t
• .	_	· /	T /	· /	ı	1			ı		ı	Г	1		ı	1		1	Г		ı		1	1	1	1			t
· ·		Ť			/	/	/																						t
							Ť	1	1																				ł
U									L .																				ı
,		I	I	I	l	I					1		1	1	1	1	1			1	1		I	I	I				ł
																													1
0 1																	Ť	Ľ											1
											<u> </u>	<u> </u>																	ı
-		1	1	1	ı	1			ı		ı	Г	1	_	· /	1	· /		·	1	· /		1	1	1	1			٩
																													1
																-													1
															1	-			1		1								-
																													4
																													4
			<u> </u>	<u> </u>	<u> </u>						<u> </u>			_	L Č	_ <u> </u>			L ×		L Č			<u> </u>	<u> </u>				ı
			T .	T .	Ι				1		Ι	1	1		Ι	T .			1		Ι			T .	T .	1			4
			<u> </u>	<u> </u>	<u> </u>						<u> </u>				<u> </u>	<u> </u>					<u> </u>	·		<u> </u>	<u> </u>				ı
			T .	T .	Ι				1		Ι	1	1		Ι	T .			1		Ι				T .	1			4
																								· ·					ł
		ı	1		1	ı			ı		1	1	ı										ı	1					4
														·	· ·	· ·	·	· ·	· ·	·	· ·								ł
			T	T								1				T			1					T	1 /				4
								_				_							_	_						· ·			ł
					1						1	1			1				1		1						,		4
			<u> </u>	<u> </u>												<u> </u>								<u> </u>	<u> </u>		<b>~</b>	✓4	ļ
			<u> </u>	<u> </u>											· I		, 				· I			<u> </u>	<u> </u>				ļ
SDI-12 SDM (Data/Clock/Enable)				ļ										✓	<b> </b>	✓		<b>✓</b>		✓					ļ				ļ
	Analog Input Single-ended Differential (high/low) Analog period average Vibrating wire² Analog Output Switched Precision Voltage Switched Precision Current Continuous Voltage Pulse Counting Switch closure High frequency Low-level Vac Digital I/O Control Status General I/O (TX,RX) Pulse-width modulation Timer I/O Interrupt Continuous Regulated³ 5 Vdc Continuous Unregulated³ 12 Vdc Switched Regulated³ 5 Vdc Switched Unregulated³ 12 Vdc UART True RS-232 (TX/RX) TTL RS-232 (TX/RX)	Analog Input Single-ended Differential (high/low) Analog period average Vibrating wire² Analog Output Switched Precision Voltage Switched Precision Current Continuous Voltage Pulse Counting Switch closure High frequency Low-level Vac Digital I/O Control Status General I/O (TX,RX) Pulse-width modulation Timer I/O Interrupt Continuous Regulated³ 5 Vdc Continuous Unregulated³ 12 Vdc Switched Regulated³ 5 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 12 Vdc UART True RS-232 (TX/RX) TTL RS-232 (TX/RX) SDI-12	Analog Input  Single-ended Differential (high/low) Analog period average Vibrating wire² Analog Output Switched Precision Voltage Switched Precision Current Continuous Voltage Pulse Counting Switch closure High frequency Low-level Vac Digital I/O Control Status General I/O (TX,RX) Pulse-width modulation Timer I/O Interrupt Continuous Regulated³ 5 Vdc Switched Regulated³ 5 Vdc Switched Regulated³ 5 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ True RS-232 (TX/RX) TTL RS-232 (TX/RX) SDI-12	Analog Input  Single-ended Differential (high/low) Analog period average Vibrating wire² Analog Output Switched Precision Voltage Switched Precision Current Continuous Voltage Pulse Counting Switch closure High frequency Low-level Vac Digital I/O Control Status General I/O (TX,RX) Pulse-width modulation Timer I/O Interrupt Continuous Regulated³ 5 Vdc Switched Regulated³ 5 Vdc Switched Regulated³ 12 Vdc Switched Unregulated³ 17 Vdc Switched Unregulated³ 18 Vdc Switched Unregulated³ 19 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 11 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 13 Vdc Switched Unregulated³ 14 Vdc Switched Unregulated³ 15 Vdc Switched Unregulated³ 16 Vdc Switched Unregulated³ 17 Vdc Switched Unregulated³ 18 Vdc Switched Unregulated³ 19 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 11 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 13 Vdc Switched Unregulated³ 14 Vdc Switched Unregulated³ 15 Vdc Switched Unregulated³ 16 Vdc Switched Unregulated³ 17 Vdc Switched Unregulated³ 18 Vdc Switched Unregulated³ 19 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 11 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 13 Vdc Switched Unregulated³ 14 Vdc Switched Unregulated³ 15 Vdc Switched Unregulated³ 16 Vdc Switched Unregulated³ 17 Vdc Switched Unregulated³ 18 Vdc Switched Unregulated³ 19 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 11 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 13 Vdc Switched Unregulated³ 14 Vdc Switched Unregulated³ 15 Vdc	Analog Input  Single-ended Differential (high/low) Analog period average Vibrating wire² Analog Output Switched Precision Voltage Switched Precision Current Continuous Voltage Pulse Counting Switch closure High frequency Low-level Vac Digital I/O Control Status General I/O (TX,RX) Pulse-width modulation Timer I/O Interrupt Continuous Regulated³ 5 Vdc Switched Regulated³ 12 Vdc Switched Unregulated³ 17 Vdc Switched Unregulated³ 18 Vdc Switched Unregulated³ 19 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 11 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 13 Vdc Switched Unregulated³ 14 Vdc Switched Unregulated³ 15 Vdc Switched Unregulated³ 16 Vdc Switched Unregulated³ 17 Vdc Switched Unregulated³ 18 Vdc Switched Unregulated³ 19 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 11 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 13 Vdc Switched Unregulated³ 14 Vdc Switched Unregulated³ 15 Vdc Switched Unregulated³ 16 Vdc Switched Unregulated³ 17 Vdc Switched Unregulated³ 18 Vdc Switched Unregulated³ 19 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 11 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 13 Vdc Switched Unregulated³ 14 Vdc Switched Unregulated³ 15 Vdc Switched Unregulated³ 16 Vdc Switched Unregulated³ 17 Vdc Switched Unregulated³ 18 Vdc Switched Unregulated³ 19 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 11 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 13 Vdc Switched Unregulated³ 14 Vdc Switched Unregulated³ 15 Vdc	Analog Input  Single-ended Differential (high/low) Analog period average Vibrating wire² Analog Output Switched Precision Voltage Switched Precision Current Continuous Voltage Pulse Counting Switch closure High frequency Low-level Vac Digital I/O Control Status General I/O (TX,RX) Pulse-width modulation Timer I/O Interrupt Continuous Regulated³ 5 Vdc Switched Regulated³ 5 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 12 Vdc Switched Regulated³ 12 Vdc Switched Regulated³ 12 Vdc Switched Regulated³ 17 Vdc Switched Unregulated³ 18 Vdc UART True RS-232 (TX/RX) TTL RS-232 (TX/RX) SDI-12	Analog Input  Single-ended Differential (high/low) Analog period average Vibrating wire² Analog Output Switched Precision Voltage Switched Precision Current Continuous Voltage Pulse Counting Switch closure High frequency Low-level Vac Digital I/O Control Status General I/O (TX,RX) Pulse-width modulation Timer I/O Interrupt Continuous Regulated³ 5 Vdc Switched Regulated³ 5 Vdc Switched Unregulated³ 12 Vdc UART True RS-232 (TX/RX) TTL RS-232 (TX/RX) SDI-12	Analog Input  Single-ended Differential (high/low) Analog period average Vibrating wire² Analog Output Switched Precision Voltage Switched Precision Current Continuous Voltage Pulse Counting Switch closure High frequency Low-level Vac Digital I/O Control Status General I/O (TX,RX) Pulse-width modulation Timer I/O Interrupt Continuous Regulated³ 5 Vdc Switched Regulated³ 12 Vdc Switched Unregulated³ 15 Vdc Switched Unregulated³ 17 Vdc Switched Unregulated³ 18 Vdc Switched Unregulated³ 19 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 11 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 13 Vdc Switched Unregulated³ 14 Vdc Switched Unregulated³ 15 Vdc Switched Unregulated³ 16 Vdc Switched Unregulated³ 17 Vdc Switched Unregulated³ 18 Vdc Switched Unregulated³ 19 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 11 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 13 Vdc Switched Unregulated³ 14 Vdc Switched Unregulated³ 15 Vdc Switched Unregulated³ 16 Vdc Switched Unregulated³ 17 Vdc Switched Unregulated³ 18 Vdc Switched Unregulated³ 19 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 11 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 13 Vdc Switched Unregulated³ 14 Vdc Switched Unregulated³ 15 Vdc Switched Unregulated³ 16 Vdc Switched Unregulated³ 17 Vdc Switched Unregulated³ 18 Vdc Switched Unregulated³ 19 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 11 Vdc Switched Unregulated³ 12 Vdc Switched Unregulated³ 13 Vdc Switched Unregulated³ 14 Vdc Switched Unregulated³ 15 Vdc Switched Unregulated³ 16 Vdc Switched Unregulated³ 17 Vdc Switched Unregulated³ 18 Vdc Switched Unregulated³ 19 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 10 Vdc Switched Unregulated³ 10 Vdc Switched Unre	Analog Input  Single-ended Differential (high/low) Analog period average Vibrating wire² Analog Output Switched Precision Voltage Switched Precision Current Continuous Voltage Pulse Counting Switch closure High frequency Low-level Vac Digital I/O Control Status General I/O (TX,RX) Pulse-width modulation Timer I/O Interrupt Continuous Regulated³ 5 Vdc Switched Regulated³ 12 Vdc Switched Unregulated³ 12 Vdc UART True RS-232 (TX/RX) TTL RS-232 (TX/RX) SDI-12	Analog Input  Single-ended Differential (high/low) Analog period average Vibrating wire² Analog Output  Switched Precision Voltage Switched Precision Current Continuous Voltage Witched Counting Witched Counting Switch Closure Witch Closure Witched Voltage Witched Voltage Witched Voltage Witched Voltage Witched Mitched Voltage Witched Mitched Voltage Witched Unregulated³ Voltage Witched Voltage Witche	Analog Input  Single-ended  Differential (high/low)  Analog period average  Vibrating wire²  Analog Output  Switched Precision Voltage  Switched Precision Current  Continuous Voltage  Switch closure  High frequency  Low-level Vac  Digital I/O  Control  Status  General I/O (TX,RX)  Pulse-width modulation  Timer I/O  Interrupt  Continuous Regulated³  5 Vde  Switched Regulated³  5 Vde  Switched Unregulated³  12 Vdc  Switched Unregulated³  13 Vdc  Switched Unregulated³  14 Vdc  Switched Unregulated³  15 Vdc  Switched Unregulated³  15 Vdc  Switched Unregulated³  17 Vdc  Switched Unregulated³  18 Vdc  Switched Unregulated³  19 Vdc  Switched Unregulated³  10 Vdc  Switched Unregulated³  11 Vdc  Switched Unregulated³  12 Vdc  Switched Unregulated³  13 Vdc  Switched Unregulated³  14 Vdc  Switched Unregulated³  15 Vdc  Switched Unregulated³  17 Vdc  Switched Unregulated³  18 Vdc  Switched Unregulated³  19 Vdc  Switched Unregulated³  10 Vdc  Switched Unregulated³  11 Vdc  Switched Unregulated³  12 Vdc  Switched Unregulated³  13 Vdc  Switched Unregulated³  14 Vdc  Switched Unregulated³  15 Vdc  Switched Unregulated³  15 Vdc  Switched Unregulated³  17 Vdc  Switched Unregulated³  18 Vdc  Switched Unregulated³  19 Vdc  Switched Unregulated³  10 Vdc  Switched Unregulated³  10 Vdc  Switched Unregulated³  11 Vdc  Switched Unregulated³  12 Vdc  Switched Unregulated³  Switched Unregulated³	Analog Input  Single-ended Differential (high/low) Analog period average Vibrating wire² Switched Precision Voltage Switched Precision Current Continuous Voltage Pulse Counting Switch closure High frequency Low-level Vac Digital I/O Control Status General I/O (TX,RX) Pulse-width modulation Timer I/O Interrupt Continuous Regulated³ 5 Vdc Switched Regulated³ 5 Vdc Switched Regulated³ 12 Vdc Switched Uargulated³ 12 Vdc UART True RS-232 (TX/RX) TTL RS-232 (TX/RX) SDI-12 SIANABO VIDE SURVEY S	Analog Input  Single-ended Differential (high/low) Analog period average Vibrating wire² Analog Output  Switched Precision Voltage Switched Precision Current Continuous Voltage Pulse Counting Switch closure High frequency Low-level Vac Digital I/O Control Status General I/O (TX,RX) Pulse-width modulation Timer I/O Interrupt Continuous Regulated³ 12 Vde Switched Regulated³ 12 Vde Switched Regulated³ 12 Vde Switched Uargulated³ 13 Vde Switched Uargulated³ 14 Vde Switched Uargulated³ 15 Vde Switched Uargulated³ 15 Vde Switched Uargulated³ 16 Vde Switched Uargulated³ 17 Vde Switched Uargulated³ 18 Vde Switched Uargulated³ 19 Vde Switched Uargulated³ 19 Vde Switched Uargulated³ 10 Vde Switched Uargulated³ 10 Vde Switched Uargulated³ 11 Vde Switched Uargulated³ 12 Vde Switched Uargulated³ 12 Vde Switched Uargulated³ 13 Vde Switched Uargulated³ 14 Vde Switched Uargulated³ 15 Vde Switched Uargulated³ 15 Vde Switched Uargulated³ 16 Vde Switched Uargulated³ 17 Vde Switched Uargulated³ 18 Vde Switched Uargulated³ 19 Vde Switched Uargulated³ 19 Vde Switched Uargulated³ 10 Vde Switched Uargulated³ 10 Vde Switched Uargulated³ 10 Vde Switched Uargulated³ 10 Vde Switched Uargulated³ 11 Vde Switched Uargulated³ 12 Vde Switched Uargulated³ 12 Vde Switched Uargulated³ 13 Vde Switched Uargulated³ 14 Vde Switched Uargulated³ 15 Vde Switched Uargulated³ 16 Vde Switched Uargulated³ 17 Vde Switched Uargulated³ 18 Vde Switched Uargulated³ 18 Vde Switched Uargulated³ 19 Vde Switched Uargulated³ 19 Vde Switched Uarg	Analog Input  Single-ended	Analog Input  Single-ended Differential (high/low) Analog period average Vibrating wire² Analog Output  Switched Precision Voltage Switched Precision Current Continuous Voltage Pulse Counting Switch closure High frequency Low-level Vac Digital I/O Control Status General I/O (TX,RX) Pulse-width modulation Timer I/O Interrupt Continuous Regulated³ 5 Vde Switched Regulated³ 12 Vde Switched Precision Switched Precision Switch closure Switch	Analog Input  Single-ended Differential (high/low) Analog period average Vibrating wire*  Switched Precision Voltage Switched Precision Current Continuous Voltage Wish closure High frequency High frequency Digital I/O Control Status General I/O (TX,RX) Pulse-width modulation Timer I/O Interrupt Continuous Regulated* SVa Continuous Regulated* SVa Continuous Unregulated* SVA CONTINUOUS Unregul	Analog Input  Single-ended  Differential (high/low)  Analog period average  Differential (high/low)  Analog Output  Switched Precision Voltage  Switched Precision Current  Continuous Voltage  Pulse Counting  Switched Precision Voltage  Differential (high/low)  Analog Output  Switched Precision Current  Continuous Voltage  Differential (high/low)  Analog Output  Switched Precision Voltage  V V V V V V V V V V V V V V V V V V V	Analog Input  Single-ended  Differential (high/low)  Analog period average  Differential (high/low)  Analog Dutput  Switched Precision Voltage  Switched Precision Current  Continuous Voltage  Pulse Counting  Switched Precision Current  Continuous Voltage  Diffine IO  I V V V V V V V V V V V V V V V I I I I	Analog Input  Single-ended  Differential (high/low)  Analog cutput  Switched Precision Voltage  Pulse Counting  Switched Precision Current  Continuous Voltage  Whigh frequency  High frequenc	Analog Input   Single-ended	COM1	Company   Comp	COM	Analog Input  Analog Input  Miles and Miles an	Analog Input  Analog Input  Analog Input  Single-ended  Differential (highlow)  Analog priod average  Virbating wire  Analog Couput  Switched Precision Voltage  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Current  Continuous Voltage  Differential (highlow)  Analog Input  Switched Precision Voltage  Switched Precision Current  Continuous Regulated Prec	Analog Input  Analog Input  Analog Input  Analog Input  Differential (high-low)  Analog Output  Switched Precision Voltage  Switched Precision Current  Continuous Voltage  Differential (high-low)  Analog Input  Differential (high-low)  Differential (high-low)  Analog Input  Differential (high-low)  Differential (high-low)	Analog Input  Single-ended  Differential (high low)  Analog Court  To Re Ta Re	Analog Input Single-ended	Analog Input   Series   Analog Compton   Analog Compton

<sup>&</sup>lt;sup>1</sup> Terminal expansion modules are available. See section Measurement and Control Peripherals — Overview (p. 86).
<sup>2</sup> Static, time domain measurement. Obsolete. See section Vibrating Wire Measurements — Overview (p. 77).
<sup>3</sup> Check the table Current Source and Sink Limits (p. 424).
<sup>4</sup> Requires an interfacing device for sensor input. See section Data Retrieval and Comms Peripherals — Lists (p. 610).

## 5.1.1.1 Switched Voltage Output — Overview

### Related Topics:

- Switched Voltage Output Specifications
- Switched Voltage Output Overview (p. 62)
- Switched Voltage Output Details (p. 424)
- Current Source and Sink Limits (p. 424)
- PLC Control Overview (p. 91)
- PLC Control Modules Overview (p. 430)
- PLC Control Modules Lists (p. 607)

C terminals are selectable as binary inputs, control outputs, or communication ports. See *Measurements* — *Overview* (p. 67) for a summary of measurement functions. Other functions include device-driven interrupts, asynchronous communications and SDI-12 communications. Table *CR3000 Terminal Definitions* (p. 60) summarizes available options.

Figure Control and Monitoring with C Terminals (p. 62) illustrates a simple application wherein a C terminal configured for digital input and another configured for control output are used to control a device (turn it on or off) and monitor the state of the device (whether the device is on or off).

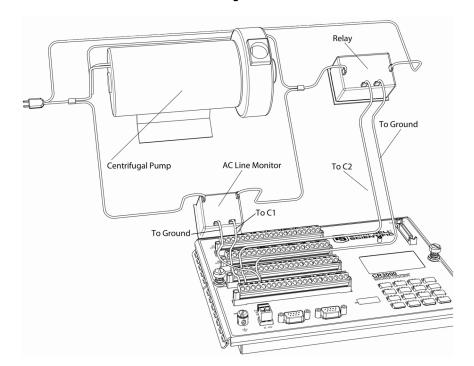


FIGURE 18: Control and Monitoring with C terminals

## 5.1.1.2 Voltage and Current Excitation — Overview

## Related Topics:

- Voltage and Current Excita (p. 62)tion Specifications
- Voltage and Current Excitation Overview (p. 62)

The CR3000 has several terminals designed to supply switched voltage and current to peripherals, sensors, or control devices:

- Voltage Excitation (switched-analog output) Vx terminals supply precise voltage. These terminals are regularly used with resistive-bridge measurements..
- Digital I/O C terminals configured for on / off and PWM (pulse width modulation) or PDM (pulse duration modulation) on C4, C5 and C7.
- Switched 12 Vdc SW12 terminals. Primary battery voltage under program control to control external devices (such as humidity sensors) requiring nominal 12 Vdc. SW12 terminals can source up to 900 mA. See the table *Current Source and Sink Limits* (p. 424).
- Continuous Analog Output (CAO) two CAO terminals (CAO1 and CAO2) capable of driving voltages from -5000 mV to 5000 mV at ±15 mA. The number of CAO terminals can be expanded with peripheral CAO devices available from Campbell Scientific. Refer to the appendix Continuous-Analog Output (CAO) Modules List (p. 607) for more information.
- Switched Current Excitation three switched current excitation terminals (IX1, IX2, IX3) with return to IXR terminal. These terminals are regularly used with resistive-bridge measurements.

### 5.1.1.3 Power Terminals

#### 5.1.1.3.1 Power In Terminals

The **POWER IN** connector is the connection point for external power supply components.

#### 5.1.1.3.2 Power Out Terminals

**Note** Refer to *Switched-Voltage Output* — *Details (p. 424)* for more information about using the CR3000 as a power supply for sensors and peripheral devices.

The CR3000 can be used as a power source for sensors and peripherals. The following voltages are available:

• 12V terminals: unregulated nominal 12 Vdc. This supply closely tracks the primary CR3000 supply voltage, so it may rise above or drop below the power requirement of the sensor or peripheral. Precautions should be taken to prevent damage to sensors or peripherals from over- or under-voltage conditions, and to minimize the error associated with the measurement of underpowered sensors. See *Power Supplies* — *Overview* (p. 86).

• 5V terminals: regulated 5 Vdc at 300 mA. The 5 Vdc supply is regulated to within a few millivolts of 5 Vdc so long as the main power supply for the CR3000 does not drop below <MinPwrSupplyVolts>.

### 5.1.1.4 Communication Ports — Overview

### Related Topics:

- Communication Ports Overview (p. 64)
- Data Retrieval and Comms Overview (p. 80)
- CPI Port and CDM Devices Overview (p. 66)
- PakBus Overview (p. 82)
- RS-232 and TTL (p. 419)

The CR3000 is equipped with hardware ports that allow communication with other devices and networks, such as:

- PC
- Smart sensors
- Modbus and DNP3 networks
- Ethernet
- Modems
- Campbell Scientific PakBus networks
- Other Campbell Scientific dataloggers
- Campbell Scientific datalogger peripherals

Communication ports include:

- CS I/O
- RS-232
- SDI-12
- SDM
- CPI (requires a peripheral device)
- Ethernet (requires a peripheral device)
- Peripheral Port supports Ethernet and CompactFlash memory card modules

#### 5.1.1.4.1 CS I/O Port

#### Read More See Serial Port Pinouts (p. 595).

 One nine-pin port, labeled CS I/O, for communicating with a PC or modem through Campbell Scientific communication interfaces, modems, or peripherals. CS I/O comms interfaces are listed in the appendix Serial I/O Modules — List (p. 605).

Note Keep CS I/O cables short (maximum of a few feet).

### 5.1.1.4.2 RS-232 Ports

**Note** RS-232 communications normally operate well up to a transmission cable capacitance of 2500 picofarads, or approximately 50 feet of commonly available serial cable.

• One nine-pin DCE port, labeled **RS-232**, normally used to communicate with a PC running *datalogger support software* (p. 91), or to connect a third-party modem. With a null-modem adapter attached, it serves as a DTE device.

### Read More See Serial Port Pinouts (p. 595).

- Two-terminal (TX and RX) RS-232 ports can be configured:
  - Up to Four TTL ports, configured from C terminals.

**Note** The nine-pin RS-232 port is isolated. RS-232 ports configured from **C** terminals are not *isolated* (p. 543).

### 5.1.1.4.3 Peripheral Port

Provided for connection of some Campbell Scientific CF memory card modules and IP network link hardware. See the appendices TCP/IP Links — List (p. 612) and Data Storage Devices — List (p. 613). See Memory Card (CRD: Drive) — Overview (p. 81) for precautions when using memory cards.

### Read More See TCP/IP — Details (p. 468).

• One multi-pin port, labeled **Peripheral Port**.

### 5.1.1.4.4 SDI-12 Ports

**Read More** See the section *Serial I/O: SDI-12 Sensor Support — Details* (p. 255).

SDI-12 is a 1200 baud protocol that supports many smart sensors. Each port requires one terminal and supports up to 16 individually addressed sensors.

• Up to four ports configured from C terminals.

### 5.1.1.4.5 SDM Port

SDM is a protocol proprietary to Campbell Scientific that supports several Campbell Scientific digital sensor and comms input and output expansion peripherals and select smart sensors.

One SDM port configured from SDM-C1, SDM-C2, and SDM-C3 terminals.

### 5.1.1.4.6 CPI Port and CDM Devices — Overview

### Related Topics:

- CPI Port and CDM Devices Overview (p. 66)
- CPI Port and CDM Devices Details (p. 494)

CPI is a new proprietary protocol that supports an expanding line of Campbell Scientific CDM modules. CDM modules are higher-speed input- and output-expansion peripherals. CPI ports also enable networking between compatible Campbell Scientific dataloggers. Consult the manuals for CDM modules for more information.

• Connection to CDM devices requires the SC-CPI interface.

#### 5.1.1.4.7 Ethernet Port

#### Read More See the section TCP/IP — Details (p. 468).

• Ethernet capability requires a peripheral Ethernet interface device, as listed in *Network Links* — *List (p. 612)*.

## 5.1.1.5 Grounding — Overview

#### Related Topics:

- Grounding Overview (p. 66)
- Grounding Details (p. 106)

Proper grounding lends stability and protection to a data acquisition system. It is the easiest and least expensive insurance against data loss — and often the most neglected. The following terminals are provided for connection of sensor and CR3000 datalogger grounds:

• \(\begin{align\*} \in \text{Signal ground reference for single-ended analog inputs, pulse inputs, excitation returns, and as a ground for sensor shield wires. Signal returns for pulse inputs should use \(\begin{align\*} \pm \text{terminals located next to the pulse} \)

input terminal. Current loop sensors, however, should be grounded to power ground.

- G Power ground return for 5V, SW12, 12V terminals, current loop sensors, and C configured for control. Use of G grounds for these outputs minimizes potentially large current flow through the analog-voltage-measurement section of the wiring panel, which can cause single-ended voltage measurement errors.
- Earth ground lug connection point for a heavy-gage earth-ground wire. A good earth connection is necessary to secure the ground potential of the CR3000 and shunt transients away from electronics. Minimum 14 AWG wire is recommended.

## 5.2 Measurements — Overview

#### Related Topics:

- Sensors Quickstart (p. 37)
- Measurements Overview (p. 67)
- Measurements Details (p. 335)
- Sensors Lists (p. 609)

Most electronic sensors, whether or not they are supplied by Campbell Scientific, can be connected directly to the CR3000.

Manuals that discuss alternative input routes, such as external multiplexers, peripheral measurement devices, or a wireless sensor network, can be found at www.campbellsci.com/manuals.

This section discusses direct sensor-to-datalogger connections and applicable CRBasic programming to instruct the CR3000 how to make, process, and store the measurements. The CR3000 wiring panel has terminals for the following measurement inputs:

# 5.2.1 Time Keeping — Overview

#### Related Topics:

- Time Keeping Overview (p. 67)
- Time Keeping Details (p. 335)

Measurement of time is an essential function of the CR3000. Time measurement with the on-board clock enables the CR3000 to attach time stamps to data, measure the interval between events, and time the initiation of control functions.

# 5.2.2 Analog Measurements — Overview

#### Related Topics:

- Analog Measurements Overview (p. 67)
- Analog Measurements Details (p. 337)

Analog sensors output a continuous voltage or current signal that varies with the phenomena measured. Sensors compatible with the CR3000 output a voltage. The CR3000 can also measure analog current output when the current is converted to voltage by using a resistive shunt.

Sensor connection is to H/L terminals configured for differential (DIFF) or single-ended (SE) inputs. For example, differential channel 1 is comprised of terminals 1H and 1L, with 1H as high and 1L as low.

### 5.2.2.1 Voltage Measurements — Overview

#### Related Topics:

- Voltage Measurements Specifications
- Voltage Measurements Overview (p. 68)
- Voltage Measurements Details (p. 380)
  - Maximum input voltage range: ±5000 mV
  - Measurement resolution range:  $0.67 \mu V$  to  $1333 \mu V$

Single-ended and differential connections are illustrated in the figures *Analog Sensor Wired to Single-Ended Channel #1 (p. 69)* and *Analog Sensor Wired to Differential Channel #1 (p. 69)*. Table *Differential and Single-Ended Input Terminals (p. 69)* lists CR3000 analog input channel terminal assignments.

Conceptually, analog voltage sensors output two signals: high and low. For example, a sensor that outputs 1000 mV on the high lead and 0 mV on the low has an overall output of 1000 mV. A sensor that outputs 2000 mV on the high lead and 1000 mV on the low also has an overall output of 1000 mV. Sometimes, the low signal is simply sensor ground (0 mV). A single-ended measurement measures the high signal with reference to ground, with the low signal tied to ground. A differential measurement measures the high signal with reference to the low signal. Each configuration has a purpose, but the differential configuration is usually preferred.

A differential configuration may significantly improve the voltage measurement. Following are conditions that often indicate that a differential measurement should be used:

- Ground currents cause voltage drop between the sensor and the signal-ground terminal. Currents >5 mA are usually considered undesirable. These currents may result from resistive-bridge sensors using voltage excitation, but these currents only flow when the voltage excitation is applied. Return currents associated with voltage excitation cannot influence other single-ended measurements of small voltage unless the same voltage-excitation terminal is enabled during the unrelated measurements.
- Measured voltage is less than 200 mV.

FIGURE 19: Analog Sensor Wired to Single-Ended Channel #1

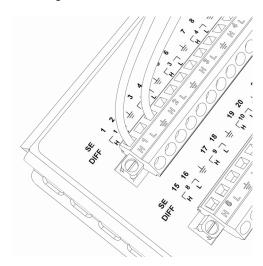


FIGURE 20: Analog Sensor Wired to Differential Channel #1

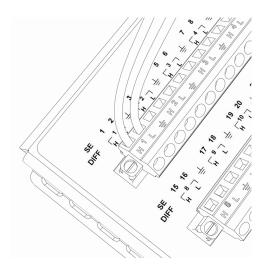


TABLE 4: Differential and Single-Ended Input Terminals

Differential DIFF Terminals	Single-Ended SE Terminals
1H	1
1L	2
2Н	3
2L	4
3Н	5
<b>3</b> L	6

TABLE 4: Differential and Single-Ended Input Terminals

Differential DIFF Terminals	Single-Ended SE Terminals
4Н	7
4L	8
5Н	9
5L	10
6Н	11
6L	12
7H	13
7L	14
8Н	15
8L	16
9Н	17
9L	18
10H	19
10L	20
11H	21
11L	22
12H	23
12L	24
13H	25
13L	26
14H	27
14L	28

## 5.2.2.1.1 Single-Ended Measurements — Overview

### Related Topics:

- Single-Ended Measurements Overview (p. 70)
- Single-Ended Measurements Details (p. 385)

A single-ended measurement measures the difference in voltage between the terminal configured for single-ended input and the reference ground. While differential measurements are usually preferred, a single-ended measurement is often adequate in applications wherein some types of noise are not present and care is taken to avoid problems caused by *ground currents (p. 541)*. Examples of applications wherein a single-ended measurement may be preferred include:

- Not enough differential terminals available. Differential measurements use twice as many H/L terminals as do single-ended measurements.
- Rapid sampling is required. Single-ended measurement time is about half that of differential measurement time.
- Sensor is not designed for differential measurements. Many Campbell
  Scientific sensors are not designed for differential measurement, but the
  draw backs of a single-ended measurement are usually mitigated by large
  programmed excitation and/or sensor output voltages.

However, be aware that because a single-ended measurement is referenced to CR3000 ground, any difference in ground potential between the sensor and the CR3000 will result in error, as emphasized in the following examples:

- If the measuring junction of a thermocouple used to measure soil temperature is not insulated, and the potential of earth ground is greater at the sensor than at the point where the CR3000 is grounded, a measurement error will result. For example, if the difference in grounds is 1 mV, with a copper-constantan thermocouple, the error will be approximately 25 °C.
- If signal conditioning circuitry, such as might be found in a gas analyzer, and the CR3000 use a common power supply, differences in current drain and lead resistance often result in different ground potentials at the two instruments despite the use of a common ground. A differential measurement should be made on the analog output from the external signal conditioner to avoid error.

### 5.2.2.1.2 Differential Measurements — Overview

### Related Topics:

- Differential Measurements Overview (p. 71)
- Differential Measurements Details (p. 386)

**Summary** Use a differential configuration when making voltage measurements, unless constrained to do otherwise.

A differential measurement measures the difference in voltage between two input terminals. Its autosequence is characterized by multiple measurements, the results of which are autoaveraged before the final value is reported. For example, the sequence on a differential measurement using the **VoltDiff()** instruction involves two measurements — first with the high input referenced to the low, then with the inputs reversed. Reversing the inputs before the second measurement cancels noise common to both leads as well as small errors caused by junctions of different metals that are throughout the measurement electronics.

### 5.2.2.2 Current Measurements — Overview

### Related Topics:

- Current Measurements Overview (p. 72)
- Current Measurements Details (p. 380)

A measurement of current is accomplished through the use of external resistors to convert current to voltage, then measure the voltage as explained in the section *Differential Measurements* — *Overview (p. 71)*. The voltage is measured with the CR3000 voltage measurement circuitry. **IX** terminals supply precise current excitation for use with resistive bridges.

### 5.2.2.3 Resistance Measurements — Overview

### Related Topics:

- Resistance Measurements Specifications
- Resistance Measurements Overview (p. 72)
- Resistance Measurements Details (p. 367)
- Measurement: RTD, PRT, PT100, PT1000 (p. 273)

Many analog sensors use some kind of variable resistor as the fundamental sensing element. As examples, wind vanes use potentiometers, pressure transducers use strain gages, and temperature sensors use thermistors. These elements are placed in a Wheatstone bridge or related circuit. With the exception of PRTs, another type of variable resistor. See *Measurement: RTD, PRT, PT100, PT1000 (p. 273)*. This manual does not give instruction on how to build variable resistors into a resistor bridge. Sensor manufacturers consider many criteria when deciding what type of resistive bridge to use for their sensors. The CR3000 can measure most bridge circuit configurations.

## 5.2.2.3.1 Voltage Excitation

Bridge resistance is determined by measuring the difference between a known voltage applied to the excitation (input) arm of a resistor bridge and the voltage measured on the output arm. The CR3000 supplies a precise-voltage excitation via **Vx** terminals. Return voltage is measured on **H/L** terminals configured for single-ended or differential input. Examples of bridge-sensor wiring using voltage excitation are illustrated in figures *Half-Bridge Wiring — Wind Vane Potentiometer* (p. 73) and *Full-Bridge Wiring — Pressure Transducer* (p. 73).

FIGURE 21: Half-Bridge Wiring Example — Wind Vane Potentiometer

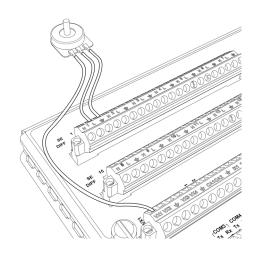


FIGURE 22: Full-Bridge Wiring Example
— Pressure Transducer



## 5.2.2.3.2 Current Excitation

Resistance can also be measured by supplying a precise current and measuring the return voltage. The CR3000 supplies a precise current from **IX** terminals. Return voltage is measured on numbered **SE** or **DIFF** terminals. Examples of bridge-sensor wiring using current excitation are illustrated in *FIGURE: PT100 Resistance() Basic-Circuit Schematic (p. 291).* 

**Note** When using long leads with current excitation, consult *Settling Error* (p. 343).

### 5.2.2.4 Strain Measurements — Overview

Related Topics:

- Strain Measurements Overview (p. 74)
- Strain Measurements Details (p. 378)
- FieldCalStrain() Examples (p. 243)

Strain gage measurements are usually associated with structural-stress analysis.

## 5.2.3 Pulse Measurements — Overview

Related Topics:

- Pulse Measurements Specifications
- Pulse Measurements Overview (p. 74)
- Pulse Measurements Details (p. 404)

The output signal generated by a pulse sensor is a series of voltage waves. The sensor couples its output signal to the measured phenomenon by modulating wave frequency. The CR3000 detects the state transition as each wave varies between voltage extremes (high-to-low or low-to-high). Measurements are processed and presented as counts, frequency, or timing data.

**P** terminals are configurable for pulse input to measure counts or frequency from the following signal types:

- High-frequency 5 Vdc square-wave
- Switch closure
- Low-level ac

C terminals configurable for input for the following:

- State
- Edge counting
- Edge timing

**Note** A period-averaging sensor has a frequency output, but it is connected to a **SE** terminal configured for period-average input and measured with the **PeriodAverage()** instruction. See *Period Averaging* — *Overview (p. 76)*.

## 5.2.3.1 Pulses Measured

The CR3000 measures three types of pulse outputs, which are illustrated in the figure *Pulse Sensor Output Signal Types* (p. 75).

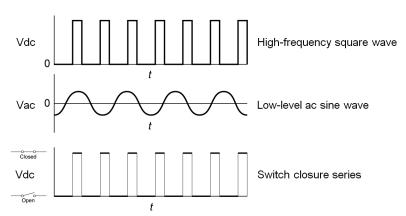


FIGURE 23: Pulse Sensor Output Signal Types

# 5.2.3.2 Pulse Input Channels

Table *Pulse Input Terminals and Measurements (p. 75)* lists devices, channels and options for measuring pulse signals.

TABLE 5: Pulse Input Terminals and Measurements			
Pulse Input Terminal	-		CRBasic Instruction
P Terminal	<ul> <li>Low-level ac</li> <li>High- frequency</li> <li>Switch-closure</li> </ul>	<ul><li>Counts</li><li>Frequency</li><li>Run average of frequency</li></ul>	PulseCount()
C Terminal	<ul> <li>Low-level ac with LLAC4 (p. 604) module</li> <li>High-frequency</li> <li>Switch-closure</li> </ul>	<ul> <li>Counts</li> <li>Frequency</li> <li>Running average of frequency</li> <li>Interval</li> <li>Period</li> <li>State</li> </ul>	PulseCount() TimerIO()

## 5.2.3.3 Pulse Sensor Wiring

Read More See Pulse Measurement Tips (p. 412).

An example of a pulse sensor connection is illustrated in figure *Pulse Input Wiring Example — Anemometer Switch (p. 76).* Pulse sensors have two active wires, one of which is ground. Connect the ground wire to a + (signal ground) terminal. Connect the other wire to a **P** terminal. Sometimes the sensor will require power from the CR3000, so there may be two added wires — one of which will be power ground. Connect power ground to a **G** terminal. Do not

confuse the pulse wire with the positive power wire, or damage to the sensor or CR3000 may result. Some switch closure sensors may require a pull-up resistor.

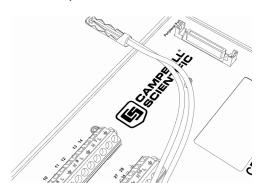


FIGURE 24: Pulse Input Wiring Example — Anemometer

## 5.2.4 Period Averaging — Overview

Related Topics:

- Period Average Measurements Specifications
- Period Average Measurements Overview (p. 76)
- Period Average Measurements Details (p. 418)

CR3000 SE terminals can be configured to measure period average.

Note Both pulse count and period average measurements are used to measure frequency output sensors. Yet pulse count and period average measurement methods are different. Pulse count measurements use dedicated hardware — pulse count accumulators, which are always monitoring the input signal, even when the CR3000 is between program scans. In contrast, period average measurement instructions only monitor the input signal during a program scan. Consequently, pulse count scans can usually be much less frequent than period average scans. Pulse counters may be more susceptible to low-frequency noise because they are always "listening", whereas period averaging may filter the noise by reason of being "asleep" most of the time. Pulse count measurements are not appropriate for sensors that are powered off between scans, whereas period average measurements work well since they can be placed in the scan to execute only when the sensor is powered and transmitting the signal.

Period average measurements use a high-frequency digital clock to measure time differences between signal transitions, whereas pulse count measurements simply accumulate the number of counts. As a result, period average measurements offer much better frequency resolution per measurement interval, as compared to pulse count measurements. The frequency resolution of pulse count measurements can be improved by extending the measurement interval by increasing the scan interval and by averaging. For information on frequency resolution, see *Frequency Resolution* (p. 409).

# 5.2.5 Vibrating Wire Measurements — Overview

#### Related Topics:

- Vibrating Wire Measurements Specifications
- Vibrating Wire Measurements Overview (p. 77)
- Vibrating Wire Measurements Details (p. 417)

Vibrating wire sensors are the sensor of choice in many environmental and industrial applications that need sensors that will be stable over very long periods, such as years or even decades. The CR3000 can measure these sensors either directly or through interface modules.

A thermistor included in most sensors can be measured to compensate for temperature errors.

Measuring the resonant frequency by means of period averaging is the classic technique, but Campbell Scientific has developed static and dynamic spectral-analysis techniques (*VSPECT (p. 562)*) that produce superior noise rejection, higher resolution, diagnostic data, and, in the case of dynamic VSPECT, measurements up to 333.3 Hz.

**SE** terminals are configurable for time-domain vibrating wire measurement, which is a technique now superseded in most applications by *VSPECT* (p. 562) vibrating wire analysis. See *Vibrating Wire Input Modules* — *List* (p. 605) for more information

Dynamic VSPECT measurements require addition of an interface module.

# 5.2.6 Reading Smart Sensors — Overview

#### **Related Topics:**

- Reading Smart Sensors Overview (p. 77)
- Reading Smart Sensors Details (p. 419)

A smart sensor is equipped with independent measurement circuitry that makes the basic measurement and sends measurement and measurement related data to the CR3000. Smart sensors vary widely in output modes. Many have multiple output options. Output options supported by the CR3000 include *SDI-12* (p. 255), RS-232 (p. 303), Modbus (p. 476), and DNP3 (p. 475).

The following smart sensor types can be measured on the indicated terminals:

- SDI-12 devices: C
- Synchronous Devices for Measurement (SDM): C

- Smart sensors: C terminals, RS-232 port, and CS I/O port with the appropriate interface.
- Modbus or DNP3 network: RS-232 port and CS I/O port with the appropriate interface
- Other serial I/O devices: C terminals, **RS-232** port, and **CS I/O** port with the appropriate interface

## 5.2.6.1 SDI-12 Sensor Support — Overview

#### Related Topics:

- SDI-12 Sensor Support Overview (p. 78)
- SDI-12 Sensor Support Details (p. 420)
- Serial I/O: SDI-12 Sensor Support Programming Resource (p. 255)

SDI-12 is a smart-sensor protocol that uses one input port on the CR3000 and is powered by 12 Vdc. Refer to the chart *CR3000 Terminal Definitions* (p. 60), which indicates C terminals that can be configured for SDI-12 input.

### 5.2.6.2 RS-232 — Overview

The CR3000 has 6 ports available for RS-232 input as shown in figure *Terminals Configurable for RS-232 Input (p. 78)*.

As indicated in figure *Use of RS-232 and Digital I/O when Reading RS-232 Devices (p. 79)*, RS-232 sensors can often be connected to C terminal pairs configured for serial I/O, to the **RS-232** port, or to the **CS I/O** port with the proper adapter. Ports can be set up for baud rate, parity, stop-bit, and so forth as described in *CRBasic Editor Help*.

FIGURE 25: Terminals Configurable for RS-232 Input



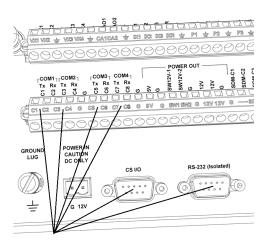


FIGURE 26: Use of RS-232 and Digital I/O when Reading RS-232 Devices

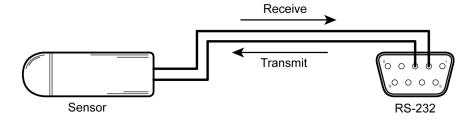



## 5.2.7 Field Calibration — Overview

### **Related Topics:**

- Field Calibration Overview (p. 79)
- Field Calibration Details (p. 229)

Calibration increases accuracy of a measurement device by adjusting its output, or the measurement of its output, to match independently verified quantities. Adjusting sensor output directly is preferred, but not always possible or practical. By adding **FieldCal()** or **FieldCalStrain()** instructions to the CR3000 CRBasic program, measurements of a linear sensor can be adjusted by modifying the programmed multiplier and offset applied to the measurement without modifying or recompiling the CRBasic program.

# 5.2.8 Cabling Effects — Overview

### Related Topics:

- Cabling Effects Overview (p. 79)
- Cabling Effects Details (p. 421)

Sensor cabling can have significant effects on sensor response and accuracy. This is usually only a concern with sensors acquired from manufacturers other than Campbell Scientific. Campbell Scientific sensors are engineered for optimal performance with factory-installed cables.

# 5.2.9 Synchronizing Measurements — Overview

## Related Topics:

- Synchronizing Measurements Overview (p. 79)
- Synchronizing Measurements Details (p. 422)

### 5.2.9.1 Synchronizing Measurements in the CR3000 — Overview

## 5.2.9.2 Synchronizing Measurements in a Datalogger Network — Overview

Large numbers of sensors, cable length restrictions, or long distances between measurement sites may require use of multiple CR3000s.

## 5.3 Data Retrieval and Comms — Overview

#### Related Topics:

- Data Retrieval and Comms Quickstart (p. 40)
- Data Retrieval and Comms Overview (p. 80)
- Data Retrieval and Comms Details (p. 466)
- Data Retrieval and Comms Peripherals Lists (p. 610)

The CR3000 communicates with external devices to receive programs, send data, or join a network. Data are usually moved through a comms link consisting of hardware and a protocol using Campbell Scientific *datalogger support software (p. 615)*. Data can also be shuttled with external memory such as a CompactFlash (CF) card (CRD: drive) or a Campbell Scientific mass storage media (USB: drive) to the PC.

## 5.3.1 Data File Formats in CR3000 Memory

Routine CR3000 operations store data in binary data tables. However, when the **TableFile()** instruction is used, data are also stored in one of several formats in discrete text files in internal or external memory. See *Memory Drives — On-board (p. 445)* for more information on the use of the **TableFile()** instruction.

# 5.3.2 Data Format on Computer

CR3000 data stored on a PC with *datalogger support software* (p. 615) are formatted as either ASCII or binary depending on the file type selected in the support software. Consult the software manual for details on available data-file formats.

# **5.3.3 Mass-Storage Device**

**Caution** When removing a Campbell Scientific mass storage device (thumb drive) from the CR3000, do so only when the LED is not lit or flashing. Removing the device while it is active can cause data corruption.

Data stored on a SC115 Campbell Scientific mass storage device can be retrieved via a comms link to the CR3000 if the device remains on the **CS I/O** port. Data can also be retrieved by removing the device, connecting it to a PC, and copying off files using *Windows File Explorer*.

# 5.3.4 Memory Card (CRD: Drive) — Overview

#### Related Topics:

- Memory Card (CRD: Drive) Overview (p. 81)
- Memory Card (CRD: Drive) Details (p. 447)
- Memory Cards and Record Numbers (p. 453)
- Data Output: Writing High-Frequency Data to Memory Cards (p. 217)
- File System Errors (p. 464)
- Data Storage Devices List (p. 613)
- Data File Format Examples (p. 450)
- Data Storage Drives Table (p. 444)

#### **Caution** Observe the following precautions when using memory cards:

- Before removing a card from the card module, or removing the card module from the CR3000, disable the card by pressing the **Initiate Removal** button (NOT the eject button), wait for the green light.
- Do not remove a memory card while the drive is active or data corruption and damage to the card may result.
- Prevent data loss by collecting data before sending a program from the memory card to the CR3000. Sending a program from the card to the CR3000 often erases all data.

Data stored on a memory card are collected to a PC through a comms link with the CR3000 or by removing the card and collecting it directly using a third-party adapter on a PC.

#### 5.3.4.1 Comms

The CR3000 accesses data on the card as needed to fill data-collection requests initiated with the datalogger support software **Collect** (p. 532) command. An alternative, if care is taken, is to collect data in binary form. Binary data are collected using the datalogger support software **File Control** | **Retrieve** (p. 539) command. Before collecting data this way, stop the CR3000 program to ensure data are not written to the card while data are retrieved, or data will be corrupted.

## 5.3.4.2 Direct with Adapter to PC

Data transfer is much faster through an adapter than through a comm link. This speed difference is especially noticeable with large files.

The format of data files collected by direct connection of the card with a PC may be different than the standard Campbell Scientific data file formats (binary — format depends on the instruction used to write to the card). See section *Data File Format Examples (p. 450)* for more information. Binary data files can be converted to a Campbell Scientific format using *CardConvert (p. 531)* software.

## 5.3.5 Comms Protocols

The primary communication protocol is *PakBus (p. 548)*. PakBus is a protocol proprietary to Campbell Scientific.

## 5.3.5.1 PakBus Comms — Overview

#### Related Topics:

- PakBus Comms Overview (p. 82)
- PakBus Networking Guide (available at www.campbellsci.com/manuals)

The CR3000 communicates with datalogger support software (p. 615), comms peripherals (p. 610), and other dataloggers (p. 603) with PakBus, a proprietary network communication protocol. PakBus is a protocol similar in concept to IP (Internet Protocol). By using signatured data packets, PakBus increases the number of communication and networking options available to the CR3000. Communication can occur via TCP/IP, on the RS-232 port, CS I/O port, and C terminals.

Advantages of PakBus are as follows:

- Simultaneous communication between the CR3000 and other devices.
- Peer-to-peer communication no PC required. Special CRBasic instructions simplify transferring data between dataloggers for distributed decision making or control.
- Data consolidation other PakBus dataloggers can be used as sensors to consolidate all data into one Campbell Scientific datalogger.
- Routing the CR3000 can act as a router, passing on messages intended for another Campbell Scientific datalogger. PakBus supports automatic route detection and selection.
- Short distance networks with no extra hardware, a CR3000 can talk to another CR3000 over distances up to 30 feet by connecting transmit, receive and ground wires between the dataloggers.

In a PakBus network, each datalogger is set to a unique address. The default PakBus address in most devices is 1. To communicate with the CR3000, the datalogger support software must know the CR3000 PakBus address. The PakBus address is changed using the CR1000KD Keyboard/Display (p. 483), DevConfig utility (p. 113), CR3000 Status table (p. 567), or PakBus Graph (p. 548) software.

## 5.3.6 Alternate Comms Protocols — Overview

## Related Topics:

- Alternate Comms Protocols Overview (p. 82)
- Alternate Comms Protocols Details (p. 468)

Other comms protocols are also included:

- Web API (p. 475, p. 475)
- Modbus (p. 83)
- DNP3 (p. 83)

Refer to Specifications (p. 95) for a complete list of supported protocols. See Data Retrieval and Comms Peripherals — Lists (p. 610) for devices available from Campbell Scientific.

Keyboard displays also communicate with the CR3000. See *Keyboard/Display* — *Overview (p. 84)* for more information.

#### 5.3.6.1 Modbus — Overview

#### **Related Topics:**

- Modbus Overview (p. 83)
- Modbus Details (p. 476)

The CR3000 supports Modbus master and Modbus slave communications for inclusion in Modbus SCADA networks. Modbus is a widely used SCADA communication protocol that facilitates exchange of information and data between computers / HMI software, instruments (RTUs) and Modbus-compatible sensors. The CR3000 communicates with Modbus over RS-232, (with a RS-232 to RS-485 such as an MD485 adapter), and TCP.

Modbus systems consist of a master (PC), RTU / PLC slaves, field instruments (sensors), and the communication-network hardware. The communication port, baud rate, data bits, stop bits, and parity are set in the Modbus driver of the master and / or the slaves. The CR3000 supports RTU and ASCII communication modes on RS-232 and RS485 connections. It exclusively uses the TCP mode on IP connections.

Field instruments can be queried by the CR3000. Because Modbus has a set command structure, programming the CR3000 to get data from field instruments is much simpler than from serial sensors. Because Modbus uses a common bus and addresses each node, field instruments are effectively multiplexed to a CR3000 without additional hardware.

#### 5.3.6.2 DNP3 — Overview

#### Related Topics:

- DNP3 Overview (p. 83)
- DNP3 Details (p. 475)

The CR3000 supports DNP3 slave communications for inclusion in DNP3 SCADA networks.

## 5.3.6.3 TCP/IP — Overview

#### Related Topics:

- TCP/IP Overview
- TCP/IP Details (p. 468)
- TCP/IP Links List (p. 612)

The following TCP/IP protocols are supported by the CR3000 when using *network links* (p. 612) that use the resident IP stack or when using a cell modem with the PPP/IP key enabled. The following sections include information on some of these protocols:

- DHCP
- DNS
- FTP
- HTML
- HTTP
- •
- Micro-serial server
- Modbus TCP/IP
- NTCIP
- NTP
- PakBus over TCP/IP
- Ping

- POP3
- SMTP
- SNMP
- Telnet
- Web API

IPv4

- XML
- UDP
- · ODI
- IPv6
- •

5.3.7 Comms Hardware — Overview

The CR3000 can accommodate, in one way or another, nearly all comms options. Campbell Scientific specializes in RS-232, USB, RS-485, short haul (twisted pairs), Wi-Fi, radio (single frequency and spread spectrum), land-line telephone, cell phone / IP modem, satellite, ethernet/internet, and sneaker net (external memory).

The most common comms hardware is an RS-232 cable or USB cable. These are short-distance direct-connect devices that require no configuration of the CR3000. All other comms methods require peripheral devices; some require that CR3000 settings be configured differently than the defaults.

# 5.3.8 Keyboard/Display — Overview

The CR1000KD Keyboard/Display is a powerful tool for field use.

The keyboard/display is an essential installation, maintenance, and troubleshooting tool for many applications. It allows interrogation and configuration of the CR3000 datalogger independent of other comms links. More information on the use of the keyboard/display is available in *Custom* 

84

*Menus* — *Overview* (p. 85). The keyboard/display will not operate when a USB cable is plugged into the USB port.

## 5.3.8.1 Integrated Keyboard/Display

The keyboard display, illustrated in figure Wiring Panel (p. 39), is an integrated feature of the CR3000.

#### 5.3.8.2 Character Set

The keyboard display character set is accessed using one of the following three procedures:

- The 16 keys default to ▲, ▼, ◄, ▶, Home, PgUp, End, PgDn, Del, and Ins.
- To enter numbers, first press **Num Lock**. **Num Lock** stays set until pressed again.
- Above all keys, except Num Lock and Shift, are characters printed in blue. To enter one of these characters, press Shift one to three times to select the position of the character as shown above the key, then press the key. For example, to enter Y, press Shift Shift Shift PgDn.
- To insert a space (Spc) or change case (Cap), press Shift one to two times for the position, then press BkSpc.
- To insert a character not printed on the keyboard, enter **Ins**, scroll down to **Character**, press **Enter**, then press **△**, **▼**, **⊸**, **▶** to scroll to the desired character in the list that is presented, then press **Enter**.

### 5.3.8.3 Custom Menus — Overview

CRBasic programming in the CR3000 facilitates creation of custom menus for the CR1000KD Keyboard/Display.

Figure Custom Menu Example (p. 86) shows windows from a simple custom menu named DataView by the programmer. DataView appears in place of the default main menu on the keyboard display. As shown, DataView has menu item Counter, and submenus PanelTemps, TCTemps and System Menu. Counter allows selection of one of four values. Each submenu displays two values from CR3000 memory. PanelTemps shows the CR3000 wiring-panel temperature at each scan, and the one-minute sample of panel temperature. TCTemps displays two thermocouple temperatures.

DataView Panel Temps: **PanelTemps** 23,4960 Scan Counter 0.00000 Final Stg 23.5000 **TCTemps** System Menu TCTemps: TC\_Temp\_1 29.4355 TC\_Temp\_2 32.3133 Data Run/Stop Program File Ports and Status Configure, Settings

FIGURE 27: Custom Menu Example

## 5.4 Measurement and Control Peripherals — Overview

Modules are available from Campbell Scientific to expand the number of terminals on the CR3000. These include:

### Multiplexers

Multiplexers increase the input capacity of terminals configured for analoginput, and the output capacity of Vx excitation terminals.

#### **SDM Devices**

Serial Device for Measurement expand the input and output capacity of the CR3000. These devices connect to the CR3000 through terminals **SDM-C1**, **SDM-C2**, and **SDM-C3**.

#### **CDM Devices**

Campbell **D**istributed **M**odules measurement and control modules that use the high speed CAN Peripheral Interface (CPI) bus technology. These connect through the SC-CPI interface.

# 5.5 Power Supplies — Overview

The CR3000 is powered by a nominal 12 Vdc source. Acceptable power range is 10 to 16 Vdc.CR3000s may be ordered with an integrated power supply base. Power to a power supply base is controlled by a manual switch on the right side of the case, below the keyboard display. Power connects through the green **POWER IN** connector on the face of the CR3000. The positive power lead connects to **12V**. The negative lead connects to **G**. The connection is internally reverse-polarity protected.

The CR3000 is internally protected against accidental polarity reversal on the power inputs.

The CR3000 has a modest-input power requirement. For example, in low-power applications, it can operate for several months on non-rechargeable batteries. Power systems for longer-term remote applications typically consist of a charging source, a charge controller, and a rechargeable battery. When ac line power is available, a Vac-to-Vac or Vac-to-Vdc wall adapter, a peripheral charging regulator, and a rechargeable battery can be used to construct a UPS (uninterruptible power supply).

# 5.6 CR3000 Setup — Overview

#### Related Topics:

- CR3000 Setup Overview (p. 87)
- CR3000 Setup Details (p. 112)
- Status, Settings, and Data Table Information (Info Tables and Settings) (p. 567)

The CR3000 is shipped factory-ready with an operating system (OS) installed. Settings default to those necessary to communicate with a PC via **RS-232** and to accept and execute application programs. For more complex applications, some settings may need adjustment. Settings can be changed with the following:

- DevConfig (Device Configuration Utility)
- CR1000KD Keyboard/Display
- Datalogger support software

OS files are sent to the CR3000 with *DevConfig* or through the program **Send** button in datalogger support software. When the OS is sent with *DevConfig*, most settings are cleared, whereas, when sent with datalogger support software, most settings are retained. Operating systems can also be transferred to the CR3000 with a Campbell Scientific mass storage device or memory card. OS and settings remain intact when power is cycled.

OS updates are occasionally made available at www.campbellsci.com.

# 5.7 CRBasic Programming — Overview

### Related Topics:

- CRBasic Programming Overview (p. 87)
- CRBasic Programming Details (p. 129)
- Programming Resource Library (p. 181)
- CRBasic Editor Help

A CRBasic program directs the CR3000 how and when sensors are to be measured, calculations made, and data stored. A program is created on a PC and sent to the CR3000. The CR3000 can store a number of programs in memory, but

only one program is active at a given time. Two Campbell Scientific software applications, *Short Cut* and *CRBasic Editor*, are used to create CR3000 programs.

- Short Cut creates a datalogger program and wiring diagram in four easy steps. It supports most sensors sold by Campbell Scientific and is recommended for creating simple programs to measure sensors and store data.
- Programs generated by Short Cut are easily imported into CRBasic
   Editor for additional editing. For complex applications, experienced
   programmers often create essential measurement and data storage code
   with Short Cut, then add more complex code with CRBasic Editor.

**Note** Once a *Short Cut* generated program has been edited with *CRBasic Editor*, it can no longer be modified with *Short Cut*.

# 5.8 Security — Overview

The CR3000 is supplied void of active security measures. By default, RS-232, Telnet, FTP and HTTP services, all of which give high level access to CR3000 data and CRBasic programs, are enabled without password protection.

You may wish to secure your CR3000 from mistakes or tampering. The following may be reasons to concern yourself with datalogger security:

- Collection of sensitive data
- Operation of critical systems
- Networks accessible by many individuals

Some options to secure your datalogger from mistakes or tampering include:

- Sending the latest operating system to the datalogger.
- Disabling unused services and securing those that are used. This includes disabling HTTP, FTP, Telnet, and Ping network services (Device Configuration Utility | Settings Editor | Network Services tab). These services can be used to discover your datalogger on an IP network.
- Setting security codes (see section *Pass-Code Lockout (p. 438)*).
- Setting a PakBus/TCP password. The PakBus TCP password controls access to PakBus communication over a TCP/IP link. PakBusTCP passwords can be set in *Device Configuration Utility*.
- Disabling FTP or setting an FTP username and password in *Device Configuration Utility*.
- Setting a PakBus encryption (AES-128) key in *Device Configuration Utility*. This forces PakBus data to be encrypted during transmission.

- Disabling HTTP or creating a .csipasswd file to secure HTTP/HTTPS (see section .csipasswd (p. 439) for more information).
- Tracking Operating System, Run, and Program signatures.
- Encrypting program files if they contain sensitive information (see CRBasic help **FileEncrypt()** instruction or use the CRBasic Editor **File** menu, **Save and Encrypt** option).
- Hiding program files for extra protection (see CRBasic help **FileManage()** instruction).
- Securing the physical datalogger and power supply under lock and key.
- Monitoring your datalogger for changes by tracking program and operating system signatures, as well as CPU and USR file contents.

**Warning** All security features can be subverted through physical access to the datalogger. If absolute security is a requirement, the physical datalogger must be kept in a secure location.

## 5.9 Maintenance — Overview

```
Related Topics:
```

- Maintenance Overview (p. 89)
- Maintenance Details (p. 497)

With reasonable care, the CR3000 should give many years of reliable service.

## 5.9.1 Protection from Moisture — Overview

```
Protection from Moisture — Overview (p. 89)
Protection from Moisture — Details (p. 112)
Protection from Moisture — Products (p. 622)
```

The CR3000 and most of its peripherals must be protected from moisture. Moisture in the electronics will seriously damage, and probably render unrepairable, the CR3000. Water can come in liquid form from flooding or sprinkler irrigation, but most often it comes as condensation. In most cases, protection from water is easily accomplished by placing the CR3000 in a weather-tight enclosure with desiccant and by elevating the enclosure above the ground. The CR3000 is shipped with internal desiccant packs to reduce humidity. Desiccant in enclosures should be changed periodically.

**Note** Do not completely seal the enclosure if lead acid batteries are present; hydrogen gas generated by the batteries may build up to an explosive concentration.

# 5.9.2 Protection from Voltage Transients — Overview

The CR3000 must be grounded to minimize the risk of damage by voltage transients associated with power surges and lightning-induced transients. Earth grounding is required to form a complete circuit for voltage clamping devices internal to the CR3000.

# 5.9.3 Factory Calibration — Overview

### Related Topics

- Auto Self-Calibration Overview (p. 93)
- Auto Self-Calibration Details (p. 373)
- Auto Self-Calibration Errors (p. 515)
- Offset Voltage Compensation (p. 347)
- Factory Calibration (p. 90)
- Factory Calibration or Repair Procedure (p. 500)

The CR3000 uses an internal voltage reference to routinely calibrate itself. Campbell Scientific recommends factory recalibration as specified in *Specifications* (p. 95). If calibration services are required, see *Assistance* (p. 5).

# 5.9.4 Internal Battery — Overview

#### Related Topics:

- Internal Battery Quickstart (p. 40)
- Internal Battery Details (p. 497)

**Warning** Misuse or improper installation of the internal lithium battery can cause severe injury. Fire, explosion, and severe burns can result. Do not recharge, disassemble, heat above 100 °C (212 °F), solder directly to the cell, incinerate, or expose contents to water. Dispose of spent lithium batteries properly.

The CR3000 contains a lithium battery that operates the clock and powers SRAM when the CR3000 is not externally powered. Voltage of the battery is monitored from the CR3000 **Status** table (*LithiumBattery (p. 584)*). Replace the battery as directed in *Internal Battery — Details (p. 497)*.

The lithium battery is not rechargeable. Its design is one of the safest available and uses lithium thionyl chloride technology. Maximum discharge current is limited to a few mA. It is protected from discharging excessive current to the internal circuits (there is no direct path outside) with a 100 ohm resistor. The design is UL listed. See:

http://www.tadiran-batterie.de/download/eng/LBR06Eng.pdf.

# 5.10 Datalogger Support Software — Overview

#### Related Topics:

- Datalogger Support Software Quickstart (p. 41)
- Datalogger Support Software Overview (p. 91)
- Datalogger Support Software Details (p. 432)
- Datalogger Support Software Lists (p. 614)

Datalogger support software handles communication between a computer or device and the CR3000. A wide array of software are available, but the following are the most commonly used:

- Short Cut Program Generator for Windows (SCWin) Generates simple CRBasic programs without the need to learn the CRBasic programming language
- PC200W Datalogger Starter Software for Windows Supports only
  direct serial connection to the CR3000 with hardwire or select Campbell
  Scientific radios. It supports sending a CRBasic program, data collection,
  and setting the CR3000 clock; available at no charge at
  www.campbellsci.com/downloads
- LoggerLink Mobile Apps Simple tools that allow an iOS or Android device to communicate with IP, Wi-Fi, or Bluetooth enabled CR3000s; includes most PC200W functionality.
- PC400 Datalogger Support Software Includes PC200W functions, CRBasic Editor, and supports all Campbell Scientific communications hardware, except satellite, in attended mode
- LoggerNet Datalogger Support Software Includes all PC400 functions and supports all Campbell Scientific communication options, except satellite, attended and automatically; includes many enhancements such as graphical data displays and a display builder

**Note** More information about software available from Campbell Scientific can be found at *www.campbellsci.com*.

# 5.11 PLC Control — Overview

#### Related Topics:

- PLC Control Overview (p. 91)
- PLC Control Modules Overview (p. 430)
- PLC Control Modules Lists (p. 607)
- Switched Voltage Output Specifications
- Switched Voltage Output Overview (p. 62)
- Switched Voltage Output Details (p. 424)
- Current Source and Sink Limits (p. 424)

The CR3000 can control instruments and devices such as the following:

- Wireless cellular modem to conserve power.
- GPS receiver to conserve power.
- Trigger a water sampler to collect a sample.
- Trigger a camera to take a picture.
- Activate an audio or visual alarm.
- Move a head gate to regulate water flows in a canal system.
- Control pH dosing and aeration for water quality purposes.
- Control a gas analyzer to stop operation when temperature is too low.
- Control irrigation scheduling.

Controlled devices can be physically connected to C terminals, usually through an external relay driver, or the SW12V (p. 426) terminal. C terminals can be set low (0 Vdc) or high (5 Vdc) using PortSet() or WriteIO() instructions. Control modules are available to expand and augment CR3000 control capacity. On / off and proportional control modules are available. See appendix PLC Control Modules — List (p. 607).

Tips for writing a control program:

- Short Cut programming wizard has provisions for simple on/off control.
- PID control can be done with the CR3000.

Control decisions can be based on time, an event, or a measured condition.

#### Example:

In the case of a cell modem, control is based on time. The modem requires 12 Vdc power, so connect its power wire to the CR3000 **SW12V** terminal. The following code snip turns the modem on for ten minutes at the top of the hour using the **TimeIntoInterval()** instruction embedded in an **If/Then** logic statement:

```
If TimeIntoInterval( 0,60,Min) Then PortSet(9,1) 'Port "9" is the SW12V Port. Turn phone on.

If TimeIntoInterval(10,60,Min) Then PortSet(9,0) 'Turn phone off.
```

**TimeIsBetween()** returns **TRUE** if the CR3000 real-time clock falls within the specified range; otherwise, the function returns **FALSE**. Like **TimeIntoInterval()**, **TimeIsBetween()** is often embedded in an **If/Then** logic statement, as shown in the following code snip.

```
If TimeIsBetween(0,10,60,Min) Then
  SW12(1) 'Turn phone on.
Else
  SW12(0) 'Turn phone off.
EndIf
```

**TimeIsBetween()** returns **TRUE** for the entire interval specified whereas **TimeIntoInterval()** returns **TRUE** only for the one scan that matches the interval specified.

For example, using the preceding code snips, if the CRBasic program is sent to the datalogger at one minute past the hour, the **TimeIsBetween()** instruction will evaluate as **TRUE** on its first scan. The **TimeIntoInterval()** instruction will evaluate as **TRUE** at the top of the next hour (59 minutes later).

**Note** START is inclusive and STOP is exclusive in the range of time that will return a TRUE result. For example: **TimeIsBetween**(0,10,60,Min) will return TRUE at 8:00:00.00 and FALSE at 08:10:00.00.

## 5.12 Auto Self-Calibration — Overview

#### Related Topics

- Auto Self-Calibration Overview (p. 93)
- Auto Self-Calibration Details (p. 373)
- Auto Self-Calibration Errors (p. 515)
- Offset Voltage Compensation (p. 347)
- Factory Calibration (p. 90)
- Factory Calibration or Repair Procedure (p. 500)

The CR3000 auto self-calibrates to compensate for changes caused by changing operating temperatures and aging. Disable auto self-calibration when it interferes with execution of very fast programs and less accuracy can be tolerated.

# 5.13 Memory — Overview

### Related Topics:

- Memory Overview (p. 93)
- Memory Details (p. 442)
- Data Storage Devices List (p. 613)
- TABLE: Info Tables and Settings: Memory (p. 575)

The CR3000 organizes memory as follows:

- OS Flash
  - Operating system (OS)
  - Serial number and board rev
  - o Boot code
  - o Erased when loading new OS (boot code only erased if changed)
- Serial Flash
  - Device settings

- Write protected
- Non-volatile
- o CPU: drive
- Automatically allocated
- FAT32 file system
- Limited write cycles (100,000)
- Slow (serial access)

### Main Memory

- o Battery backed
- OS variables
- o CRBasic compiled program binary structure (490 KB maximum)
- CRBasic variables
- Data memory
- Communication memory
- USR: drive
- User allocated
- FAT32 RAM drive
- Photographic images (see *Cameras List* (p. 610))
- Data files from TableFile() instruction (TOA5, TOB1, CSIXML and CSIJSON)
- O Keep memory (p. 543) (OS variables not initialized)
- o Dynamic runtime memory allocation

Memory for data can be increased with the addition of a *CF* (p. 532) card and *CF* storage module (connects to the **Peripheral** port) or a mass storage device (thumb drive) that connects to **CS I/O** or both. See *Data Storage Devices* — *List* (p. 613) for information on available memory expansion products.

By default, final-storage memory (memory for stored data) is organized as ring memory. When the ring is full, oldest data are overwritten by newest data. The **DataTable()** instruction, however, has an option to set a data table to *Fill and Stop*.

# 6. Specifications

CR3000 specifications are valid from -25° to 50°C in non-condensing environments unless otherwise specified. Recalibration is recommended every three years. Critical specifications and system configurations should be confirmed with a Campbell Scientific sales engineer before purchase.

#### PROGRAM EXECUTION RATE

10 ms to one day at 10 ms increments ANALOG INPUTS (SE 1–28, DIFF 1–14)

ANALUG INPUTS (3E 1-26, DIFF 1-14)
Fourteen differential (DIFF) or 28 single-ended (SE) individually configured input channels. Channel expansion provided by optional analog multiplexers.

RANGES and RESOLUTION: With reference to the following table,

basic resolution (Basic Res) is the resolution of a single A/D conversion. A DIFF measurement with input reversal has better (finer) resolution by twice than Basic Res

	DIFF Res, μV <sub>2</sub>	Basic Res, μV
Range $(mV)_1$	(17 bit)	(16 bit)
±5000	83.33	167
±1000	16.67	33.3
±200	3.33	6.67
±50	0.83	1.67
±20	0.33	0.67

1Range overhead of ≈9% on all ranges guarantees full-scale voltage will not cause over-range. <sub>2</sub>Resolution of DIFF measurements with input reversal.

- ANALOG INPUT ACCURACY<sub>3</sub>: ±(0.04% of reading + offset), 0° to 40°C ±(0.07% of reading + offset), -25° to 50°C ±(0.09% of reading + offset), -40° to 85°C (-XT only)

Accuracy does not include sensor and measurement noise.

Offset definitions:
Offset = 1.5 x Basic Res + 1.0 μV (for DIFF measurement w/ input reversal)
Offset = 3 x Basic Res + 2.0  $\mu$ V (for DIFF measurement w/o input

Offset = 3 x Basic Res + 5.0 µV (for SE measurement)
ANALOG MEASUREMENT SPEED:

ANALOG IVILASORLIVILINI SPELD.				
			Total Ti	me <sub>4</sub>
Inte- gration Type Code	Inte- gration Time	Settling Time	SE with no Rev	DIFF with Input Rev
250 _60Hz <sub>5</sub> _50Hz <sub>5</sub>	250 μs 16.67 ms 20.00 ms	200 μs 3 ms 3 ms	≈0.7 ms ≈20 ms ≈23 ms	≈1.4 ms ≈40 ms ≈46 ms

Includes 250 us for conversion to engineering units.

5AC line noise filter

INPUT-NOISE VOLTAGE: For DIFF measurements with input reversal on ±20 mV input range (digital resolution dominates for higher ranges): 250 μs Integration: 0.4 μV RMS

50/60 Hz Integration: 0.19 μV RMS INPUT LIMITS: ±5 Vdc

DC COMMON-MODE REJECTION: >100 dB

NORMAL-MODE REJECTION: 70 dB @ 60 Hz when using 60 Hz

INPUT VOLTAGE RANGE W/O MEASUREMENT CORRUPTION: ±8.6 Vdc max.
SUSTAINED-INPUT VOLTAGE W/O DAMAGE: ±16 Vdc max

INPUT CURRENT: ±1 nA typical, ±6 nA max. @ 50°C; ±120 nA @

INPUT RESISTANCE: 20 GΩ typical

ACCURACY OF BUILT-IN REFERENCE JUNCTION THERMISTOR (for thermocouple measurements): ±0.3°C, -25° to 50°C ±0.8°C, -55° to 85°C (-XT only)

#### ANALOG OUTPUTS (VX 1-4, IX 1-3, CAO 1-2)

Four switched voltage and three switched current outputs sequentially active only during measurement. Two continuous

RANGES AND RESOLUTION:

			Current	Compli-
Chan-		Res-	Source	ance
nel	Range	olution	/ Sink	Voltage
VX 1-4	±5 Vdc	0.17 mV	±50 mA	N/A
IX 1-3	±2.5 mA	0.08 μΑ	N/A	±5 Vdc
CAO 1-2	±5 Vdc	0.17 mV	±15 mA	N/A

ANALOG OUTPUT ACCURACY (VX and CAO):

±(0.04% of setting + 0.5 mV, 0° to 40°C ±(0.07% of setting + 0.5 mV, -25° to 50°C ±(0.09% of setting + 0.5 mV, -40° to 85°C (-XT only)

ANALOG OUTPUT ACCURACY (IX) ±(0.13% of setting + 0.5 μA, 0° to 40°C ±(0.13% of setting + 0.5 μA, -25° to 50°C ±(0.15% of setting + 0.5 μA, -40° to 85°C (-XT only)

VX FREQUENCY SWEEP FUNCTION: Switched outputs provide a programmable swept frequency, 0 to 5000 mV square waves for exciting vibrating wire transducers.

PERIOD AVERAGE

Any of the 28 SE analog inputs can be used for period averaging. Accuracy is ±(0.01% of reading + resolution), where resolution is 68 ns divided by the specified number of cycles to be measured. INPUT AMPLITUDE AND FREQUENCY:

Volt- age Gain	Range Code	Input Signal Peak-Pe Min mV <sub>6</sub>	ak Max V <sub>7</sub>	Min Pulse Width μs	Max Freq kHz <sub>8</sub>
1	mV1000	200	10	2.5	200
5	mV200	20	2	5.0	100
20	mV50	5	2	10.0	50
50	mV20	2	2	100	20

6Signal to be centered around Threshold (see PeriodAvg()

Fisignal to be centered around ground. 8The maximum frequency = 1/(twice minimum pulse width) for 50% of duty cycle signals.

#### RATIOMETRIC MEASUREMENTS

MEASUREMENT TYPES: The CR3000 provides ratiometric MEASUREMENT TYPES: The CRSUOU provides ratiometric resistance measurements using voltage or current excitation. Four switched voltage excitation outputs are available for measurement of four- and six-wire full bridges, and two-, three-, and four-wire half bridges. Three switched current excitation outputs are available for direct resistance measurements. Optional excitation polarity reversal minimizes dc errors.

RATIOMETRIC MEASUREMENT ACCURACY $_{9,10,11}$ :  $\pm (0.02\%$  of Voltage Measurement + Offset $_{12}$ ),  $0^{\circ}$  to  $40^{\circ}$ C  $\pm (0.025\%$  of Voltage Measurement + Offset $_{12}$ ),  $-25^{\circ}$  to  $50^{\circ}$ C  $\pm (0.03\%$  of Voltage Measurement + Offset $_{12}$ ),  $-40^{\circ}$  to  $85^{\circ}$ C (-XT) <sub>9</sub>Accuracy specification assumes excitation reversal for excitation voltages < 1000500 mV and excitation currents < 500 μA. Assumption does not include bridge resistor errors and sensor and measurement noise.

10For **Resistance()** instruction, the sensor resistance is determined

10For **Resistance()** instruction, the sensor resistance is determined from VS / IX, where excitation current IX is measured across a 1000 Ω, ±0.005% at 25°C, 2 ppm •°C\_1 TCR internal resistor. 11 Estimated accuracy,  $\Delta X$  (where X is value returned from measurement with **Multiplier** = 1, **Offset** = 0): **BRHalf()** Instruction:  $\Delta X = \Delta V1/VX$ . **BRFull()** Instruction:  $\Delta X = 1000 \times \Delta V1/VX$ , expressed as  $mV \bullet V._1$ . **Note**  $\Delta V1$  is calculated from the ratiometric measurement accuracy. See manual section *Resistance Measurements* for more information. 12 Offset definitions: Offset = 1.5 x Basic Res + 1.0  $\mu V$  (for DIFF measurement w/ input reversal)

reversal)

Offset = 3 x Basic Res + 2.0  $\mu$ V (for DIFF measurement w/o input

Offset = 3 x Basic Res + 5.0 µV (for SE measurement)

Note Excitation reversal reduces offsets by a factor of two.

PULSE COUNTERS (P 1–4)

Four inputs individually selectable for switch closure, high-frequency pulse, or low-level ac. Independent 24-bit counters for each input

MAXIMUM COUNTS PER SCAN: 16.8 x 10<sub>6</sub>

SWITCH CLOSURE MODE: Minimum Switch Closed Time: 5 ms

Minimum Switch Open Time: 6 ms Max. Bounce Time: 1 ms open without being counted

Max. Bounce Time. I ms open without being counted HIGH-FREQUENCY PULSE MODE:

Maximum-Input Frequency: 250 kHz

Maximum-Input Voltage: ±20 V

Voltage Thresholds: Count upon transition from below 0.9 V to above 2.2 V after input filter with 1.2 µs time constant.

LOW-LEVEL AC MODE: Internal ac coupling removes dc offsets up to  $\pm 0.5 \, \text{Vdc}.$ 

Input Hysteresis: 12 mV RMS @ 1 Hz Maximum ac-Input Voltage: ±20 V Minimum ac-Input Voltage:

Sine wave (mV RMS)	Range (Hz)
20	1.0 to 20
200	0.5 to 200
2000	0.3 to 10,000
5000	0.3 to 20,000

#### DIGITAL I/O PORTS (C 1-8, SDM 1-3)

Eight ports software selectable as binary inputs or control outputs. Provide on/off, pulse width modulation, edge timing, subroutine interrupts / wake up, switch closure pulse counting, high-frequency pulse counting, asynchronous communications (UARTs), and SDI-12 communications.

LOW FREQUENCY MODE MAX: <1 kHz HIGH FREQUENCY MODE MAX: 400 kHz

SWITCH-CLOSURE FREQUENCY MAX: 150 Hz

EDGE-TIMING RESOLUTION: 136 ns

OUTPUT VOLTAGES (no load): high 5.0 V  $\pm 0.1$  V; low < 0.1 V OUTPUT RESISTANCE: 330  $\Omega$ 

INPUT STATE: high 3.8 to 16 V; low -8.0 to 1.2 V

INPLIT HYSTERISIS: 1 4 V

INPUT RESISTANCE:

INPUT RESISTANCE: 100 k $\Omega$  with inputs < 6.2 Vdc 220  $\Omega$  with inputs  $\geq$  6.2 Vdc

SERIAL DEVICE / RS-232 SUPPORT: 0 to 5 Vdc UART ADDITIONAL DIGITAL PORTS: SDM-C1, SDM-C2, SDM-C3 are

dedicated for measuring SDM devices.

SWITCHED 12 Vdc (SW12V)

Two independent 12 Vdc unregulated terminals switched on and off under program control. Thermal fuse hold current = 900 mA at 20°C, 650 mA at 50°C, and 360 mA at 85°C.

View the EU Declaration of Conformity at

#### COMMUNICATION

RS-232 PORTS:

NO-232 PUNIS:
DCE nine-pin: (electrically isolated) for computer connection or connection of modems not manufactured by Campbell Scientific. COM1 to COM4: four independent Tx/Rx pairs on control ports (non-isolated); 0 to 5 Vdc UART

Baud Rate: selectable from 300 bps to 115.2 kbps. Default Format: eight data bits; one stop bits; no parity.

Optional Formats: seven data bits; two stop bits; odd, even parity. CS I/O PORT: Interface with comms peripherals manufactured by Campbell Scientific.

SDI-12: Digital control ports C1, C3, C5, C7 are individually configurable and meet SDI-12 Standard v. 1.3 for datalogger mode. Up to ten SDI-12 sensors are supported per port. PERIPHERAL PORT: 40-pin interface for attaching CompactFlash or Ethernet peripherals.

PROTOCOLS SUPPORTED: PakBus, AES-128 Encrypted PakBus, Modbus, DNP3, FTP, HTTP, XML, HTML, POP3, SMTP, Telnet, NTCIP, NTP, web API, SDI-12, SDM.

#### SYSTEM

PROCESSOR: Renesas H8S 2674 (16-bit CPU with 32-bit internal core running at ~21.9 MHz)
MEMORY: 2 MB of flash for operating system; 4 MB of battery-

backed SRAM for CPU, CRBasic programs, and data.
REAL-TIME CLOCK ACCURACY: ±3 min. per year. Correction via GPS

RTC CLOCK RESOLUTION: 10 ms

#### SYSTEM POWER REQUIREMENTS

VOLTAGE: 10 to 16 Vdc

INTERNAL BATTERIES: 1200-mAhr lithium battery for clock and SRAM backup. Typically provides 3 years of backup. Optional 10-Ahr alkaline or 7-Ahr rechargeable battery + base available as primary power supply.

EXTERNAL BATTERIES: Optional 12 Vdc nominal alkaline and rechargeable available. Power connection is reverse polarity protected.

TYPICAL CURRENT DRAIN at 12 Vdc:

Sleep Mode: 2 mA
1 Hz Sample Rate (one fast SE meas.): 3 mA
100 Hz Sample Rate (one fast SE meas.): 10 mA
100 Hz Sample Rate (one fast SE meas.): with RS-232
communications): 38 mA

Active integrated keyboard display adds 1 mA (42 mA with

#### PHYSICAL

DIMENSIONS: 241 x 178 x 96 mm (9.5 x 7.0 x 3.8 in.); additional clearance required for cables and leads.
MASS / WEIGHT:

WIA33 / WEIGITI.		
Base Type:	Mass (kg)	Weight (lbs)
Low Prof Base	1.6	3.6
Alkaline Base	3.8	8.3
Recharge Base	4.8	10.7

Warranty is stated in the published price list and in opening pages of this and other user manuals

# 7. Installation

#### Related Topics:

- Quickstart (p. 37)
- Specifications (p. 95)
- Installation (p. 97)
- Operation (p. 335)

## 7.1 Enclosures — Details

```
Enclosures — Details (p. 97)
Enclosures — Products (p. 621)
```

Illustrated in figure *Enclosure* (p. 98) is the typical use of enclosures available from Campbell Scientific designed for housing the CR3000. This style of enclosure is classified as NEMA 4X (watertight, dust-tight, corrosion-resistant, indoor and outdoor use). Enclosures have back plates to which are mounted the CR3000 datalogger and associated peripherals. Back plates are perforated on one-inch centers with a grid of holes that are lined as needed with anchoring nylon inserts. The CR3000 base has mounting holes (some models may be shipped with rubber inserts in these holes) through which small screws are inserted into the nylon anchors. **Remove rubber inserts**, if any, to access the mounting holes. Screws and nylon anchors are supplied in a kit that is included with the enclosure.

• 

FIGURE 28: Enclosure

#### 7.2 Power Supplies — Details

### Related Topics:

- Power Input Terminals Specifications
- Power Supplies Quickstart (p. 39)
- Power Supplies Overview (p. 86)
- Power Supplies Details (p. 98)
  Power Supplies Products (p. 618)
- Power Sources (p. 99)
- Troubleshooting Power Supplies (p. 517)

Reliable power is the foundation of a reliable data acquisition system. When designing a power supply, consideration should be made regarding worst-case power requirements and environmental extremes. For example, when designing a solar power system, design it to operate with 14 days of reserve time at the winter solstice when the following are limiting environmental factors:

- Sunlight intensity is the lowest
- Sunlight duration is the shortest
- Battery temperatures are the lowest
- System power requires are often the highest

The CR3000 is internally protected against accidental polarity reversal on the power inputs.

The CR3000 has a modest-input power requirement. For example, in low-power applications, it can operate for several months on non-rechargeable batteries. Power systems for longer-term remote applications typically consist of a charging source, a charge controller, and a rechargeable battery. When ac line power is available, a Vac-to-Vac or Vac-to-Vdc wall adapter, a peripheral charging regulator, and a rechargeable battery can be used to construct a UPS (uninterruptible power supply).

Caution Voltage levels at the 12V and switched SW12 terminals, and pin 8 on the CS I/O port, are tied closely to the voltage levels of the main power supply. For example, if the power received at the POWER IN 12V and G terminals is 16 Vdc, the 12V and SW12 terminals, and pin 8 on the CS I/O port, will supply 16 Vdc to a connected peripheral. If the connected peripheral or sensor is not designed for that voltage level, it may be damaged.

# 7.2.1 CR3000 Power Requirement

The CR3000 operates with power from 10 to 16 Vdc applied at the **POWER IN** terminals of the green connector on the face of the wiring panel, or at the power input receptacle on the underside of the CR3000 module, which is reserved for interated power supplies. The CR3000 is often provided with a power supply integrated into its base. These integrated power supplies connect to the underside of the datalogger module. If an integrated supply is provided, the **POWER IN** connector will probably not be used. If an integrated supply is not provided, an external supply will be required.

The CR3000 is internally protected against accidental polarity reversal on the power inputs. A transient voltage suppressor (TVS) diode at the **POWER IN 12V** terminals provides protection from intermittent high voltages by clamping these transients to within the range of 19 to 21 V. Sustained input voltages in excess of 19 V, can damage the TVS diode.

# 7.2.2 Calculating Power Consumption

System operating time for batteries can be determined by dividing the battery capacity (ampere-hours) by the average system current drain (amperes). The CR3000 typically has a quiescent current drain of 0.2 mA (with display off) 0.3 mA with a 1 Hz sample rate, and 10 mA with a 100 Hz scan rate. When the CR1000KD Keyboard/Display is active, an additional 1 mA is added to the current drain while enabling the backlight for the display adds 42 mA.

### 7.2.3 Power Sources

#### Related Topics:

- · Power Input Terminals Specifications
- Power Supplies Quickstart (p. 39)
- Power Supplies Overview (p. 86)

- Power Supplies Details (p. 98)
- Power Supplies Products (p. 618)
- Power Sources (p. 99)
- Troubleshooting Power Supplies (p. 517)

Be aware that some Vac-to-Vdc power converters produce switching noise or *ac* (p. 529) ripple as an artifact of the ac-to-dc rectification process. Excessive switching noise on the output side of a power supply can increase measurement noise, and so increase measurement error. Noise from grid or mains power also may be transmitted through the transformer, or induced electro-magnetically from nearby motors, heaters, or power lines.

High-quality power regulators typically reduce noise due to power regulation. Using the optional 50 Hz or 60 Hz rejection arguments for CRBasic analog input measurement instructions (see *Measurements* — *Details (p. 335))* often improves rejection of noise sourced from power mains. The CRBasic standard deviation instruction, **SDEV()**, can be used to evaluate measurement noise.

The main power for the CR3000 is provided by an internal- or external-power supply.

Options for an internal supply include alkaline- and rechargeable-battery bases. While the CR3000 has a wide operating-temperature range, battery-base ranges are more limited. Exceeding the specified range may degrade battery capacity and lifetime. Battery leakage caused by too-high temperatures can result in damage to the power supply or the CR3000.

### 7.2.3.1 Vehicle Power Connections

If a CR3000 is powered by a motor-vehicle power supply, a second power supply may be needed. When starting the motor of the vehicle, battery voltage often drops below the voltage required for CR3000 operation. This may cause the CR3000 to stop measurements until the voltage again equals or exceeds the lower limit. A second supply can be provided to prevent measurement lapses during vehicle starting. The figure *Connecting to Vehicle Power Supply (p. 101)* illustrates how a second power supply is connected to the CR3000. The diode *OR* connection causes the supply with the largest voltage to power the CR3000 and prevents the second backup supply from attempting to power the vehicle.

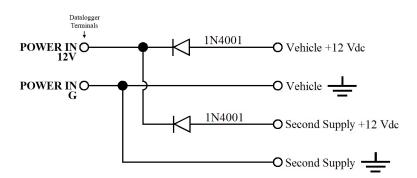


FIGURE 29: Connecting to Vehicle Power Supply

# 7.2.4 Uninterruptable Power Supply (UPS)

A UPS (un-interruptible power supply) is often the best power source for long-term installations. An external UPS consists of a primary-power source, a charging regulator external to the CR3000, and an external battery. The primary power source, which is often a transformer, power converter, or solar panel, connects to the charging regulator, as does a nominal 12 Vdc sealed rechargeable battery. A third connection connects the charging regulator to the 12V and G terminals of the POWER IN connector..

# 7.2.5 External Power Supply Installation

When connecting external power to the CR3000, remove the green **POWER IN** connector from the CR3000 face. Insert the positive 12 Vdc lead into the green connector, then insert the negative lead. Re-seat the green connector into the CR3000. The CR3000 is internally protected against reversed external-power polarity. Should this occur, correct the wire connections and the CR3000 will resume operation.

# 7.2.6 External Alkaline Power Supply

If external alkaline power is used, the alkaline battery pack is connected directly to the **POWER IN 12V** and **G** terminals. Voltage input range is 10 to 16 Vdc.

# 7.2.7 Integrated Batteries

Internal batteries (battery bases) have a thermal fuse that limits source current and minimizes the need for repair. If excessive current is drawn, the fuse gets hot, increases in resistance, and limits current. When the problem is fixed, the fuse cools and the resistance decreases, usually allowing current to eventually pass. When excessive current is drawn, as will occur when shorting a positive lead to a ground terminal, allow 10 to 15 seconds for the fuse to cool before reconnecting power.

A thermal fuse in the alkaline base will allow a current drain of 1.85 A at 20 °C (1.3 A at 50 °C). In event of a short, the thermal fuse will cut power after about 40 seconds.

## 7.2.7.1 Alkaline-Battery Base

Consult the appendix *Power Supplies* — *List (p. 618)* for models and part numbers of power supplies available from Campbell Scientific. The most current information is found at *www.campbellsci.com*.

The alkaline battery base includes 10 alkaline, D-cell batteries. Suggested temperature range for use is  $-25^{\circ}$  to  $+50^{\circ}$ C. A fresh set of high-quality cells has an approximate voltage of 15.5 Vdc and about 10 ampere-hours of power reserve at  $20^{\circ}$ C. Ampere-hour rating decreases with temperature as shown in table *Alkaline Battery Service and Temperatures (p. 103)*. CRBasic instruction **Battery()** is used to measure battery voltage. Replace the alkaline cells before the voltage drops below 11 Vdc.

If external power is connected to a CR3000 with an alkaline base, power will be drawn from the source of highest voltage. In a configuration wherein an external, float-charged sealed-rechargeable battery is connected, the alkaline base will lose approximately 35% of its capacity before the external supply becomes the highest voltage source, and therefore the primary power source.

## Installing New Alkaline Batteries

Install new batteries with the following procedure:


- 1. Position the power switch on the side of the base to **OFF**.
- Loosen the two knurled thumbscrews at the lateral edges of the datalogging module face.
- 3. Disconnect the green terminal strips from the wiring panel, if necessary.
- 4. Carefully separate the datalogging module from the base, unplugging the white connector that connects the module to the base. The connector is located just under the lower-left lip of the datalogging module, near the ground lug. A small lever on the side of the connector must be depressed before pulling it out.
- 5. Install new alkaline batteries with orientation as shown in figure *Alkaline Battery Orientation* (p. 103).
- Reconnect the white power connector to the datalogging module. Re-seat the module and tighten down the knurled thumbscrews. Re-seat the terminal strips if necessary.
- 7. Switch the power switch to **ON**.
- 8. Check for normal datalogging function before leaving the site.

**TABLE 6: Alkaline Battery Temperatures and Service** 

Temperature	Percent of Service at 20 °C <sup>1</sup>
20 °C to 50 °C	100 %
15 °C	98 %
10 °C	94 %
5 °C	90 %
0 °C	86 %
−10 °C	70 %
−20 °C	50 %
−30 °C	30 %

 $<sup>^1</sup>$  Data based on one "D" cell under conditions of 50 mA current drain with a 30  $\Omega$  load. As the current drain decreases, the percent service improves for a given temperature.

FIGURE 30: Alkaline Battery Orientation

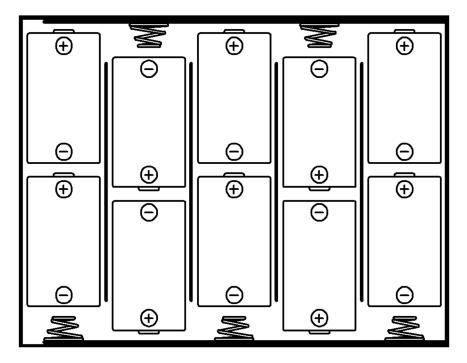

## 7.2.7.2 Sealed Rechargeable-Battery Base

A CR3000 with a rechargeable base option (see the appendix *Battery Bases (p. 619)*) has an integrated power supply that uses two 6 Vdc, 7 Ahr, sealed-rechargeable lead-acid batteries, an ac-to-ac transformer (18 V-RMS ac output), and a temperature compensated charging circuit with a charge-indicating LED. An ac transformer or solar panel should be connected to the base at all times through the

green **CHARGING INPUT** connector located on the side of the base. The charging source powers the CR3000 while float charging the batteries. The batteries power the CR3000 if the charging source is interrupted. The table *Sealed Rechargeable Battery and AC Transformer Specifications* (p. 105) lists the recommended operational temperature range and other specifications.

Leads from the charging source connect to the **CHARGING INPUT** by way of two, screw-secured terminals on the connector. Polarities of the leads on these terminals do not matter. A transzorb provides transient protection to the charging circuit. A sustained input voltage in excess of 40 V will cause the transzorb to limit voltage.

A red LED (light) is on the base near the connector. It is illuminated when a voltage is present at the charge terminals. The charge terminals must be between 17 and 24 Vdc or at 18 V-RMS ac for charging to occur; however, the LED will also illuminate when the connected voltage is not adequate for charging. The **POWER** switch controls CR3000 power. Battery charging continues when the switch is in the **OFF** position.

Monitor the power supply using CRBasic instruction **Battery()**. Incorporating this instruction into the CRBasic program will enable continuous tracking of power-supply performance. If the system-voltage level consistently decreases through time, an element of the charging system is degraded or has failed. The **Battery()** instruction measures the voltage internal to the CR3000, not the voltage of the battery. The measured voltage will be about 0.3 Vdc less than the voltage at the internal or external 12 Vdc input due to a Schottkey diode. External-power sources must be disconnected from the CR3000 to measure the battery voltage.

#### Replacing Sealed Rechargeable Batteries

Replacement of rechargeable batteries may be indicated if the supplied power shows signs of degrading. See *Troubleshooting — Power Supplies (p. 517)*.

To replace the batteries, perform the following procedure while consulting figure *Sealed-Rechargeable Battery Wiring (p. 106).* 

Install new batteries with the following procedure:

- 1. Position the power switch on the side of the base to **OFF**.
- Loosen the two knurled thumbscrews at the lateral edges of the datalogging module face.
- 3. Disconnect the green terminal strips from the wiring panel, if necessary.
- 4. Carefully separate the datalogging module from the base, unplugging the white connector that connects the module to the base. The connector is located just under the lower-left lip of the datalogging module, near the ground lug. A small lever on the side of the connector must be depressed before pulling it out.
- 5. Remove the two batteries and replace with batteries specified in table *Sealed-Rechargeable Battery Specifications* (p. 105).

- 6. Reconnect the white power connector to the datalogging module. Re-seat the module and tighten down the knurled thumbscrews. Re-seat the terminal strips if necessary.
- 7. Switch the power switch to **ON**.
- 8. Check for normal datalogging function before leaving the site.

## Sealed Rechargeable-Battery Safety

There are inherent hazards associated with the use of sealed rechargeable batteries. Under normal operation, lead acid batteries generate small quantities of hydrogen gas. This gaseous by-product is generally insignificant because the hydrogen dissipates naturally before building-up to an explosive level (4%). However, if the batteries are shorted or overcharged, hydrogen gas may be generated at a rate sufficient to create a hazard. Campbell Scientific makes the following recommendations:

- A CR3000 equipped with standard, sealed-rechargeable batteries should NEVER be used in applications requiring INTRINSICALLY SAFE equipment.
- A sealed, rechargeable battery should not be housed in a gas-tight enclosure.

TABLE 7: CR3000 Base Sealed-Rechargeable Battery Specifications			
Feature	Specification		
Battery Type	Sealed Rechargeable		
Manufacturer	Yuasa		
Model Number	Yuasa NP7-6		
Campbell Scientific Part Number	8216		
Float Life @ 25 °C	3 years minimum		
Capacity	7.0 Ampere-hours		
Shelf Life, Full Charge	6 months		
Charge Time (AC Source)	40 hr full charge, 20 hr 95% charge		
Operating Temperature	-15 °C to 50 °C charge -20 °C to 60 °C discharge		

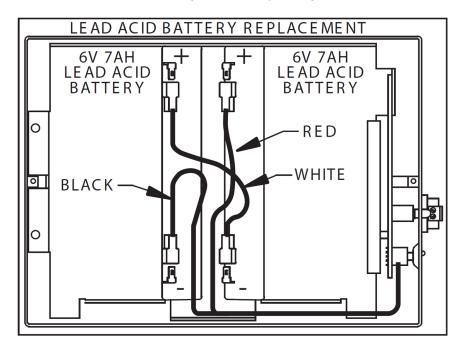


FIGURE 31: Sealed-Rechargeable Battery Wiring

TABLE 8: CR3000 Ac-Transformer Specifications		
Feature	Specification	
Input	120 Vac, 60 Hz	
Isolated Output	18 Vac 1.11 Amp	

# 7.2.7.3 Low Profile (No Battery) Base

A CR3000 with the low-profile base (see *Battery Bases* — *List (p. 619)*) will not have an internal power supply. In this configuration, power is supplied to the CR3000 by attaching an external 12 Vdc power source to the **POWER IN** connector on the lower left of the CR3000 face. See *Power Supplies* — *List (p. 618)* for that can be used with a low-profile base. See *Power Supplies* — *Details (p. 98)* for instructions on connecting external power supplies to the CR3000.

# 7.3 Grounding — Details

Grounding the CR3000 with its peripheral devices and sensors is critical in all applications. Proper grounding will ensure maximum ESD (electrostatic discharge) protection and measurement accuracy.

### 7.3.1 ESD Protection

Related Topics:

- ESD Protection (p. 107)
- Lightening Protection (p. 108)

ESD (electrostatic discharge) can originate from several sources, the most common and destructive being lightning strikes. Primary lightning strikes hit the CR3000 or sensors directly. Secondary strikes induce a high voltage in power lines or sensor wires.

The primary devices for protection against ESD are gas-discharge tubes (GDT). All critical inputs and outputs on the CR3000 are protected with GDTs or transient voltage suppression diodes. GDTs fire at 150 V to allow current to be diverted to the earth ground lug. To be effective, the earth ground lug must be properly connected to earth (chassis) ground. As shown in figure *Schematic of Grounds (p. 108)*, signal grounds and power grounds have independent paths to the earth-ground lug.

Communication ports are another path for transients. You should provide communication paths, such as telephone or short-haul modem lines, with sparkgap protection. Spark-gap protection is usually an option with these products, so request it when ordering. Spark gaps must be connected to either the earth ground lug, the enclosure ground, or to the earth (chassis) ground.

A good earth (chassis) ground will minimize damage to the datalogger and sensors by providing a low-resistance path around the system to a point of low potential. Campbell Scientific recommends that all dataloggers be earth (chassis) grounded. All components of the system (dataloggers, sensors, external power supplies, mounts, housings, etc.) should be referenced to one common earth (chassis) ground.

In the field, at a minimum, a proper earth ground will consist of a five foot copper-sheathed grounding rod driven into the earth and connected to the large brass ground lug on the wiring panel with a 14 AWG wire. In low-conductive substrates, such as sand, very dry soil, ice, or rock, a single ground rod will probably not provide an adequate earth ground. For these situations, search for published literature on lightning protection or contact a qualified lightning-protection consultant.

In vehicle applications, the earth ground lug should be firmly attached to the vehicle chassis with 12 AWG wire or larger.

In laboratory applications, locating a stable earth ground is challenging, but still necessary. In older buildings, new Vac receptacles on older Vac wiring may indicate that a safety ground exists when, in fact, the socket is not grounded. If a safety ground does exist, good practice dictates the verification that it carries no current. If the integrity of the Vac power ground is in doubt, also ground the system through the building plumbing, or use another verified connection to earth ground.

FIGURE 32: Schematic of Grounds

Connect pulse-counter returns (negative leads) to the ground terminal (=) that is adjacent to the pulse-input terminal. Returns of large current excitations may also be connected to pulse grounds to minimize induced single-ended offset voltages in half-bridge measurements. Connect analog-signal shields and returns to ground terminals (= located adjacent to analog-input terminals. Analog Ground Plane Tie 5V, SW12V, 12V, and C1-C8 returns to power grounds (G). External CR3000 power input 0.9A Thermal Fuse (2 Star ground at GROUND LUG  $C \in$ 1.85A To CR3000 Electronics Thermal Fuse Thermal Fuse On/Off 1.85-A thermal fuse 5-Amp thermal fuse Battery

## 7.3.1.1 Lightning Protection

### Related Topics:

- ESD Protection (p. 107)
- Lightening Protection (p. 108)

The most common and destructive ESDs are primary and secondary lightning strikes. Primary lightning strikes hit instrumentation directly. Secondary strikes induce voltage in power lines or wires connected to instrumentation. While elaborate, expensive, and nearly infallible lightning protection systems are on the market, Campbell Scientific, for many years, has employed a simple and inexpensive design that protects most systems in most circumstances. The system employs a lightening rod, metal mast, heavy-gage ground wire, and ground rod to direct damaging current away from the CR3000. This system, however, not infallible. Figure Lightning Protection Scheme (p. 109) is a drawing of a typical application of the system.

**Note** Lightning strikes may damage or destroy the CR3000 and associated sensors and power supplies.

In addition to protections discussed in , use of a simple lightning rod and low-resistance path to earth ground is adequate protection in many installations. . .

Lightning Charge Dissipation Lightning Rod Path of Least Resistance **Highly Conductive** Metal Mast Instrument **Enclosure** 14-AWG 4-AWG Copper Wire Copper Cable Copper-Clad Strike Dissipation **Ground Rod** 

FIGURE 33: Lightning Protection Scheme

# 7.3.2 Single-Ended Measurement Reference

Low-level, single-ended voltage measurements (<200 mV) are sensitive to ground potential fluctuation due to changing return currents from 12V, SW12, 5V, and C1 – C8 terminals. The CR3000 grounding scheme is designed to minimize

these fluctuations by separating signal grounds ( $\pm$ ) from power grounds (G). To take advantage of this design, observe the following rules:

- Connect grounds associated with 12V, SW12, 5V, and C1 C8 terminals to G terminals.
- Connect excitation grounds to the nearest 
   terminal on the same terminal block.
- Connect the low side of single-ended sensors to the nearest \(\display\) terminal on the same terminal block.
- Connect shield wires to the  $\pm$  terminal nearest the terminals to which the sensor signal wires are connected.

**Note** Several ground wires can be connected to the same ground terminal.

If offset problems occur because of shield or ground leads with large current flow, tying the problem leads into  $\pm$  terminals next to terminals configured for excitation and pulse-count should help. Problem leads can also be tied directly to the ground lug to minimize induced single-ended offset voltages.

### 7.3.3 Ground Potential Differences

Because a single-ended measurement is referenced to CR3000 ground, any difference in ground potential between the sensor and the CR3000 will result in a measurement error. Differential measurements MUST be used when the input ground is known to be at a different ground potential from CR3000 ground. See the section *Single-Ended Measurements* — *Details (p. 385)* for more information.

Ground potential differences are a common problem when measuring full-bridge sensors (strain gages, pressure transducers, etc), and when measuring thermocouples in soil.

# 7.3.3.1 Soil Temperature Thermocouple

If the measuring junction of a thermocouple is not insulated when in soil or water, and the potential of earth ground is, for example, 1 mV greater at the sensor than at the point where the CR3000 is grounded, the measured voltage is 1 mV greater than the thermocouple output. With a copper-constantan thermocouple, 1 mV equates to approximately 25 °C measurement error.

# 7.3.3.2 External Signal Conditioner

External instruments with integrated signal conditioners, such as an infrared gas analyzer (IRGA), are frequently used to make measurements and send analog information to the CR3000. These instruments are often powered by the same Vac-line source as the CR3000. Despite being tied to the same ground, differences in current drain and lead resistance result in different ground

potentials at the two instruments. For this reason, a differential measurement should be made on the analog output from the external signal conditioner.

# 7.3.4 Ground Looping in Ionic Measurements

When measuring soil-moisture with a resistance block, or water conductivity with a resistance cell, the potential exists for a ground loop error. In the case of an ionic soil matric potential (soil moisture) sensor, a ground loop arises because soil and water provide an alternate path for the excitation to return to CR3000 ground. This example is modeled in the diagram *Model of a Ground Loop with a Resistive Sensor* (p. 112). With Rg in the resistor network, the signal measured from the sensor is described by the following equation:

$$V_1 = V_x \frac{R_s}{(R_s + R_f) + R_s R_f / R_g}$$

where

V<sub>x</sub> is the excitation voltage

Rf is a fixed resistor


R<sub>s</sub> is the sensor resistance

 $R_{\rm g}$  is the resistance between the excited electrode and CR3000 earth ground.

 $R_x R_f / R_g$  is the source of error due to the ground loop. When  $R_g$  is large, the error is negligible. Note that the geometry of the electrodes has a great effect on the magnitude of this error. The Delmhorst gypsum block used in the Campbell Scientific 227 probe has two concentric cylindrical electrodes. The center electrode is used for excitation; because it is encircled by the ground electrode, the path for a ground loop through the soil is greatly reduced. Moisture blocks which consist of two parallel plate electrodes are particularly susceptible to ground loop problems. Similar considerations apply to the geometry of the electrodes in water conductivity sensors.

The ground electrode of the conductivity or soil moisture probe and the CR3000 earth ground form a galvanic cell, with the water/soil solution acting as the electrolyte. If current is allowed to flow, the resulting oxidation or reduction will soon damage the electrode, just as if de excitation was used to make the measurement. Campbell Scientific resistive soil probes and conductivity probes are built with series capacitors to block this de current. In addition to preventing sensor deterioration, the capacitors block any de component from affecting the measurement.

FIGURE 34: Model of a Ground Loop with a Resistive Sensor

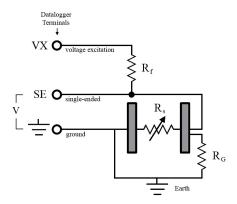

### 7.4 Protection from Moisture — Details

Protection from Moisture — Overview (p. 89)
Protection from Moisture — Details (p. 112)
Protection from Moisture — Products (p. 622)

When humidity levels reach the dew point, condensation occurs and damage to CR3000 electronics can result. Effective humidity control is the responsibility of the user. The CR3000 module is protected by a packet of silica gel desiccant, which is installed at the factory. This packet is replaced whenever the CR3000 is repaired at Campbell Scientific. The module should not normally be opened except to replace the internal lithium battery.

Adequate desiccant should be placed in the instrumentation enclosure to provide added protection.

# 7.5 CR3000 Setup — Details

#### Related Topics:

- CR3000 Setup Overview (p. 87)
- CR3000 Setup Details (p. 112)
- Status, Settings, and Data Table Information (Info Tables and Settings) (p. 567)

Your new CR3000 is already configured to communicate with Campbell Scientific *datalogger support software* (p. 91) on the **RS-232** port, and over most comms links. If you find that an older CR3000 no longer communicates with these simple links, update the operating system and do a full reset of the unit, as described in *Resetting the CR3000* (p. 454). Some applications, especially those implementing TCP/IP features, may require changes to factory defaults.

Configuring modifies the firmware of the CR3000. Programming modifies the CR3000 CRBasic program. Settings are key to configuring the CR3000.

# 7.5.1 Tools — Setup

Configuration tools include the following:

- Device Configuration Utility (p. 113)
- Network Planner (p. 114)
- Info tables and settings (p. 117)
- CRBasic program (p. 118)
- Executable CPU: files (p. 118)
- Keyboard display (p. 493)
- Terminal commands

# 7.5.1.1 DevConfig — Setup Tools

The most versatile set up tool is *Device Configuration Utility*, or *DevConfig*. It is bundled with *LoggerNet*, *PC400*, *RTDAQ*, or it can be downloaded from *www.campbellsci.com/downloads*. It has the following basic features:

- Extensive context sensitive help
- Connects directly to the CR3000 over a serial or IP connection
- Facilitates access to most settings, status fields, and info table information fields
- Includes a terminal emulator that facilitates access to the command prompt of the CR3000

DevConfig Help guides you through connection and use. The simplest connection is to connect a serial cable from the computer COM port or USB port to the **RS-232** port on the CR3000 as shown in figure Connect Power and Comms (p. 44).



FIGURE 35: Device Configuration Utility (DevConfig)

### 7.5.1.2 Network Planner — Setup Tools

Network Planner is a drag-and-drop application used in designing PakBus datalogger networks. You interact with Network Planner through a drawing canvas upon which are placed PC and datalogger nodes. Links representing various comms options are drawn between nodes. Activities to take place between the nodes are specified. Network Planner automatically specifies settings for individual devices and creates configuring XML files to download to each device through DevConfig (p. 113).

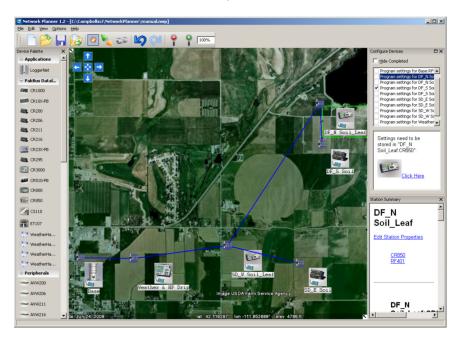


FIGURE 36: Network Planner Setup

### 7.5.1.2.1 Overview — Network Planner

Network Planner allows you to

- Create a graphical representation of a network, as shown in figure *Network Planner Setup (p. 115)*,
- Determine settings for devices and LoggerNet, and
- Program devices and *LoggerNet* with new settings.

Why is *Network Planner* needed?

- PakBus protocol allows complex networks to be developed.
- Setup of individual devices is difficult.
- Settings are distributed across a network.
- Different device types need settings coordinated.

#### Caveats

- Network Planner aids in, but does not replace, the design process.
- It aids development of PakBus networks only.
- It does not make hardware recommendations.

- It does not generate datalogger programs.
- It does not understand distances or topography; that is, it does not warn
  when broadcast distances are exceeded, nor does it identify obstacles to
  radio transmission.

For more detailed information on *Network Planner*, please consult the *LoggerNet* manual, which is available at *www.campbellsci.com*.

# 7.5.1.2.2 Basics — Network Planner PakBus Settings

- Device addresses are automatically allocated but can be changed.
- Device connections are used to determine whether neighbor lists should be specified.
- Verification intervals will depend on the activities between devices.
- Beacon intervals will be assigned but will have default values.
- Network role (for example, router or leaf node) will be assigned based on device links.

#### **Device Links and Communication Resources**

- Disallow links that will not work.
- Comparative desirability of links.
- Prevent over-allocation of resources.
- Optimal RS-232 and CS I/O ME baud rates based on device links.
- Optimal packet-size limits based on anticipated routes.

#### Fundamentals of Using Network Planner

- Add a background (optional)
- Place stations, peripherals, etc.
- Establish links
- Set up activities (scheduled poll, callback)
- Configure devices
- Configure LoggerNet (adds the planned network to the LoggerNet Network Map)

### 7.5.1.3 Info Tables and Settings — Setup Tools

#### Related Topics:

- Info Tables and Settings (p. 567)
- Common Uses of the Status Table (p. 569)
- Status Table as Debug Resource (p. 510)

Info tables and settings contain fields, settings, and information essential to setup, programming, and debugging of many advanced CR3000 systems. Info tables and settings are numerous. Note the following:

- All info tables and settings, except a handful, are accessible through a keyword. This discussion is organized around these keywords. Keywords and descriptions are listed alphabetically in sub appendix *Info Tables and Settings Descriptions* (p. 576).
- Info table fields are mostly read only. Some are resettable.
- Settings are mostly read/write.
- Directories in sub appendix *Info Tables and Settings Directories* (p. 569) list several groupings of keywords. Each keyword listed in these groups is linked to the relevant description.
- Some info tables and settings have multiple names depending on the interface used to access them. The names are listed with the descriptions.
- No single interface accesses all info tables and settings. Interfaces used for access include the following:

TABLE 9: Info Tables and Settings Interfaces					
Interface	Location				
Settings Editor	Device Configuration Utility, LoggerNet Connect screen, PakBus Graph				
Info tables (Status, DataTableInfo, CPIInfo, etc)	View as a data table in a numeric monitor				
Station Status	Menu item in LoggerNet				
<b>Edit Settings</b>	Menu item in <i>PakBusGraph</i> software.				
Keyboard/Display Settings	Menu items in Configure, Settings				
status.keyword/settings.keyword Syntax in CRBasic program					
<sup>1</sup> Information presented in <b>Station Status</b> is not updated automatically. Click the <b>Refresh</b> button to update.					

**Note** Communication and processor bandwidth are consumed when generating the **Status** and and other information tables. If the CR3000 is very tight on processing time, as may occur in very long or complex

operations, retrieving these tables repeatedly may cause *skipped scans* (p. 512).

### 7.5.1.4 CRBasic Program — Setup Tools

Info tables and settings can be set or accessed using CRBasic instructions SetStatus() or SetSetting().

For example, to set the setting **StationName** to **BlackIceCouloir**, the following syntax is used:

```
SetSetting("StationName", "BlackIceCouloir")
```

where *StationName* is the keyword for the setting, and *BlackIceCouloir* is the set value.

Settings can be requested by the CRBasic program using the following syntax:

```
x = Status.[setting]
```

where **Setting** is the keyword for a setting.

For example, to acquire the value set in setting **StationName**, use the following statement:

x = Status.StationName

### 7.5.1.5 Executable CPU: Files — Setup Tools

Many CR3000 settings can be changed remotely over a comms link either directly, or as discussed in *CRBasic Program* — *Setup Tools (p. 118)*, as part of the CRBasic program. These conveniences come with the risk of inadvertently changing settings and disabling communications. Such an occurrence will likely require an on-site visit to correct the problem if at least one of the provisions discussed in this section is not put in place. For example, wireless-ethernet (cell) modems are often controlled by a switched 12 Vdc (SW12) terminal. SW12 is normally off, so, if the program controlling SW12 is disabled, such as by replacing it with a program that neglects SW12 control, the cell modem is switched off and the remote CR3000 drops out of comms.

Executable CPU: files include the following:

- 'Include' file (p. 119)
- Default.cr3 file (p. 119)
- Powerup.ini file (p. 460)

To be used, each file needs to be created and then placed on the CPU: drive of the CR3000. The 'include' file and default.cr3 file consist of CRBasic code. Powerup.ini has a different, limited programming language.

#### 7.5.1.5.1 Default.cr3 File

A file named default.cr3 can be stored on the CR3000 CPU: drive. At power up, the CR3000 loads default.cr3 if no other program takes priority (see *Executable File Run Priorities (p. 122)*). Default.cr3 can be edited to preserve critical datalogger settings such as communication settings, but cannot be more than a few lines of code.

Downloading operating systems over comms requires much of the available CR3000 memory. If the intent is to load operating systems via a comms link, and have a default.cr3 file in the CR3000, the default.cr3 program should not allocate significant memory, as might happen by allocating a large USR: drive. Do not use a **DataTable()** instruction set for auto allocation of memory, either. Refer to *Operating System — Installation (p. 123)* for information about sending the operating system.

Execution of default.cr3 at power-up can be aborted by holding down the **DEL** key on the CR1000KD Keyboard/Display.

```
CRBasic EXAMPLE 1: Simple Default.cr3 File to Control SW12 Terminal

'This program example demonstrates use of a Default.cr3 file. It must be restricted
'to few lines of code. This program controls the SW12 switched power terminal, which
'may be helpful in assuring that the default power state of a remote modem is ON.

BeginProg
Scan(1,Sec,0,0)
If TimeIntoInterval(15,60,Sec) Then SW12(1,1)
If TimeIntoInterval(45,60,Sec) Then SW12(1,0)
NextScan
```

#### 7.5.1.5.2 "Include" File

**EndProg** 

An alternative to a subroutine is an 'include' file. An 'include' file is a CRBasic program file that resides on the CR3000 CPU: drive and compiles as an insert to the CRBasic program. It may also *run on its own (p. 122)*. It is essentially a subroutine stored in a file separate from the main program file. It can be used once or multiple times by the main program, and by multiple programs. The file begins with the **SlowSequence** instruction and can contain any code.

Procedure to use the "Include File":

- Write the file, beginning with the SlowSequence instruction followed by any other code.
- 2. Send the file to the CR3000 using tools in the **File Control** menu of *datalogger support software* (p. 91).
- 3. Enter the path and name of the file in the **Include File** setting using *DevConfig* or *PakBusGraph*.

Figures "Include File" Settings With DevConfig (p. 120) and "Include File" Settings With PakBusGraph (p. 121) show methods to set required settings with DevConfig

or with comms. There is no restriction on the length of the file. CRBasic example *Using an "Include File"* (p. 121) shows a program that expects a file to control power to a modem.

Consider the the example "include file", CPU:pakbus\_broker.dld. The rules used by the CR3000 when it starts are as follows:

- 1. If the logger is starting from power-up, any file that is marked as the "run on power-up" program is the "current program". Otherwise, any file that is marked as "run now" is selected. This behavior has always been present and is not affected by this setting.
- 2. If there is a file specified by this setting, it is incorporated into the program selected above.
- 3. If there is no current file selected or if the current file cannot be compiled, the datalogger will run the program given by this setting as the current program.
- 4. If the program run by this setting cannot be run or if no program is specified, the datalogger will attempt to run the program named default.cr3 on its CPU: drive.
- 5. If there is no default.cr3 file or if that file cannot be compiled, the datalogger will not run any program.

The CR3000 will now allow a **SlowSequence** statement to take the place of the **BeginProg** statement. This feature allows the specified file to act both as an include file and as the default program.

The formal syntax for this setting follows:

FIGURE 37: "Include" File Settings With DevConfig



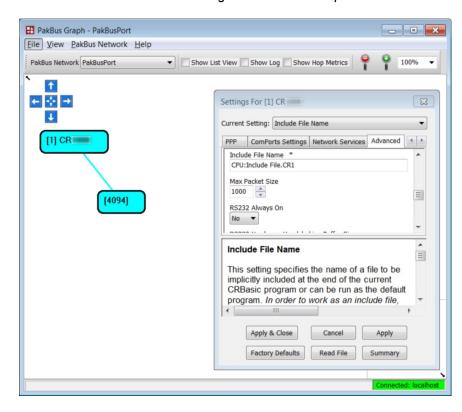


FIGURE 38: "Include" File Settings With PakBusGraph

### CRBasic EXAMPLE 2: Using an "Include" File

'This program example demonstrates the use of an 'include' file. An 'include' file is a CRBasic file that usually

'resides on the CPU: drive of the CR3000. It is essentially a subroutine that is 'stored in a file separate from the main program, but it compiles as an insert to the main 'program. It can be used once or multiple times, and by multiple programs.

''Include' files begin with the SlowSequence instruction and can contain any code.

'Procedure to use an 'include' file in this example:

- '1. Copy the code from the CRbasic example 'Include' File to Control Switched 12 V (p. 122) to 'CRBasic Editor, name it 'IncludeFile.cr3, and save it to the same PC folder on which resides the main program file (this make pre-compiling possible. Including the
- ' SlowSequence instruction as the first statement is required, followed by any other code.
- '2. Send the 'include' file to the CPU: drive of the CR3000 using the File Control menu of the datalogger support software. Be sure to de-select the Run Now and Run On Power-up options that are presented by the software when sending the file.
- '3. Add the Include instruction to the main CRBasic program at the location from which the 'include' file is to be called (see the following code).
- '4. Enter the CR3000 file system path and file name after the Include() instruction, as shown in the following code.

'IncludeFile.cr3 contains code to control power to a cellular phone modem.

'Cell phone + wire to be connected to SW12 terminal. Negative (-) wire 'to G.

```
Public PTemp, batt_volt

DataTable(Test,1,-1)
    DataInterval(0,15,Sec,10)
    Minimum(1,batt_volt,FP2,0,False)
    Sample(1,PTemp,FP2)
EndTable

BeginProg
    Scan(1,Sec,0,0)
        PanelTemp(PTemp,250)
        Battery(Batt_volt)
        CallTable Test
    NextScan
    Include "CPU:IncludeFile.CR1" '<<<<<<<<<'>'<<<<<<<<'>'<</>'include' file code executed here
EndProg
```

#### 7.5.1.5.3 Executable File Run Priorities

- When the CR3000 powers up, it executes commands in the powerup.ini file (on Campbell Scientific mass storage device or memory card including commands to set the CRBasic program file attributes to Run Now or Run On Power-up.
- 2. When the CR3000 powers up, a program file marked as **Run On Power-up** will be the current program.
- 3. If there is a file specified in the **Include File Name** setting, it is compiled at the end of the program selected in step.
- 4. If there is no file selected in step 1, or if the selected file cannot be compiled, the CR3000 will attempt to run the program listed in the **Include File Name** setting. The CR3000 allows a **SlowSequence** statement to take the place of the **BeginProg** statement. This allows the "Include File" to act as the default program.
- 5. If the program listed in the **Include File Name** setting cannot be run or if no program is specified, the CR3000 will attempt to run the program named default.cr3 on its CPU: drive.

6. If there is no default.cr3 file or it cannot be compiled, the CR3000 will not automatically run any program.

# 7.5.2 Setup Tasks

Following are a few common configuration actions:

- Updating the operating system (p. 123).
- Access CR3000 infor tables and settings (p. 117) to help troubleshoot
- Set the CR3000 clock
- Save current configuration
- Restore a configuration

Tools available to perform these actions are listed in the following table:

TABLE 10: Common Configuration Actions and Tools					
Action	Tools to Use <sup>1</sup>				
Updating the operating system	DevConfig (p. 113) software, Program Send (p. 550), memory card (p. 81), mass storage device				
Access a register	DevConfig, PakBus Graph, CRBasic program, 'Include' file (p. 119), Default.cr3 file (p. 119).				
Set the CR3000 clock	DevConfig, PC200W, PC400, LoggerNet				
Save / restore configuration	DevConfig				
<sup>1</sup> Tools are listed in order of preference.					

# 7.5.2.1 Operating System (OS) — Details

The CR3000 is shipped with the operating system pre-loaded. Check the pre-loaded version by connecting your PC to the CR3000 using the procedure outlined in *DevConfig Help*. OS version is displayed in the following location:

#### **Deployment** tab $\rightarrow$ **Datalogger** tab $\rightarrow$ **OS** Version text box

Update the OS on the CR3000 as directed in *DevConfig Help*. The current version of the OS is found at *www.campbellsci.com/downloads*. OS updates are free of charge.

**Note** An OS file has a .obj extension. It can be compressed using the gzip compression algorithm. The datalogger will accept and decompress the file on receipt. See *Program and OS Compression Q and A (p. 433)*.

Note the following precautions:

- Since sending an OS resets CR3000 memory, data loss will certainly occur. Depending on several factors, the CR3000 may also become incapacitated for a time.
  - Is sending the OS necessary to correct a critical problem? If not, consider waiting until a scheduled maintenance visit to the site.
  - Is the site conveniently accessible such that a site visit can be undertaken to correct a problem of reset settings without excessive expense?
  - If the OS must be sent, and the site is difficult or expensive to access, try the OS download procedure on an identically programmed, more conveniently located CR3000.
- Campbell Scientific recommends upgrading operating systems only with
  a direct-hardwire link. However, the Send Program (p. 550) button in the
  datalogger support software allows the OS to be sent over all software
  supported comms systems.
  - Operating systems are very large files be cautious of line charges.
  - Updating the OS may reset CR3000 settings, even settings critical to supporting the comms link. Newer operating systems minimize this risk.

The operating system is updated with one of the following tools:

# 7.5.2.1.1 OS Update with DevConfig Send OS Tab

Using this method results in the CR3000 being restored to factory defaults. The existing OS is over written as it is received. Failure to receive the complete new OS will leave the CR3000 in an unstable state. Use this method only with a direct hardwire serial connection.

#### How

Use the following procedure with *DevConfig*: Do not click **Connect**.

- 1. Select CR3000 from the list of devices at left
- 2. Select the appropriate communication port and baud rate at the bottom left
- 3. Click the **Send OS** tab located at the top of *DevConfig* window
- 4. Follow the on-screen **OS Download Instructions**

#### Pros/Cons

This is a good way to recover a CR3000 that has gone into an unresponsive state. Often, an operating system can be loaded even if you are unable to communicate with the CR3000 through other means.

Loading an operating system through this method will do the following:

- 1. Restore all CR3000 settings to factory defaults
- 2. Delete data in final storage
- 3. Delete data from and remove the USR drive
- 4. Delete program files stored on the datalogger

### 7.5.2.1.2 OS Update with File Control

This method is very similar to sending an OS as a program, with the exception that you have to manually prepare the datalogger to accept the new OS.

#### How

- 1. Connect to the CR3000 with Connect or DevConfig
- 2. Collect data
- 3. Transfer a default. CR1 (p. 119) program file to the CR3000 CPU: drive
- 4. Stop the current program and select the option to delete associated data (this will free up SRAM memory allocated for data storage)
- 5. Collect files from the USR: drive (if applicable)
- 6. Delete the USR: drive (if applicable)
- 7. Send the new .obj OS file to the CR3000
- 8. Restart the previous program (default.CR1 will be running after OS compiles)

#### Pros/Cons

This method is preferred because the user must manually configure the datalogger to receive an OS and thus should be cognizant of what is happening (loss of data, program being stopped, etc.).

Loading an operating system through this method will do the following:

- 1. Preserve all CR3000 settings
- 2. Delete all data in final storage
- 3. Delete USR: drive

- 4. Stop current program deletes data and clears run options
- 5. Deletes data generated using the CardOut() or TableFile() instructions

### 7.5.2.1.3 OS Update with Send Program Command

A send program command is a feature of *DevConfig* and other *datalogger support* software (p. 614). Location of this command in the software is listed in the following table:

TABLE 11: Program Send Command Locations							
Datalogger Support Software	Name of Button	Location of Button					
DevConfig	Send Program	Logger Control tab lower left					
LoggerNet	Send New	Connect window, lower right					
PC400	Send Program	Main window, lower right					
PC200W	Send Program	Main window, lower right					
RTDAQ	Send Program	Main window, lower right					

This method results in the CR3000 retaining its settings (a feature since OS version 16). The new OS file is temporarily stored in CR3000 SRAM memory, which necessitates the following:

- Sufficient memory needs to be available. Before attempting to send the
  OS, you may need to delete other files in the CPU: and USR: drives, and
  you may need to remove the USR: drive altogether. Since OS 25, older 2
  MB CR3000s do not have sufficient memory to perform this operation.
- SRAM will be cleared to make room, so program run options and data
  will be lost. If CR3000 communications are controlled with the current
  program, first load a default.cr3 CRBasic program on to the CPU: drive.
  Default.cr3 will run by default after the CR3000 compiles the new OS
  and clears the current run options.

#### How

From the *LoggerNet* Connect window, perform the following steps:

- 1. Connect to the station
- 2. Collect data
- 3. Click the Send New...

- 4. Select the OS file to send
- 5. Restart the existing program through **File Control**, or send a new program with *CRBasic Editor* and specify new run options.

#### Pros/Cons

This is the best way to load a new operating system on the CR3000 and have its settings retained (most of the time). This means that you will still be able to communicate with the station because the PakBus address is preserved and PakBusTCP client connections are maintained. Plus, if you are using a TCP/IP connection, the file transfer is much faster than loading a new OS directly through *DevConfig*.

The bad news is that, since it clears the run options for the current program, you can lose communications with the station if power is toggled to a communication peripheral under program control, such as turning a cell modem on/off to conserve power use.

Also, if sufficient memory is not available, instability may result. It's probably best to clear out the memory before attempting to send the new OS file. If you have defined a USR drive you will probably need to remove it as well.

Loading an operating system through this method will do the following:

- 1. Preserve all CR3000 settings
- 2. Delete all data in final storage
- 3. Stop current program (Stop and deletes data) and clears run options
- 4. Deletes data generated using the CardOut() instruction

### 7.5.2.1.4 OS Update with External Memory and PowerUp.ini File

#### How

- 1. Place a *powerup.ini* (p. 460) text file and operating system .obj file on the external memory device
- 2. Attached the external memory device to the datalogger
- 3. Power cycle the datalogger

#### Pros/Cons

This is a great way to change the OS without a laptop in the field. The down side is only if you want to do more than one thing with the powerup.ini, such as change OS and load a new program, which necessitates that you use separate cards or modify the .ini file between the two tasks you wish to perform.

Loading an operating system through this method will do the following:

- 1. Preserve all datalogger settings
- 2. Delete all data in final storage
- 3. Preserve USR drive and data stored there
- 4. Maintains program run options
- 5. Deletes data generated using the CardOut() or TableFile() instructions

#### DevConfig Send OS tab:

- If you are having trouble communicating with the CR3000
- If you want to return the CR3000 to a known configuration

#### Send Program (p. 550) or Send New... command:

- If you want to send an OS remotely
- If you are not too concerned about the consequences

#### File Control tab:

- If you want to update the OS remotely
- If your only connection to the CR3000 is over IP
- If you have IP access and want to change the OS for testing purposes

External memory and PowerUp.ini file:

• If you want to change the OS without a PC

### 7.5.2.2 Factory Defaults — Installation

In *DevConfig*, clicking the **Factory Defaults** button at the base of the **Settings Editor** tab sends a command to the CR3000 to revert to its factory default settings. The reverted values will not take effect until the changes have been applied.

### 7.5.2.3 Saving and Restoring Configurations — Installation

In *DevConfig*, clicking **Save** on a summary screen saves the configuration to an XML file. This file can be used to load a saved configuration back into the CR3000 by clicking **Read File** and **Apply**.

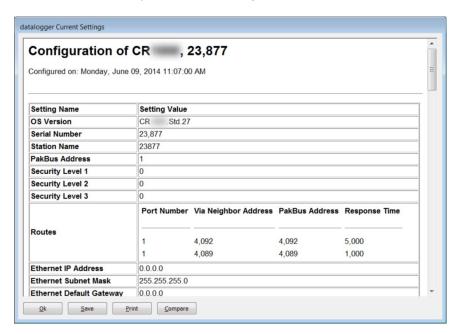


FIGURE 39: Summary of CR3000 Configuration

# 7.6 CRBasic Programming — Details

#### Related Topics:

- CRBasic Programming Overview (p. 87)
- CRBasic Programming Details (p. 129)
- Programming Resource Library (p. 181)
- CRBasic Editor Help

Programs are created with either *Short Cut* (p. 555) or *CRBasic Editor* (p. 132). Read the instructions for the use of each in their respective Help systems.

# 7.6.1 Program Structure


Essential elements of a CRBasic program are listed in the table *CRBasic Program Structure* (p. 129) and demonstrated in CRBasic example *Program Structure* (p. 130).


**TABLE 12: CRBasic Program Structure** 

Program Element <sup>1</sup>	Purpose			
Const	Declare fixed constants.			
Public	Declare and dimension variables viewable during program execution.			
Dim	Declare and dimension variables not viewable during program execution.			
Alias	Assign aliases to variables.			
Units	Optional. Assign engineering units to variables. Units are not active code. The CR3000 makes no use of units nor checks unit accuracy.			
DataTable Sample() Average() Maximum() Minimum()	<ul> <li>Define stored-data tables.</li> <li>Process or store trigger: set triggers when data should be stored. Triggers may be a fixed interval, a condition, or both.</li> <li>Set the size of a data table.</li> <li>Send data to a Campbell Scientific mass storage device or memory card if available.</li> </ul>			
BeginProg	Begin the action part of the program.			
Scan()	Set the interval for a series of measurements.			
Measurements	Make measurements.			
Processing	Process measurement and other data.			
CallTable()	Call data tables to process and store data.			
Controls	Check measurements and initiate any control actions.			
NextScan	Loop back to Scan() and wait for the next scan.			
EndProg	End the program.			

<sup>&</sup>lt;sup>1</sup> Fine points:

- Maximum program-line length is <u>512</u> characters.
- Maximum constant-name length is about <u>500</u> characters.
- Processes or calculations repeated during program execution can be packaged in a subroutine and called when needed rather than repeating the code each time.

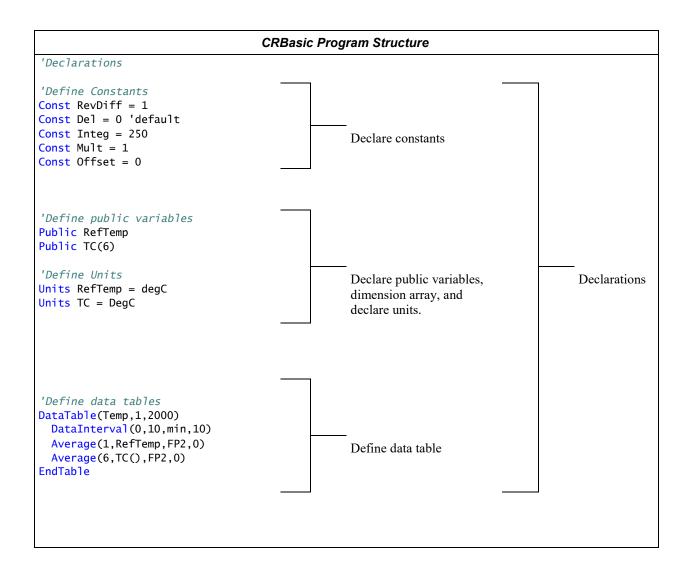

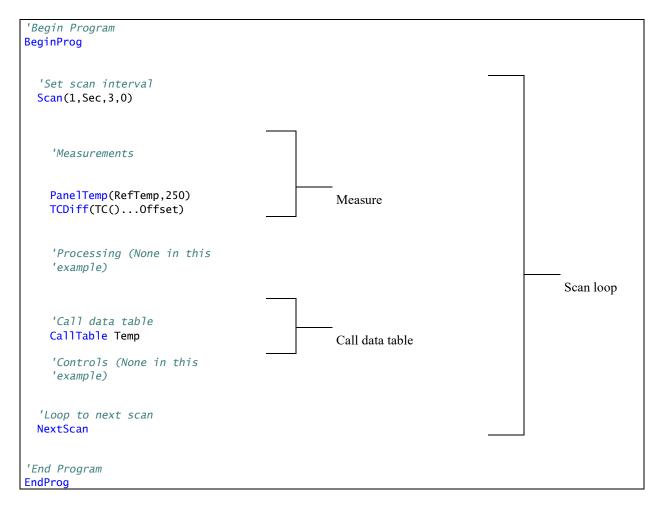

# 7.6.2 Writing and Editing Programs

# 7.6.2.1 Short Cut Programming Wizard

Short Cut is easy-to-use, menu-driven software that presents lists of predefined measurement, processing, and control algorithms from which to choose. You make choices, and Short Cut writes the CRBasic code required to perform the tasks. Short Cut creates a wiring diagram to simplify connection of sensors and external devices. Quickstart (p. 37) works through a measurement example using Short Cut.

For many complex applications, *Short Cut* is still a good place to start. When as much information as possible is entered, *Short Cut* will create a program template from which to work, already formatted with most of the proper structure, measurement routines, and variables. The program can then be edited further using *CRBasic Program Editor*.

#### 7.6.2.2 CRBasic Editor

CR3000 application programs are written in a variation of BASIC (Beginner's All-purpose Symbolic Instruction Code) computer language, CRBasic (Campbell Recorder BASIC). *CRBasic Editor* is a text editor that facilitates creation and

modification of the ASCII text file that constitutes the CR3000 application program. *CRBasic Editor* is a component of *LoggerNet*, *RTDAQ*, and *PC400 datalogger support software* (p. 91).

Fundamental elements of CRBasic include the following:

- Variables named packets of CR3000 memory into which are stored values that normally vary during program execution. Values are typically the result of measurements and processing. Variables are given an alphanumeric name and can be dimensioned into arrays of related data.
- Constants discrete packets of CR3000 memory into which are stored specific values that do not vary during program executions. Constants are given alphanumeric names and assigned values at the beginning declarations of a CRBasic program.

**Note** Keywords and predefined constants are reserved for internal CR3000 use. If a user-programmed variable happens to be a keyword or predefined constant, a runtime or compile error will occur. To correct the error, simply change the variable name by adding or deleting one or more letters, numbers, or the underscore (\_) from the variable name, then recompile and resend the program. *CRBasic Editor Help* provides a list of keywords and predefined constants.

- Common instructions instructions (called "commands" in BASIC) and operators used in most BASIC languages, including program control statements, and logic and mathematical operators.
- Special instructions instructions (commands) unique to CRBasic, including measurement instructions, and processing instructions that compress many common calculations used in CR3000 dataloggers.

These four elements must be properly placed within the program structure.

### 7.6.2.2.1 Inserting Comments into Program

Comments are non-executable text placed within the body of a program to document or clarify program algorithms.

As shown in CRBasic example *Inserting Comments (p. 133)*, comments are inserted into a program by preceding the comment with a single quote ('). Comments can be entered either as independent lines or following CR3000 code. When the CR3000 compiler sees a single quote ('), it ignores the rest of the line.

#### **CRBasic EXAMPLE 4:** Inserting Comments

'This program example demonstrates the insertion of comments into a program. Comments are 'placed in two places: to occupy single lines, such as this explanation does, or to be 'placed after a statement.

'Declaration of variables starts here.
Public Start(6)

'Declare the start time array

BeginProg EndProg

### 7.6.2.2.2 Conserving Program Memory

One or more of the following memory-saving techniques can be used on the rare occasions when a program reaches memory limits:

- Declare variables as **DIM** instead of **Public**. **DIM** variables do not require buffer memory for data retrieval.
- Reduce arrays to the minimum size needed. Arrays save memory over the use of scalars as there is less "meta-data" required per value. However, as a rough approximation, 19200 (4 kB memory) variables will fill available memory.
- Use variable arrays with aliases instead of individual variables with unique names. Aliases consume less memory than unique variable names.
- Confine string concatenation to **DIM** variables.
- Dimension string variables only to the size required.

**Read More** More information on string variable-memory use and conservation is available in *String Operations* (p. 327).

# 7.6.3 Programming Syntax

# 7.6.3.1 Program Statements

CRBasic programs are made up of a series of statements. Each statement normally occupies one line of text in the program file. Statements consist of instructions, variables, constants, expressions, or a combination of these. "Instructions" are CRBasic commands. Normally, only one instruction is included in a statement. However, some instructions, such as **If** and **Then**, are allowed to be included in the same statement.

Lists of instructions and expression operators can be found in *CRBasic Editor Help (p. 132)*.

### 7.6.3.1.1 Multiple Statements on One Line

Multiple short statements can be placed on a single text line if they are separated by a colon (:). This is a convenient feature in some programs. However, in general, programs that confine text lines to single statements are easier for humans to read.

In most cases, regarding statements separated by: as being separate lines is safe. However, in the case of an implied **EndIf**, CRBasic behaves in what may be an unexpected manner. In the case of an **If...Then...Else...EndIf** statement, where the **EndIf** is only implied, it is implied after the last statement on the line. For example:

```
If A then B : C : D

does not mean:

If A then B (implied EndIf) : C : D

Rather, it does mean:

If A then B : C : D (implied EndIf)
```

### 7.6.3.1.2 One Statement on Multiple Lines

Long statements that overrun the *CRBasic Editor* page width can be continued on the next line if the statement break includes a space and an underscore (\_). The underscore must be the last character in a text line, other than additional white space.

**Note** CRBasic statements are limited to 512 characters, whether or not a line continuation is used.

Examples:

```
Public A, B, _
    C,D, E, F

If (A And B) _
    Or (C And D) _
    Or (E And F) then ExitScan
```

### 7.6.3.2 Single-Statement Declarations

Single-statements are used to declare variables, constants, variable and constant related elements, station name, and hardware settings. The following instructions are used usually before the **BeginProg** instruction:

- Public
- Dim
- Constant
- Units

- Alias
- StationName

The table *Rules for Names (p. 169)* lists declaration names and allowed lengths. See *Predefined Constants (p. 148)* for other naming limitations.

### 7.6.3.3 Declaring Variables

A variable is a packet of memory that is given an alphanumeric name. Measurements and processing results pass through variables during program execution. Variables are declared as **Public** or **Dim**. **Public** variables are viewable through *numeric monitors* (p. 547). **Dim** variables cannot be viewed. A public variables can be set as read-only, using the **ReadOnly** instruction, so that it cannot be changed from a numeric monitor. The program, however, continues to have read/write access to the variable.

Declared variables are initialized once when the program starts. Additionally, variables that are used in the **Function()** or **Sub()** declaration, or that are declared within the body of the function or subroutine, are local to that function or subroutine.

Variable names can be up to 39 characters in length, but most variables should be no more than 35 characters long. This allows for four additional characters that are added as a suffix to the variable name when it is output to a data table. Variable names can contain the following characters:

- A to Z
- a to z
- 0 to 9
- \_ (underscore)
- \$

Names must start with a letter, underscore, or dollar sign. Spaces and quote marks are not allowed. Variable names are not case sensitive.

Several variables can be declared on a single line, separated by commas:

```
Public RefTemp, AirTemp2, Batt_Volt
```

Variables can also be assigned initial values in the declaration. Following is an example of declaring a variable and assigning it an initial value.

```
Public SetTemp = {35}
```

In string variables, string size defaults to 24 characters (changed from 16 characters in April 2013, OS 26).

### 7.6.3.3.1 Declaring Data Types

Variables and data values stored in final memory can be configured with various data types to optimize program execution and memory usage.

The declaration of variables with the **Dim** or **Public** instructions allows an optional type descriptor **As** that specifies the data type. The default data type (declaration without a descriptor) is *IEEE4* floating point, which is equivalent to the **As Float** declaration. Variable data types are listed in the table *Data Types in Variable Memory (p. 137).* Final-data memory data types are listed in the table *Data Types in Final-Storage Memory (p. 138).* CRBasic example *Data Type Declarations (p. 140)* shows various data types in use in the declarations and output sections of a program.

CRBasic allows mixing data types within a single array of variables; however, this practice can result in at least one problem. The datalogger support software is incapable of efficiently handling different data types for the same field name. Consequently, the software mangles the field names in data file headers.

TABLE 1	TABLE 13: Data Types in Variable Memory						
Name	Comman d	Description	Word Size (Bytes)	Notes	Resolution / Range		
Float	As Float or As IEEE4	IEEE floating point	4	Data type of all variables unless declared otherwise. IEEE Standard 754	<ul> <li>24 bits (about 7 digits)</li> <li>±1.4E-45 to ±3.4E38</li> </ul>		
Long	As Long	Signed integer	4	Use to store count data in the range of ±2,147,483,648 Speed: integer math is faster than floating point math. Resolution: 32 bits. Compare to 24 bits in IEEE4. Suitable for storing whole numbers, counting number, and integers in final-storage memory. If storing non-integers, the fractional portion of the value is lost.	32 bits -2,147,483,648 to +2,147,483,647		
Boolean	As Boolean	Signed integer	4	Use to store true or false states, such as states of flags and control ports. 0 is always false. –1 is always true. Depending on the application, any other number may be interpreted as true or false. See the section <i>True</i> = -1, <i>False</i> = 0 (p. 173).	True = $-1$ or any number $\ge 1$ False = any number $\ge 0$ and $< 1$		

TABLE 13: Data Types in Variable Memory								
Name	Comman d	Description	Word Size (Bytes)	Notes	Resolution / Range			
				See caution. <sup>1</sup>				
			Minimum : 3 (4 with null terminato r) Default: 24	String size is defined by the CR3000 operating system and CRBasic program.  When converting from STRING to FLOAT, numerics at the beginning of a string convert, but conversion stops when a non-numeric is	Unless declared otherwise, string size is 24 bytes or characters. String size is allocated in multiples of four bytes; for example, String * 25, String * 26, String * 27, and String * 28 allocate 28 bytes (27 usable). Minimum string size is 4 (3 usable). See <i>CRBasic Editor Help</i> for more information.			
String	As String	ASCII string	Maximu m:	encountered. If the string begins with a non-numeric, the FLOAT will be NAN. If	Maximum length is limited only by available CR3000 memory. As a special			

the FLOAT will be NAN. If

numeric values separated by

non-numeric characters, the

SplitStr() instruction can be

used to parse out the numeric

values. See the sections String Operations (p. 327) and Serial

the string contains multiple

case, a string can be declared as String \* 1.

This allows the efficient storage of a single

character. The string will take up 4 bytes in

memory and when stored in a data table,

but it will hold only one character.

limited

only to

the size of

available

CR3000

memory.

<sup>1</sup> CAUTION When using a very long string in a variable declared **Public**, the operations of datalogger support software (p. 615) will frequently transmit the entire string over the communication link. If communication bandwidth is limited, or if communications are paid for by they byte, declaring the variable **Dim** may be preferred.

I/O (p. 303).

TABLE 1	TABLE 14: Data Types in Final-Storage Memory								
Name	Argument	Description	Word Size (Bytes)	Notes	Resolution / Range				
					Absolute	Value		Decimal Location	
		Campbell Scientific floating point	2	Default final-memory data type. Use <i>FP2</i> for stored data requiring 3 or 4 significant digits. If more significant digits are needed, use <i>IEEE4</i> or an offset.	0 – 7.999			X.XXX	
					8 – 79.99			XX.XX	
FP2	FP2				80 – 799.9			XXX.X	
					800 – 7999.			XXXX.	
					Zero	Minimu	ım	Maximum	
					0.000	±0.00	1	±7999.	
IEEE4	IEEE4 or Float	IEEE floating point	4	IEEE Standard 754	±1.4E–45 t	o ±3.4E38	3		

TABLE 14: Data Types in Final-Storage Memory						
Name	Argument	Description	Word Size (Bytes)	Notes	Resolution / Range	
				Use to store count data in the range of ±2,147,483,648		
			4	Speed: integer math is faster than floating point math.		
Long	Long	Signed integer		Resolution: 32 bits. Compare to 24 bits in IEEE4.	-2,147,483,648 to +2,147,483,647	
Long	ŝ	Signed integer		Suitable for storing whole numbers, counting number, and integers in final-storage memory. If storing non-integers, the fractional portion of the value is lost.		
				Use to store positive count data ≤		
UINT2	UINT2	Unsigned integer	2	+65535.  Use to store port or flag status. See CRBasic example <i>Load binary information into a variable (p. 149)</i> .  When <b>Public FLOAT</b> s convert to <i>UINT2</i> at final data storage, values outside the range 0 – 65535 yield unusable data. <b>INF</b> converts to <b>65535</b> . <b>NAN</b> converts to 0.	0 to 65535	
				Use to store positive count data ≤ 2147483647.		
UINT4	UINT4	Unsigned integer	4	Other uses include storage of long ID numbers (such as are read from a bar reader), serial numbers, or address.  May also be required for use in	0 to 4,294,967,295 (2 <sup>32</sup> )	
				some Modbus devices.		
Boolean	Boolean	Signed integer	4	Use to store true or false states, such as states of flags and control ports. 0 is always false. –1 is always true. Depending on the application, any other number may be interpreted as true or false. See the section <i>True</i> = -1, <i>False</i> = 0 (p. 173). To save memory, consider using <i>UINT2</i> or <i>BOOL8</i> .	True = $-1$ or any number $\geq 1$ False = any number $\geq 0$ and $< 1$	
Bool8	Bool8	Integer	1	8 bits (0 or 1) of information. Uses less space than 32-bit BOOLEAN. Holding the same information in BOOLEAN will require 256 bits. See <i>Bool8 Data Type</i> (p. 203).	True = 1, False = 0	

TABLE 1	TABLE 14: Data Types in Final-Storage Memory							
Name	Argument	Description	Word Size (Bytes)	Notes	Resolution / Range			
NSEC	NSEC	Time stamp	8	Divided up as four bytes of seconds since 1990 and four bytes of nanoseconds into the second. Used to record and process time data. See <i>NSEC Data Type</i> (p. 208).	1 nanosecond			
String	String	ASCII string	Minimum: 3 (4 with null terminator) Default: 24 Maximum: limited only to the size of available CR3000 memory.	See caution. <sup>1</sup> String size is defined by the CR3000 operating system and CRBasic program.  When converting from STRING to FLOAT, numerics at the beginning of a string convert, but conversion stops when a nonnumeric is encountered. If the string begins with a non-numeric, the FLOAT will be NAN. If the string contains multiple numeric values separated by non-numeric characters, the SplitStr() instruction can be used to parse out the numeric values. See the sections String Operations (p. 327) and Serial I/O (p. 303).	Unless declared otherwise, string size is 24 bytes or characters. String size is allocated in multiples of four bytes; for example, String * 25, String * 26, String * 27, and String * 28 allocate 28 bytes (27 usable). Minimum string size is 4 (3 usable). See <i>CRBasic Editor Help</i> for more information. Maximum length is limited only by available CR3000 memory. As a special case, a string can be declared as String * 1. This allows the efficient storage of a single character. The string will take up 4 bytes in memory and when stored in a data table, but it will hold only one character.			

### **CRBasic EXAMPLE 5:** Data Type Declarations

'This program example demonstrates various data type declarations.

'Data type declarations associated with any one variable occur twice: first in a Public 'or Dim statement, then in a DataTable/EndTable segment. If not otherwise specified, data 'types default to floating point: As Float in Public or Dim declarations, FP2 in data 'table declarations.

'Float Variable Examples

Public Z

Public X As Float

'Long Variable Example
Public CR3000Time As Long
Public PosCounter As Long
Public PosNegCounter As Long

```
'Boolean Variable Examples
Public Switches(8) As Boolean
Public FLAGS(16) As Boolean
'String Variable Example
Public FirstName As String * 16 'allows a string up to 16 characters long
DataTable(TableName,True,-1)
  'FP2 Data Storage Example
  Sample(1,Z,FP2)
  'IEEE4 / Float Data Storage Example
  Sample(1,X,IEEE4)
  'UINT2 Data Storage Example
  Sample(1, PosCounter, UINT2)
  'LONG Data Storage Example
  Sample(1, PosNegCounter, Long)
  'STRING Data Storage Example
  Sample(1,FirstName,String)
  'BOOLEAN Data Storage Example
  Sample(8, Switches(), Boolean)
  'BOOL8 Data Storage Example
  Sample(2,FLAGS(),Bool8)
  'NSEC Data Storage Example
  Sample(1,CR3000Time,Nsec)
EndTable
BeginProg
'Program logic goes here
EndProg
```

### 7.6.3.3.2 Dimensioning Numeric Variables

Some applications require multi-dimension arrays. Array dimensions are analogous to spatial dimensions (distance, area, and volume). A single-dimension array, declared as,

```
Public VariableName(x)
```

with (x) being the index, denotes x number of variables as a series.

A two-dimensional array, declared as,

```
Public VariableName(x,y)
```

with (x,y) being the indices, denotes  $(x \cdot y)$  number of variables in a square x-by-y matrix.

Three-dimensional arrays, declared as

```
Public VariableName (x,y,z)
```

with (x,y,z) being the indices, have  $(x \cdot y \cdot z)$  number of variables in a cubic x-byy-by-z matrix. Dimensions greater than three are not permitted by CRBasic.

When using variables in place of integers as dimension indices (see CRBasic example *Using Variable Array Dimension Indices (p. 142)*), declaring the indices **As Long** variables is recommended. Doing so allows for more efficient use of CR3000 resources.

### CRBasic EXAMPLE 6: Using Variable Array Dimension Indices

```
'This program example demonstrates the use of dimension indices in arrays. The variable
'VariableName is declared with three dimensions with 4 in each index. This indicates the
'array has means it has 64 elements. Element 24 is loaded with the value 2.718.

Dim aaa As Long
Dim bbb As Long
Dim ccc As Long
Public VariableName(4,4,4) As Float

BeginProg
Scan(1,sec,0,0)
aaa = 3
bbb = 2
ccc = 4
VariableName(aaa,bbb,ccc) = 2.718
NextScan
EndProg
```

# 7.6.3.3.3 Dimensioning String Variables

Strings can be declared to a maximum of two dimensions. The third "dimension" is used for accessing characters within a string. See *String Operations (p. 327)*. String length can also be declared. See table *Data Types in Variable Memory. (p. 137)* 

A one-dimension string array called **StringVar**, with five elements in the array and each element with a length of 36 characters, is declared as

```
Public StringVar(5) As String * 36
```

Five variables are declared, each 36 characters long:

```
StringVar(1)
StringVar(2)
StringVar(3)
StringVar(4)
StringVar(5)
```

### 7.6.3.3.4 Declaring Flag Variables

A flag is a variable, usually declared **As Boolean** (p. 531), that indicates True or False, on or off, go or not go, etc. Program execution can be branched based on the value in a flag. Sometime flags are simply used to inform an observer that an event is occurring or has occurred. While any variable of any data type can be used as a flag, using Boolean variables, especially variables named "Flag", usually

works best in practice. CRBasic example *Flag Declaration and Use (p. 143)* demonstrates changing words in a string based on a flag.

# **CRBasic EXAMPLE 7:** Flag Declaration and Use 'This program example demonstrates the declaration and use of flags as Boolean variables, 'and the use of strings to report flag status. To run the demonstration, send this program 'to the CR3000, then toggle variables Flag(1) and Flag(2) to true or false to see how the 'program logic sets the words "High" or "Low" in variables FlagReport(1) and FlagReport(2). 'To set a flag to true when using LoggerNet Connect Numeric Monitor, simply click on the 'forest green dot adjacent to the word "false." If using a keyboard, a choice of "True" or '"False" is made available. Public Flag(2) As Boolean Public FlagReport(2) As String BeginProg Scan(1, Sec, 0, 0) If Flag(1) = True Then FlagReport(1) = "High" E1se FlagReport(1) = "Low" EndIf If Flag(2) = True Then FlagReport(2) = "High" FlagReport(2) = "Low" EndIf NextScan

#### 7.6.3.4 Using Variable Pointers

EndProg

A pointer is the memory address of a variable. Use a pointer as a convenient way to reference the memory location of a variable rather than referencing it by name. This is useful in a Function() instruction function when parameters are local to the function and changes to them have no effect on original arguments.

Define a pointer variable using the @ operator. For example:

```
PTR = @X
```

Use the ! operator to de-reference a pointer (return the value at the pointer). For example:

```
!PTR = Myvar
```

Use the @ operatore to return the name of the variable stored in a memory location. For example:

```
Name=(@)X
```

Pointer variables must be of type LONG and initialized by the @ operator, or a **variable out-of-bounds** error will occur.

When a **Function()** function returns a pointer, apply the ! operator to the function call, as shown in the following example:

```
Function ConstrainFunc(Value As Long, Low As Long, High As Long)
As Long
If !Value < !Low Then
   Return Low
ElseIf !Value > !High Then
   Return High
Else
   Return Value
EndIf
EndFunction
'Call within program
FuncFltRes = !ConstrainFunc(@FltVal,@FltLow,@FltHigh)
```

### 7.6.3.5 Declaring Arrays

```
Related Topics:
```

- Declaring Arrays (p. 144)
- VarOutOfBounds (p. 513)

Multiple variables of the same root name can be declared. The resulting series of like-named variables is called an array. An array is created by placing a suffix of (x) on the variable name. X number of variables are created that differ in name only by the incrementing number in the suffix. For example, the four statements

```
Public TempC1
Public TempC2
Public TempC3
Public TempC4
```

can simply be condensed to

```
Public TempC(4).
```

This statement creates in memory the four variables TempC(1), TempC(2), TempC(3), and TempC(4).

A variable array is useful in program operations that affect many variables in the same way. CRBasic example *Using a Variable Array in Calculations* (p. 145) shows compact code that converts four temperatures (°C) to °F.

In this example, a **For/Next** structure with an incrementing variable is used to specify which elements of the array will have the logical operation applied to them. The CRBasic **For/Next** function will only operate on array elements that are clearly specified and ignore the rest. If an array element is not specifically referenced, as is the case in the declaration

```
Dim TempC()
```

CRBasic references only the first element of the array, **TempC(1)**.

See CRBasic example *Concatenation of Numbers and Strings (p. 329)* for an example of using the += assignment operator when working with arrays.

# **CRBasic EXAMPLE 8:** Using a Variable Array in Calculations 'This program example demonstrates the use of a variable array to reduce code. 'example, two variable arrays are used to convert four temperature measurements from 'degree C to degrees F. Public TempC(4) Public TempF(4) Dim T BeginProg Scan(1, Sec, 0, 0) Therm107(TempC(1),1,1,Vx1,0,250,1.0,0) Therm107(TempC(2),1,2,Vx1,0,250,1.0,0) Therm107(TempC(3),1,3,Vx1,0,250,1.0,0) Therm107(TempC(4),1,4,Vx1,0,250,1.0,0) For T = 1 To 4 TempF(T) = TempC(T) \* 1.8 + 32Next T NextScan **EndProg**

## 7.6.3.5.1 Advanced Array Declaration

This section describes syntax that facilitates array filling, scaling, copying, etc.

The main applications are as follows:

- a) initiating an array
- b) scaling an array, for example converting all of the FREQ/HZ returned by a group of AVW200's into digits, strain, level, etc.
- c) creating boolean arrays based on comparisons with a scalar or another array

The main drivers at the time of starting down this path were

- 1) multiple years of feedback from customers asking me how to more tersely initialize and scale arrays often trying to compare CRBasic to Matlab or Python.
- 2) Easier ways to scale vibrating wire measurements and transpose their resulting data arrays:

CRBasic provides an array notation that allows one to easily operate on a single dimension of an array. Using this notation one can easily:

- initialize an array dimension
- copy a dimension to a new location
- · scale an array dimension

 perform a mathematical or logical operation for each element in a dimension using scalar or similarly located elements in different arrays and dimensions

Here are some syntax rules and behaviors. Given the array, Array(A,B,C):

- The () pair must always be present, i.e., reference the array as Array() or Array(A,B,C)().
- Only 1 dimension of the array can be operated on at a time. To select the dimension, negate the element index.
- Operations will not cross from 1 dimension into another. We access from the specified starting point to the end of the dimension, where the dimension is specified by a negative or by default is the least significant.
- If indices are not specified, or none have been negated, the least significant dimension of the array will be assumed.
- The offset into the dimension being accessed is given by A,B, and C in Array(A,B,C)().
- If the Array is referenced as Array(), then the starting point is assumed Array(1,1,1) and the least significant dimensioned is accessed.

## 7.6.3.6 Declaring Local and Global Variables

Advanced programs may use *subroutines* (p. 332) or functions, each of which can have a set of **Dim** variables dedicated to that subroutine or function. These are called *local* variables. Names of local variable can be identical to names of *global variables* (p. 541) and to names of local variables declared in other subroutines and functions. This feature allows creation of a CRBasic library of reusable subroutines and functions that will not cause variable name conflicts. If a program with local **Dim** variables attempts to use them globally, the compile error **undeclared variable** will occur.

To make a local variable displayable, in cases where making it public creates a naming conflict, sample the local variable to a data table and display the data element table in a *numeric monitor* (p. 547).

When exchanging the contents of a global and local variables, declare each passing / receiving pair with identical data types and string lengths.

#### 7.6.3.7 Initializing Variables

By default, variables are set equal to zero at the time the datalogger program compiles. Variables can be initialized to non-zero values in the declaration. Examples of syntax are shown in CRBasic example *Initializing Variables (p. 146)*.

# 

#### 7.6.3.8 Declaring Constants

BeginProg EndProg

Declare a constant name at the beginning of a program to use the alphanumeric name in place of a numeric or string value. In the body of the program, use the name rather than the value itself to make the program more secure against unintended changes, and easier to read and modify. CRBasic example *Using the Const Declaration (p. 148)* shows how to declare and use constants.

If declared using **ConstTable** / **EndConstTable** instructions, constants can be changed on the CR1000KD Keyboard/Display while the program is running (**Configure**, **Settings** | **Constant Table**). Changes can also be made with the C command in a terminal emulator (see *Troubleshooting* – *Using Terminal Mode* (p. 523)).

Constants, in memory, are four-byte signed integers or floating point numbers of up to about 500 characters in length (length limited to the maximum *command line (p. 532)* length).

CRBasic syntax does not have a provision for declaring a data type for a constant, so the compiler infers data type based on the format of the constant value expression, which is usually a single scalar. There are three possible outcomes:

- string the constant expression produces a string or the value is enclosed in quotes
- integer the constant expression does not produce a floating point value or the constant does not have a decimal point. Range = -2,147,483,648 to 2,147,483,647
- floating point. Range  $\approx -1E38$  to 1E38

If the constant is not written as a decimal, the compiler treats the value as an integer. Integer and floating point values are represented by 32 bits. A floating-point value achieves its extended range by using a base-two exponential format. The range of integers that a floating-point value can reliably store is limited by the

**EndProg** 

size of the mantissa, which is  $\pm 16,777,216$ . If the attempt is made to express a floating-point constant outside of this range, precision may be lost.

Constants in a constant table can also be changed using the **SetSetting()** instruction and the constant table using the CR1000KD.

**Note** Using all uppercase for constant names may make them easier to recognize.

```
CRBasic EXAMPLE 10: Using the Const Declaration

'This program example demonstrates the use of the Const declaration.

'Declare variables
Public PTempC
Public PTempF

'Declare constants
Const CtoF_Mult = 1.8
Const CtoF_Offset = 32

BeginProg
Scan(1,Sec,0,0)
PanelTemp(PTempC,250)
PTempF = PTempC * CtoF_Mult + CtoF_Offset
NextScan
```

#### 7.6.3.8.1 Predefined Constants

Many words are reserved for use by CRBasic. These words cannot be used as variable or table names in a program. Predefined constants include instruction names and valid alphanumeric names for instruction parameters. On account the list of predefined constants is long and frequently increases as the operating system is developed, the best course is to compile programs frequently during CRBasic program development. The compiler will catch the use of any reserved words. Following are listed predefined constants that are assigned a value:

• LoggerType = 3000 (as in CR3000)

These may be useful in programming.

## 7.6.3.9 Declaring Aliases and Units

A variable can be assigned a second name, or alias, in the CRBasic program. Aliasing is particularly useful when using arrays. Arrays are powerful tools for complex programming, but they place near identical names on multiple variables. Aliasing allows the power of the array to be used with the clarity of unique names.

The declared variable name can be used interchangeably with the declared alias in the body of the CRBasic program. However, when a value is stored to final-memory, the value will have the alias name attached to it. So, if the CRBasic

program needs to access that value, the program must use the the alias-derived name.

Variables in one, two, and three dimensional arrays can be assigned units. Units are not used elsewhere in programming, but add meaning to resultant data table headers. If different units are to be used with each element of an array, first assign aliases to the array elements and then assign units to each alias. For example:

```
Alias var_array(1) = solar_radiation
Alias var_array(2) = quanta
Units solar_radiation = Wm-2
Units variable2 = moles_m-2_s-1
```

#### 7.6.3.10 Numerical Formats

Four numerical formats are supported by CRBasic. Most common is the use of base-10 numbers. Scientific notation, binary, and hexadecimal formats can also be used, as shown in the table *Formats for Entering Numbers in CRBasic (p. 149)*. Only standard, base-10 notation is supported by Campbell Scientific hardware and software displays.

TABLE 15: Formats for Entering Numbers in CRBasic			
Format	Example Base 10 Equivalent Val		
Standard	6.832	6.832	
Scientific notation	5.67E-8	5.67 x 10 <sup>-8</sup>	
Binary	&B1101	13	
Hexadecimal	&HFF	255	

Binary format (1 = high, 0 = low) is useful when loading the status of multiple flags or ports into a single variable. For example, storing the binary number &B11100000 preserves the status of flags 8 through 1: flags 1 to 5 are low, 6 to 8 are high. CRBasic example *Load Binary Information into a Variable* (p. 149) shows an algorithm that loads binary status of flags into a LONG integer variable.

**EndProg** 

# CRBasic EXAMPLE 11: Load binary information into a variable 'This program example demonstrates how binary data are loaded into a variable. The binary 'format (1 = high, 0 = low) is useful when loading the status of multiple flags 'or ports into a single variable. For example, storing the binary number &B11100000 'preserves the status of flags 8 through 1: flags 1 to 5 are low, 6 to 8 are high. 'This example demonstrates an algorithm that loads binary status of flags into a LONG 'integer variable. Public FlagInt As Long Public Flag(8) As Boolean Public I DataTable(FlagOut,True,-1) Sample(1,FlagInt,UINT2) EndTable BeginProq Scan(1, Sec, 3, 0) FlagInt = 0For I = 1 To 8 If Flag(I) = true Then FlagInt = FlagInt + $2 \land (I - 1)$ EndIf Next I CallTable FlagOut NextScan

#### 7.6.3.11 Multi-Statement Declarations

Multi-statement declarations are used to declare data tables, subroutines, functions, and incidentals. Related instructions include the following:

- DataTable() / EndTable
- Sub() / EndSub
- Function() / EndFunction
- ShutDown / ShutdownEnd
- DialSequence() / EndDialSequence
- ModemHangup() / EndModemHangup
- WebPageBegin() / WebPageEnd

Multi-statement declarations can be located as follows:

- Prior to **BeginProg**,
- After EndSequence or an infinite Scan() / NextScan and before EndProg or SlowSequence
- Immediately following **SlowSequence**. **SlowSequence** code starts executing after any declaration sequence. Only declaration sequences can occur after **EndSequence** and before **SlowSequence** or **EndProg**.

## 7.6.3.11.1 Declaring Data Tables

Data are stored in tables as directed by the CRBasic program. A data table is created by a series of CRBasic instructions entered after variable declarations but before the **BeginProg** instruction. These instructions include:

```
DataTable()
  'Output Trigger Condition(s)
  'Output Processing Instructions
EndTable
```

A data table is essentially a file that resides in CR3000 memory. The file is written to each time data are directed to that file. The trigger that initiates data storage is tripped either by the CR3000 clock, or by an event, such as a high temperature. The maximum number of data tables is 253 (prior to OS 28, the limit was 30 data tables), but the maximum can vary with other programming considerations. If your need for data tables approaches the maximum, only testing will define your limit. Data tables may store individual measurements, individual calculated values, or summary data such as averages, maxima, or minima to data tables.

Each data table is associated with overhead information that becomes part of the ASCII file header (first few lines of the file) when data are downloaded to a PC. Overhead information includes the following:

- Table format
- Datalogger type and operating system version
- Name of the CRBasic program running in the datalogger
- Name of the data table (limited to 20 characters)
- Alphanumeric field names to attach at the head of data columns

This information is referred to as "table definitions."

TABLE 16: Typical Data Table							
TOA5	CR3000	CR3000	1048	CR3000.Std.13.06	CPU:Data.cr3	35723	OneMin
TIMESTAMP	RECORD	BattVolt_Avg	PTempC_Avg	TempC_Avg(1)	TempC_Avg(2)		
TS	RN	Volts	Deg C	Deg C	Deg C		
		Avg	Avg	Avg	Avg		
7/11/2007 16:10	0	13.18	23.5	23.54	25.12		
7/11/2007 16:20	1	13.18	23.5	23.54	25.51		
7/11/2007 16:30	2	13.19	23.51	23.05	25.73		
7/11/2007 16:40	3	13.19	23.54	23.61	25.95		
7/11/2007 16:50	4	13.19	23.55	23.09	26.05		
7/11/2007 17:00	5	13.19	23.55	23.05	26.05		
7/11/2007 17:10	6	13.18	23.55	23.06	25.04		

The table *Typical Data Table (p. 151)* shows a data file as it appears after the associated data table is downloaded from a CR3000 programmed with the code in CRBasic example *Declaration and Use of a Data Table (p. 153)*. The data file consists of five or more lines. Each line consists of one or more fields. The first four lines constitute the file header. Subsequent lines contain data.

**Note** Discrete data files (ASCII or binary) can also be written to a CR3000 memory drive using the **TableFile()** instruction.

The first header line is the environment line. It consists of eight fields, listed in table *TOA5 Environment Line* (p. 152).

TABLE 17: TOA5 Environment Line				
Field	Description	Changed By		
1	TOA5			
2	Station name	As named in datalogger support software (p. 432)		
3	Datalogger model			
4	Datalogger serial number			
5	Datalogger OS version New OS			
6	6 Datalogger program name New program			
7	Datalogger program signature	New or revised program		
8	Table name	Revised program		

The second header line reports field names. This line consists of a set of commadelimited strings that identify the name of individual fields as given in the datalogger program. If the field is an element of an array, the name will be followed by a comma-separated list of subscripts within parentheses that

identifies the array index. For example, a variable named Values, which is declared as a two-by-two array in the datalogger program, will be represented by four field names: Values(1,1), Values(1,2), Values(2,1), and Values(2,2). Scalar variables will not have array subscripts. There will be one value on this line for each scalar value defined by the table. Default field names are a combination of the variable names (or alias) from which data are derived and a three-letter suffix. The suffix is an abbreviation of the data process that outputs the data to storage. For example, Avg is the abbreviation for the data process called by the Average() instruction. If the default field names are not acceptable to the programmer, FieldNames() instruction can be used to customize the names. TIMESTAMP, RECORD, Batt\_Volt\_Avg, PTemp\_C\_Avg, TempC\_Avg(1), and TempC\_Avg(2) are the default field names in the table Typical Data Table (p. 151).

The third-header line identifies engineering units for that field of data. These units are declared at the beginning of a CRBasic program, as shown in CRBasic example *Declaration and Use of a Data Table (p. 153)*. Units are strictly for documentation. The CR3000 does not make use of declared units, nor does it check their accuracy.

The fourth line of the header reports abbreviations of the data process used to produce the field of data. See the table *Data Process Abbreviations* (p. 178).

Subsequent lines are observed data and associated record keeping. The first field being a time stamp, and the second being the record (data line) number.

As shown in CRBasic example *Declaration and Use of a Data Table (p. 153)*, data table declaration begins with the **DataTable()** instruction and ends with the **EndTable()** instruction. Between **DataTable()** and **EndTable()** are instructions that define what data to store and under what conditions data are stored. A data table must be called by the CRBasic program for data storage processing to occur. Typically, data tables are called by the **CallTable()** instruction once each **Scan**.

#### CRBasic EXAMPLE 12: Declaration and Use of a Data Table

```
'This program example demonstrates declaration and use of data tables.
'Declare Variables
Public Batt_Volt
Public PTemp_C
Public Temp_C(2)
'Define Units
Units Batt_Volt=Volts
Units PTemp_C=Deg_C
Units Temp_C()=Deg_C
'Define Data Tables
                                   'Required beginning of data table declaration
DataTable(OneMin,True,-1)
                                   'Optional instruction to trigger table at one-minute interval
  DataInterval(0,1,Min,10)
  Average(1,Batt_Volt,FP2,False)
                                   'Optional instruction to average variable Batt_Volt
  Average(1,PTemp_C,FP2,False)
                                   'Optional instruction to average variable PTemp_C
  Average(2,Temp_C(),FP2,False)
                                   'Optional instruction to average variable Temp_C
                                   'Required end of data table declaration
EndTable
```

```
DataTable(Table1,True,-1)
  DataInterval(0,1440,Min,0) 'Optional instruction to trigger table at 24-hour interval
 Minimum(1,Batt_Volt,FP2,False,False) 'Optional instruction to determine minimum Batt_Volt
EndTable
'Main Program
BeginProg
  Scan(5, Sec, 1, 0)
    'Default Datalogger Battery Voltage measurement Batt_Volt:
    Battery(Batt_Volt)
    'Wiring Panel Temperature measurement PTemp_C:
    PanelTemp(PTemp_C,_60Hz)
    'Type T (copper-constantan) Thermocouple measurements Temp_C:
    TCDiff(Temp_C(),2,mV20C,1,TypeT,PTemp_C,True,0,_60Hz,1,0)
    'Call Data Tables and Store Data
    CallTable(OneMin)
    CallTable(Table1)
  NextScan
EndProg
```

#### DataTable() / EndTable Instructions

The **DataTable()** instruction has three parameters: a user-specified alphanumeric name for the table such as *OneMin*, a trigger condition (for example, *True*), and the size to make the table in memory such as *-1* (automatic allocation).

 Name — The table name can be any combination of numbers, letters, and underscore up to 20 characters in length. The first character must be a letter or underscore.

**Note** While other characters may pass the precompiler and compiler, runtime errors may occur if these naming rules are not adhered to.

• TrigVar — Controls whether or not data records are written to storage. Data records are written to storage if TrigVar is true and if other conditions, such as DataInterval(), are met. Default setting is -1 (True). TrigVar may be a variable, expression, or constant. TrigVar does not control intermediate processing. Intermediate processing is controlled by the disable variable, DisableVar, which is a parameter in all output processing instructions. See Data Output: Processing Instructions (p. 157).

**Read More** Data Output: Triggers and Omitting Samples (p. 202) discusses the use of **TrigVar** and **DisableVar** in special applications.

• Size — Table size is the number of records to store in a table before new data begins overwriting old data. If 10 is entered, 10 records are stored in the table; the eleventh record will overwrite the first record. If -1 is entered, memory for the table is allocated automatically at the time the program compiles. Automatic allocation is preferred in most applications since the CR3000 sizes all tables such that they fill (and

begin overwriting the oldest data) at about the same time. Approximately 2 kB of extra data-table space are allocated to minimize the possibility of new data overwriting the oldest data in ring memory when *datalogger support software* (p. 91) collects the oldest data at the same time new data are written. These extra records are not reported in the **Status** table and are not reported to the support software and so are not collected.

Rules on table size change if a CardOut() instruction or TableFile() instruction with *Option 64* are included in the table declaration. These instructions support writing of data to a memory card. Writing data to a card requires additional memory be allocated as a data copy buffer. The CR3000 automatically determines the size the buffer needs to be. See *Memory Cards and Record Numbers (p. 453)*.

CRBasic example *Declaration and Use of a Data Table (p. 153)* creates a data table named **OneMin**, stores data once a minute as defined by **DataInterval()**, and retains the most recent records in SRAM. **DataRecordSize** entries in the **DataTableInformation** table report allocated memory in terms of number of records the tables hold.

# DataInterval() Instruction

**DataInterval()** instructs the CR3000 to both write data records at the specified interval and to recognize when a record has been skipped. The interval is independent of the **Scan()** / **NextScan** interval; however, it must be a multiple of the **Scan()** / **NextScan** interval.

Sometimes, usually because of a timing issue, program logic prevents a record from being written. If a record is not written, the CR3000 recognizes the omission as a "lapse" and increments the **SkippedRecord** counter in the **Status** table. Lapses waste significant memory in the data table and may cause the data table to fill sooner than expected. **DataInterval()** instruction parameter **Lapses** controls the CR3000 response to a lapse. See table **DataInterval()** Lapse Parameter **Options (p. 156)** for more information.

**Note** Program logic that results in lapses includes scan intervals inadequate to the length of the program (skipped scans), the use of **DataInterval()** in event-driven data tables, and logic that directs program execution around the **CallTable()** instruction.

A data table consists of successive 1 KB data frames. Each data frame contains a time stamp, frame number, and one or more records. By default, a time stamp and record number are not stored with each record. Rather, the datalogger support software data extraction extraction routine uses the frame time stamp and frame number to time stamp and number each record as it is stored to computer memory. This technique saves comms bandwidth and 16 bytes of CR3000 memory per record. However, when a record is skipped, or several records are skipped contiguously, a lapse occurs, the **SkippedRecords** status entry is incremented, and a 16-byte sub-header with time stamp and record number is inserted into the

data frame before the next record is written. Consequently, programs that lapse frequently waste significant memory.

If *Lapses* is set to an argument of 20, the memory allocated for the data table is increased by enough memory to accommodate 20 sub-headers (320 bytes). If more than 20 lapses occur, the actual number of records that are written to the data table before the oldest is overwritten (ring memory) may be less than what was specified in the **DataTable()**, or the CF **CardOut()** instruction, or a **TableFile()** instruction with *Option 64*.

If a program is planned to experience multiple lapses, and if comms bandwidth is not a consideration, the *Lapses* parameter should be set to  $\theta$  to ensure the CR3000 allocates adequate memory for each data table.

TABLE 18: DataInterval() Lapse Parameter Options		
DataInterval() Lapse Argument	Effect	
Lapse > 0	If table record number is fixed, X data frames (1 kB per data frame) are added to data table if memory is available. If record number is autoallocated, no memory is added to table.	
Lapse = 0	Time stamp and record number are always stored with each record.	
Lapse < 0	When lapse occurs, no new data frame is created. Record time stamps calculated at data extraction may be in error.	

#### Scan Time and System Time

In some applications, system time (see *System Time* (p. 558)), rather than scan time (see *Scan Time* (p. 554)), is desired. To get the system time, the **CallTable()** instruction must be run outside the **Scan()** loop. See *Time Stamps* (p. 335).

#### OpenInterval() Instruction

By default, the CR3000 uses closed intervals. Data output to a data table based on **DataInterval()** includes measurements from only the current interval. Intermediate memory that contains measurements is cleared the next time the data table is called regardless of whether or not a record was written to the data table.

Typically, time series data (averages, totals, maxima, etc.), that are output to a data table based on an interval, only include measurements from the current interval. After each data-output interval, the memory that contains the measurements for the time series data are cleared. If a data-output interval is missed (because all criteria are not met for output to occur), the memory is cleared the next time the data table is called. If the **OpenInterval** instruction is contained in the **DataTable()** declaration, the memory is not cleared. This results in all measurements being included in the time series data since the last time data were stored (even though the data may span multiple data-output intervals).

**Note** Array-based dataloggers, such as CR10X and CR23X, use open intervals exclusively.

#### **Data Output Processing Instructions**

Data-storage processing instructions (aka, "output processing" instructions) determine what data are stored in a data table. When a data table is called in the CRBasic program, data-storage processing instructions process variables holding current inputs or calculations. If trigger conditions are true, for example if the data-output interval has expired, processed values are stored into the data table. In CRBasic example *Declaration and Use of a Data Table (p. 153)*, three averages are stored.

Consider the **Average()** instruction as an example data-storage processing instruction. **Average()** stores the average of a variable over the data-output interval. Its parameters are:

- **Reps** number of sequential elements in the variable array for which averages are calculated. **Reps** is set to **1** to average **PTemp**, and set to **2** to average two thermocouple temperatures, both of which reside in the variable array **Temp\_C**.
- **Source** variable array to average. Variable arrays **PTemp\_C** (an array of 1) and **Temp\_C()** (an array of 2) are used.
- **Data Type** Data type for the stored average (the example uses data type **FP2** (p. 599)).

**Read More** See *Declaring Data Types (p. 137)* for more information on available data types.

• **DisableVar** — controls whether a measurement or value is included in an output processing function. A measurement or value is not included if **DisableVar** is **true** (≠ 0). For example, if the disable variable in an **Average()** instruction is **true**, the current value will not be included in the average. CRBasic example *Use of the Disable Variable (p. 157)* and CRBasic example *Using NAN to Filter Data (p. 509)* show how **DisableVar** can be used to exclude values from an averaging process. In these examples, **DisableVar** is controlled by **Flag1**. When **Flag1** is high, or **True**, **DisableVar** is **True**. When it is **False**, **DisableVar** is **False**. When **False** is entered as the argument for **DisableVar**, all readings are included in the average. The average of variable **Oscillator** does not include samples occurring when **Flag1** is high (**True**), which results in an average of 2; when **Flag1** is low or **False** (all samples used), the average is **1.5**.

**Read More** Data Output: Triggers and Omitting Samples (p. 202) and Measurements and NAN (p. 507) discuss the use of **TrigVar** and **DisableVar** in special applications.

## **CRBasic EXAMPLE 13:** Use of the Disable Variable 'This program example demonstrates the use of the 'disable' variable, or DisableVar, which 'is a parameter in many output processing instructions. Use of the 'disable' variable 'allows source data to be selectively included in averages, maxima, minima, etc. If the ''disable' variable equals -1, or true, data are not included; if equal to 0, or false, 'data are included. The 'disable' variable is set to false by default. 'Declare Variables and Units Public Oscillator As Long Public Flag(1) As Boolean Public DisableVar As Boolean 'Define Data Tables DataTable(OscAvgData,True,-1) DataInterval(0,1,Min,10) Average(1,0scillator,FP2,DisableVar) EndTable 'Main Program BeginProg Scan(1, Sec, 1, 0) 'Reset and Increment Counter If Oscillator = 2 Then Oscillator = 0 Oscillator = Oscillator + 1 'Process and Control If Oscillator = 1 If Flag(1) = True ThenDisableVar = True EndIf

#### **Numbers of Records**

'Call Data Tables and Store Data

DisableVar = False

CallTable(OscAvgData)

E1se

NextScan EndProg

The exact number of records that can be stored in a data table is governed by a complex set of rules, the summary of which can be found in *Memory Cards and Record Numbers (p. 453)*.

# 7.6.3.11.2 Declaring Subroutines

**Read More** See *Subroutines* (p. 332) for more information on programming with subroutines.

Subroutines allow a section of code to be called by multiple processes in the main body of a program. Subroutines are defined before the main program body of a program.

**Note** A particular subroutine can be called by multiple program sequences simultaneously. To preserve measurement and processing integrity, the CR3000 queues calls on the subroutine, allowing only one call to be processed at a time in the order calls are received. This may cause unexpected pauses in the conflicting program sequences.

## 7.6.3.11.3 Declaring Subroutines

**Function()** / **EndFunction** instructions allow you to create a customized CRBasic instruction. The declaration is similar to a subroutine declaration.

#### 7.6.3.11.4 Declaring Incidental Sequences

A sequence is two or more statements of code. Data-table sequences are essential features of nearly all programs. Although used less frequently, subroutine and function sequences also have a general purpose nature. In contrast, the following sequences are used only in specific applications.

Also see ApplyAndRestartSequence() instruction.

## Shut-Down Sequences

The **ShutDownBegin** / **ShutDownEnd** instructions are used to define code that will execute whenever the currently running program is shutdown by prescribed means. More information is available in *CRBasic Editor Help*.

#### **Dial Sequences**

The **DialSequence** / **EndDialSequence** instructions are used to define the code necessary to route packets to a PakBus<sup>®</sup> device. More information is available in *CRBasic Editor Help*.

#### Modem-Hangup Sequences

The **ModemHangup** / **EndModemHangup** instructions are used to enclose code that should be run when a COM port hangs up communication. More information is available in *CRBasic Editor Help*.

#### Web Page Sequences

The **WebPageBegin** / **WebPageEnd** instructions are used to declare a web page that is displayed when a request for the defined HTML page comes from an external source. More information is available in *CRBasic Editor Help*.

## 7.6.3.12 Execution and Task Priority

Execution of program instructions is divided among the following three tasks:

- Measurement task rigidly timed measurement of sensors connected directly to the CR3000
- CDM task rigidly timed measurement and control of CDM/CPI (p. 532) peripheral devices
- Digital task (a.k.a, SDM task) rigidly timed measurement and control of SDM (p. 554) peripheral devices, pulse measurements, and RS-232 measurements.
- Processing task converts measurements to numbers represented by engineering units, performs calculations, stores data, makes decisions to actuate controls, and performs serial I/O communication.

Instructions or commands that are handled by each task are listed in table *Program Tasks (p. 160)*.

These tasks are executed in either pipeline or sequential mode. When in pipeline mode, tasks run more or less in parallel. When in sequential mode, tasks run more or less in sequence. When a program is compiled, the CR3000 evaluates the program and automatically determines which mode to use. Using the **PipelineMode** or **SequentialMode** instruction at the beginning of the program will force the program into one mode or the other. Mode information is included in a message returned by the datalogger, which is displayed by the *datalogger support software* (p. 91). The *CRBasic Editor* pre-compiler returns a similar message.

**Note** A program can be forced to run in sequential or pipeline mode by placing the **SequentialMode** or **PipelineMode** instruction in the declarations section of the program.

Some tasks in a program may have higher priorities than others. Measurement tasks generally take precedence over all others. Task priorities are different for pipeline mode and sequential mode.

TABLE 19: Program Tasks				
Measurement Task	Digital Task	Processing Task		
<ul> <li>Analog measurements</li> <li>Excitation</li> <li>Read pulse counters (Pulse())</li> <li>Read control ports (GetPort())</li> <li>Set control ports (SetPort())</li> <li>VibratingWire( )</li> <li>PeriodAvg()</li> <li>CS616()</li> <li>Calibrate()</li> </ul>	<ul> <li>SDM instructions, except</li> <li>SDMSI04() and SDMI016()</li> <li>CDM instructions / CPI devices.</li> <li>Pulse counters</li> </ul>	<ul> <li>Processing</li> <li>Output</li> <li>Serial I/O</li> <li>SDMSIO4()</li> <li>SDMIO16()</li> <li>ReadIO()</li> <li>WriteIO()</li> <li>Expression evaluation and variable setting in measurement and SDM instructions</li> </ul>		

## 7.6.3.12.1 Pipeline Mode

Pipeline mode handles measurement, most digital, and processing tasks separately, and, in many cases, simultaneously. Measurements are scheduled to execute at exact times and with the highest priority, resulting in more precise timing of measurement, and usually more efficient processing and power consumption.

Pipeline scheduling requires that the program be written such that measurements are executed every scan. Because multiple tasks are taking place at the same time, the sequence in which the instructions are executed may not be in the order in which they appear in the program. Therefore, conditional measurements are not allowed in pipeline mode. Because of the precise execution of measurement instructions, processing in the current scan (including update of public variables and data storage) is delayed until all measurements are complete. Some processing, such as transferring variables to control instructions, like **PortSet()** and **ExciteV()**, may not be completed until the next scan.

When a condition is true for a task to start, it is put in a queue. Because all tasks are given the same priority, the task is put at the back of the queue. Every 10 ms (or faster if a new task is triggered) the task currently running is paused and put at the back of the queue, and the next task in the queue begins running. In this way, all tasks are given equal processing time by the CR3000.

All tasks are given the same general priority. However, when a conflict arises between tasks, program execution adheres to the following priority schedule:

- 1. Measurements in main program
- 2. Auto self-calibration

- 3. Measurements in slow sequences
- 4. Processing tasks

## 7.6.3.12.2 Sequential Mode

Sequential mode executes instructions in the sequence in which they are written in the program. Sequential mode may be slower than pipeline mode since it executes only one line of code at a time. After a measurement is made, the result is converted to a value determined by processing arguments that are included in the measurement command, and then program execution proceeds to the next instruction. This line-by-line execution allows writing conditional measurements into the program.

**Note** The exact time at which measurements are made in sequential mode may vary if other measurements or processing are made conditionally, if there is heavy communication activity, or if other interrupts, such as accessing a Campbell Scientific mass storage device or memory card, occur.

When running in sequential mode, the datalogger uses a queuing system for processing tasks similar to the one used in pipeline mode. The main difference when running a program in sequential mode is that there is no pre-scheduling of measurements; instead, all instructions are executed in the programmed order.

A priority scheme is used to avoid conflicting use of measurement hardware. The main scan has the highest priority and prevents other sequences from using measurement hardware until the main scan, including processing, is complete. Other tasks, such as processing from other sequences and communications, can occur while the main sequence is running. Once the main scan has finished, other sequences have access to measurement hardware with the order of priority being the auto self calibration sequence followed by the slow sequences in the order they are declared in the program.

**Note** Measurement tasks have priority over other tasks such as processing and communication to allow accurate timing needed within most measurement instructions.

Care must be taken when initializing variables when multiple sequences are used in a program. If any sequence relies on something (variable, port, etc.) that is initialized in another sequence, there must be a handshaking scheme placed in the CRBasic program to make sure that the initializing sequence has completed before the dependent task can proceed. This can be done with a simple variable or even a delay, but understand that the CR1000 operating system will not do this handshaking between independent tasks.

A similar concern is the reuse of the same variable in multiple tasks. Without some sort of messaging between the two tasks placed into the CRBasic program, unpredictable results are likely to occur. The **SemaphoreGet()** and **SemaphoreRelease()** instruction pair provide a tool to prevent unwanted access of an object (variable, COM port, etc.) by another task while the object is in use. Consult *CRBasic Editor Help* for information on using **SemaphoreGet()** and **SemaphoreRelease()**.

# 7.6.3.13 Execution Timing

Timing of program execution is regulated by timing instructions listed in the following table.

TABLE 20: Program Timing Instructions				
Instructions	General Guidelines	Syntax Form		
Scan() / NextScan	Use in most programs. Begins / ends the main scan.	BeginProg Scan() '. '. '. NextScan EndProg		
SlowSequence / EndSequence	Use when measurements or processing must run at slower frequencies than that of the main program.	BeginProg Scan() '. '. '. NextScan SlowSequence Scan() '. '. NextScan EndSequence		
SubScan / NextSubScan	Use when measurements or processing must run at faster frequencies than that of the main program.	BeginProg Scan() '. '. SubScan() '. '. NextSubScan NextScan EndProg		

# 7.6.3.13.1 Scan() / NextScan

Simple CR3000 programs are often built entirely within a single Scan() / NextScan structure, with only variable and data-table declarations outside the scan. Scan() / NextScan creates an infinite loop; each periodic pass through the loop is synchronized to the CR3000 clock. Scan() parameters allow modification of the period in 10 ms increments up to 24 hours. As shown in CRBasic example BeginProg / Scan() / NextScan / EndProg Syntax (p. 163), the CRBasic program may be relatively short.

#### CRBasic EXAMPLE 14: BeginProg / Scan() / NextScan / EndProg Syntax 'This program example demonstrates the use of BeginProg/EndProg and Scan()/NextScan syntax. Public PanelTemp\_ DataTable(PanelTempData,True,-1) DataInterval(0,1,Min,10) Sample(1, PanelTemp\_, FP2) EndTable BeginProg ' <<<<<BeginProg Scan(1,Sec,3,0) ' PanelTemp(PanelTemp\_,250) CallTable PanelTempData NextScan ' <<<<<< NextScan EndProg ' <<<<<EndProg

**Scan()** determines how frequently instructions in the program are executed, as shown in the following CRBasic code snip:

```
'Scan(Interval, Units, BufferSize, Count)
Scan(1,Sec,3,0)
'CRBasic instructions go here
ExitScan
```

Scan() has four parameters:

- Interval the interval between scans. Interval is 10 ms ≤ Interval ≤ 1 day.
- *Units* the time unit for the interval.
- **BufferSize** the size (number of scans) of a buffer in RAM that holds the raw results of measurements. When running in pipeline mode, using a buffer allows the processing in the scan to lag behind measurements at times without affecting measurement timing. Use of the *CRBasic Editor* default size is normal. Refer *SkippedScan (p. 512)* for troubleshooting tips.
- **Count** number of scans to make before proceeding to the instruction following **NextScan**. A count of **0** means to continue looping forever (or until **ExitScan**).

# 7.6.3.13.2 SlowSequence / EndSequence

Slow sequences include automatic and programmed sequences. Auto selfcalibration calibration is an automatic slow sequence.

User-entered slow sequences are declared with the **SlowSequence** instruction and run outside the main-program scan. Slow sequences typically run at a slower rate than the main scan. Up to four slow-sequence scans can be defined in a program.

Instructions in a slow-sequence scan are executed when the main scan is not active. When running in pipeline mode, slow-sequence measurements are spliced in after measurements in the main program, as time allows. Because of this

splicing, measurements in a slow sequence may span across multiple-scan intervals in the main program. When no measurements need to be spliced, the slow-sequence scan will run independent of the main scan, so slow sequences with no measurements can run at intervals ≤ main-scan interval (still in 10 ms increments) without skipping scans. When measurements are spliced, checking for skipped slow scans is done after the first splice is complete rather than immediately after the interval comes true.

In sequential mode, all instructions in slow sequences are executed as they occur in the program according to task priority.

Auto self-calibration is an automatic, slow-sequence scan, as is the watchdog task.

Read More See Auto Self-Calibration — Overview (p. 93).

# 7.6.3.13.3 SubScan() / NextSubScan

SubScan() / NextSubScan are used in the control of analog multiplexers (*Analog Multiplexers* — *List (p. 604)*) or to measure analog inputs at a faster rate than the program scan. SubScan() / NextSubScan can be used in a SlowSequenc / EndSequence with an interval of 0. SubScan cannot be nested. PulseCount or SDM measurement cannot be used within a sub scan.

#### 7.6.3.13.4 Scan Priorities in Sequential Mode

**Note** Measurement tasks have priority over other tasks such as processing and communication to allow accurate timing needed within most measurement instructions.

A priority scheme is used in sequential mode to avoid conflicting use of measurement hardware. As illustrated in figure *Sequential-Mode Scan Priority Flow Diagrams (p. 167)*, the main scan sequence has the highest priority. Other sequences, such as slow sequences and auto self-calibration scans, must wait to access measurement hardware until the main scan, including measurements and processing, is complete.

#### Main Scans

Execution of the main scan usually occurs quickly, so the processor may be idle much of the time. For example, a weather-measurement program may scan once per second, but program execution may only occupy 250 ms, leaving 75% of available scan time unused. The CR3000 can make efficient use of this interstitial-scan time to optimize program execution and communication control. Unless disabled, or crowded out by a too demanding schedule, self-calibration (see *Auto Self-Calibration — Overview (p. 93)*) has priority and uses some interstitial scan time. If self-calibration is crowded out, a warning message is issued by the CRBasic pre-compiler. Remaining priorities include slow-sequence scans in the order they are programmed and digital triggers. Following is a brief introduction to the rules and priorities that govern use of interstitial-scan time in sequential mode. Rules and priorities governing pipeline mode are somewhat more complex and are not expanded upon.

Permission to proceed with a measurement is granted by the measurement *semaphore* (p. 554). Main scans with measurements have priority to acquire the semaphore before measurements in a calibration or slow-sequence scan. The semaphore is taken by the main scan at its beginning if there are measurements included in the scan. The semaphore is released only after the last instruction in the main scan is executed.

#### Slow-Sequence Scans

Slow-sequence scans begin after a **SlowSequence** instruction. They start processing tasks prior to a measurement but stop to wait when a measurement semaphore is needed. Slow sequences release the *semaphore* (p. 554) after complete execution of each measurement instruction to allow the main scan to acquire the semaphore when it needs to start. If the measurement semaphore is set by a slow-sequence scan and the beginning of a main scan gets to the top of the queue, the main scan will not start until it can acquire the semaphore; it waits for the slow sequence to release the semaphore. A slow-sequence scan does not hold the semaphore for the whole of its scan. It releases the semaphore after each use of the hardware.

## WaitDigTrig Scans

#### Read More See Synchronizing Measurements — Details (p. 422).

Main scans and slow sequences usually trigger at intervals defined by the Scan() instruction. Some applications, however, require the main- or slow-sequence scan to be started by an external digital trigger such as a 5 Vdc pulse on a control port. The WaitDigTrig() instruction activates a program when an external trigger is detected. WaitDigTrig() gives priority to begin a scan, but the scan will execute and acquire the semaphore (p. 554) according to the rules stated in Main Scans (p. 165) and Slow-Sequence Scans (p. 166). Any processing will be time sliced with processing from other sequences. Every time the program encounters WaitDigTrig(), it will stop and wait to be triggered.

**Note WaitDigTrig()** can be used to program a CR3000 to control another CR3000.

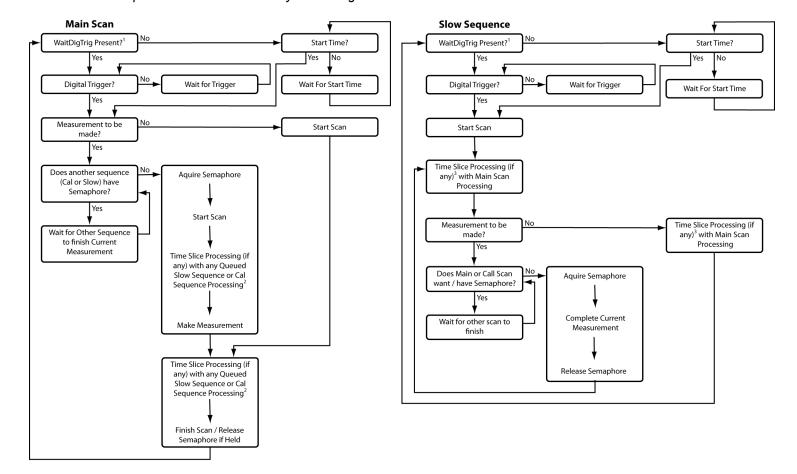


FIGURE 40: Sequential-Mode Scan Priority Flow Diagrams

- 1- Program with WaitDigTrig() immediately after Scan()
- 2- Processing (if any) time sliced with slow sequence processing only if no measurements in main scan
- 3- Processing time sliced with main scan processing if no measurements in main scan, otherwise time sliced with whole main scans

# 7.6.3.14 Programming Instructions

In addition to BASIC syntax, additional instructions are included in CRBasic to facilitate measurements and store data. See *CRBasic Editor Help (p. 132)* for a comprehensive list of these instructions.

# 7.6.3.14.1 Measurement and Data Storage Processing

CRBasic instructions have been created for making measurements and storing data. Measurement instructions set up CR3000 hardware to make measurements and store results in variables. Data storage instructions process measurements into averages, maxima, minima, standard deviation, FFT, etc.

Each instruction is a keyword followed by a series of informational parameters needed to complete the procedure. For example, the instruction for measuring CR3000 panel temperature is:

PanelTemp(Dest,Integ)

PanelTemp is the keyword. Two parameters follow: *Dest*, a destination variable name in which the temperature value is stored; and *Integ*, of a length of time to integrate the measurement. To place the panel temperature measurement in the variable *RefTemp*, using a 250 µs integration time, the syntax is as shown in CRBasic example *Measurement Instruction Syntax (p. 168)*.

#### **CRBasic EXAMPLE 15:** Measurement Instruction Syntax

```
'This program example demonstrates the use of a single measurement instruction. In this 'case, the program measures the temperature of the CR3000 wiring panel.

Public RefTemp 'Declare variable to receive instruction

BeginProg
Scan(1,Sec,3,0)
PanelTemp(RefTemp, 250) '<<<<<Instruction to make measurement
NextScan
EndProg
```

## 7.6.3.14.2 Argument Types

Most CRBasic commands (*instructions*) have sub-commands (*parameters*). Parameters are populated by the programmer with arguments. Many instructions have parameters that allow different types of arguments. Common argument types are listed below. Allowed argument types are specifically identified in the description of each instruction in *CRBasic Editor Help*.

- Constant, or expression that evaluates as a constant
- Variable
- Variable or array
- Constant, variable, or expression
- Constant, variable, array, or expression
- Name
- Name or list of names
- Variable, or expression
- Variable, array, or expression

# 7.6.3.14.3 Names in Arguments

Table *Rules for Names (p. 169)* lists the maximum length and allowed characters for the names for variables, arrays, constants, etc. The *CRBasic Editor* pre-compiler will identify names that are too long or improperly formatted.

**Caution** Concerning characters allowed in names, characters not listed in in the table, *Rules for Names*, may appear to be supported in a specific operating system. However, they may not be supported in future operating systems.

TABLE 21: Rules for Names			
Name Category <sup>1</sup>	Maximum Length (number of characters)	Allowed characters	
Variable or array	39		
Constant	38		
Units	38	Letters A to Z, a to z, _ (underscore), and numbers 0 to 9. Names must start with a letter or underscore. CRBasic	
Alias	39	is not case sensitive. Units are excepted from the above	
Station name	64	rules. Since units are strings that ride along with the data, they are not subjected to the stringent syntax checking that is applied to variables,	
Data-table name	20	constants, subroutines, tables, and other names.	
Field name	39		
Field-name description	64		

<sup>1</sup> Variables, constants, units, aliases, station names, field names, data table names, and file names can share identical names; that is, once a name is used, it is reserved only in that category. See *Predefined Constants* (p. 148) for another naming limitation.

## 7.6.3.15 Expressions in Arguments

Read More See Programming Expression Types (p. 170).

Many CRBasic instruction parameters allow the entry of arguments as expressions. If an expression is a comparison, it will return -1 if true and 0 if false. See *Logical Expressions (p. 173)*. The following code snip shows the use of an expressions as an argument in the *TrigVar* parameter of the **DataTable()** instruction:

```
'DataTable(Name, TrigVar, Size)
DataTable(Temp, TC > 100, 5000)
```

When the trigger is TC > 100, a thermocouple temperature greater than 100 sets the trigger to True and data are stored.

#### 7.6.3.16 Programming Expression Types

An expression is a series of words, operators, or numbers that produce a value or result. Expressions are evaluated from left to right, with deference to precedence rules. The result of each stage of the evaluation is of type Long (integer, 32 bits) if the variables are of type Long (constants are integers) and the functions give integer results, such as occurs with INTDV(). If part of the equation has a floating point variable or constant (24 bits), or a function that results in a floating point, the rest of the expression is evaluated using floating-point, 24-bit math, even if the final function is to convert the result to an integer, so precision can be lost; for example, INT((rtYear-1993)\*.25). This is a critical feature to consider when, 1) trying to use integer math to retain numerical resolution beyond the limit of floating point variables, or 2) if the result is to be tested for equivalence against another value. See *Floating-Point Arithmetic (p. 170)* for limits.

Two types of expressions, mathematical and programming, are used in CRBasic. A useful property of expressions in CRBasic is that they are equivalent to and often interchangeable with their results.

Consider the expressions:

```
x = (z * 1.8) + 32 '(mathematical expression)
If x = 23 then y = 5 '(programming expression)
```

The variable x can be omitted and the expressions combined and written as:

```
If (z * 1.8 + 32 = 23) then y = 5
```

Replacing the result with the expression should be done judiciously and with the realization that doing so may make program code more difficult to decipher.

## 7.6.3.16.1 Floating-Point Arithmetic

Related Topics:

- Floating-Point Arithmetic (p. 170)
- Floating-Point Math, NAN, and ±INF (p. 507)
- TABLE: Data Types in Variable Memory (p. 137)

All arithmetic in the CR3000, and all declared variables, are single precision IEEE four-byte floating point.

A few operations are performed as double precision. These are AddPrecise(), Average(), AvgRun(), AvgSpa(), CovSpa(), MovePrecise(), RMSSpa(), StdDev(), StdDevSpa(), Totalize(), and TotRun().

Floating-point arithmetic is common in many electronic, computational systems, but it has pitfalls high-level programmers should be aware of. Several sources

discuss floating-point arithmetic thoroughly. One readily available source is the topic *Floating Point* at www.wikipedia.org. In summary, CR3000 programmers should consider at least the following:

- Floating-point numbers do not perfectly mimic real numbers.
- Floating-point arithmetic does not perfectly mimic true arithmetic.
- Avoid use of equality in conditional statements. Use >= and <= instead. For example, use If X >= Y then do rather than If X = Y then do.
- When programming extended-cyclical summation of non-integers, use the **AddPrecise()** instruction. Otherwise, as the size of the sum increases, fractional addends will have an ever decreasing effect on the magnitude of the sum, because normal floating-point numbers are limited to about 7 digits of resolution.

## 7.6.3.16.2 Arithmetic Operations

Arithmetic operations are written out in CRBasic syntax much as they are in common algebraic notation. For example, to convert Celsius temperature to Fahrenheit, the syntax is:

```
TempF = TempC * 1.8 + 32
```

**Read More** Code space can be conserved while filling an array or partial array with the same value. See an example of how this is done in the CRBasic example *Use of Move() to Conserve Code Space (p. 171)*. CRBasic example *Use of Variable Arrays to Conserve Code Space (p. 171)* shows example code to convert twenty temperatures in a variable array from °C to °F.

## 7.6.3.16.3 Expressions with Numeric Data Types

**FLOATs**, **LONGs** and **Booleans** are cross-converted to other data types, such as **FP2**, by using '='.

#### Boolean from FLOAT or LONG

When a **FLOAT** or **LONG** is converted to a **Boolean** as shown in CRBasic example *Conversion of FLOAT / LONG to Boolean (p. 172)*, zero becomes false (0) and non-zero becomes true (-1).

```
CRBasic EXAMPLE 18: Conversion of FLOAT / LONG to Boolean
'This program example demonstrates conversion of Float and Long data types to Boolean
'data type.
Public Fa As Float
Public Fb As Float
Public L As Long
Public Ba As Boolean
Public Bb As Boolean
Public Bc As Boolean
BeginProg
 Fa = 0
  Fb = 0.125
 L = 126
  Ba = Fa
                           'This will set Ba = False (0)
                           'This will Set Bb = True (-1)
  Bb = Fb
  Bc = L
                           'This will Set Bc = True (-1)
EndProg
```

#### FLOAT from LONG or Boolean

When a **LONG** or **Boolean** is converted to **FLOAT**, the integer value is loaded into the **FLOAT**. Booleans are converted to **-1** or **0**. **LONG** integers greater than 24 bits (16,777,215; the size of the mantissa for a **FLOAT**) will lose resolution when converted to **FLOAT**.

#### LONG from FLOAT or Boolean

When converted to **Long**, **Boolean** is converted to **-1** or **0**. When a **FLOAT** is converted to a **LONG**, it is truncated. This conversion is the same as the **INT** function (Arithmetic Functions). The conversion is to an integer equal to or less than the value of the float; for example, **4.6** becomes **4** and **-4.6** becomes **-5**).

If a **FLOAT** is greater than the largest allowable **LONG** (+2,147,483,647), the integer is set to the maximum. If a **FLOAT** is less than the smallest allowable **LONG** (-2,147,483,648), the integer is set to the minimum.

#### Integers in Expressions

**LONG**s are evaluated in expressions as integers when possible. CRBasic example *Evaluation of Integers (p. 172)* illustrates evaluation of integers as **LONG**s and **FLOAT**s.

# CRBasic EXAMPLE 19: Evaluation of Integers 'This program example demonstrates the evaluation of integers. Public I As Long Public X As Float BeginProg I = 126 X = (I+3) \* 3.4 'I+3 is evaluated as an integer, then converted to Float data type before it is

#### Constants Conversion

'multiplied by 3.4.

EndProg

Constants are not declared with a data type, so the CR3000 assigns the data type as needed. If a constant (either entered as a number or declared with **CONST**) can be expressed correctly as an integer, the compiler will use the type that is most efficient in each expression. The integer version is used if possible, for example, if the expression has not yet encountered a **FLOAT**. CRBasic example *Constants to LONGs or FLOATs* (p. 173) lists a programming case wherein a value normally considered an integer (10) is assigned by the CR3000 to be **As FLOAT**.

```
CRBasic EXAMPLE 20: Constants to LONGs or FLOATs

'This program example demonstrates conversion of constants to Long or Float data types.

Public L As Long
Public F1 As Float
Public F2 As Float
Const ID = 10

BeginProg
F1 = F2 + ID
L = ID * 5
EndProg
```

In the just previous CRBasic example, L is an integer. F1 and F2 are FLOATS. The numeral 5 is loaded As FLOAT to add efficiently with constant ID, which was compiled As FLOAT for the previous expression to avoid an inefficient runtime conversion from LONG to FLOAT before each floating point addition.

# 7.6.3.16.4 Logical Expressions

Measurements can indicate absence or presence of an event. For example, an RH measurement of 100% indicates a condensation event such as fog, rain, or dew. The CR3000 can render the state of the event into binary form for further processing, so the event is either occurring (true), or the event has not occurred (false).

## True = -1, False = 0

In all cases, the argument **0** is translated as **FALSE** in logical expressions; by extension, any non-zero number is considered "non-FALSE." However, the

argument **TRUE** is predefined in the CR3000 operating system to only equal **-1**, so only the argument **-1** is *always* translated as **TRUE**. Consider the expression

```
If Condition(1) = TRUE Then...
```

This condition is true only when Condition(1) = -1. If Condition(1) is any other non-zero, the condition will not be found true because the constant **TRUE** is predefined as -1 in the CR3000 system memory. By entering = **TRUE**, a literal comparison is done. So, to be absolutely certain a function is true, it must be set to **TRUE** or -1.

**Note TRUE** is **-1** so that every bit is set high (-1 is &B11111111 for all four bytes). This allows the **AND** operation to work correctly. The **AND** operation does an AND boolean function on every bit, so **TRUE AND X** will be non-zero if at least one of the bits in X is non-zero (if X is not zero). When a variable of data type BOOLEAN is assigned any non-zero number, the CR3000 internally converts it to **-1**.

The CR3000 is able to translate the conditions listed in table *Binary Conditions of TRUE and FALSE (p. 174)* to binary form (-1 or 0), using the listed instructions and saving the binary form in the memory location indicated. Table *Logical Expression Examples (p. 175)* explains some logical expressions.

#### Non-Zero = True (Sometimes)

Any argument other than  $\theta$  or -1 will be translated as TRUE in some cases and FALSE in other cases. While using only -1 as the numerical representation of TRUE is safe, it may not always be the best programming technique. Consider the expression

```
If Condition(1) then...
```

Measurement Event

Since = **True** is omitted from the expression, **Condition(1)** is considered true if it equals any non-zero value.

**TABLE 22:** Binary Conditions of TRUE and FALSE

Condition	CRBasic Instruction(s) Used	Memory Location of Binary Result	
Time	TimeIntoInterval()	Variable, System	
	IfTime()	Variable, System	
	TimeIsBetween()	Variable, System	
Control Port Trigger	WaitDigTrig()	System	
Communications	VoiceBeg()	System	

ComPortIsActive()

PPPClose()

DataEvent()

Variable

Variable

System

Using TRUE or FALSE conditions with logic operators such as AND and OR, logical expressions can be encoded to perform one of the following three general logic functions. Doing so facilitates conditional processing and control applications:

- 1. Evaluate an expression, take one path or action if the expression is true (=-1), and / or another path or action if the expression is false (=0).
- 2. Evaluate multiple expressions linked with **AND** or **OR**.
- 3. Evaluate multiple **AND** or **OR** links.

The following commands and logical operators are used to construct logical expressions. *TABLE: Logical Expression Examples (p. 175)* demonstrate some logical expressions.

- IF
- AND
- OR
- NOT
- XOR
- IMP
- IIF

#### **TABLE 23:** Logical Expression Examples

If X >= 5 then Y = 0

Sets the variable Y to 0 if the expression " $X \ge 5$ " is true, i.e. if X is greater than or equal to 5. The CR3000 evaluates the expression ( $X \ge 5$ ) and registers in system memory a -1 if the expression is true, or a 0 if the expression is false.

If X >= 5 OR Z = 2 then Y = 0

Sets Y = 0 if either  $X \ge 5$  or Z = 2 is true.

If X >= 5 AND Z = 2 then Y = 0

Sets Y = 0 only if both  $X \ge 5$  and Z = 2 are true.

If 6 then Y = 0.

If 6 is true since 6 (a non-zero number) is returned, so Y is set to 0 every time the statement is executed.

If 0 then Y = 0.

If 0 is false since 0 is returned, so Y will never be set to 0 by this statement.

Z = (X > Y).

Z equals -1 if X > Y, or Z will equal 0 if  $X \le Y$ .

#### **TABLE 23:** Logical Expression Examples

The **NOT** operator complements every bit in the word. A Boolean can be FALSE (0 or all bits set to 0) or TRUE (-1 or all bits set to 1). *Complementing* a Boolean turns TRUE to FALSE (all bits complemented to 0).

#### **Example Program**

```
(a AND b) = (26 AND 26) = (&b11010 AND &b11010) =
'&b11010. NOT (&b11010) yields &b00101.
'This is non-zero, so when converted to a
'BOOLEAN, it becomes TRUE.
Public a As LONG
Public b As LONG
Public is_true As Boolean
Public not_is_true As Boolean
Public not_a_and_b As Boolean
BeginProg
  a = 26
  b = a
  Scan (1, Sec, 0, 0)
    is_true = a AND b
                                  'This evaluates to TRUE.
    not_is_true = NOT (is_true) 'This evaluates to FALSE.
    not_a_and_b = NOT (a AND b) 'This evaluates to TRUE!
  NextScan
EndProg
```

## 7.6.3.16.5 String Expressions

CRBasic facilitates concatenation of string variables to variables of all data types using & and + operators. To ensure consistent results, use & when concatenating strings. Use + when concatenating strings to other variable types. CRBasic example String and Variable Concatenation (p. 176) demonstrates CRBasic code for concatenating strings and integers. See section String Operations (p. 327) in the Programming Resource Library (p. 181) for more information on string programming.

#### CRBasic EXAMPLE 21: String and Variable Concatenation

```
'This program example demonstrates the concatenation of variables declared As String to 'other strings and to variables declared as other data types.

'Declare Variables
Dim PhraseNum(2) As Long
Dim Word(15) As String * 10
Public Phrase(2) As String * 80

'Declare Data Table
DataTable(HAL,1,-1)
DataInterval(0,15,Sec,10)

'Write phrases to data table "Test"
Sample(2,Phrase,String)
EndTable
```

```
'Program
BeginProg
  Scan(1, Sec, 0, 0)
    'Assign strings to String variables
   Word(1) = "Good"
   Word(2) = "morning"
   Word(3) = "Dave"
   Word(4) = "I'm"
   Word(5) = "sorry"
   Word(6) = "afraid"
   Word(7) = "I"
   Word(8) = "can't"
   Word(9) = "do"
   Word(10) = "that"
   Word(11) = " "
   Word(12) = "."
   Word(13) = ":"
   Word(14) = "."
   Word(15) = Chr(34)
    'Assign integers to Long variables
    PhraseNum(1) = 1
    PhraseNum(2) = 2
    'Concatenate string "1. Good morning, Dave"
    Phrase(1) = PhraseNum(1)\&Word(14)\&Word(11)\&Word(15)\&Word(1)\&Word(11)\&Word(2)\&\_
                Word(12)&Word(11)&Word(3)&Word(14)&Word(15)
    'Concatenate string "2. I'm afraid I can't do that, Dave."
    Phrase(2) = PhraseNum(2)&Word(14)&Word(11)&Word(15)&Word(4)&Word(11)&Word(6)&Word(11)&_
                Word(7)&Word(11)&Word(8)&Word(11)&Word(11)&Word(10)&Word(12)& _
                Word(11)&Word(3)&Word(14)&Word(15)
    CallTable HAL
  NextScan
EndProg
```

## 7.6.3.17 Programming Access to Data Tables

A data table is a memory location where data records are stored. Sometimes, the stored data needs to be used in the CRBasic program. For example, a program can be written to retrieve the average temperature of the last five days for further processing. CRBasic has syntax provisions facilitating access to these table data, or to meta data relating to the data table. Except when using the **GetRecord()** instruction, the syntax is entered directly into the CRBasic program through a variable name. The general form is:

TableName.FieldName\_Prc(Fieldname Index, Records Back)

#### Where:

- **TableName** is the name of the data table.
- FieldName is the name of the variable from which the processed value is derived.

- **Prc** is the abbreviation of the name of the data process used. See table *Data Process Abbreviations* (p. 178) for a complete list of these abbreviations. This is not needed for values from **Status** or **Public** tables.
- **Fieldname Index** is the array element number in fields that are arrays (optional).
- **Records Back** is how far back into the table to go to get the value (optional). If left blank, the most recent record is acquired.

TABLE 24: Data Process Abbreviations		
Abbreviation Process Name		
Tot	Totalize	
Avg	Average	
Max	Maximum	
Min	Minimum	
SMM	Sample at Max or Min	
Std	Standard Deviation	
MMT	Moment	
No abbreviation	Sample	
Hst	Histogram <sup>1</sup>	
H4D	Histogram4D	
FFT	FFT	
Cov	Covariance	
RFH	Rainflow Histogram	
LCr	Level Crossing	
WVc	WindVector	
Med	Median	
ETsz	ET	
RSo	Solar Radiation (from ET)	
TMx	Time of Max	
TMn	Time of Min	

<sup>1</sup>**Hst** is reported in the form Hst,20,1.0000e+00,0.0000e+00,1.0000e+01 where Hst denotes a histogram, 20 = 20 bins, 1 = weighting factor, 0 = lower bound, 10 = upper bound.

For example, to access the number of watchdog errors, use the statement

wderr = status.watchdogerrors

where **wderr** is a declared variable, **status** is the table name, and **watchdogerrors** is the keyword for the watchdog error field.

Seven special variable names are used to access information about a table.

- EventCount
- EventEnd
- Output
- Record
- TableFull
- TableSize
- TimeStamp

Consult CRBasic Editor Help index topic DataTable access for complete information.

The **DataTableInformation** table also include this information. See *Info Tables* and Settings (p. 567).

# 7.6.3.18 Programming to Use Signatures

Signatures help assure system integrity and security. The following resources provide information on using signatures.

- Signature() instruction in Diagnostics
- RunSignature (p. 589)
- ProgSignature (p. 588)
- OSSignature (p. 586)
- Security Overview (p. 88)

Many signatures are recorded in the **Status** table, which is a type of data table. Signatures recorded in the **Status** table can be copied to a variable using the programming technique described in the *Programming Access to Data Tables (p. 177)*. Once in variable form, signatures can be sampled as part of another data table for archiving.

# 7.6.3.19 Functions (with a capital F)

A Function is a subroutine that returns only one value of any *data type (p. 137)*. Use a Function to create a custom CRBasic "Instruction." It is declared with **Function()**. An example is a Function that returns a string containing the day of

the week, such as **Monday** or **Friday**. See *CRBasic Editor Help* topic **Function/EndFunction** 

# 7.6.4 Sending CRBasic Programs

The CR3000 requires that a CRBasic program file be sent to its memory to direct measurement, processing, and data storage operations. The program file can have the extension cr3 or .dld and can be compressed using the GZip algorithm before sending it to the CR3000. Upon receipt of the file, the CR3000 automatically decompresses the file and uses it just as any other program file. See *Program and OS Compression Q and A (p. 433)* for more information.

Options for sending a program include the following:

- Program Send (p. 550) command in datalogger-support software (p. 91)
- Program send command in Device Configuration Utility (DevConfig (p. 113))
- Campbell Scientific mass storage device (p. 613) or memory card

A good practice is to always retrieve data from the CR3000 before sending a program; otherwise, data may be lost.

**Note** See *File Management* (p. 456) and the Campbell Scientific mass storage device or memory card documentation available at *www.campbellsci.com*.

# 7.6.4.1 Preserving Data at Program Send

You can send CRBasic programs to the CR3000 in multiple ways. Depending on the way you choose, the CR3000 keeps or deletes data already stored in memory. Regardless of the program-upload tool used, if any change occurs to the following data table structures, data are erased when a new program is sent:

- Data table name(s)
- Data-output interval or offset
- Number of fields per record
- Number of bytes per field
- Field type, size, name, or position
- Number of records in table

The program sending command path options listed in table *Program Send Options That Reset Memory (p. 181)* reset CR3000 memory and erase data. To keep data, send programs using the **File Control Send** (p. 539) command in *datalogger support software* (p. 535), or the **Compile > Compile, Save, Send** command in *CRBasic* 


Editor. Compile > Compile, Save, Send displays the window shown in figure CRBasic Editor Program Send File Control Window (p. 181) before the program is sent. To keep data, select Run Now, Run On Power-up, and Preserve data if no table changed, then press Send Program.

**Note** To retain data, **Preserve data if no table changed** must be selected whether or not a Campbell Scientific mass storage device or memory card is connected.

TABLE 25: Program Send Options That Reset Memory <sup>1</sup>		
Datalogger Support Software	First Click	Next Click
LoggerNet >	Connect >	Program Send
PC400 >	Clock/Program >	Send Program
PC200W>	Clock/Program >	Send Program
RTDAQ >	Clock/Program >	Send Program
DevConfig >	Logger Control >	Send Program

<sup>&</sup>lt;sup>1</sup>Reset memory and set CRBasic program attributes to **Run Always** 

FIGURE 41: CRBasic Editor Program Send File Control window

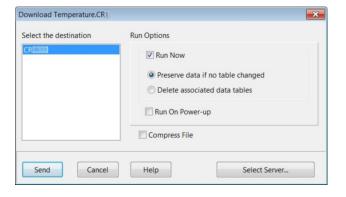

# 7.7 Programming Resource Library

This library of notes and CRBasic code addresses a narrow selection of CR3000 applications.

# 7.7.1 Advanced Programming Techniques

### 7.7.1.1 Capturing Events

CRBasic example *Capturing Events (p. 181)* demonstrates programming to output data to a data table at the occurrence of an event.

```
CRBasic EXAMPLE 22: BeginProg / Scan / NextScan / EndProg Syntax
'This program example demonstrates detection and recording of an event. An event has a
'beginning and an end. This program records an event as occurring at the end of the event.
'The event recorded is the transition of a delta temperature above 3 degrees. The event is
'recorded when the delta temperature drops back below 3 degrees.
'The DataEvent instruction forces a record in data table Event each time an
'event ends. Number of events is written to the reserved variable
'EventCount(1,1). In this program, EventCount(1,1) is recorded in the
'OneMinute Table.
'Note : the DataEvent instruction must be used within a data table with a
'more frequent record interval than the expected frequency of the event.
'Declare Variables
Public PTemp_C, AirTemp_C, DeltaT_C
Public EventCounter
'Declare Event Driven Data Table
DataTable(Event, True, 1000)
 DataEvent(0,DeltaT_C>=3,DeltaT_C<3,0)</pre>
  Sample(1,PTemp_C, FP2)
  Sample(1,AirTemp_C, FP2)
  Sample(1,DeltaT_C, FP2)
EndTable
'Declare Time Driven Data Table
DataTable(OneMin,True,-1)
 DataInterval(0,1,Min,10)
  Sample(1,EventCounter, FP2)
EndTable
BeginProg
 Scan(1, Sec, 1, 0)
    'Wiring Panel Temperature
    PanelTemp(PTemp_C,_60Hz)
    'Type T Thermocouple measurements:
   TCDiff(AirTemp_C,1,mV20C,1,TypeT,PTemp_C,True,0,_60Hz,1,0)
    'Calculate the difference between air and panel temps
   DeltaT_C = AirTemp_C - PTemp_C
    'Update Event Counter (uses special syntax Event.EventCount(1,1))
    EventCounter = Event.EventCount(1,1)
    'Call data table(s)
   CallTable(Event)
   CallTable(OneMin)
  NextScan
EndProg
```

### 7.7.1.2 Conditional Output

CRBasic example *Conditional Output (p. 183)* demonstrates conditionally sending data to a data table based on a trigger other than time.

```
CRBasic EXAMPLE 23: Conditional Output
'This program example demonstrates the conditional writing of data to a data table.
'also demonstrates use of StationName() and Units instructions.
'Declare Station Name (saved to Status table)
StationName(Delta_Temp_Station)
'Declare Variables
Public PTemp_C, AirTemp_C, DeltaT_C
'Declare Units
Units PTemp_C = deg C
Units AirTemp_C = deg C
Units DeltaT_C = deg C
'Declare Output Table -- Output Conditional on Delta T >= 3
'Table stores data at the Scan rate (once per second) when condition is met
'because DataInterval instruction is not included in the table declaration
'after the DataTable declaration.
DataTable(DeltaT,DeltaT_C >= 3,-1)
  Sample(1,Status.StationName,String)
  Sample(1,DeltaT_C,FP2)
  Sample(1, PTemp_C, FP2)
  Sample(1,AirTemp_C,FP2)
EndTable
BeginProg
  Scan(1, Sec, 1, 0)
    'Measure wiring panel temperature
    PanelTemp(PTemp_C,_60Hz)
    'Measure type T thermocouple
    TCDiff(AirTemp_C,1,mV20C,1,TypeT,PTemp_C,True,0,_60Hz,1,0)
    'Calculate the difference between air and panel temps
   DeltaT_C = AirTemp_C - PTemp_C
    'Call data table(s)
    CallTable(DeltaT)
  NextScan
EndProg
```

### 7.7.1.3 Groundwater Pump Test

CRBasic example *Groundwater Pump Test (p. 183)* shows how to do the following:

- Write multiple-interval data to the same data table
- Use program control instructions outside the Scan() / NextScan structure
- Execute conditional code
- Use multiple sequential scans, each with a scan count

#### **CRBasic EXAMPLE 24:** Groundwater Pump Test

```
'This program example demonstrates the use of multiple scans in a program by running a
'groundwater pump test. Note that Scan() time units of Sec have been changed to mSec for
'this demonstration to allow the program to run its course in a short time. To use this
'program for an actual pump test, change the Scan() instruction mSec arguments to Sec. You
'will also need to put a level measurement in the MeasureLevel subroutine.
'A groundwater pump test requires that water level be measured and recorded
'according to the following schedule:
'Minutes into Test Data-Output Interval
'_____
                        _____
    0-10
                            10 seconds
    10-30
                            30 seconds
                       60 seconds
120 seconds
300 seconds
600 seconds
  30-100
' 100-300
' 300-1000
     1000+
'Declare Variables
Public PTemp
Public Batt_Volt
Public Level
Public LevelMeasureCount As Long
Public ScanCounter(6) As Long
'Declare Data Table
DataTable(LogTable,1,-1)
 Minimum(1,Batt_Volt,FP2,0,False)
  Sample(1, PTemp, FP2)
  Sample(1,Level,FP2)
EndTable
'Declare Level Measurement Subroutine
Sub MeasureLevel
 LevelMeasureCount = LevelMeasureCount + 1 'Included to show passes through sub-routine
  'Level measurement instructions goes here
EndSub
'Main Program
BeginProg
  'Minute 0 to 10 of test: 10-second data-output interval
  Scan(10, mSec, 0, 60) 'There are 60 10-second scans in 10 minutes
   ScanCounter(1) = ScanCounter(1) + 1 'Included to show passes through this scan
   Battery(Batt_volt)
   PanelTemp(PTemp, 250)
   Call MeasureLevel
    'Call Output Tables
   CallTable LogTable
  NextScan
```

```
'Minute 10 to 30 of test: 30-second data-output interval
 Scan(30,mSec.0,40) 'There are 40 30-second scans in 20 minutes
    ScanCounter(2) = ScanCounter(2) + 1 'Included to show passes through this scan
   Battery(Batt_volt)
   PanelTemp(PTemp, 250)
   Call MeasureLevel
    'Call Output Tables
   CallTable LogTable
 NextScan
  'Minute 30 to 100 of test: 60-second data-output interval
 Scan(60, mSec, 0, 70) 'There are 70 60-second scans in 70 minutes
    ScanCounter(3) = ScanCounter(3) + 1 'Included to show passes through this scan
   Battery(Batt_volt)
   PanelTemp(PTemp, 250)
   Call MeasureLevel
    'Call Output Tables
   CallTable LogTable
 NextScan
  'Minute 100 to 300 of test: 120-second data-output interval
 Scan(120, mSec, 0, 200) 'There are 200 120-second scans in 10 minutes
   ScanCounter(4) = ScanCounter(4) + 1 'Included to show passes through this scan
   Battery(Batt_volt)
   PanelTemp(PTemp, 250)
   Call MeasureLevel
    'Call Output Tables
   CallTable LogTable
 NextScan
  'Minute 300 to 1000 of test: 300-second data-output interval
 Scan(300, mSec, 0, 140) 'There are 140 300-second scans in 700 minutes
    ScanCounter(5) = ScanCounter(5) + 1 'Included to show passes through this scan
   Battery(Batt_volt)
   PanelTemp(PTemp, 250)
   Call MeasureLevel
    'Call Output Tables
   CallTable LogTable
 NextScan
  'Minute 1000+ of test: 600-second data-output interval
 Scan(600, mSec, 0, 0) 'At minute 1000, continue 600-second scans indefinitely
   ScanCounter(6) = ScanCounter(6) + 1 'Included to show passes through this scan
   Battery(Batt_volt)
   PanelTemp(PTemp, 250)
   Call MeasureLevel
    'Call Output Tables
   CallTable LogTable
 NextScan
EndProg
```

#### 7.7.1.4 Miscellaneous Features

CRBasic example *Miscellaneous Program Features (p. 186)* shows how to use several CRBasic features: data type, units, names, event counters, flags, data-output intervals, and control statements.

```
CRBasic EXAMPLE 25: Miscellaneous Program Features
'This program example demonstrates the use of a single measurement instruction. In this
'case, the program measures the temperature of the CR3000 wiring panel.
Public RefTemp 'Declare variable to receive instruction
BeginProg
 Scan(1, Sec, 3, 0)
    PanelTemp(RefTemp, 250) 'Instruction to make measurement
EndProg
'A program can be (and should be!) extensively documented. Any text preceded by an
'apostrophe is ignored by the CRBasic compiler.
'One thermocouple is measured twice using the wiring panel temperature as the reference
'temperature. The first measurement is reported in Degrees C, the second in Degrees F.
'The first measurement is then converted from Degree C to Degrees F on the subsequent
'line, the result being placed in another variable. The difference between the panel
'reference temperature and the first measurement is calculated, the difference is then
'used to control the status of a program control flag. Program control then
'transitions into device control as the status of the flag is used to determine the
'state of a control port that controls an LED (light emitting diode).
'Battery voltage is measured and stored just because good programming practice dictates
'it be so.
'Two data storage tables are created. Table "OneMin" is an interval driven table that
'stores data every minute as determined by the CR1000 clock. Table "Event" is an event
'driven table that only stores data when certain conditions are met.
'Declare Public (viewable) Variables
Public Batt_Volt As FLOAT
                                                 'Declared as Float
Public PTemp_C
                                                  'Float by default
Public AirTemp_C
                                                  'Float by default
Public AirTemp_F
                                                 'Float by default
Public AirTemp2 F
                                                 'Float by default
Public DeltaT_C
                                                 'Float by default
Public HowMany
                                                 'Float by default
Public Counter As Long
                                                'Declared as Long so counter does not have
                                                   'rounding error
                                                 'Declared as String with 16 chars for a
Public SiteName As String * 16
                                                   'site name (optional)
'Declare program control flags & terms. Set the words "High" and "Low" to equal "TRUE"
'and "FALSE" respectively
Public Flag(1) As Boolean
Const High = True
Const Low = False
```

```
'Optional - Declare a Station Name into a location in the Status table.
StationName(CR1000_on_desk)
'Optional -- Declare units. Units are not used in programming, but only appear in the
'data file header.
Units Batt_Volt = Volts
Units PTemp = deg C
Units AirTemp = deg C
Units AirTempF2 = deg F
Units DeltaT_C = deg C
'Declare an interval driven output table
DataTable(OneMin,True,-1)
                                                  'Time driven data storage
  DataInterval(0,1,Min,0)
                                                  'Controls the interval
 Average(1,AirTemp_C,IEEE4,0)
                                                  'Stores temperature average in high
                                                   'resolution format
 Maximum(1,AirTemp_C,IEEE4,0,False)
                                                 'Stores temperature maximum in high
                                                   'resolution format
                                                 'Stores temperature minimum in low
  Minimum(1,AirTemp_C,FP2,0,False)
                                                   'resolution format
                                                 'Stores battery voltage minimum in low
  Minimum(1,Batt_Volt,FP2,0,False)
                                                   'resolution format
                                                 'Stores counter in integer format
  Sample(1,Counter,Long)
  Sample(1,SiteName,String)
                                                  'Stores site name as a string
                                                  'Stores how many data events in low
  Sample(1, HowMany, FP2)
                                                   'resolution format
EndTable
'Declare an event driven data output table
DataTable(Event,True,1000)
                                                  'Data table - event driven
  DataInterval(0,5,Sec,10)
                                                  '-AND interval driven
  DataEvent(0,DeltaT_C >= 3,DeltaT_C < 3,0)</pre>
                                                 '-AND event range driven
  Maximum(1,AirTemp_C,FP2,0,False)
                                                 'Stores temperature maximum in low
                                                   'resolution format
 Minimum(1,AirTemp_C,FP2,0,False)
                                                 'Stores temperature minimum in low
                                                   'resolution format
                                                 'Stores temp difference sample in low
  Sample(1,DeltaT_C, FP2)
                                                   'resolution format
  Sample(1, HowMany, FP2)
                                                 'Stores how many data events in low
                                                    'resolution format
EndTable
BeginProg
  'A second way of naming a station is to load the name into a string variable. The is
  'place here so it is executed only once, which saves a small amount of program
  'execution time.
  SiteName = "CR1000SiteName"
```

```
Scan(1, Sec, 1, 0)
    'Measurements
    'Battery Voltage
   Battery(Batt_Volt)
    'Wiring Panel Temperature
   PanelTemp(PTemp_C,250)
    'Type T Thermocouple measurements:
   TCDiff(AirTemp_C,1,mV20C,1,TypeT,PTemp_C,True,0,_60Hz,1,0)
   TCDiff(AirTemp_F,1,mV20C,1,TypeT,PTemp_C,True,0,_60Hz,1.8,32)
    'Convert from degree C to degree F
   AirTemp2_F = AirTemp_C * 1.8 + 32
    'Count the number of times through the program. This demonstrates the use of a
    'Long integer variable in counters.
   Counter = Counter + 1
    'Calculate the difference between air and panel temps
   DeltaT_C = AirTemp_C - PTemp_C
    'Control the flag based on the difference in temperature. If DeltaT >= 3 then
    'set Flag 1 high, otherwise set it low
   If DeltaT_C >= 3 Then
     Flag(1) = high
     Flag(1) = low
   EndIf
    'Turn LED connected to Port 1 on when Flag 1 is high
   If Flag(1) = high Then
     PortSet(1,1)
                                                 'alternate syntax: PortSet(1,high)
     PortSet(1,0)
                                                 'alternate syntax: PortSet(1, low)
    EndIf
    'Count how many times the DataEvent "DeltaT_C>=3" has occurred. The
    'TableName.EventCount syntax is used to return the number of data storage events
    'that have occurred for an event driven table. This example looks in the data
    'table "Event", which is declared above, and reports the event count. The (1,1)
    'after EventCount just needs to be included.
   HowMany = Event.EventCount(1,1)
    'Call Data Tables
   CallTable(OneMin)
   CallTable(Event)
 NextScan
EndProg
```

#### 7.7.1.5 PulseCountReset Instruction

**PulseCountReset** is used in rare instances to force the reset or zeroing of CR3000 pulse accumulators. See *Measurements — Overview* (p. 67).

PulseCount() instructions in separate scans measure the same pulse input terminal. While the compiler does not allow multiple PulseCount() instructions in the same scan to measure the same terminal, multiple scans using the same terminal are allowed. PulseCount() information is not maintained globally, but for each individual instruction occurrence. So, if a program needs to alternate between fast and slow scan times, two separate scans can be used with logic to jump between them. If a PulseCount() is used in both scans, then a PulseCountReset is used prior to entering each scan.

### 7.7.1.6 Scaling Array

CRBasic example *Scaling Array* (p. 189) how to create and use a scaling array. Several multipliers and offsets are entered at the beginning of the program and then used by several measurement instructions throughout the program.

#### CRBasic EXAMPLE 26: Scaling Array

```
'This program example demonstrates the use of a scaling array. An array of three
'temperatures are measured. The first is expressed as degrees Celsius, the second as
'Kelvin, and the third as degrees Fahrenheit.
'Declare viewable variables
Public PTemp_C
Public Temp_C(3)
Public Count
'Declare scaling arrays as non-viewable variables
Dim Mult(3)
Dim Offset(3)
'Declare Output Table
DataTable(Min_5,True,-1)
 DataInterval(0,5,Min,0)
 Average(1,PTemp_C,FP2,0)
 Maximum(1,PTemp_C,FP2,0,0)
 Minimum(1,PTemp_C,FP2,0,0)
 Average(3,Temp_C(),FP2,0)
 Minimum(3,Temp_C(1),FP2,0,0)
 Maximum(3,Temp_C(1),FP2,0,0)
EndTable
'Begin Program
BeginProg
  'Load scaling array
 Mult(1) = 1.0 : Offset(1) = 0
                                     'Scales 1st thermocouple temperature to Celsius
 Mult(2) = 1.0 : Offset(2) = 273.15 'Scales 2nd thermocouple temperature to Kelvin
 Mult(3) = 1.8 : Offset(3) = 32
                                     'Scales 3rd thermocouple temperature to Fahrenheit
```

```
Scan(5,Sec,1,0)

'Measure reference temperature
PanelTemp(PTemp_C,250)

'Measure three thermocouples and scale each. Scaling factors from the scaling array
'are applied to each measurement because the syntax uses an argument of 3 in the Reps
'parameter of the TCDiff() instruction and scaling variable arrays as arguments in the
'Multiplier and Offset parameters.

TCDiff(Temp_C(), 3, mV20C,1,TypeT,PTemp_C,True,0,250,Mult(),Offset())

CallTable(Min_5)

NextScan
EndProg
```

### 7.7.1.7 Signatures: Example Programs

A program signature is a unique integer calculated from all characters in a given set of code. When a character changes, the signature changes. Adding signatures to stored data allows system administrators to track program changes and data quality. The following program signatures are available.

- text signature
- binary-runtime signature
- executable-code signatures

### 7.7.1.7.1 Text Signature

The text signature is the most-widely used. It is calculated from all text in a program including blank lines and comments. It is found in **ProgSignature** field of the **Status** table. See CRBasic example *Program Signatures* (p. 190).

### 7.7.1.7.2 Binary Runtime Signature

The binary runtime signature is calculated only from program code — not from comments or blank lines. See CRBasic example *Program Signatures* (p. 190).

### 7.7.1.7.3 Executable Code Signatures

Executable code signatures allow signatures to be calculated on discrete sections of code that resides between the **BeginProg** and **EndProg** instructions. See CRBasic example *Program Signatures* (p. 190).

```
CRBasic EXAMPLE 27: Program Signatures
'This program example demonstrates how to request the program text signature (ProgSig =
Status.ProgSignature), and the
'binary run-time signature (RunSig = Status.RunSignature). It also calculates two
'executable code segment signatures (ExeSig(1), ExeSig(2))
'Define Public Variables
Public RunSig, ProgSig, ExeSig(2),x,y
'Define Data Table
DataTable(Signatures,1,1000)
  DataInterval(0,1,Day,10)
  Sample(1,ProgSig,FP2)
  Sample(1,RunSig,FP2)
  Sample(2,ExeSig(),FP2)
EndTable
'Program
BeginProg
 ExeSig() = Signature
                                                  'initialize executable code signature
                                                  'function
 Scan(1, Sec, 0, 0)
   ProgSig = Status.ProgSignature
                                                  'Set variable to Status table entry
                                                  '"ProgSignature"
                                                  'Set variable to Status table entry
   RunSig = Status.RunSignature
                                                  '"RunSignature"
   x = 24
   ExeSig(1) = Signature
                                                  'signature includes code since initial
                                                  'Signature instruction
   ExeSig(2) = Signature
                                                  'Signature includes all code since
                                                  'ExeSig(1) = Signature
  CallTable Signatures
NextScan
```

### 7.7.1.8 Use of Multiple Scans

CRBasic example *Use of Multiple Scans (p. 191)* shows how to use of multiple scans. Some applications require measurements or processing to occur at an interval different from that of the main program scan. Secondary, or slow sequence, scans are prefaced with the **SlowSequence** instruction.

```
CRBasic EXAMPLE 28: Use of Multiple Scans
'This program example demonstrates the use of multiple scans. Some applications require
'measurements or processing to occur at an interval different from that of the main
'program scan. Secondary scans are preceded with the SlowSequence instruction.
'Declare Public Variables
Public PTemp
Public Counter1
    'Declare Data Table 1
                                             'DataTable1 is event driven.
   DataTable(DataTable1,1,-1)
                                              'The event is the scan.
      Sample(1,PTemp,FP2)
      Sample(1, Counter1, fp2)
   EndTable
'Main Program
BeginProq
                                              'Begin executable section of program
  Scan(1, Sec, 0, 0)
                                              'Begin main scan
    PanelTemp(PTemp, 250)
   Counter1 = Counter1 + 1
   CallTable DataTable1
                                              'Call DataTable1
  NextScan
                                              'End main scan
  S1owSequence
                                              'Begin slow sequence
    'Declare Public Variables for Secondary Scan (can be declared at head of program)
    Public Batt_Volt
   Public Counter2
    'Declare Data Table
                                              'DataTable2 is event driven.
   DataTable(DataTable2,1,-1)
                                              'The event is the scan.
      Sample(1,Batt_Volt,FP2)
      Sample(1,Counter2,FP2)
   EndTable
  Scan(5, Sec, 0, 0)
                                              'Begin 1st secondary scan
   Counter2 = Counter2 + 1
   Battery(Batt_Volt)
   CallTable DataTable2
                                              'Call DataTable2
                                              'End slow sequence scan
 NextScan
EndProg
                                              'End executable section of program
```

# 7.7.2 Data Input: Loading Large Data Sets

Large data sets like look-up tables or tag numbers, can be loaded in the CR3000 for use by the CRBasic program. Do this by using the **Data**, **DataLong**, and **Read** instructions, as demonstrated in CRBasic example *Loading Large Data Sets* (p. 192).

### CRBasic EXAMPLE 29: Loading Large Data Sets 'This program example demonstrates how to load a set of data into variables. Twenty values 'are loaded into two arrays: one declared As Float, one declared As Long. Individual Data 'lines can be many more values long than shown (limited only by maximum statement length), 'and many more lines can be written. Thousands of values can be loaded in this way. 'Declare Float and Long variables. Can also be declared as Dim. Public DataSetFloat(10) As Float Public DataSetLong(10) As Long Dim x 'Write data set to CR3000 memory Data 1.1,2.2,3.3,4.4,5.5 Data -1.1,-2.2,-3.3,-4.4,-5.5 DataLong 1,2,3,4,5 DataLong -1,-2,-3,-4,-5 'Declare data table DataTable (DataSet\_,True,-1) Sample (10,DataSetFloat(),Float) Sample (10,DataSetLong(),Long) EndTable BeginProg 'Assign Float data to variable array declared As Float For x = 1 To 10 Read DataSetFloat(x) Next x 'Assign Long data to variable array declared As Long For x = 1 To 10 Read DataSetLong(x) Next x Scan(1, sec, 0, 1)'Write all data to final-data memory CallTable DataSet\_

# 7.7.3 Data Input: Array-Assigned Expression

NextScan

**EndProg** 

CRBasic provides for the following operations on one dimension of a multidimensional array:

- Initialize
- Transpose
- Copy

- Mathematical
- Logical

#### Examples include:

- Process a variable array without use of For/Next
- Create boolean arrays based on comparisons with another array or a scalar variable
- Copy a dimension to a new location
- Perform logical operations for each element in a dimension using scalar or similarly located elements in different arrays and dimensions

**Note** Array-assigned expression notation is an alternative to **For/Next** instructions that can be used by advanced programmers. It will probably not reduce processing time significantly over the use of **For/Next**. To reduce processing time, consider using the **Move()** instruction, which requires even more intensive programming.

### Syntax rules:

- Definitions:
  - Least-significant dimension the last or right-most figure in an array index. For example, in the array array(a,b), b is the least-significant dimension index. In the array array(a,b,c), c is least significant.
  - Negate place a negative or minus sign (-) before the array index.
     For example, when negating the least-significant dimension in array(a,b,c), the notion is array(a,b,-c)
- An empty set of parentheses designates an array-assigned expression. For example, reference *array()* or *array(a,b,c)()*.
- Only one dimension of the array is operated on at a time.
- To select the dimension to be operated on, negate the dimension of index of interest.
- Operations will not cross dimensions. An operation begins at the specified starting point and continues to one of the following:
  - o End of the dimension
  - Where the dimension is specified by a negative
  - Where the dimension is the least significant (default)

- If indices are not specified, or none have been preceded with a minus sign, the least significant dimension of the array is assumed.
- The offset into the dimension being accessed is given by (a,b,c).
- If the array is referenced as *array()*, the starting point is *array(1,1,1)* and the least significant dimension is accessed. For example, if the array is declared as *test(a,b,c)*, and subsequently referenced as *test()*, then the starting point is *test(1,1,1)* and dimension **c** is accessed.

### CRBasic EXAMPLE 30: Array Assigned Expression: Sum Columns and Rows 'This example sums three rows and two columns of a 3x2 array. 'Source array image: '1.23,2.34 '3.45,4.56 '5.67,6.78 Public Array(3,2) = {1.23,2.34,3.45,4.56,5.67,6.78} 'load values into source array Public RowSum(3) Public ColumnSum(2) BeginProg Scan(1, Sec, 0, 0) 'For each row, add up the two columns RowSum() = Array(-1,1)() + Array(-1,2)()'For each column, add up the three rows ColumnSum() = Array(1,-1)() + Array(2,-1)() + Array(3,-1)()NextScan

EndProg

```
CRBasic EXAMPLE 31: Array Assigned Expression: Transpose an Array

'This example transposes a 3x2 array to a 2x3 array
'Source array image:
'1,2
'3,4
'5,6

'Destination array image (transpose of source):
'1,3,5
'2,4,6

'Dimension and initialize source array
Public A(3,2) = {1,2,3,4,5,6}

'Dimension destination array
Public At(2,3)

'Delcare For/Next counter
Dim i
```

```
BeginProg
Scan (1,Sec,0,0)
For i = 1 To 2
    'For each column of the source array A(), copy the column into a row of the
    'destination array At()
    At(i,-1)() = A(-1,i)()
    Next i
    NextScan
EndProg
```

### **CRBasic EXAMPLE 32:** Array Assigned Expression: Comparison / Boolean Evaluation 'Example: Comparison / Boolean Evaluation 'Element-wise comparisons is performed through scalar expansion or by comparing each 'element in one array to a similarly located element in another array to generate a 'resultant boolean array to be used for decision making and control, such as 'an array input to a SDM-CD16AC. Public TempC(3) = $\{15.1234, 20.5678, 25.9876\}$ Public TempC\_Rounded(3) Public TempDiff(3) Public TempC\_Alarm(3) As Boolean Public TempF\_Thresh $(3) = \{55,60,80\}$ Public TempF\_Alarm(3) As Boolean BeginProg Scan(1, Sec, 0, 0) 'element-wise comparison of each temperature in the array to a scalar value 'set corresponding alarm boolean value true if temperature exceeds 20 degC $TempC\_Alarm() = TempC() > 20$ 'some, not all or most, instructions will accept this array notation to auto-index 'through the array 'round each temperature to the nearest tenth of a degree $TempC_Rounded() = Round(TempC(), 1)$ 'element-wise subtraction 'each element in TempC\_Rounded is subtracted from the similarly located element inTempC 'calculate the difference between each TempC value and the rounded counterpart TempDiff() = TempC() - TempC\_Rounded() 'element-wise operations can be mixed with scalar expansion operations 'set corresponding alarm boolean value true if temperature, after being 'converted to degF, exceeds it's corresponding alarm threshold value in degF $TempF\_Alarm() = (TempC() * 1.8 + 32) > TempF\_Thresh()$

NextScan EndProg

### CRBasic EXAMPLE 33: Array Assigned Expression: Fill Array Dimension 'Example: Fill Array Dimension Public A(3) Public B(3,2) Public C(4,3,2) Public Da(3,2) = $\{1,1,1,1,1,1\}$ Public Db(3,2) Public DMultiplier(3) = {10,100,1000} Public DOffset(3) = $\{1,2,3\}$ BeginProg Scan(1, Sec, 0, 0) A() = 1 'set all elements of 1D array or first dimension to 1 B(1,1)() = 100 'set B(1,1) and B(1,2) to 100 B(-2,1)() = 200 'set B(2,1) and B(3,1) to 200 B(-2,2)() = 300 'set B(2,2) and B(3,2) to 300 C(1,-1,1)() = A() 'copy A(1), A(2), and A(3) into C(1,1,1), C(1,2,1), and C(1,3,1), 'respectively C(2,-1,1)() = A() \* 1.8 + 32 'scale and then copy A(1), A(2), and A(3) into C(2,1,1), C(2,2,1), and C(2,3,1), respectively 'scale the first column of Da by corresponding multiplier and offset 'copy the result into the first column of Db 'then set second column of Db to NAN Db(-1,1)() = Da(-1,1)() \* DMultiplier() + DOffset()Db(-1,2)() = NAN

# 7.7.4 Data Output: Calculating Running Average

NextScan EndProg

The **AvgRun()** instruction calculates a running average of a measurement or calculated value. A running average (*Dest*) is the average of the last N values where N is the number of values, as expressed in the running-average equation:

$$\mathbf{Dest} = \frac{\sum_{i=1}^{i-N} X_i}{N}$$

where  $X_N$  is the most recent value of the source variable and  $X_{N-1}$  is the previous value ( $X_1$  is the oldest value included in the average, i.e., N-1 values back from the most recent). NANs are ignored in the processing of **AvgRun()** unless all values in the population are NAN.

**AvgRun()** uses high-precision math, so a 32-bit extension of the mantissa is saved and used internally resulting in 56 bits of precision.

**Note** This instruction should not normally be inserted within a **For/Next** construct with the **Source** and **Destination** parameters indexed and **Reps** set to **1**. Doing so will perform a single running average, using the values of the different elements of the array, instead of performing an independent running average on each element of the array. The results will be a running average of a spatial average of the various source array elements.

A running average is a digital low-pass filter; its output is attenuated as a function of frequency, and its output is delayed in time. Degree of attenuation and phase shift (time delay) depend on the frequency of the input signal and the time length (which is related to the number of points) of the running average.

The figure *Running-Average Frequency Response* (p. 200) is a graph of signal attenuation plotted against signal frequency normalized to 1/(running average) duration). The signal is attenuated by a synchronizing filter with an order of 1 (simple averaging):  $\sin(\pi X) / (\pi X)$ , where X is the ratio of the input signal frequency to the running-average frequency (running-average frequency = 1 / time length of the running average).

### Example:

```
Scan period = 1 \text{ ms},
```

N value = 4 (number of points to average),

Running-average duration = 4 ms

Running-average frequency = 1 / (running-average duration = 250 Hz)

Input-signal frequency = 100 Hz

Input frequency to running average (normalized frequency) = 100 / 250 = 0.4

 $Sin(0.4\pi) / (0.4\pi) = 0.757$  (or read from figure *Running-Average Frequency Response* (p. 200), where the X axis is 0.4)

For a 100 Hz input signal with an amplitude of 10 V peak-to-peak, a running average outputs a 100 Hz signal with an amplitude of 7.57 V peak-to-peak.

There is also a phase shift, or delay, in the **AvgRun()** output. The formula for calculating the delay, in number of samples, is:

Delay in samples = (N-1)/2

#### **Note** N = number of points in running average

To calculate the delay in time, multiply the result from the above equation by the period at which the running average is executed (usually the scan period):

Delay in time =  $(\text{scan period}) \cdot (N-1) / 2$ 

For the example above, the delay is:

Delay in time = 
$$(1 \text{ ms}) \cdot (4-1) / 2 = 1.5 \text{ ms}$$

#### Example:

An accelerometer was tested while mounted on a beam. The test had the following characteristics:

- o Accelerometer resonant frequency  $\approx 36 \text{ Hz}$
- $\circ$  Measurement period = 2 ms
- Running average duration = 20 ms (frequency of 50 Hz)

Normalized resonant frequency was calculated as follows:

```
36 Hz / 50 Hz = 0.72

SIN(0.72\pi) / (0.72\pi) = 0.34.
```

So, the recorded amplitude was about 1/3 of the input-signal amplitude. A CRBasic program was written with variables **Accel2** and **Accel2RA**. The raw measurement was stored in **Accel2**. **Accel2RA** held the result of performing a running average on the **Accel2**. Both values were stored at a rate of 500 Hz. Figure *Running-Average Signal Attenuation* (p. 200) shows the two variables plotted to illustrate the attenuation. The running-average value has the lower amplitude.

The resultant delay, Dr, is calculated as follows:

$$D_r = (scan rate) \cdot (N-1)/2 = 2 ms (10-1)/2$$
  
= 9 ms

D<sub>r</sub> is about 1/3 of the input-signal period.


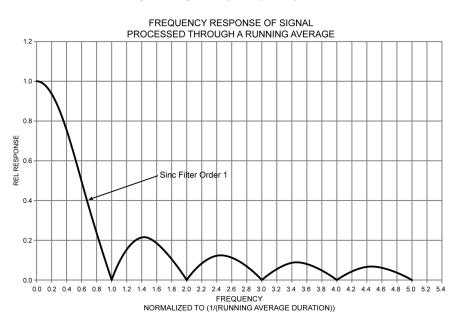


FIGURE 42: Running-Average Frequency Response

FIGURE 43: Running-Average Signal Attenuation

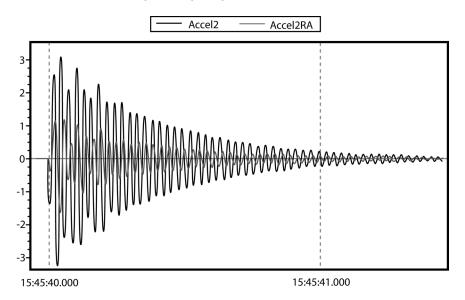

# 7.7.5 Data Output: Two Intervals in One Data Table

### CRBasic EXAMPLE 34: Two Data-Output Intervals in One Data Table

```
'This program example demonstrates the use of two time intervals in a data table. One time
'interval in a data table is the norm, but some applications require two.
'Allocate memory to a data table with two time intervals as is done with a conditional table,
'that is, rather than auto-allocate, set a fixed number of records.
'Declare Public Variables
Public PTemp, batt_volt, airtempC, deltaT
Public int_fast As Boolean
Public int_slow As Boolean
Public counter(4) As Long
'Declare Data Table
'Table is output on one of two intervals, depending on condition.
'Note the parenthesis around the TriggerVariable AND statements.
DataTable(TwoInt,(int_fast AND TimeIntoInterval(0,5,Sec)) OR (int_slow AND _
          TimeIntoInterval(0,15,sec)),15000)
  Minimum(1,batt_volt,FP2,0,False)
  Sample(1, PTemp, FP2)
  Maximum(1,counter(1),Long,False,False)
  Minimum(1,counter(1),Long,False,False)
  Maximum(1,deltaT,FP2,False,False)
 Minimum(1,deltaT,FP2,False,False)
  Average(1,deltaT,IEEE4,false)
EndTable
'Main Program
BeginProg
  Scan(1, Sec, 0, 0)
    PanelTemp(PTemp, 250)
    Battery(Batt_volt)
    counter(1) = counter(1) + 1
    'Measure thermocouple
   TCDiff(AirTempC,1,mV20C,1,TypeT,PTemp,True,0,250,1.0,0)
    'calculate the difference in air temperature and panel temperature
    deltaT = airtempC - PTemp
    'When the difference in air temperatures is >=3 turn LED on and trigger the faster of
    'the two data-table intervals.
    If deltaT >= 3 Then
      PortSet(4, true)
      int_fast = true
      int slow = false
      PortSet(4, false)
      int_fast = false
      int_slow = true
    EndIf
```

'Call output tables
CallTable TwoInt

NextScan EndProg

# 7.7.6 Data Output: Triggers and Omitting Samples

*TrigVar* is the third parameter in the **DataTable()** instruction. It controls whether or not a data record is written to final memory. *TrigVar* control is subject to other conditional instructions such as the **DataInterval()** and **DataEvent()** instructions.

**DisableVar** is the last parameter in most output processing instructions, such as **Average()**, **Maximum()**, **Minimum()**, etc. It controls whether or not a particular measurement or value is included in the affected output-processing function.

For individual measurements to affect summary data, output processing instructions such as **Average()** must be executed whenever the data table is called from the program — normally once each scan. For example, for an average to be calculated for the hour, each measurement must be added to a total over the hour. This accumulation of data is not affected by **TrigVar**. **TrigVar** controls only the moment when the final calculation is performed and the processed data (the average) are written to the data table. For this summary moment to occur, **TrigVar** and all other conditions (such as **DataInterval()** and **DataEvent()**) must be true. Expressed another way, when **TrigVar** is false, output processing instructions (for example, **Average()**) perform intermediate processing but not the final process, and a new record will not be created.

**Note** In many applications, output records are solely interval based and *TrigVar* is always set to **TRUE** (-1). In such applications, **DataInterval()** is the sole specifier of the output trigger condition.

Figure Data from TrigVar Program (p. 203) shows data produced by CRBasic example Using TrigVar to Trigger Data Storage (p. 203), which uses **TrigVar** rather than **DataInterval()** to trigger data storage.

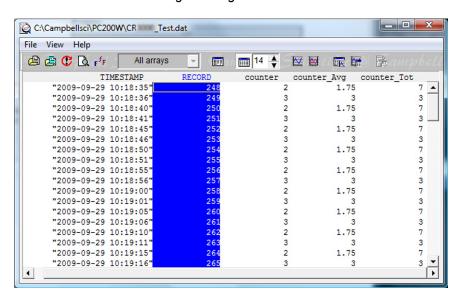


FIGURE 44: Data from TrigVar Program

```
CRBasic EXAMPLE 35: Using TrigVar to Trigger Data Storage
'This program example demonstrates the use of the TrigVar parameter in the DataTable()
'instruction to trigger data storage. In this example, the variable Counter is
'incremented by 1 at each scan. The data table, which includes the Sample(), Average(), and
'Totalize() instructions, is called every scan. Data are stored when TrigVar is true, and
'TrigVar is True when Counter = 2 or Counter = 3. Data stored are the sample, average,
'and total of the variable Counter, which is equal to 0, 1, 2, 3, or 4 when the data table
'is called.
Public Counter
DataTable(Test,Counter=2 or Counter=3,100)
  Sample(1,Counter,FP2)
  Average(1,Counter,FP2,False)
  Totalize(1,Counter,FP2,False)
EndTable
BeginProg
  Scan(1, Sec, 0, 0)
    Counter = Counter + 1
    If Counter = 5 Then
      Counter = 0
    EndIf
    CallTable Test
  NextScan
EndProg
```

# 7.7.7 Data Output: Using Data Type Bool8

Variables used exclusively to store either **True** or **False** are usually declared **As BOOLEAN**. When recorded in final-data memory, the state of Boolean variables is typically stored in **BOOLEAN** data type. **BOOLEAN** data type uses a four-byte integer format. To conserve final-data memory or comms band, you can use the **BOOL8** data type. A BOOL8 is a one-byte value that holds eight bits

of information (eight states with one bit per state). To store the same information using a 32 bit **BOOLEAN** data type, 256 bits are required (8 states \* 32 bits per state).

When programming with BOOL8 data type, repetitions in the output processing **DataTable()** instruction must be divisible by two, since an odd number of bytes cannot be stored. Also note that when the CR3000 converts a LONG or FLOAT data type to BOOL8, only the least significant eight bits of the binary equivalent are used, i.e., only the binary representation of the decimal integer *modulo divide* (p. 545) 256 is used.

#### Example:

```
Given: LONG integer 5435
Find: BOOL8 representation of 5435
Solution:
    5435 / 256 = 21.2304687
    0.2304687 * 256 = 59
    Binary representation of 59 = 00111011 (CR3000 stores these bits in reverse order)
```


When datalogger support software (p. 91) retrieves the BOOL8 value, it splits it apart into eight fields of -1 or 0 when storing to an ASCII file. Consequently, more memory is required for the ASCII file, but CR3000 memory is conserved. The compact **BOOL8** data type also uses less comms band width when transmitted.

CRBasic example *Bool8 and Bit Shift Operators* (p. 206) programs the CR3000 to monitor the state of 32 "alarms" as a tutorial exercise. The alarms are toggled by manually entering zero or non-zero (e.g., 0 or 1) in each public variable representing an alarm as shown in figure *Alarms Toggled in Bit Shift Example* (p. 205). Samples of the four public variables *FlagsBool8(1)*, *FlagsBool8(2)*, *FlagsBool8(3)*, and *FlagsBool8(4)* are stored in data table **Bool8Data** as four one-byte values. However, as shown in figure *Bool8 Data from Bit Shift Example* (*Numeric Monitor*) (p. 205), when viewing the data table in a *numeric monitor* (p. 547), data are conveniently translated into 32 values of **True** or **False**. In addition, as shown in figure *Bool8 Data from Bit Shift Example* (*PC Data File*) (p. 206), when *datalogger support software* (p. 91) stores the data in an ASCII file, it is stored as 32 columns of either -1 or 0, each column representing the state of an alarm. You can use variable *aliasing* (p. 148) in the CRBasic program to make the data more understandable.

- - X CR1000 Numeric Display 1: Real Time Monitoring (Connected) 0 Alarm(19) 0 Alarm(1) 1 Alarm(20) 0 Alarm(2) Add. Alarm(3) 0 Alarm(21) 1 0 Alarm(22) Alarm(4) 0 0 Alarm(23) Alarm(5) 1 Delete Alarm(6) 0 Alarm(24) 1 0 Alarm(25) 0 Alarm(7) Alarm(8) 0 Alarm(26) 0 Delete All 1 Alarm(27) 0 Alarm(10) 0 Alarm(28) 1 Options.. Alarm(11) 1 Alarm(29) 1 1 Alarm(30) Alarm(12) 0 Alarm(13) 0 Alarm(31) 0 Stop Alarm(14) 0 Alarm(32) Alarm(15) Alarm(16) 1 Alarm(17) Alarm(18) 1 Update Interval 00 m 01 s 000 ms \* ?

FIGURE 45: Alarms Toggled in Bit Shift Example

FIGURE 46: Bool8 Data from Bit Shift Example (Numeric Monitor)

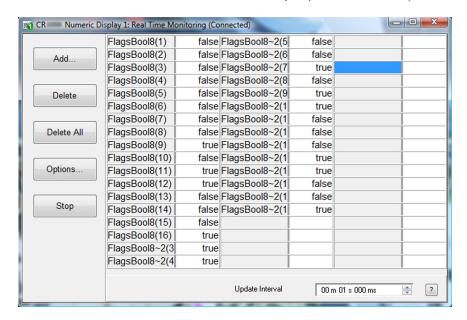

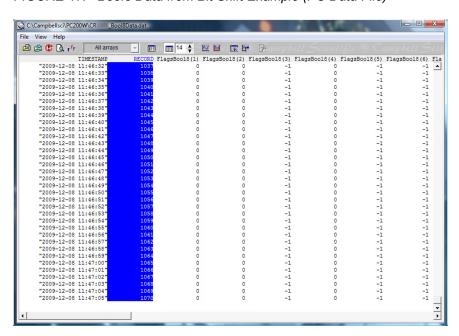


FIGURE 47: Bool8 Data from Bit Shift Example (PC Data File)

```
CRBasic EXAMPLE 36: Bool8 and a Bit Shift Operator
'This program example demonstrates the use of the Bool8 data type and the ">>" bit-shift
'operator.
Public Alarm(32)
Public Flags As Long
Public FlagsBool8(4) As Long
DataTable(Bool8Data,True,-1)
 DataInterval(0,1,Sec,10)
  'store bits 1 through 16 in columns 1 through 16 of data file
  Sample(2,FlagsBool8(1),Bool8)
  'store bits 17 through 32 in columns 17 through 32 of data file
  Sample(2,FlagsBool8(3),Bool8)
EndTable
BeginProg
 Scan(1,Sec,3,0)
    'Reset all bits each pass before setting bits selectively
   Flags = \&h0
    'Set bits selectively. Hex is used to save space.
    'Logical OR bitwise comparison
```

```
'If bit in
          OR bit in
                     The result
'Flags Is
           Bin/Hex Is
                    Is
           0
                         0
    0
              1
                          1
    1
               0
                          1
               1
                          1
'Binary equivalent of Hex:
If Alarm(1) Then Flags = Flags OR &h1
                                                                &b1
If Alarm(2) Then Flags = Flags OR &h2
                                                               &b10
If Alarm(3) Then Flags = Flags OR &h4
                                                              &b100
If Alarm(4) Then Flags = Flags OR &h8
                                                             &b1000
If Alarm(5) Then Flags = Flags OR &h10
                                                             &b10000
If Alarm(6) Then Flags = Flags OR &h20
                                                            &b100000
If Alarm(7) Then Flags = Flags OR &h40
                                                           &b1000000
If Alarm(8) Then Flags = Flags OR &h80
                                                          &b10000000
If Alarm(9) Then Flags = Flags OR &h100
                                                         &b100000000
If Alarm(10) Then Flags = Flags OR &h200
                                                         &b1000000000
If Alarm(11) Then Flags = Flags OR &h400
                                                        &b10000000000
If Alarm(12) Then Flags = Flags OR &h800
                                                       &b100000000000
If Alarm(13) Then Flags = Flags OR &h1000
                                                      &b10000000000000
If Alarm(14) Then Flags = Flags OR &h2000
                                                     &b100000000000000
If Alarm(15) Then Flags = Flags OR &h4000
                                                    &b1000000000000000
If Alarm(16) Then Flags = Flags OR &h8000
                                                    &b10000000000000000
If Alarm(17) Then Flags = Flags OR &h10000
                                                   If Alarm(18) Then Flags = Flags OR &h20000
                                                  If Alarm(19) Then Flags = Flags OR &h40000
                                                 If Alarm(20) Then Flags = Flags OR &h80000
                                                If Alarm(21) Then Flags = Flags OR &h100000
                                               If Alarm(22) Then Flags = Flags OR &h200000
                                               If Alarm(23) Then Flags = Flags OR &h400000
                                              If Alarm(24) Then Flags = Flags OR &h800000
                                             If Alarm(25) Then Flags = Flags OR &h1000000
                                            If Alarm(26) Then Flags = Flags OR &h2000000
                                           If Alarm(27) Then Flags = Flags OR &h4000000
                                           If Alarm(28) Then Flags = Flags OR &h8000000
                                          If Alarm(29) Then Flags = Flags OR &h10000000
                                         If Alarm(30) Then Flags = Flags OR &h20000000
                                      If Alarm(31) Then Flags = Flags OR &h40000000
                                      If Alarm(32) Then Flags = Flags OR &h80000000
'Note &HFF = &B11111111. By shifting at 8 bit increments along 32-bit 'Flags' (Long
'data type), the first 8 bits in the four Longs FlagsBool8(4) are loaded with alarm
'states. Only the first 8 bits of each Long 'FlagsBool8' are stored when converted
'to Boo18.
'Logical AND bitwise comparison
'If bit in
           OR bit in
                     The result
                     Is
'Flags Is
           Bin/Hex Is
            0
   0
   0
              1
                        0
   1
              0
                        0
    1
              1
                         1
```

# 7.7.8 Data Output: Using Data Type NSEC

Data of NSEC type reside only in final-data memory. A datum of NSEC consists of eight bytes — four bytes of seconds since 1990 and four bytes of nanoseconds into the second. *Nsec* is declared in the *Data Type* parameter in final storage output processing instructions. It is used in the following applications:

- Placing a time stamp in a second position in a record.
- Accessing a time stamp from a data table and subsequently storing it as part of a larger data table. **Maximum()**, **Minimum()**, and **FileTime()** instructions produce a time stamp that may be accessed from the program after being written to a data table. The time of other events, such as alarms, can be stored using the **RealTime()** instruction.
- Accessing and storing a time stamp from another datalogger in a PakBus network.

### 7.7.8.1 NSEC Options

NSEC is used in a CRBasic program one of the following ways. In all cases, the time variable is only sampled with a **Sample()** instruction, Reps = 1.

- 1. Time variable is declared **As Long. Sample()** instruction assumes the time variable holds seconds since 1990 and microseconds into the second is 0. The value stored in final-data memory is a standard time stamp. See CRBasic example *NSEC One Element Time Array (p. 208)*.
- Time-variable array dimensioned to (2) and As Long Sample() instruction assumes the first time variable array element holds seconds since 1990 and the second element holds microseconds into the second. See CRBasic example NSEC Two Element Time Array (p. 209).
- 3. Time-variable array dimensioned to (7) or (9) and **As Long** or **As Float Sample()** instruction assumes data are stored in the variable array in the sequence year, month, day of year, hour, minutes, seconds, and milliseconds. See CRBasic example *NSEC Seven and Nine Element Time Arrays* (p. 210).

CRBasic example *NSEC* — *Convert Time Stamp to Universal Time* (p. 208) shows one of several practical uses of the NSEC data type.

#### **CRBasic EXAMPLE 37:** NSEC — One Element Time Array

```
'This program example demonstrates the use of NSEC data type to determine seconds since
'00:00:00 1 January 1990. A time stamp is retrieved into variable TimeVar(1) as seconds
'since 00:00:00 1 January 1990. Because the variable is dimensioned to 1, NSEC assumes
'the value = seconds since 00:00:00 1 January 1990.
'Declarations
Public PTemp
Public TimeVar(1) As Long
DataTable(FirstTable,True,-1)
  DataInterval(0,1,Sec,10)
  Sample(1, PTemp, FP2)
EndTable
DataTable(SecondTable,True,-1)
  DataInterval(0,5,Sec,10)
  Sample(1,TimeVar,Nsec)
EndTable
'Program
BeginProg
  Scan(1, Sec, 0, 0)
   TimeVar = FirstTable.TimeStamp
    CallTable FirstTable
    CallTable SecondTable
 NextScan
EndProg
```

### CRBasic EXAMPLE 38: NSEC — Two Element Time Array

```
'This program example demonstrates how to determine seconds since 00:00:00 1 January 1990,
'and microseconds into the last second. This is done by retrieving variable TimeStamp into
'variables TimeOfMaxVar(1) and TimeOfMaxVar(2). Because the variable TimeOfMaxVar() is
'dimensioned to 2, NSEC assumes the following:
 1) TimeOfMaxVar(1) = seconds since 00:00:00 1 January 1990, and
' 2) TimeOfMaxVar(2) = microseconds into a second.
'Declarations
Public PTempC
Public MaxVar
Public TimeOfMaxVar(2) As Long
DataTable(FirstTable,True,-1)
 DataInterval(0,1,Min,10)
  Maximum(1,PTempC,FP2,False,True)
EndTable
DataTable(SecondTable,True,-1)
 DataInterval(0,5,Min,10)
  Sample(1,MaxVar,FP2)
  Sample(1,TimeOfMaxVar,Nsec)
EndTable
```

```
'Program
BeginProg
Scan(1,Sec,0,0)

PanelTemp(PTempC,250)
MaxVar = FirstTable.PTempC_Max
TimeOfMaxVar = FirstTable.PTempC_TMx
CallTable FirstTable
CallTable SecondTable
NextScan
EndProg
```

#### **CRBasic EXAMPLE 39:** NSEC — Seven and Nine Element Time Arrays

```
'This program example demonstrates the use of NSEC data type to sample a time stamp into
'final-data memory using an array dimensioned to 7 or 9.
'A time stamp is retrieved into variable rTime(1) through rTime(9) as year, month, day,
'hour, minutes, seconds, and microseconds using the RealTime() instruction. The first
'seven time values are copied to variable rTime2(1) through rTime2(7). Because the
'variables are dimensioned to 7 or greater, NSEC assumes the first seven time factors
'in the arrays are year, month, day, hour, minutes, seconds, and microseconds.
'Declarations
Public rTime(9) As Long
                                              '(or Float)
Public rTime2(7) As Long
                                              '(or Float)
Dim x
DataTable(SecondTable,True,-1)
  DataInterval(0,5,Sec,10)
  Sample(1,rTime,NSEC)
  Sample(1,rTime2,NSEC)
EndTable
'Program
BeginProg
  Scan(1, Sec, 0, 0)
    RealTime(rTime)
    For x = 1 To 7
      rTime2(x) = rTime(x)
    CallTable SecondTable
  NextScan
EndProg
```

```
CRBasic EXAMPLE 40: NSEC —Convert Timestamp to Universal Time
'This program example demonstrates the use of NSEC data type to convert a data time stamp
'to universal time.
'Application: the CR3000 needs to display Universal Time (UT) in human readable
'string forms. The CR3000 can calculate UT by adding the appropriate offset to a
'standard time stamp. Adding offsets requires the time stamp be converted to numeric
'form, the offset applied, then the new time be converted back to string forms.
'These are accomplished by:
 1) reading Public. TimeStamp into a LONG numeric variable.
' 2) store it into a type NSEC datum in final-data memory.
' 3) sample it back into string form using the TableName.FieldName notation.
'Declarations
Public UTTime(3) As String * 30
Dim TimeLong As Long
Const UTC Offset = -7 * 3600
                                              '-7 hours offset (as seconds)
DataTable(TimeTable, true, 1)
 Sample(1,TimeLong,Nsec)
EndTable
'Program
BeginProg
 Scan(1, Sec, 0, 0)
    '1) Read Public.TimeStamp into a LONG numeric variable. Note that TimeStamp is a
        system variable, so it is not declared.
   TimeLong = Public.TimeStamp(1,1) + UTC_Offset
    '2) Store it into a type NSEC datum in final-data memory.
    CallTable(TimeTable)
    '3) sample time to three string forms using the TableName.FieldName notation.
    'Form 1: "mm/dd/vyyy hr:mm:ss
    UTTime(1) = TimeTable.TimeLong(1,1)
    'Form 2: "dd/mm/yyyy hr:mm:ss
    UTTime(2) = TimeTable.TimeLong(3,1)
    'Form 3: "ccyy-mm-dd hr:mm:ss (ISO 8601 Int'l Date)
    UTTime(3) = TimeTable.TimeLong(4,1)
  NextScan
EndProg
```

# 7.7.9 Data Output: Wind Vector

The WindVector() instruction processes wind-speed and direction measurements to calculate mean speed, mean vector magnitude, and mean vector direction over a data-storage interval. Measurements from polar (wind speed and direction) or orthogonal (fixed East and North propellers) sensors are supported. Vector direction and standard deviation of vector direction can be calculated weighted or unweighted for wind speed.

### 7.7.9.1 OutputOpt Parameters

In the CR3000 **WindVector()** instruction, the *OutputOpt* parameter defines the processed data that are stored. All output options result in an array of values, the elements of which have \_WVc(n) as a suffix, where n is the element number. The array uses the name of the *Speed/East* variable as its base. See table *WindVector() OutputOpt Options (p. 212)*.

TABLE 26: WindVector() OutputOpt Options		
Option	Description (WVc() is the Output Array)	
0	WVc(1): Mean horizontal wind speed (S) WVc(2): Unit vector mean wind direction ( $\Theta$ 1) WVc(3): Standard deviation of wind direction $\sigma$ ( $\Theta$ 1). Standard deviation is calculated using the Yamartino algorithm. This option complies with EPA guidelines for use with straight-line Gaussian dispersion models to model plume transport.	
1	WVc(1): Mean horizontal wind speed (S) WVc(2): Unit vector mean wind direction (Θ1)	
2	WVc(1): Mean horizontal wind speed (S) WVc(2): Resultant mean horizontal wind speed (U) WVc(3): Resultant mean wind direction ( $\Theta$ u) WVc(4): Standard deviation of wind direction $\sigma(\Theta$ u). This standard deviation is calculated using Campbell Scientific's wind speed weighted algorithm. Use of the resultant mean horizontal wind direction is not recommended for straight-line Gaussian dispersion models, but may be used to model transport direction in a variable-trajectory model.	
3	WVc(1): Unit vector mean wind direction (Θ1)	
4	WVc(1): Unit vector mean wind direction $(\Theta 1)$ WVc(2): Standard deviation of wind direction $\sigma(\Theta u)$ . This standard deviation is calculated using Campbell Scientific's wind speed weighted algorithm. Use of the resultant mean horizontal wind direction is not recommended for straight-line Gaussian dispersion models, but may be used to model transport direction in a variable-trajectory model.	

### 7.7.9.2 Wind Vector Processing

**WindVector()** uses a zero-wind-speed measurement when processing scalar wind speed only. Because vectors require magnitude and direction, measurements at zero wind speed are not used in vector speed or direction calculations. This means, for example, that manually-computed hourly vector directions from 15 minute vector directions will not agree with CR3000-computed hourly vector directions. Correct manual calculation of hourly vector direction from 15 minute vector directions requires proper weighting of the 15 minute vector directions by the number of valid (non-zero wind speed) wind direction samples.

**Note** Cup anemometers typically have a mechanical offset which is added to each measurement. A numeric offset is usually encoded in the CRBasic program to compensate for the mechanical offset. When this is done, a measurement will equal the offset only when wind speed is zero; consequently, additional code is often included to zero the measurement when it equals the offset so that **WindVector()** can reject measurements when wind speed is zero.

Standard deviation can be processed one of two ways: 1) using every sample taken during the data storage interval (enter  $\theta$  for the *Subinterval* parameter), or 2) by averaging standard deviations processed from shorter sub-intervals of the data-storage interval. Averaging sub-interval standard deviations minimizes the effects of meander under light wind conditions, and it provides more complete information for periods of transition (see EPA publication "On-site Meteorological Program Guidance for Regulatory Modeling Applications").

Standard deviation of horizontal wind fluctuations from sub-intervals is calculated as follows:

$$\sigma(\Theta) = \left[ \left( \left( \sigma \Theta_1 \right)^2 + \left( \sigma \Theta_2 \right)^2 \dots + \left( \sigma \Theta_M \right)^2 \right) / M \right]^{1/2}$$

where:  $\sigma(\Theta)$  is the standard deviation over the data-storage interval, and  $\sigma\Theta_1\ldots\sigma\Theta_M$  are sub-interval standard deviations. A sub-interval is specified as a number of scans. The number of scans for a sub-interval is given by:

Desired sub-interval (secs) / scan rate (secs)

For example, if the scan rate is 1 second and the data-output interval is 60 minutes, the standard deviation is calculated from all 3600 scans when the sub-interval is 0. With a sub-interval of 900 scans (15 minutes) the standard deviation is the root-mean-square average of the four sub-interval standard deviations. The last sub-interval is weighted if it does not contain the specified number of scans.


The EPA recommends hourly standard deviation of horizontal wind direction (sigma theta) be computed from four fifteen-minute sub-intervals.

#### 7.7.9.2.1 Measured Raw Data

- S<sub>i</sub>: horizontal wind speed
- Θ<sub>i</sub>: horizontal wind direction
- Ue<sub>i</sub>: east-west component of wind
- Un<sub>i</sub>: north-south component of wind
- N: number of samples

# 7.7.9.2.2 Calculations Input Sample Vectors

FIGURE 48: Input Sample Vectors

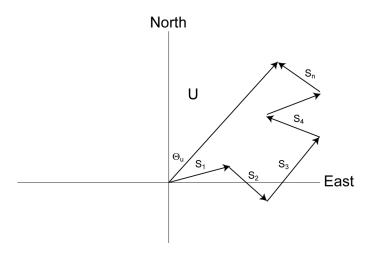

In figure *Input Sample Vectors* (p. 214), the short, head-to-tail vectors are the input sample vectors described by  $s_i$  and  $\Theta_i$ , the sample speed and direction, or by  $Ue_i$  and  $Un_i$ , the east and north components of the sample vector. At the end of data storage interval T, the sum of the sample vectors is described by a vector of magnitude U and direction  $\Theta_U$ . If the input sample interval is t, the number of samples in data storage interval T is N = T/t. The mean vector magnitude is  $\overline{U} = U/N$ .

Scalar mean horizontal wind speed, S:

$$S = (\sum s_i) / N$$

where in the case of orthogonal sensors:

$$s_i = (Ue_i^2 + Un_i^2)^{1/2}$$

Unit vector mean wind direction,

$$\Theta_1 = \arctan(Ux / Uy)$$

where

$$Ux = \left(\sum \sin \Theta_{i}\right) / N$$

$$Uy = \left(\sum \cos \Theta_{i}\right) / N$$

or, in the case of orthogonal sensors

$$Ux = \left(\sum (Ue_i / U_i) / N\right)$$

$$Uy = \left(\sum (Un_i / U_i) / N\right)$$

where

$$U_i = (Ue_i^2 + Un_i^2)^{1/2}$$

Standard deviation of wind direction (Yamartino algorithm)

$$\sigma(\Theta_1) = \arcsin(\epsilon)[1 + 0.1547\epsilon^3]$$

where,

$$\varepsilon = [1 - ((Ux)^2 + (Uy)^2)]^{1/2}$$


and Ux and Uy are as defined above.

#### Mean Wind Vector

Resultant mean horizontal wind speed, Ū:

$$\overline{U} = \left(Ue^2 + Un^2\right)^{1/2}$$

FIGURE 49: Mean Wind-Vector Graph

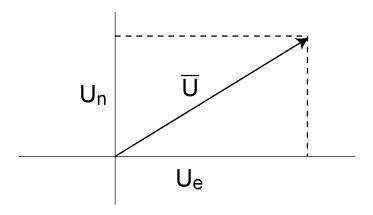

where for polar sensors:

$$Ue = \left(\sum s_i \sin \Theta_i\right) / N$$

$$Un = \left(\sum s_i \cos \Theta_i\right) / N$$

or, in the case of orthogonal sensors:

$$Ue = (\sum Ue_i) / N$$

$$Un = (\sum Un_{i}) / N$$

Resultant mean wind direction, Ou:

$$\Theta u = \arctan (Ue / Un)$$

Standard deviation of wind direction,  $\sigma$  ( $\Theta$ u), using Campbell Scientific algorithm:

$$\sigma(\Theta \mathbf{u}) = 81(1 - \overline{\mathbf{U}} / \mathbf{S})^{1/2}$$

The algorithm for  $\sigma$  ( $\Theta$ u) is developed by noting, as shown in the figure *Standard Deviation of Direction* (p. 216), that

$$\cos (\Theta_i') = U_i / S_i$$

where

$$\Theta_{i}{}' = \Theta_{i}$$
 -  $\Theta u$ 

FIGURE 50: Standard Deviation of Direction

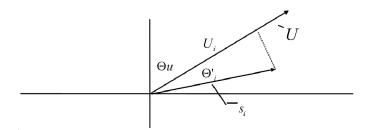


FIGURE 51: Standard Deviation of Direction

The Taylor Series for the Cosine function, truncated after 2 terms is:

$$\cos(\Theta_i') \cong 1 - (\Theta_i')^2 / 2$$

For deviations less than 40 degrees, the error in this approximation is less than 1%. At deviations of 60 degrees, the error is 10%.

The speed sample can be expressed as the deviation about the mean speed,

$$S_i = S_i' + S_i'$$

Equating the two expressions for  $Cos(\theta)$  and using the previous equation for  $s_i$ ;

1 - 
$$(\Theta_i')^2 / 2 = U_i / (s_i' + S)$$

Solving for  $(\Theta_i')^2$ , one obtains;

$$(\Theta_i')^2 = 2 - 2U_i / S - (\Theta_i')^2 S_i' / S + 2S_i' / S$$

Summing  $(\Theta_i)^2$  over N samples and dividing by N yields the variance of  $\Theta$ u.

#### **Note** The sum of the last term equals 0.

$$(\sigma(\Theta u))^2 = (\sum_{i=1}^{N} (\Theta_i')^2 / N) = 2 (1 - \overline{U} / S) - \sum_{i=1}^{N} ((\Theta_i)^2 s_i') / NS$$

The term,

$$\sum ((\Theta_i')^2 s_i') / NS$$

is 0 if the deviations in speed are not correlated with the deviation in direction. This assumption has been verified in tests on wind data by Campbell Scientific; the Air Resources Laboratory, NOAA, Idaho Falls, ID; and MERDI, Butte, MT. In these tests, the maximum differences in

$$\sigma(\Theta u) = \left(\sum (\Theta_i')^2 / N\right)^{1/2}$$

and

$$\sigma(\Theta \mathbf{u}) = (2 (1 - \overline{\mathbf{U}} / \mathbf{S}))^{1/2}$$

have never been greater than a few degrees.

The final form is arrived at by converting from radians to degrees (57.296 degrees/radian).

$$\sigma(\Theta u) = (2 (1 - \overline{U} / S)^{1/2} = 81 (1 - \overline{U} / S)^{1/2}$$

# 7.7.10 Data Output: Writing High-Frequency Data to Memory Cards

#### Related Topics:

- Memory Card (CRD: Drive) Overview (p. 81)
- Memory Card (CRD: Drive) Details (p. 447)
- Memory Cards and Record Numbers (p. 453)
- Data Output: Writing High-Frequency Data to Memory Cards (p. 217)
- File System Errors (p. 464)
- Data Storage Devices List (p. 613)

- Data File Format Examples (p. 450)
- Data Storage Drives Table (p. 444)

The usual method for writing high-frequency time series data to memory cards, especially in high-speed measurement applications, is to use the **TableFile()** instruction with *Option 64*. It supports 16 GB or smaller memory cards and permits smaller and variable file sizes.

# 7.7.10.1 TableFile() with Option 64

**Option 64** has been added as a format option for the CRBasic instruction **TableFile()**. It combines the speed and efficiency of the **CardOut()** instruction with the flexibility of the **TableFile()** instruction. Memory cards<sup>1</sup> up to 16 GB are supported. **TableFile()** is a CRBasic instruction that creates a file from a data table in datalogger CPU memory. **Option 64** directs that the file be written in TOB3 format exclusively to the CRD: drive<sup>2</sup>.

Syntax for the **TableFile()** instruction is as follows:

```
TableFile(FileName, Option, MaxFiles, NumRecs/
TimeIntoInterval, Interval, Units, OutStat, LastFileName)
```

where *Option* is given the argument of 64. Refer to *CRBasic Editor Help*<sup>3</sup> for a detailed description of each parameter.

**Note** The CRD: drive (the drive designation for the optional memory card) is the only drive that is allowed for use with *Option 64*.

**Note** Memory cards add a measure of security in guarding against data loss. However, no system is infallible. Finding a functioning memory card in the mud after a moose has trampled your weather station or a tractor has run an offset disk over your soil-moisture station may be difficult. The best rule is to collect data from the CR3000 only as often as you can afford to lose the data. In other words, if you can afford to lose a months worth of data, you can afford to collect the data only once a month.

# 7.7.10.2 TableFile() with Option 64 Replaces CardOut()

**TableFile()** with *Option 64* has several advantages over **CardOut()** when used in most applications. These include:

<sup>&</sup>lt;sup>1</sup> Memory cards for the CR3000 are the compact flash (CF) type.

<sup>&</sup>lt;sup>2</sup> The CRD: drive is a memory drive created when a memory card is connected into the CR3000 through the appropriate peripheral device. The CR3000 is adapted for CF use by addition of the NL115 or CFM100 modules. NL115 and CFM100 modules are available at additional cost from Campbell Scientific.

<sup>&</sup>lt;sup>3</sup> CRBasic Editor is included in Campbell Scientific datalogger support software (p. 91) suites LoggerNet, PC400, and RTDAQ.

- Allowing multiple small files to be written from the same data table so
  that storage for a single table can exceed 2 GB. TableFile() controls the
  size of its output files through the *NumRecs*, *TimeIntoInterval*, and *Interval* parameters.
- Faster compile times when small file sizes are specified.
- Easy retrieval of closed files with File Control (p. 539) utility, FTP, or e-mail.

# 7.7.10.3 TableFile() with Option 64 Programming

As shown in the following CRBasic code snip, the **TableFile()** instruction must be placed inside a **DataTable()** / **EndTable** declaration. The **TableFile()** instruction writes data to the memory card based on user-specified parameters that determine the file size based on number of records to store, or an interval over which to store data. The resulting file is saved with a suffix of X.dat, where X is a number that is incremented each time a new file is written.

```
DataTable(TableName,TriggerVariable,Size)
  TableFile(FileName...LastFileName)
  'Output processing instructions go here
EndTable
```

For example, in micrometeorological applications, **TableFile()** with *Option 64* is used to create a new high-frequency data file once per day. The size of the file created is a function of the datalogger scan frequency and the number of variables saved to the data table. For a typical eddy-covariance station, this daily file is about 50 MB large (10 Hz scan frequency and 15 IEEE4 data points). CRBasic example *Using TableFile()* with *Option 64* with *Memory Card (p. 219)* is an example of a micromet application.

#### CRBasic EXAMPLE 41: Using TableFile() with Option 64 with Memory Card

```
'This program example demonstrates the use of TableFile() with Option 64 in micrometeorology
'eddy-covariance programs. The file naming scheme used in instruction TableFile() is
'customized using variables, constants, and text.
Public Sensor(10)
DataTable(Ts_data,TRUE,-1)
  'TableFile("filename",Option,MaxFiles,NumRec/TimeIntoInterval,Interval,Units,
     OutStat,LastFileName)
  TableFile("CRD:"&Status.SerialNumber(1,1)&".ts_data_",64,-1,0,1,Day,0,0)
  Sample(10, sensor(1), IEEE4)
EndTable
BeginProg
  Scan(100, mSec, 100, 0)
    'Measurement instructions go here.
    'Processing instructions go here.
    CallTable ts_data
  NextScan
EndProg
```

## 7.7.10.4 Converting TOB3 Files with CardConvert

The TOB3 format that is used to write data to memory cards saves disk space. However, the resulting binary files must be converted to another format to be read or used by other programs. The *CardConvert* software, included in Campbell Scientific *datalogger support software* (p. 91), will convert data files from one format to another. *CardConvert Help* has more details.

# 7.7.10.5 TableFile() with Option 64 Q & A

Q: How does Option 64 differ from other TableFile() options?

**A:** Pre-allocation of memory combines with TOB3 data format to give *Option 64* two principal advantages over other **TableFile()** options. These are:

- increased runtime write performance
- short card-eject times

**Option 64** is unique among table file options in that it pre-allocates enough memory on the memory card to store an interval amount of data  $^1$ . Pre-allocation allows data to be continuously and more quickly written to the card in  $\approx 1$  KB blocks. TOB3 binary format copies data directly from CPU memory to the memory card without format conversion, lending additional speed and efficiency to the data storage process.

**Note** Pre-allocation of memory card files significantly increases run time write performance. It also reduces the risk of file corruption that can occur as a result of power loss or incorrect card removal.

**Note** To avoid data corruption and loss, memory card removal must always be initiated by pressing the **Initiate Removal** button on the face of the NL115 or CFM100 modules. The card must be ejected only after the **Status** light shows a solid green.

**Q:** Why are individual files limited to 2 GB?

**A:** In common with many other systems, the datalogger natively supports signed four-byte integers. This data type can represent a number as large as 231, or in terms of bytes, roughly 2 GB. This is the maximum file length that can be represented in the datalogger directory table.

**Q:** Why does a large card cause long program compile times?

A: Program compile times increase with card and file sizes. As the datalogger boots up, the card must be searched to determine space available for data storage. In addition, for tables that are created by **TableFile()** with *Option 64*, an empty file that is large enough to hold all of the specified records must be created (i.e., memory is pre-allocated). When using **TableFile()** with *Option 64*, program compile times can be lessened by reducing the number of records or data-output

interval that will be included in each file. For example, if the maximum file size specified is 2 GB, the datalogger must scan through and pre-allocate 2 GB of card memory. However, if smaller files are specified, then compile times are reduced because the datalogger is only required to scan through enough memory to pre-allocate memory for the smaller file.

**Q:** Why does a freshly formatted card cause long compile times?

A: Program compile times take longer with freshly formatted cards because the cards use a FAT32 system (File Allocation Table with 32 table element bits) to be compatible with PCs. Because of the way the FAT32 card format works, you can avoid long CR3000 compile times with a freshly formatted card by first formatting the new card on a PC, then copy a small file to the card from the PC, and then delete the file with the PC. When the small file is copied to the card, the PC updates a sector on the card that which allows the CR3000 program to compile faster. This only needs to be done once when the card is formatted. If you have the CR3000 update the card sector, the first CR3000 program compile with the card can take as long as 30 minutes. After that, compile times will be normal.

Q: Which memory card should I use?

**A:** Campbell Scientific recommends and supports only the use of FMJ brand CF cards. These cards are industrial-grade and have passed Campbell Scientific hardware testing. Following are listed advantages these cards have over less expensive commercial-grade cards:

- less susceptible to failure and data loss
- match the datalogger operating temperature range
- faster read/write times
- better vibration and shock resistance
- longer life spans (more read/write cycles)

**Note** More CF card recommendations are presented in the application note, *CF Card Information*, which is available at *www.campbellsci.com*.

Q: Can closed files be retrieved remotely?

**A:** Yes. Closed files can be retrieved using the **Retrieve** function in the datalogger support software *File Control (p. 539)* utility, FTP, HTTP, or e-mail. Although open files will appear in the CRD: drive directory, do not attempt to retrieve open files. Doing so may corrupt the file and result in data loss. Smaller files typically transmit more quickly and more reliably than large files.

Q: Can data be accessed?

A: Yes. Data in the open or most recent file can be collected using the **Collect** or **Custom Collect** utilities in *LoggerNet*, *PC400*, or *RTDAQ*. Data can also be viewed using datalogger support software or accessed through the datalogger using data table access syntax such as **TableName**. **FieldName** (see *CRBasic Editor Help*). Once a file is closed, data can be accessed only by first retrieving the file, as discussed previously, and processing the file using *CardConvert* software.

**Q:** What happens when a card is inserted?

**A:** When a card is inserted, whether it is a new card or the previously used card, a new file is always created.

**Q:** What does a power cycle or program restart do?

**A:** Each time the program starts, whether by user control, power cycle, or a watchdog, **TableFile()** with *Option 64* will create a new file.

**Q:** What happens when a card is filled?

A: If the memory card fills, new data are written over oldest data. A card must be exchanged before it fills, or the oldest data will be overwritten by incoming new records and lost. During the card exchange, once the old card is removed, the new card must be inserted before the data table in datalogger CPU memory rings<sup>2</sup>, or data will be overwritten and lost. For example, consider an application wherein the data table in datalogger CPU memory has a capacity for about 45 minutes of data<sup>3</sup>. The exchange must take place anytime before the 45 minutes expire. If the exchange is delayed by an additional 5 minutes, 5 minutes of data at the beginning of the last 45 minute interval (since it is the oldest data) will be overwritten in CPU memory before transfer to the new card and lost.

# 7.7.11 Displaying Data: Custom Menus — Details

#### Related Topics:

- Custom Menus Overview (p. 85)
- Data Displays: Custom Menus Details (p. 222)
- Keyboard/Display Overview (p. 84)
- CRBasic Editor Help for DisplayMenu()

Menus for the CR1000KD Keyboard/Display can be customized to simplify routine operations. Viewing data, toggling control functions, or entering notes are

<sup>&</sup>lt;sup>1</sup> Other options of **TableFile()** do not pre-allocate memory, so they should be avoided when collecting high-frequency time-series data. More information is available in *CRBasic Editor Help*.

<sup>&</sup>lt;sup>2</sup> "rings": the datalogger has a ring memory. In other words, once filled, rather than stopping when full, oldest data are overwritten by new data. In this context, "rings" designates when new data begins to overwrite the oldest data.

<sup>&</sup>lt;sup>3</sup> CPU data table fill times can be confirmed in the datalogger **DataTableInfo** table.

common applications. Individual menu screens support up to eight lines of text with up to seven variables.

Use the following CRBasic instructions. Refer to *CRBasic Editor Help* for complete information.

#### DisplayMenu()

Marks the beginning and end of a custom menu. Only one allowed per program.

**Note** Label must be at least six characters long to mask default display clock.

#### **EndMenu**

Marks the end of a custom menu. Only one allowed per program.

#### DisplayValue()

Defines a label and displays a value (variable or data table value) not to be edited, such as a measurement.

#### MenuItem()

Defines a label and displays a variable to be edited by typing or from a pick list defined by MenuPick ().

#### MenuPick()

Creates a pick list from which to edit a **MenuItem()** variable. Follows immediately after **MenuItem()**. If variable is declared **As Boolean**, **MenuPick()** allows only True or False or declared equivalents. Otherwise, many items are allowed in the pick list. Order of items in list is determined by order of instruction; however, item displayed initially in **MenuItem()** is determined by the value of the item.

#### SubMenu() / EndSubMenu

Defines the beginning and end of a second-level menu.

**Note SubMenu()** label must be at least six characters long to mask default display clock.

CRBasic example *Custom Menus (p. 226)* demonstrates how to program a custom menu to facilitates viewing data, entering notes, and controlling a device. Following is a list of figures that show the organization of the custom menu.

```
Custom Menu Example — Home Screen (p. 224)

Custom Menu Example — View Data Window (p. 224)

Custom Menu Example — Make Notes Sub Menu (p. 224)

Custom Menu Example — Predefined Notes Pick List (p. 225)

Custom Menu Example — Free Entry Notes Window (p. 225)
```

```
Custom Menu Example — Accept / Clear Notes Window (p. 225)
Custom Menu Example — Control Sub Menu (p. 226)
Custom Menu Example — Control LED Pick List (p. 226)
Custom Menu Example — Control LED Boolean Pick List (p. 226)
```

FIGURE 52: Custom Menu Example — Home Screen


* * CUSTOM MENU DEMO * *	
	>
View Data	>
Make Notes	>
Control	>

FIGURE 53: Custom Menu Example — View Data Window

View Data : Ref Temp C	25.7643
TC 1 Temp C TC 2 Temp C	24.3663   24.2643

FIGURE 54: Custom Menu Example — Make Notes Sub Menu

Make Notes : Predefined Free Entry Accept/Clear	     ??????



Predefined
Cal\_Done
Offset\_Changed

FIGURE 56: Custom Menu Example — Free Entry Notes Window

Modify Value Free Entry

**Current Value:** 

New Value:

FIGURE 57: Custom Menu Example — Accept / Clear Notes Window

Accept / Clear Accept Clear

FIGURE 58: Custom Menu Example — Control Sub Menu

Control:
Count to LED | 0
Manual LED | Off

FIGURE 59: Custom Menu Example — Control LED Pick List

Count to LED
15
30
45
60

FIGURE 60: Custom Menu Example — Control LED Boolean Pick List

Manual LED On Off

**Note** See figures *Custom Menu Example* — *Home Screen (p. 224)* through *Custom Menu Example* — *Control LED Boolean Pick List (p. 226)* in reference to the following CRBasic example.

#### CRBasic EXAMPLE 42: Custom Menus

```
'This program example demonstrates the building of a custom CR1000KD Keyboard/Display menu.
'Declarations supporting View Data menu item
Public RefTemp
                                               'Reference Temp Variable
Public TCTemp(2)
                                               'Thermocouple Temp Array
'Delarations supporting blank line menu item
Const Escape = "Hit Esc"
                                               'Word indicates action to exit dead end
'Declarations supporting Enter Notes menu item
Public SelectNote As String * 20
                                               'Hold predefined pick list note
Const Cal_Done = "Cal Done"
                                               'Word stored when Cal Don selected
Const Offst_Chgd = "Offset Changed"
                                               'Word stored when Offst_Chgd selected
Const Blank = ""
                                               'Word stored when blank selected
Public EnterNote As String * 30
                                               'Variable to hold free entry note
Public CycleNotes As String * 20
                                               'Variable to hold notes control word
Const Accept = "Accept"
                                               'Notes control word
Const Clear = "Clear"
                                               'Notes control word
'Declarations supporting Control menu item
Const On = true
                                               'Assign "On" as Boolean True
                                               'Assign "Off" as Boolean False
Const Off = false
Public StartFlag As Boolean
                                               'LED Control Process Variable
Public CountDown As Long
                                               'LED Count Down Variable
                                               'LED Control Variable
Public ToggleLED As Boolean
'Define Note DataTable
                                               'Set up Notes data table, written
DataTable(Notes,1,-1)
                                               'to when a note is accepted
  Sample(1, SelectNote, String)
                                               'Sample Pick List Note
  Sample(1,EnterNote,String)
                                               'Sample Free Entry Note
EndTable
'Define temperature DataTable
                                               'Set up temperature data table.
DataTable(TempC.1.-1)
                                               'Written to every 60 seconds with:
 DataInterval(0,60,Sec,10)
  Sample(1,RefTemp,FP2)
                                               'Sample of reference temperature
                                               'Sample of thermocouple 1
  Sample(1,TCTemp(1),FP2)
                                               'Sample of thermocouple 2
  Sample(1,TCTemp(2),FP2)
EndTable
'Custom Menu Declarations
DisplayMenu("**CUSTOM MENU DEMO**",-3)
                                               'Create Menu; Upon power up, the custom menu
                                               'is displayed. The system menu is hidden
                                               'from the user.
                                               'Dummy Sub menu to write a blank line
  SubMenu("")
   DisplayValue("",Escape)
                                               'a blank line
  EndSubMenu
                                               'End of dummy submenu
  SubMenu("View Data ")
                                               'Create Submenu named PanelTemps
   DisplayValue("Ref Temp C", RefTemp)
                                               'Item for Submenu from Public
    DisplayValue("TC 1 Temp C",TCTemp(1))
                                               'Item for Submenu - TCTemps(1)
   DisplayValue("TC 2 Temp C",TCTemp(2))
                                               'Item for Submenu - TCTemps(2)
                                               'End of Submenu
  EndSubMenu
  SubMenu("Make Notes ")
                                               'Create Submenu named PanelTemps
   MenuItem("Predefined", SelectNote)
                                               'Choose predefined notes Menu Item
    MenuPick(Cal_Done,Offset_Changed)
                                               'Create pick list of predefined notes
                                               'User entered notes Menu Item
    MenuItem("Free Entry",EnterNote)
```

```
MenuItem("Accept/Clear",CycleNotes)
   MenuPick(Accept,Clear)
  EndSubMenu
 SubMenu("Control ")
                                             'Create Submenu named PanelTemps
   MenuItem("Count to LED", CountDown)
                                             'Create menu item CountDown
   MenuPick(15,30,45,60)
                                             'Create a pick list for CountDown
   MenuItem("Manual LED", toggleLED)
                                             'Manual LED control Menu Item
   MenuPick(On,Off)
   EndSubMenu
EndMenu
                                             'End custom menu creation
'Main Program
BeginProg
 CycleNotes = "?????"
                                             'Initialize Notes Sub Menu,
                                             'write ????? as a null
  Scan(1, Sec, 3, 0)
    'Measurements
   PanelTemp(RefTemp, 250)
                                              'Measure Reference Temperature
                                             'Measure Two Thermocouples
   TCDiff(TCTemp(),2,mV20C,1,TypeT,RefTemp,True,0,_60Hz,1.0,0)
   CallTable TempC
                                             'Call data table
    'Menu Item "Make Notes" Support Code
   If CycleNotes = "Accept" Then
     CallTable Notes
                                             'Write data to Notes data table
     CycleNotes = "Accepted"
                                            'Write "Accepted" after written
                                             'Pause so user can read "Accepted"
     Delay(1,500,mSec)
                                         'Clear free entry note
     SelectNote = ""
     EnterNote = ""
     CycleNotes = "?????"
                                            'Write ????? as a null prompt
   If CycleNotes = "Clear" Then
                                             'Clear notes when requested
      SelectNote = ""
                                             'Clear pick list note
     EnterNote = ""
                                             'Clear free entry note
     CycleNotes = "??????"
                                             'Write ????? as a null prompt
   EndIf
    'Menu Item "Control" Menu Support Code
   CountDown = CountDown - 1
                                             'Count down by 1
    If CountDown <= 0</pre>
                                             'Stop count down from passing 0
     CountDown = 0
   EndIf
    If CountDown > 0 Then
     StartFlag = True
                                             'Indicate countdown started
   If StartFlag = True AND CountDown = 0 Then'Interprocess count down
                                              'and manual LED
     ToggleLED = True
     StartFlag = False
    If StartFlag = True AND CountDown <> 0 Then'Interprocess count down and manual LED
     ToggleLED = False
   PortSet(4,ToggleLED)
                                              'Set control port according
                                              'to result of processing
 NextScan
EndProg
```

## 7.7.12 Field Calibration — Details

Related Topics:

- Field Calibration Overview (p. 79)
- Field Calibration Details (p. 229)

Calibration increases accuracy of a sensor by adjusting or correcting its output to match independently verified quantities. Adjusting a sensor output signal is preferred, but not always possible or practical. By using the **FieldCal()** or **FieldCalStrain()** instruction, a linear sensor output can be corrected in the CR3000 after the measurement by adjusting the multiplier and offset.

When included in the CRBasic program, **FieldCal()** and **FieldCalStrain()** can be used through a datalogger support software *calibration wizard (p. 531)*. Help for using the wizard is available in the software.

A more arcane procedure that does not require a PC can be executed though the on-board keyboard and display. If you do not have a keyboard, the same procedure can be done in a *numeric monitor* (p. 547). Numeric monitor screen captures are used in the following procedures. Running through these procedures will give you a foundation for how field calibration works, but use of the calibration wizard for routine work is recommended.

More detail is available in CRBasic Editor Help.

#### 7.7.12.1 Field Calibration CAL Files

Calibration data are stored automatically, usually on the CR3000 CPU: drive, in CAL (.cal) files. These data become the source for calibration factors when requested by the <code>LoadFieldCal()</code> instruction. A file is created automatically on the same CR3000 memory drive and given the same name as the program that creates and uses it. For example, the CRBasic program file CPU:MyProg.cr3 generates the CAL file CPU:MyProg.cal.

CAL files are created if a program using **FieldCal()** or **FieldCalStrain()** does not find an existing, compatible CAL file. Files are updated with each successful calibration with new calibration factors factors. A calibration history is recorded only if the CRBasic program creates a *data table (p. 535)* with the **SampleFieldCal()** instruction.

**Note** CAL files created by **FieldCal()** and **FieldCalStrain()** differ from files created by the **CalFile()** instruction See *File Management in CR3000 Memory* (p. 456).

# 7.7.12.2 Field Calibration Programming

Field-calibration functionality is included in a CRBasic program through either of the following instructions:

- **FieldCal()** the principal instruction used for non-strain gage type sensors. For introductory purposes, use one **FieldCal()** instruction and a unique set of **FieldCal()** variables for each sensor. For more advanced applications, use variable arrays.
- **FieldCalStrain()** the principal instruction used for strain gages measuring microstrain. Use one **FieldCalStrain()** instruction and a unique set of **FieldCalStrain()** variables for each sensor. For more advanced applications, use variable arrays.

FieldCal() and FieldCalStrain() use the following instructions:

- LoadFieldCal() an optional instruction that evaluates the validity of, and loads values from a CAL file.
- **SampleFieldCal** an optional data-storage output instruction that writes the latest calibration values to a data table (not to the CAL file).

FieldCal() and FieldCalStrain() use the following reserved Boolean variable:

• NewFieldCal — a reserved Boolean variable under CR3000 control used to optionally trigger a data storage output table one time after a calibration has succeeded.

See CRBasic Editor Help for operational details on CRBasic instructions.

#### 7.7.12.3 Field Calibration Wizard Overview

The *LoggerNet* and *RTDAQ* field calibration wizards step you through the procedure by performing the mode-variable changes and measurements automatically. You set the sensor to known values and input those values into the wizard.

When a program with **FieldCal()** or **FieldCalStrain()** is running, select *LoggerNet* or *RTDAQ* | **Datalogger** | **Calibration Wizard** to start the wizard. A list of measurements used is shown.

For more information on using the calibration wizard, consult *LoggerNet* or *RTDAQ* Help.

#### 7.7.12.4 Field Calibration Numeric Monitor Procedures

Manual field calibration through the numeric monitor (in lieu of a on-board keyboard and display is presented here to introduce the use and function of the **FieldCal()** and **FieldCalStrain()** instructions. This section is not a comprehensive treatment of field-calibration topics. The most comprehensive resource to date covering use of **FieldCal()** and **FieldCalStrain()** is *RTDAQ* software documentation available at *www.campbellsci.com*. Be aware of the following precautions:

The CR3000 does not check for out-of-bounds values in mode variables.

• Valid mode variable entries are 1 or 4.

Before, during, and after calibration, one of the following codes will be stored in the **CalMode** variable:

TABLE 27: FieldCal() Codes		
Value Returned	State	
-1	Error in the calibration setup	
-2	Multiplier set to $\theta$ or $NAN$ ; measurement = $NAN$	
-3	<b>Reps</b> is set to a value other than 1 or the size of <b>MeasureVar</b>	
0	No calibration	
1	Ready to calculate ( <i>KnownVar</i> holds the first of a two point calibration)	
2	Working	
3	First point done (only applicable for two point calibrations)	
4	Ready to calculate ( <i>KnownVar</i> holds the second of a two-point calibration)	
5	Working (only applicable for two point calibrations)	
6	Calibration complete	

# 7.7.12.4.1 One-Point Calibrations (Zero or Offset)

Zero operation applies an offset of equal magnitude but opposite sign. For example, when performing a zeroing operation on a measurement of 15.3, the value -15.3 will be added to subsequent measurements.

Offset operation applies an offset of equal magnitude and same sign. For example, when performing an offset operation on a measurement of 15.3, the value 15.3 will be added to subsequent measurements.

See FieldCal() Zero or Tare (Opt 0) Example (p. 233) and FieldCal() Offset (Opt 1) Example (p. 235) for demonstration programs:

- Use a separate FieldCal() instruction and variables for each sensor to be calibrated. In the CRBasic program, put the FieldCal() instruction immediately below the associated measurement instruction.
- 2. Set mode variable = 0 or 6 before starting.
- 3. Place the sensor into zeroing or offset condition.
- 4. Set *KnownVar* variable to the offset or zero value.
- 5. Set mode variable = 1 to start calibration.

# 7.7.12.4.2 Two-Point Calibrations (gain and offset)

Use this two-point calibration procedure to adjust multipliers (slopes) and offsets (y intercepts). See *FieldCal() Slope and Offset (Opt 2) Example (p. 238)* and *FieldCal() Slope (Opt 3) Example (p. 240)* for demonstration programs:

- 1. Use a separate **FieldCal()** instruction and separate variables for each sensor to be calibrated.
- 2. Ensure mode variable =  $\mathbf{0}$  or  $\mathbf{6}$  before starting.
  - a. If **Mode** > **0** and  $\neq$  **6**, calibration is in progress.
  - b. If **Mode** < **0**, calibration encountered an error.
- 3. Place sensor into first known point condition.
- 4. Set *KnownVar* variable to first known point.
- 5. Set *Mode* variable = 1 to start first part of calibration.
  - a. Mode = 2 (automatic) during the first point calibration.
  - b. Mode = 3 (automatic) when the first point is completed.
- 6. Place sensor into second known point condition.
- 7. Set *KnownVar* variable to second known point.
- 8. Set *Mode* = 4 to start second part of calibration.
  - a. Mode = 5 (automatic) during second point calibration.
  - b. Mode = 6 (automatic) when calibration is complete.

#### 7.7.12.4.3 Zero Basis Point Calibration

Zero-basis calibration (**FieldCal()** instruction *Option 4*) is designed for use with static vibrating wire measurements. It loads values into zero-point variables to track conditions at the time of the zero calibration. See *FieldCal() Zero Basis (Opt 4) Example (p. 243)* for a demonstration program.

## 7.7.12.5 Field Calibration Examples

FieldCal() has the following calibration options:

- Zero
- Offset
- Two-point slope and offset

- Two-point slope only
- Zero basis (designed for use with static vibrating wire measurements)

These demonstration programs are provided as an aid in becoming familiar with the **FieldCal()** features at a test bench without actual sensors. For the purpose of the demonstration, sensor signals are simulated by CR3000 terminals configured for excitation. To reset tests, use the support software *File Control (p. 539)* menu commands to delete .cal files, and then send the demonstration program again to the CR3000. Term equivalents are as follows:

```
"offset" = "y- intercept" = "zero"
"multiplier" = "slope" = "gain"
```

# 7.7.12.5.1 FieldCal() Zero or Tare (Opt 0) Example

Most CRBasic measurement instructions have a *multiplier* and *offset* parameter. FieldCal() *Option 0* adjusts the *offset* argument such that the output of the sensor being calibrated is set to the value of the FieldCal() *KnownVar* parameter, which is set to 0. Subsequent measurements have the same offset subtracted. *Option 0* does not affect the *multiplier* argument.

Example Case: A sensor measures the relative humidity (RH) of air. Multiplier is known to be stable, but sensor offset drifts and requires regular zeroing in a desiccated chamber. The following procedure zeros the RH sensor to obtain the calibration report shown. To step through the example, use the CR1000KD Keyboard/Display or software *numeric monitor* (p. 547) to change variable values as directed.

TABLE 28: Calibration Report for Relative Humidity Sensor		
CRBasic Variable At Deployment At 30-Day Service		
SimulatedRHSignal output	<i>100</i> mV	<i>105</i> mV
KnownRH (desiccated chamber)	0 %	0 %
RHMultiplier	<b>0.05</b> % / mV	<b>0.05</b> % / mV
RHOffset	-5 %	-5.25 %
RH	0 %	0 %

- 1. Send CRBasic example *FieldCal() Zero (p. 234)* to the CR3000. A terminal configured for excitation has been programmed to simulate a sensor output.
- To place the simulated RH sensor in a simulated-calibration condition (in the field it would be placed in a desiccated chamber), place a jumper wire between terminals VX1 and SE1. The following variables are preset by the program: SimulatedRHSignal = 100, KnownRH = 0.

- 3. To start the 'calibration', set variable *CalMode* = 1. When *CalMode* increments to 6, zero calibration is complete. Calibrated *RHOffset* will equal 5% at this stage of this example.
- 4. To continue this example and simulate a zero-drift condition, set variable *SimulatedRHSignal* = *105*.
- 5. To simulate conditions for a 30-day-service calibration, again with desiccated chamber conditions, keep variable *KnownRH* = 0.0. Set variable *CalMode* = 1 to start calibration. When *CalMode* increments to 6, simulated 30-day-service zero calibration is complete. Calibrated *RHOffset* will equal -5.2 %.

```
CRBasic EXAMPLE 43: FieldCal() Zero
'This program example demonstrates the use of FieldCal() in calculating and applying a zero
'calibration. A zero calibration measures the signal magnitude of a sensor in a known zero
'condition and calculates the negative magnitude to use as an offset in subsequent
'measurements. It does not affect the multiplier.
'This program demonstrates the zero calibration with the following procedure:
 -- Simulate a signal from a relative-humidity sensor.
  -- Measure the 'sensor' signal.
' -- Calculate and apply a zero calibration.
'You can set up the simulation by loading this program into the CR3000 and interconnecting
'the following terminals with a jumper wire to simulate the relative-humidity sensor signal
'as follows:
' Vx1 --- SE1
'For the simulation, the initial 'sensor' signal is set automatically. Start the zero routine
'by setting variable CalMode = 1. When CalMode = 6 (will occur automatically after 10
'measurements), the routine is complete. Note the new value in variable RHOffset. Now
'enter the following millivolt value as the simulated sensor signal and note how the new
'offset is added to the measurement:
 SimulatedRHSignal = 1000
'NOTE: This program places a .cal file on the CPU: drive of the CR3000. The .cal file must
'be erased to reset the demonstration.
'DECLARE SIMULATED SIGNAL VARIABLE AND SET INITIAL MILLIVOLT SIGNAL MAGNITUDE
Public SimulatedRHSignal = 100
'DECLARE CALIBRATION STANDARD VARIABLE AND SET PERCENT RH MAGNITUDE
Public KnownRH = 0
'DECLARE MEASUREMENT RESULT VARIABLE.
Public RH
'DECLARE OFFSET RESULT VARIABLE
Public RHOffset
```

```
'DECLARE VARIABLE FOR FieldCal() CONTROL
Public CalMode
'DECLARE DATA TABLE FOR RETRIEVABLE CALIBRATION RESULTS
DataTable(CalHist,NewFieldCal,200)
  SampleFieldCal
EndTable
BeginProg
  'LOAD CALIBRATION CONSTANTS FROM FILE CPU:CALHIST.CAL
  'Effective after the zero calibration procedure (when variable CalMode = 6)
  LoadFieldCal(true)
  Scan(100, mSec, 0, 0)
    'SIMULATE SIGNAL THEN MAKE THE MEASUREMENT
    'Zero calibration is applied when variable CalMode = 6
    ExciteV(Vx1,SimulatedRHSignal,0)
   VoltSE(RH,1,mV2000,1,1,0,250,0.05,RHOffset)
    'PERFORM A ZERO CALIBRATION.
    'Start by setting variable CalMode = 1. Finished when variable CalMode = 6.
    'FieldCal(Function, MeasureVar, Reps, MultVar, OffsetVar, Mode, KnownVar, Index, Avg)
    FieldCal(0,RH,1,0,RHOffset,CalMode,KnownRH,1,30)
    'If there was a calibration, store calibration values into data table CalHist
    CallTable(CalHist)
  NextScan
EndProg
```

# 7.7.12.5.2 FieldCal() Offset (Opt 1) Example

Most CRBasic measurement instructions have a *multiplier* and *offset* parameter. FieldCal() *Option 1* adjusts the *offset* argument such that the output of the sensor being calibrated is set to the magnitude of the FieldCal() *KnownVar* parameter. Subsequent measurements have the same offset added. *Option 0* does not affect the *multiplier* argument. *Option 0* does not affect the *multiplier* argument.

Example Case: A sensor measures the salinity of water. Multiplier is known to be stable, but sensor offset drifts and requires regular offset correction using a standard solution. The following procedure offsets the measurement to obtain the calibration report shown.

TABLE 29: Calibration Report for Salinity Sensor		
CRBasic Variable At Deployment At Seven-Day Service		
SimulatedSalinitySignal output	<b>1350</b> mV	1345 mV
KnownSalintiy (standard solution)	<b>30</b> mg/l <b>30</b> mg/l	
SalinityMultiplier	<b>0.05</b> mg/l/mV <b>0.05</b> mg/l/mV	
SalinityOffset	-37.50 mg/l -37.23 mg/l	
Salinity reading	<b>30</b> mg/l	<b>30</b> mg/l

- 1. Send CRBasic example *FieldCal() Offset (p. 236)* to the CR3000. A terminal configured for excitation has been programmed to simulate a sensor output.
- 2. To simulate the salinity sensor in a simulated-calibration condition, (in the field it would be placed in a 30 mg/l standard solution), place a jumper wire between terminals **VX1** and **SE1**. The following variables are preset by the program: *SimulatedSalinitySignal* = 1350, *KnownSalinity* = 30.
- 3. To start a simulated calibration, set variable *CalMode* = 1. When *CalMode* increments to 6, offset calibration is complete. The calibrated offset will equal -37.48 mg/l.
- 4. To continue this example and simulate an offset-drift condition, set variable *SimulatedSalinitySignal* = 1345.
- 5. To simulate seven-day-service calibration conditions (30 mg/l standard solution), the variable *KnownSalinity* remains at *30.0*. Change the value in variable *CalMode* to *1* to start the calibration. When *CalMode* increments to *6*, the seven-day-service offset calibration is complete. Calibrated offset will equal *-37.23* mg/l.

#### CRBasic EXAMPLE 44: FieldCal() Offset

```
'This program example demonstrates the use of FieldCal() in calculating and applying an
'offset calibration. An offset calibration compares the signal magnitude of a sensor to a
'known standard and calculates an offset to adjust the sensor output to the known value.
'The offset is then used to adjust subsequent measurements.
'This program demonstrates the offset calibration with the following procedure:
 -- Simulate a signal from a salinity sensor.
' -- Measure the 'sensor' signal.
' -- Calculate and apply an offset.
'You can set up the simulation by loading this program into the CR3000 and interconnecting the
'following terminals with a jumper wire to simulate the salinity sensor signal as follows:
' Vx1 --- SE1
'For the simulation, the value of the calibration standard and the initial 'sensor' signal
'are set automatically. Start the calibration routine by setting variable CalMode = 1. When
'CalMode = 6 (will occur automatically after 10 measurements), the routine is complete.
'Note the new value in variable SalinityOffset. Now enter the following millivolt value as
'the simulated sensor signal and note how the new offset is added to the measurement:
' SimulatedSalinitySignal = 1345
'NOTE: This program places a .cal file on the CPU: drive of the CR3000. The .cal file must
'be erased to reset the demonstration.
'DECLARE SIMULATED SIGNAL VARIABLE AND SET INITIAL MAGNITUDE
Public SimulatedSalinitySignal = 1350
'DECLARE CALIBRATION STANDARD VARIABLE AND SET MAGNITUDE
Public KnownSalinity = 30
                                              'ma/1
'DECLARE MEASUREMENT RESULT VARIABLE.
Public Salinity
'DECLARE OFFSET RESULT VARIABLE
Public SalinityOffset
'DECLARE VARIABLE FOR FieldCal() CONTROL
Public CalMode
'DECLARE DATA TABLE FOR RETRIEVABLE CALIBRATION RESULTS
DataTable(CalHist,NewFieldCal,200)
 SampleFieldCal
EndTable
  'LOAD CALIBRATION CONSTANTS FROM FILE CPU:CALHIST.CAL
  'Effective after the zero calibration procedure (when variable CalMode = 6)
  LoadFieldCal(true)
  Scan(100, mSec, 0, 0)
```

```
'SIMULATE SIGNAL THEN MAKE THE MEASUREMENT
'Zero calibration is applied when variable CalMode = 6
ExciteV(Vx1,SimulatedSalinitySignal,0)
VoltSE(Salinity,1,mV2000,1,1,0,250,0.05,SalinityOffset)

'PERFORM AN OFFSET CALIBRATION.
'Start by setting variable CalMode = 1. Finished when variable CalMode = 6.
'FieldCal(Function, MeasureVar, Reps, MultVar, OffsetVar, Mode, KnownVar, Index, Avg)
FieldCal(1,Salinity,1,0,SalinityOffset,CalMode,KnownSalinity,1,30)

'If there was a calibration, store calibration values into data table CalHist
CallTable(CalHist)

NextScan
EndProg
```

## 7.7.12.5.3 FieldCal() Slope and Offset (Opt 2) Example

Most CRBasic measurement instructions have a *multiplier* and *offset* parameter. FieldCal() *Option 2* adjusts the *multiplier* and *offset* arguments such that the output of the sensor being calibrated is set to a value consistent with the linear relationship that intersects two known points sequentially entered in the FieldCal() *KnownVar* parameter. Subsequent measurements are scaled with the same multiplier and offset.

Example Case: A meter measures the volume of water flowing through a pipe. Multiplier and offset are known to drift, so a two-point calibration is required periodically at known flow rates. The following procedure adjusts multiplier and offset to correct for meter drift as shown in the calibration report below. Note that the flow meter outputs millivolts inversely proportional to flow.

TABLE 30: Calibration Report for Flow Meter		
CRBasic Variable	At Deployment	At Seven-Day Service
SimulatedFlowSignal	<b>300</b> mV	<b>285</b> mV
KnownFlow	<i>30</i> L/s	<i>30</i> L/s
SimulatedFlowSignal	<i>550</i> mV	<b>522</b> mV
KnownFlow	<i>10</i> L/s	<i>10</i> L/s
FlowMultiplier	<b>-0.0799</b> L/s/mV	<b>-0.0841</b> L/s/mV
FlowOffset	<b>53.90</b> L	<b>53.92</b> L

- 1. Send CRBasic example FieldCal() Two-Point Slope and Offset (p. 239) to the CR3000.
- 2. To place the simulated flow sensor in a simulated calibration condition (in the field a real sensor would be placed in a condition of know flow), place a jumper wire between terminals **VX1** and **SE1**.
- 3. Perform the simulated deployment calibration as follows:

- a. For the first point, set variable *SimulatedFlowSignal* = 300. Set variable *KnownFlow* = 30.0.
- b. Start the calibration by setting variable CalMode = 1.
- c. When *CalMode* increments to 3, for the second point, set variable *SimulatedFlowSignal* = 550. Set variable *KnownFlow* = 10.
- d. Resume the deployment calibration by setting variable *CalMode* = 4
- 4. When variable *CalMode* increments to 6, the deployment calibration is complete. Calibrated multiplier is **-0.08**; calibrated offset is **53.9**.
- 5. To continue this example, suppose the simulated sensor multiplier and offset drift. Simulate a seven-day service calibration to correct the drift as follows:
  - a. Set variable *SimulatedFlowSignal* = 285. Set variable *KnownFlow* = 30.0.
  - b. Start the seven-day service calibration by setting variable CalMode = 1.
  - c. When *CalMode* increments to 3, set variable *SimulatedFlowSignal* = 522. Set variable *KnownFlow* = 10.
  - d. Resume the calibration by setting variable CalMode = 4
- 6. When variable **CalMode** increments to **6**, the calibration is complete. The corrected multiplier is **-0.08**; offset is **53.9**.

#### CRBasic EXAMPLE 45: FieldCal() Two-Point Slope and Offset

'This program example demonstrates the use of FieldCal() in calculating and applying a 'multiplier and offset calibration. A multiplier and offset calibration compares signal 'magnitudes of a sensor to known standards. The calculated multiplier and offset scale the 'reported magnitude of the sensor to a value consistent with the linear relationship that 'intersects known points sequentially entered in to the FieldCal() KnownVar parameter. 'Subsequent measurements are scaled by the new multiplier and offset.

'This program demonstrates the multiplier and offset calibration with the following procedure:

- ' -- Simulate a signal from a flow sensor.
- ' -- Measure the 'sensor' signal.
- ' -- Calculate and apply a multiplier and offset.

'You can set up the simulation by loading this program into the CR3000 and interconnecting 'the following terminals with a jumper wire to simulate a flow sensor signal as follows: Vx1 --- SE1

'For the simulation, the value of the calibration standard and the initial 'sensor' signal 'are set automatically. Start the multiplier-and-offset routine by setting variable 'CalMode = 1. The value in CalMode will increment automatically. When CalMode = 3, set 'variables SimulatedFlowSignal = 550 and KnownFlow = 10, then set CalMode = 4. CalMode 'will again increment automatically. When CalMode = 6 (occurs automatically after 10

```
'measurements), the routine is complete. Note the new values in variables FlowMultiplier and
'FlowOffest. Now enter a new value in the simulated sensor signal as follows and note
'how the new multiplier and offset scale the measurement:
  SimulatedFlowSignal = 1000
'NOTE: This program places a .cal file on the CPU: drive of the CR3000. The .cal file must
'be erased to reset the demonstration.
'DECLARE SIMULATED SIGNAL VARIABLE AND SET INITIAL MAGNITUDE
Public SimulatedFlowSignal = 300
                                                   'Excitation mV, second setting is 550
'DECLARE CALIBRATION STANDARD VARIABLE AND SET MAGNITUDE
Public KnownFlow = 30
                                                   'Known flow, second setting is 10
'DECLARE MEASUREMENT RESULT VARIABLE.
Public Flow
'DECLARE MULTIPLIER AND OFFSET RESULT VARIABLES AND SET INITIAL MAGNITUDES
Public FlowMultiplier = 1
Public FlowOffset = 0
'DECLARE VARIABLE FOR FieldCal() CONTROL
Public CalMode
'DECLARE DATA TABLE FOR RETRIEVABLE CALIBRATION RESULTS
DataTable(CalHist,NewFieldCal,200)
 SampleFieldCal
FndTable
BeginProg
  'LOAD CALIBRATION CONSTANTS FROM FILE CPU: CALHIST. CAL
  'Effective after the zero calibration procedure (when variable CalMode = 6)
  LoadFieldCal(true)
  Scan(100,mSec,0,0)
    'SIMULATE SIGNAL THEN MAKE THE MEASUREMENT
    'Multiplier calibration is applied when variable CalMode = 6
   ExciteV(Vx1,SimulatedFlowSignal,0)
   VoltSE(Flow,1,mV5000,1,1,0,250,FlowMultiplier,FlowOffset)
    'PERFORM A MULTIPLIER CALIBRATION.
    'Start by setting variable CalMode = 1. Finished when variable CalMode = 6.
    'FieldCal(Function, MeasureVar, Reps, MultVar, OffsetVar, Mode, KnownVar, Index, Avg)
   FieldCal(2,Flow,1,FlowMultiplier,FlowOffset,CalMode,KnownFlow,1,30)
    'If there was a calibration, store it into a data table
    CallTable(CalHist)
 NextScan
EndProg
```

## 7.7.12.5.4 FieldCal() Slope (Opt 3) Example

Most CRBasic measurement instructions have a *multiplier* and *offset* parameter. FieldCal() *Option 3* adjusts the *multiplier* argument such that the output of the sensor being calibrated is set to a value consistent with the linear relationship that intersects two known points sequentially entered in the FieldCal() *KnownVar* 

parameter. Subsequent measurements are scaled with the same multiplier. FieldCal() *Option 3* does not affect *offset*.

Some measurement applications do not require determination of offset. Frequency analysis, for example, may only require relative data to characterize change.

Example Case: A soil-water sensor is to be used to detect a pulse of water moving through soil. A pulse of soil water can be detected with an offset, but sensitivity to the pulse is important, so an accurate multiplier is essential. To adjust the sensitivity of the sensor, two soil samples, with volumetric water contents of 10% and 35%, will provide two known points.

TABLE 31: Calibration Report for Water Content Sensor		
CRBasic Variable	At Deployment	
SimulatedWaterContentSignal	<i>175</i> mV	
KnownWC	10 %	
SimulatedWaterContentSignal	<i>700</i> mV	
KnownWC	35 %	
WCMultiplier	<b>0.0476</b> %/mV	

The following procedure sets the sensitivity of a simulated soil water-content sensor.

- 1. Send CRBasic example FieldCal() Multiplier (p. 241) to the CR3000.
- 2. To simulate the soil-water sensor signal, place a jumper wire between terminals **VX1** and **SE1**.
- 3. Simulate deployment-calibration conditions in two stages as follows:
  - a. Set variable *SimulatedWaterContentSignal* to *175*. Set variable *KnownWC* to *10.0*.
  - b. Start the calibration by setting variable CalMode = 1.
  - c. When *CalMode* increments to 3, set variable *SimulatedWaterContentSignal* to 700. Set variable *KnownWC* to 35.
  - d. Resume the calibration by setting variable *CalMode* = 4
- 4. When variable *CalMode* increments to 6, the calibration is complete. Calibrated multiplier is 0.0476.

#### CRBasic EXAMPLE 46: FieldCal() Multiplier

```
'This program example demonstrates the use of FieldCal() in calculating and applying a
'multiplier only calibration. A multiplier calibration compares the signal magnitude of a
'sensor to known standards. The calculated multiplier scales the reported magnitude of the
'sensor to a value consistent with the linear relationship that intersects known points
'sequentially entered in to the FieldCal() KnownVar parameter. Subsequent measurements are
'scaled by the multiplier.
'This program demonstrates the multiplier calibration with the following procedure:
 -- Simulate a signal from a water content sensor.
' -- Measure the 'sensor' signal.
' -- Calculate and apply an offset.
'You can set up the simulation by loading this program into the CR3000 and interconnecting
'the following terminals with a jumper wire to simulate a water content sensor signal as
'follows:
' Vx1 --- SE1
'For the simulation, the value of the calibration standard and the initial 'sensor' signal
'are set automatically. Start the multiplier routine by setting variable CalMode = 1. When
'CalMode = 6 (occurs automatically after 10 measurements), the routine is complete. Note the
'new value in variable WCMultiplier. Now enter a new value in the simulated sensor signal
'as follows and note how the new multiplier scales the measurement:
' SimulatedWaterContentSignal = 350
'NOTE: This program places a .cal file on the CPU: drive of the CR3000. The .cal file must
'be erased to reset the demonstration.
'DECLARE SIMULATED SIGNAL VARIABLE AND SET INITIAL MAGNITUDE
Public SimulatedWaterContentSignal = 175
                                            'mV, second setting is 700 mV
'DECLARE CALIBRATION STANDARD VARIABLE AND SET MAGNITUDE
Public KnownWC = 10
                                             '% by Volume, second setting is 35%
'DECLARE MEASUREMENT RESULT VARIABLE.
Public WC
'DECLARE MULTIPLIER RESULT VARIABLE AND SET INITIAL MAGNITUDE
Public WCMultiplier = 1
'DECLARE VARIABLE FOR FieldCal() CONTROL
Public CalMode
'DECLARE DATA TABLE FOR RETRIEVABLE CALIBRATION RESULTS
DataTable(CalHist,NewFieldCal,200)
 SampleFieldCal
EndTable
BeginProg
  'LOAD CALIBRATION CONSTANTS FROM FILE CPU: CALHIST. CAL
  'Effective after the zero calibration procedure (when variable CalMode = 6)
  LoadFieldCal(true)
  Scan(100.mSec.0.0)
    'SIMULATE SIGNAL THEN MAKE THE MEASUREMENT
    'Multiplier calibration is applied when variable CalMode = 6
   ExciteV(Vx1, SimulatedWaterContentSignal, 0)
   VoltSE(WC,1,mV2000,1,1,0,250,WCMultiplier,0)
```

```
'PERFORM A MULTIPLIER CALIBRATION.

'Start by setting variable CalMode = 1. Finished when variable CalMode = 6.

'FieldCal(Function, MeasureVar, Reps, MultVar, OffsetVar, Mode, KnownVar, Index, Avg)

FieldCal(3,WC,1,WCMultiplier,0,CalMode,KnownWC,1,30)

'If there was a calibration, store it into data table CalHist

CallTable(CalHist)

NextScan
EndProg
```

# 7.7.12.5.5 FieldCal() Zero Basis (Opt 4) Example

Zero-basis calibration (**FieldCal()** instruction *Option 4*) is designed for use in static vibrating wire measurements. For more information, refer to these manuals available at www.campbellsci.com:

AVW200-Series Two-Channel VSPECT Vibrating Wire Measurement Device CR6 Measurement and Control Datalogger Operators Manual

## 7.7.12.6 Field Calibration Strain Examples

#### Related Topics:

- Strain Measurements Overview (p. 74)
- Strain Measurements Details (p. 378)
- FieldCalStrain() Examples (p. 243)

Strain-gage systems consist of one or more strain gages, a resistive bridge in which the gage resides, and a measurement device such as the CR3000 datalogger. The **FieldCalStrain()** instruction facilitates shunt calibration of strain-gage systems and is designed exclusively for strain applications wherein microstrain is the unit of measure. The **FieldCal()** instruction (see *Field Calibration Examples (p. 232)*) is typically used in non-microstrain applications.

Shunt calibration of strain-gage systems is common practice. However, the technique provides many opportunities for misapplication and misinterpretation. This section is not intended to be a primer on shunt-calibration theory, but only to introduce use of the technique with the CR3000 datalogger. Campbell Scientific strongly urges users to study shunt-calibration theory from other sources. A thorough treatment of strain gages and shunt-calibration theory is available from Vishay using search terms such as 'micro-measurements', 'stress analysis', 'strain gages', 'calculator list', at:

http://www.vishaypg.com

# 7.7.12.6.1 FieldCalStrain() Shunt Calibration Concepts

- 1. Shunt calibration does not calibrate the strain gage itself.
- Shunt calibration does compensate for long leads and non-linearity in the
  resistive bridge. Long leads reduce sensitivity because of voltage drop.
  FieldCalStrain() uses the known value of the shunt resistor to adjust the gain
  (multiplier / span) to compensate. The gain adjustment (S) is incorporated by

**FieldCalStrain()** with the manufacturer's gage factor (GF), becoming the adjusted gage factor ( $GF_{adj}$ ), which is then used as the gage factor in **StrainCalc()**. GF is stored in the CAL file and continues to be used in subsequent calibrations. Non-linearity of the bridge is compensated for by selecting a shunt resistor with a value that best simulates a measurement near the range of measurements to be made. Strain-gage manufacturers typically specify and supply a range of resistors available for shunt calibration.

- 3. Shunt calibration verifies the function of the CR3000.
- 4. The zero function of **FieldCalStrain()** allows a particular strain to be set as an arbitrary zero, if desired. Zeroing is normally done after the shunt calibration.

Zero and shunt options can be combined in single CRBasic program.

CRBasic example FieldCalStrain() Calibration (p. 245) is provided to demonstrate use of FieldCalStrain() features. If a strain gage configured as shown in figure Quarter-Bridge Strain Gage with RC Resistor Shunt (p. 245) is not available, strain signals can be simulated by building the simple circuit, substituting a  $1000~\Omega$  potentiometer for the strain gage. To reset calibration tests, use the support software File Control (p. 539) menu to delete .cal files, and then send the demonstration program again to the CR3000.

Example Case: A  $1000 \Omega$  strain gage is placed into a resistive bridge at position R1. The resulting circuit is a quarter-bridge strain gage with alternate shunt-resistor (Rc) positions shown. Gage specifications indicate that the gage factor is 2.0 and that with a  $249 \text{ k}\Omega$  shunt, measurement should be about 2000 microstrain.

Send CRBasic example *FieldCalStrain() Calibration (p. 245)* as a program to a CR3000 datalogger.


## 7.7.12.6.2 FieldCalStrain() Shunt Calibration Example

CRBasic example FieldCalStrain() Calibration (p. 245) is provided to demonstrate use of **FieldCalStrain()** features. If a strain gage configured as shown in figure Quarter-Bridge Strain Gage with RC Resistor Shunt (p. 245) is not available, strain signals can be simulated by building the simple circuit, substituting a  $1000~\Omega$  potentiometer for the strain gage. To reset calibration tests, use the support software File Control (p. 539) menu to delete .cal files, and then send the demonstration program again to the CR3000.

Case: A 1000  $\Omega$  strain gage is placed into a resistive bridge at position R1. The resulting circuit is a quarter-bridge strain gage with alternate shunt-resistor (Rc) positions shown. Gage specifications indicate that the gage factor is 2.0 and that with a 249 k $\Omega$  shunt, measurement should be about 2000 microstrain.

Send CRBasic example *FieldCalStrain() Calibration (p. 245)* as a program to a CR3000 datalogger.

FIGURE 61: Quarter-Bridge Strain Gage with RC Resistor Shunt

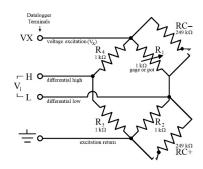

#### CRBasic EXAMPLE 47: FieldCalStrain() Calibration

```
'This program example demonstrates the use of the FieldCalStrain() instruction by measuring
'quarter-bridge strain-gage measurements.
Public Raw_mVperV
Public MicroStrain
'Variables that are arguments in the Zero Function
Public Zero Mode
Public Zero_mVperV
'Variables that are arguments in the Shunt Function
Public Shunt_Mode
Public KnownRes
Public GF_Adj
Public GF_Raw
'----- Tables -----
DataTable(CalHist,NewFieldCal,50)
 SampleFieldCal
EndTable
BeginProg
  'Set Gage Factors
 GF_Raw = 2.1
 GF_Adj = GF_Raw 'The adj Gage factors are used in the calculation of uStrain
  'If a calibration has been done, the following will load the zero or
  'Adjusted GF from the Calibration file
 LoadFieldCal(True)
```

```
Scan(100, mSec, 100, 0)
    'Measure Bridge Resistance
    BrFull(Raw_mVperV,1,mV50,1,Vx1,1,2500,True ,True ,0,250,1.0,0)
    'Calculate Strain for 1/4 Bridge (1 Active Element)
    StrainCalc(microStrain,1,Raw_mVperV,Zero_mVperV,1,GF_Adj,0)
    'Steps (1) & (3): Zero Calibration
    'Balance bridge and set Zero_Mode = 1 in numeric monitor. Repeat after
    'shunt calibration.
    FieldCalStrain(10,Raw_mVperV,1,0,Zero_mVperV,Zero_Mode,0,1,10,0 ,microStrain)
    'Step (2) Shunt Calibration
    'After zero calibration, and with bridge balanced (zeroed), set
    'KnownRes = to gage resistance (resistance of gage at rest), then set
    'Shunt_Mode = 1. When Shunt_Mode increments to 3, position shunt resistor
    'and set KnownRes = shunt resistance, then set Shunt_Mode = 4.
    FieldCalStrain(13,MicroStrain,1,GF_Adj,0,Shunt_Mode,KnownRes,1,10,GF_Raw,0)
   CallTable CalHist
 NextScan
EndProg
```

# 7.7.12.6.3 FieldCalStrain() Quarter-Bridge Shunt Example

With CRBasic example *FieldCalStrain() Calibration (p. 245)* sent to the CR3000, and the strain gage stable, use the CR1000KD Keyboard/Display or software numeric monitor to change the value in variable **KnownRes** to the nominal resistance of the gage, 1000  $\Omega$ , as shown in figure *Strain Gage Shunt Calibration Start (p. 246)*. Set **Shunt\_Mode** to 1 to start the two-point shunt calibration. When **Shunt\_Mode** increments to 3, the first step is complete.

To complete the calibration, shunt R1 with the 249 k $\Omega$  resistor. Set variable **KnownRes** to **249000**. As shown in figure *Strain Gage Shunt Calibration Finish* (p. 247), set **Shunt\_Mode** to **4**. When **Shunt\_Mode** = **6**, shunt calibration is complete.

 Raw m∨per∨
 -1.109

 MicroStrain
 2,117

 Zero Mode
 0

 Zero m∨per∨
 0.0000

 Shunt Mode
 1

 KnownRes
 1,000

 GF Adj
 2.100

2.100

GF Raw

FIGURE 62: Strain Gage Shunt Calibration Start

FIGURE 63: Strain Gage Shunt Calibration Finish

Raw mVperV MicroStrain	-1.109
MicroStrain	-2,215
Zero Mode	0
Zero m∨per∨	0.0000
Shunt Mode	6
KnownRes	249,000
GF Adj	-2.008
GF Raw	2.000

# 7.7.12.6.4 FieldCalStrain() Quarter-Bridge Zero

Continuing from FieldCalStrain() Quarter-Bridge Shunt Example (p. 246), keep the 249 k $\Omega$  resistor in place to simulate a strain. Using the CR1000KD Keyboard/Display or software numeric monitor, change the value in variable **Zero\_Mode** to 1 to start the zero calibration as shown in figure Zero Procedure Start (p. 247). When **Zero\_Mode** increments to 6, zero calibration is complete as shown in figure Zero Procedure Finish (p. 247).

FIGURE 64: Zero Procedure Start

Raw mVperV	-1.110
MicroStrain	-2,214
Zero Mode	1
Zero mVperV	0.0000
Shunt Mode	6
KnownRes	249,000
GF Adj	-2.010
GF Raw	2.000

FIGURE 65: Zero Procedure Finish

-1.110
0
6
-1.1096
6
249,000
-2.010
2.000

# 7.7.13 Measurement: Fast Analog Voltage

Measurement speed requirements vary widely. The following are examples:

- An agricultural weather station measures weather and soil sensors once every 10 seconds.
- A station that warns of rising water in a stream bed measures at 10 Hz.
- A station measuring mechanical stress measures at 1000 Hz.
- A station measuring the temperature of a grass fire measures at 93750 Hz.

TABLE: Maximum Measurement Speeds Using VoltSE() (p. 248) lists maximum speeds at which single-ended voltage inputs can be measured using the VoltSE() instruction. Differential measurements are slower. That fact that you can program the CR3000 to measure at these speeds, however, does not mean necessarily that you should. The integrity of measurements begins to come into question when fN1, which is the reciprocal of signal integration time, is larger than 15000, and when Settling Time is less than 500 μs. While programming the CR3000 for fast measurements, you must balance the need for data integrity with the need for speed.

TABLE 32: Maximum Measurement Speeds Using VoltSE()	
VoltSE() Measurement Type Maximum Speed on n Channels	
Fast Scan()	100 Hz, n = 16
Cluster Burst <sup>1,2</sup>	1000 Hz, $n = 1$ 500 Hz, $n = 2$
<b>Dwell Burst</b> <sup>1,3</sup>	$\leq$ 1735 samples @ 2000 Hz, $n = 1$

<sup>&</sup>lt;sup>1</sup> Bursts are programmed episodes of rapid analog measurements that cannot be maintained continuously. Input channels can be single-ended **SE** terminals or differential **H/L** terminal pairs. Bursts require pipeline mode and may require additional **Scan()** buffers. Test specific applications thoroughly before deployment.

You can make fast measurements with the following instructions:

- Single-Ended Instrucitons:
  - o TCSe()
  - BrHalf()

<sup>&</sup>lt;sup>2</sup> Cluster bursts loop through a series of channels, one measurement per channel, until the programmed loop count is complete.

<sup>&</sup>lt;sup>3</sup> Dwell bursts sit on one channel until the programmed measurement count is complete.

- o BrHalf3W()
- o BrHalf4W()
- o Therm107()
- o Therm108()
- Therm109()

#### • Differential Instructions:

- VoltDiff()
- o TCDiff()
- o BrFull()
- o BrFull6W()
- Resistance()

To do this, use the same programming techniques demonstrated in the following example programs. Actual measurements speeds will vary.

```
CRBasic EXAMPLE 48: Fast Analog Voltage Measurement: Fast Scan()
'This program makes 100 Hz measurements of one single-ended channel. The
'following programming features are key to making this application work:
'--PipelineMode enabled
'--Measurement speed set with Scan() Interval=10 and Units=mSec
'--Scan() BufferOption increased to 5
PipeLineMode
Public FastContinuousSE(1)
DataTable(FastContinuousSEData,1,-1)
 Sample(1, FastContinuousSE(), FP2)
EndTable
BeginProg
  'Scan(Interval, Units, BufferOption, Count)
  Scan(10, mSec, 5, 0)
    'VoltSe(Dest, Reps, Range, SEChan, MeasOff, SettlingTime, Integ, Mult, Offset)
    VoltSe(FastContinuousSE(),1,mV20,1,False,100,100,1.0,0)
    CallTable FastContinuousSEData
  NextScan
EndProg
```

# CRBasic EXAMPLE 49: Analog Voltage Measurement: Cluster Burst 'This program makes 500 measurements of two single-ended channels at 500 Hz. 'Sample pattern is 1,2,1,2. Measurement cycle is repeated every 1 Sec. The following 'programming features are key to making this application work: '--PipelingMode enabled. '--Measurement speed set as follows: ' Scan() Interval=1, Units=Sec. ' SubScan() SubInterval=2, Units=mSec, and Count= 500. '--Scan() BufferOption increased to 5. PipeLineMode Public ClusterBurstSE(2) DataTable(ClusterBurstSEData,1,-1) Sample(2,ClusterBurstSE(),FP2) EndTable BeginProg 'Scan(Interval, Units, BufferOption, Count) Scan(1,Sec,5,0) 'SubScan(SubInterval, Units, Count) SubScan(2,mSec,500) 'VoltSE(Dest, Reps, Range, SEChan, MeasOff, SettlingTime, Integ, Mult, Offset) VoltSe(ClusterBurstSE(),2,mV20,1,False,100,100,1.0,0) CallTable ClusterBurstSEData NextSubScan NextScan EndProg

# CRBasic EXAMPLE 50: Dwell Burst Measurement 'This program makes 1735 measurements of two single-ended channels at '2000 Hz. Sample pattern is 1,1,1..., pause, 2,2,2..., pause. 'Measurement cycle is repeated every 2 Sec. The following programming features are 'key to making this application work: '--PipelineMode.enabled. '--Dash (-) placed before channel number. '--Measurement count per channel set with VoltSE() Count=1735. '--Measurement speed set with VoltSE() SampleInterval $(\mu s)=500$ . '--Scan() BufferOption increased to 5. 'NOTES: '--Sampling occurs at the beginning of the Scan() interval. '--All measurements for one channel are placed in a single large variable array. '--The large array is stored in a single long record in the data table. '--The exact sampling interval is calculated as follows: ' SampleTime = 1.085069 \* INT((SampleInterval / 1.085069) + 0.5) PipeLineMode Public DwellBurstSE1(1735) Public DwellBurstSE2(1735) DataTable(DwellBurstSEData,1,-1) Sample(1735,DwellBurstSE1(),FP2) Sample(1735, DwellBurstSE2(), FP2) EndTable BeginProg 'Scan(Interval, Units, BufferOption, Count) Scan(2, Sec, 5, 0) 'VoltSE(Dest, Count, Range, -SEChan, MeasOff, SampleInterval (µs), Inteq, Mult, Offset) VoltSe(DwellBurstSE1(),1735,mV20,-1,False,500,100,1.0,0) VoltSe(DwellBurstSE2(),1735,mV20,-2,False,500,100,1.0,0) CallTable DwellBurstSEData NextScan EndProg

TABLE 33: Voltage Measurement Instruction Parameters for Dwell Burst	
Parameters	Description
Destination	A variable array dimensioned to store all measurements from one input. For example, the declaration,  Dim FastTemp(500)  dimensions array FastTemp() to store 500 measurements, which is one second of data at 500 Hz or one-half second of data at 1000 Hz.  The dimension can be any integer from 1 to 65535.
Count (was Repetitions)	The number of measurements to make on one channel. This number usually equals the number of elements dimensioned in the <i>Destination</i> array. Valid arguments range from <i>1</i> to <i>65535</i> .
Voltage Range	The analog-input voltage range to be used during measurements. No change from standard measurement mode. Use any valid voltage range. However, ranges appended with C cause measurements to be slower.
Single-Ended Channel	The single-ended analog-input terminal number preceded by a dash (-). Valid arguments range from -1 to -28.
Differential Channel	The differential analog input terminal number preceded by a dash (-). Valid arguments range from -1 to -14.
Measure Offset	No change from standard measurement mode. For fastest rate, set to <i>False</i> .
Measurements per Excitation	Must equal the value entered in <i>Repetitions</i> .
Reverse Ex	No change from standard measurement mode. For fastest rate, set to <i>False</i> .
Rev Diff	No change from standard measurement mode. For fastest rate, set to <i>False</i> .
SampleInterval (was SettlingTime)	Sample interval in µs. This argument determines the measurement rate.  • 500 µs interval = 2000 Hz rate  • 750 µs interval = 1333.33 Hz rate
Integ	Ignored if set to an integer.Arguments _50Hz and _60Hz are valid for ac rejection but are probably not very useful in burst applications.
Multiplier	No change from standard measurement mode. Enter the proper multiplier. This is the slope of the linear equation that equates output voltage to the measured phenomena. Any number greater or less than $\theta$ is valid.
Offset	No change from standard measurement mode. Enter the proper offset. This is the Y intercept of the linear equation that equates output voltage to the measured phenomena.

# 7.7.13.1 Tips — Fast Analog Voltage

• In the preceding examples, the CR3000 disables the auto self-calibration to reach the stated measurement speeds. Disabling auto self-calibration increases the risk of measurement errors, especially when the CR3000 is exposed to temperature swings.

- When testing and troubleshooting fast measurements, the following **Status** table registers may provide useful information:
  - O SkippedScan (p. 590)
  - O MeasureTime (p. 585)
  - O ProcessTime (p. 588)
  - O MaxProcTime (p. 584)
  - O BuffDepth (p. 577)
  - O MaxBuffDepth (p. 584)
- When the number of **Scan()/NextScan** *BufferOptions* is exceeded, a skipped scan occurs, which means a measurement was missed.
- Bursts have a duty cycle less than 100%. Assuming no other
  measurement instructions are present in the program, each burst occurs at
  the beginning of the Scan() *Interval*. During the rest of the scan, the
  CR3000 catches up on overhead tasks and processes data stored in
  buffers.
- If you wish to account for the time needed in the Scan()/NextScan *Interval*, consider the following two points:
  - Status table MeasureTime (p. 585) field reports the measurement time that occupies the Scan()/NextScan Interval. MeasureTime includes time needed to make measurements inside and outside SubScan()/NextSubScan.
  - O NextScan needs 100 μs to run
- One Scan()/NextScan buffer holds the raw measurements made in one main scan, inside and outside the sub-scan.

For example, one execution of the following code sequence stores 30000 measurements in one buffer:

```
'Scan(Interval, Units, BufferOption, Count)
Scan(40,Sec,3,0)
SubScan(2,mSec,10000)
VoltSe(Measurement(),3,mV5000,[U6]1,False,150,250,1.0,0)
NextSubScan
NextScan
```

- You can dwell burst more than one channel with the same program by adding a voltage measurement instruction for each channel to be measured. Channels will be measured in series.
- The following points apply to cluster burst measurements:
  - Measure smaller clusters for faster speeds.

- SubScan()/NextSubScan introduces potential problems. These are discussed in SubScan() / Next Sub (p. 165).
- o SubScan()/NextSubScan Counts cannot be larger than 65535.
- For SubScan()/NextSubScan to work, set Scan()/NextScan
   *Interval* large enough for *Counts* to finish before the next
   Scan()/NextScan *Interval*.

# 7.7.14 Measurement: Excite, Delay, Measure

This example demonstrates how to make voltage measurements that require excitation of controllable length prior to measurement. Overcoming the delay caused by a very long cable length on a sensor is a common application for this technique.

## CRBasic EXAMPLE 51: Measurement with Excitation and Delay

```
'This program example demonstrates how to perform an excite/delay/measure operation.
'In this example, the system requires 1 s of excitation to stabilize before the sensors
are measured. A single-ended measurement is made, and a separate differential measurement
'is made. To see this program in action, connect the following terminal pairs to simulate
'sensor connections:
      Vx1 ----- SE1
      Vx2 ----- DIFF 2 H
      DIFF 2 L ----- Ground Symbol
'With these connections made, variables VoltageSE and VoltageDiff will equal 2500 mV.
'Declare variables.
Public VoltageSE As Float
Public VoltageDIFF As Float
'Declare data table
DataTable (Voltage,True,-1)
 Sample (1,VoltageSE,Float)
 Sample (1,VoltageDIFF,Float)
EndTable
BeginProg
 Scan(5, sec, 0, 0)
    'Excite - delay 1 second - single-ended measurement:
   ExciteV (Vx1,2500,0) '<<<<Note: Delay = 0
   Delay (0,1000,mSec)
   VoltSe (VoltageSE, 1, mV5000, 1, 1, 0, 250, 1.0, 0)
```

```
'Excite - delay 1 second - differential measurement:
ExciteV (Vx2,2500,0) '<<<<Note: Delay = 0
Delay (0,1000,mSec)
VoltDiff (VoltageDIFF,1,mV5000,2,True,0,250,1.0,0)

'Write data to final-data memory
CallTable Voltage

NextScan
EndProg</pre>
```

## 7.7.15 Serial I/O: SDI-12 Sensor Support — Details

## Related Topics:

- SDI-12 Sensor Support Overview (p. 78)
- SDI-12 Sensor Support Details (p. 420)
- Serial I/O: SDI-12 Sensor Support Programming Resource (p. 255)

See the table CR3000 Terminal Definitions (p. 60) for C terminal assignments for SDI-12 input. Multiple SDI-12 sensors can be connected to each configured terminal. If multiple sensors are wired to a single terminal, each sensor must have a unique address. SDI-12 standard v 1.3 sensors accept addresses 0 through 9, a through z, and A through Z. For a CRBasic programming example demonstrating the changing of an SDI-12 address on the fly, see Campbell Scientific publication PS200/CH200 12 V Charging Regulators, which is available at www.campbellsci.com.

The CR3000 supports SDI-12 communication through two modes — transparent mode and programmed mode.

- Transparent mode facilitates sensor setup and troubleshooting. It allows commands to be manually issued and the full sensor response viewed.
   Transparent mode does not record data.
- Programmed mode automates much of the SDI-12 protocol and provides for data recording.

## 7.7.15.1 SDI-12 Transparent Mode


System operators can manually interrogate and enter settings in probes using transparent mode. Transparent mode is useful in troubleshooting SDI-12 systems because it allows direct communication with probes.

Transparent mode may need to wait for commands issued by the programmed mode to finish before sending responses. While in transparent mode, CR3000 programs may not execute. CR3000 security may need to be unlocked before transparent mode can be activated.

Transparent mode is entered while the PC is in comms with the CR3000 through a terminal emulator program. It is easily accessed through a terminal emulator. Campbell Scientific DevConfig program has a terminal utility, as to other *datalogger support software* (p. 91). Keyboard displays cannot be used.

To enter the SDI-12 transparent mode, enter the datalogger support software terminal emulator as shown in the figure *Entering SDI-12 Transparent Mode (p. 256)*. Press **Enter** until the CR3000 responds with the prompt **CR3000>**. Type **SDI12** at the prompt and press **Enter**. In response, the query **Enter Cx Port** is presented with a list of available ports. Enter the port number assigned to the terminal to which the SDI-12 sensor is connected. For example, port **1** is entered for terminal **C1**. An **Entering SDI12 Terminal** response indicates that SDI-12 transparent mode is active and ready to transmit SDI-12 commands and display responses.

FIGURE 66: Entering SDI-12 Transparent Mode

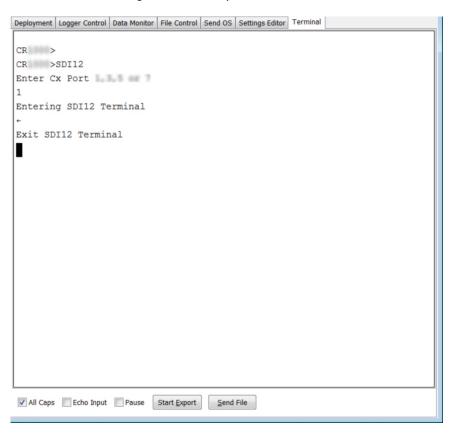

## 7.7.15.1.1 SDI-12 Transparent Mode Commands

Commands have three components:

- Sensor address (a) a single character, and is the first character of the command. Sensors are usually assigned a default address of zero by the manufacturer. Wildcard address (?) is used in the Address Query command. Some manufacturers may allow it to be used in other commands.
- Command body (for example, M1) an upper case letter (the "command") followed by alphanumeric qualifiers.
- Command termination (!) an exclamation mark.

An active sensor responds to each command. Responses have several standard forms and terminate with <CR><LF> (carriage return–line feed).

SDI-12 commands and responses are defined by the SDI-12 Support Group (www.sdi-12.org) and are summarized in the table *Standard SDI-12 Command & Response Set (p. 257).* Sensor manufacturers determine which commands to support. The most common commands are detailed in the table *SDI-12 Commands for Transparent Mode (p. 257).* 

TABLE 34: SDI-12 Commands for Transparent Mode					
Command Name	Command Syntax <sup>1</sup>	Response <sup>2</sup> Notes			
Break	Continuous spacing for at least 12 milliseconds	None			
Address Query	?!	a <cr><lf></lf></cr>			
Acknowledge Active	a!	a <cr><lf></lf></cr>			
Change Address	aAb!	<b>b</b> < <b>CR</b> >< <b>LF</b> > (support for this command is required only if the sensor supports software changeable addresses)			
Start Concurrent Measurement	aC!	atttnn <cr><lf></lf></cr>			
Additional Concurrent Measurements	aC1! aC9!	atttnn <cr><lf></lf></cr>			
Additional Concurrent Measurements and Request CRC	aCC1! aCC9!	atttnn <cr><lf></lf></cr>			
Send Data	aD0! aD9!	a <values><cr><lf> or a<values><crc><cr><lf></lf></cr></crc></values></lf></cr></values>			
Send Identification	aI!	allcccccccmmmmmmvvvvxxxx <cr><lf>. For example, 013CampbellCS1234003STD.03.01 means address = 0, SDI-12 protocol version number = 1.3, manufacturer is Campbell Scientific, CS1234 is the sensor model number (fictitious in this example), 003 is the sensor version number, STD.03.01 indicates the sensor revision number is .01.</lf></cr>			
Start Measurement <sup>3</sup>	aM!	atttn <cr><lf></lf></cr>			
Start Measurement and Request CRC <sup>3</sup>	aMC!	atttn <cr><lf></lf></cr>			
Additional Measurements <sup>3</sup>	aM1! aM9!	atttn <cr><lf></lf></cr>			
Additional Measurements and Request CRC <sup>3</sup>	aMC1! aMC9!	atttn <cr><lf></lf></cr>			
Continuous Measurements	aR0! aR9!	a <values><cr><lf> (formatted like the D commands)</lf></cr></values>			
Continuous Measurements and Request CRC	aRC0! aRC9!	a <values><crc><cr><lf> (formatted like the D commands)</lf></cr></crc></values>			
Start Verification <sup>3</sup>	aV!	atttn <cr><lf></lf></cr>			
		•			

TABLE 34: SDI-12 Commands for Transparent Mode			
Command Name	Command Syntax <sup>1</sup>	Response <sup>2</sup> Notes	

<sup>&</sup>lt;sup>1</sup> If the terminator '!' is not present, the command will not be issued. The CRBasic **SDI12Recorder()** instruction, however, will still pick up data resulting from a previously issued **C!** command.

#### SDI-12 Address Commands

Address and identification commands request metadata about the sensor. Connect only a single probe when using these commands.

?!

Requests the sensor address. Response is address, a.

Syntax:

?!

#### aAb!

Changes the sensor address. **a** is the current address and **b** is the new address. Response is the new address.

Syntax:

aAb!

aI!

Requests the sensor identification. Response is defined by the sensor manufacturer, but usually includes the sensor address, SDI-12 version, manufacturer's name, and sensor model information. Serial number or other sensor specific information may also be included.

Syntax:

aI!

An example of a response from the aI! command is:

013NRSYSINC1000001.2101 <CR><LF>

where:

0 is the SDI-12 address.13 is the SDI-12 version (1.3).NRSYSINC indicates the manufacturer.

<sup>&</sup>lt;sup>2</sup> Complete response string can be obtained when using the **SDI12Recorder()** instruction by declaring the **Destination** variable **as String**.

<sup>&</sup>lt;sup>3</sup> This command may result in a service request.

100000 indicates the sensor model.1.2 is the sensor version.101 is the sensor serial number.

#### **SDI-12 Start Measurement Commands**

Measurement commands elicite responses in the form:

atttnn

where:

a is the sensor address
ttt is the time (s) until measurement data are available
nn is the number of values to be returned when one or more subsequent D!
commands are issued.

#### aMv!

Starts a standard measurement. Qualifier  $\mathbf{v}$  is a variable between 1 and 9. If supported by the sensor manufacturer,  $\mathbf{v}$  requests variant data. Variants may include alternate units (e.g., °C or °F), additional values (e.g., level and temperature), or a diagnostic of the sensor internal battery.

Syntax:

aMv!

As an example, the response from the command 5M! is:

500410

where:

**5** reports the sensor SDI-12 address.

**004** indicates the data will be available in 4 seconds.

10 indicates that 10 values will be available.

The command **5M7!** elicites a similar response, but the appendage **7** instructs the sensor to return the voltage of the internal battery.

#### aC!

Start concurrent measurement. The CR3000 requests a measurement, continues program execution, and picks up the requested data on the next pass through the program. A measurement request is then sent again so data are ready on the next scan. The datalogger scan rate should be set such that the resulting skew between time of measurement and time of data collection does not compromise data integrity. This command is new with v. 1.2 of the SDI-12 specification.

Syntax:

aC!

## Aborting an SDI-12 Measurement Command

A measurement command (M! or C!) is aborted when any other valid command is sent to the sensor.

#### SDI-12 Send Data Command

Send data commands are normally issued automatically by the CR3000 after the **aMv!** or **aCv!** measurement commands. In transparent mode through CR3000 terminal commands, you need to issue these commands in series. When in automatic mode, if the expected number of data values are not returned in response to a **aD0!** command, the datalogger issues **aD1!**, **aD2!**, etc., until all data are received. In transparent mode, you must do likewise. The limiting constraint is that the total number of characters that can be returned to a **aDv!** command is 35 (75 for **aCv!**). If the number of characters exceed the limit, the remainder of the response are obtained with subsequent **aDv!** commands wherein **v** increments with each iteration.

aDv!

Request data from the sensor.

Example Syntax:

aD0!

## SDI-12 Continuous Measurement Command (aR0! to aR9!)

Sensors that are continuously monitoring, such as a shaft encoder, do not require an M command. They can be read directly with the Continuous Measurement Command (R0! to R9!). For example, if the sensor is operating in a continuous measurement mode, then aR0! will return the current reading of the sensor. Responses to R commands are formatted like responses to send data (aDv!) commands. The main difference is that R commands do not require a preceding M command. The maximum number of characters returned in the <values> part of the response is 75.

Each **R** command is an independent measurement. For example, **aR5!** need not be preceded by **aR0!** through **aR4!**. If a sensor is unable to take a continuous measurement, then it must return its address followed by **<CR><LF>** (carriage return and line feed) in response to an **R** command. If a CRC was requested, then the **<CR><LF>** must be preceded by the CRC.

aRv!

Request continuous data from the sensor.

Example Syntax:

aR5!

#### 7.7.15.2 SDI-12 Recorder Mode

The CR3000 can be programmed to act as an SDI-12 recording device or as an SDI-12 sensor.

For troubleshooting purposes, responses to SDI-12 commands can be captured in programmed mode by placing a variable declared **As String** in the variable parameter. Variables not declared **As String** will capture only numeric data.

Another troubleshooting tool is the terminal-mode snoop utility, which allows monitoring of SDI-12 traffic. Enter terminal mode as described in *SDI-12 Transparent Mode (p. 255)*, issue CRLF (**Enter>** key) until CR3000> prompt appears. Type **W** and then **Enter>**. Type **9** in answer to **Select:**, **100** in answer to **Enter timeout (secs):**, **Y** to **ASCII (Y)?**. SDI-12 communications are then opened for viewing.

The SDI12Recorder() instruction automates the issuance of commands and interpretation of sensor responses. Commands entered into the SDIRecorder() instruction differ slightly in function from similar commands entered in transparent mode. In transparent mode, for example, the operator manually enters aM! and aD0! to initiate a measurement and get data, with the operator providing the proper time delay between the request for measurement and the request for data. In programmed mode, the CR3000 provides command and timing services within a single line of code. For example, when the SDI12Recorder() instruction is programmed with the M! command (note that the SDI-12 address is a separate instruction parameter), the CR3000 issues the aM! and aD0! commands with proper elapsed time between the two. The CR3000 automatically issues retries and performs other services that make the SDI-12 measurement work as trouble free as possible. Table SDI-12Recorder() Commands (p. 261) summarizes CR3000 actions triggered by some SDI12Recorder() commands.

If the **SDI12Recorder()** instruction is not successful, **NAN** will be loaded into the first variable. See NAN and  $\pm INF$  (p. 506) for more information.

TABLE 35: SDI-12 Commands for Programmed (SDIRecorder()) Mode					
Command Name	SDIRecorder() SDICommand Argument	SDI-12 Command Sent Sensor Response <sup>1</sup> CR3000 Response Notes			
Address Query	?!	CR3000: issues a?! command. Only one sensor can be attached to the C terminal configured for SDI-12 for this command to elicit a response. Sensor must support this command.			
Change Address	Ab!	CR3000: issues aAb! command			
Concurrent Measurement	Cv!, CCv!	CR3000: issues aCv! command			
		Sensor: responds with atttnn			

Command Name	SDIRecorder() SDICommand Argument	SDI-12 Command Sent Sensor Response <sup>1</sup> CR3000 Response Notes		
		CR3000: if $ttt = 0$ , issues <b>aDv!</b> command(s). If $nnn = 0$ then <b>NAN</b> put in the first element of the array.		
		Sensor: responds with data		
		CR3000: else, if <b>ttt</b> > 0 then moves to next CRBasic program instruction		
		CR3000: at next time <b>SDIRecorder()</b> is executed, if elapsed time < <b>ttt</b> , moves to next CRBasic instruction		
		CR3000: else, issues aDv! command(s)		
		Sensor: responds with data		
		CR3000: issues <b>aCv!</b> command (to request data for next scan)		
	Cv	CR3000: tests to see if ttt expired. If ttt not expired, loads 1e9 into first variable		
Alternate Concurrent Measurement	(note — no! termination) <sup>2</sup>	and then moves to next CRBasic instruction. If the expired, issues aDv! command(s). See section Alternate Start Concurrent Measurement Command (Cv) (p. 263)		
		Sensor: responds to <b>aDv!</b> command(s) with data, if any. If no data, loads NAN into variable.		
		CR3000: moves to next CRBasic instruction (does not re-issue aCv! command)		
Send Identification	I!	CR3000: issues aI! command		
Start Measurement	M!, Mv!, MCv!	CR3000: issues aMv! command		
		Sensor: responds with atttnn		
		CR3000: If $nnn = 0$ then <b>NAN</b> put in the first element of the array.		
		CR3000: waits until <b>ttt</b> <sup>3</sup> seconds (unless a service request is received). Issues <b>aDv!</b> command(s). If a service request is received, issues <b>aDv!</b> immediately.		
		Sensor: responds with data		
Continuous Measurements	Rv!, RCv!	CR3000: issues aRv! command		
Start Verification	V!	CR3000: issues aV! command		

<sup>&</sup>lt;sup>1</sup>See table SDI-12 Commands for Transparent Mode (p. 257) for complete sensor responses.

<sup>&</sup>lt;sup>2</sup>Use variable replacement in program to use same instance of **SDI12Recorder()** as issued **aCV!** (see the CRBasic example *Using Alternate Concurrent Command (aC)* (p. 266)).

<sup>&</sup>lt;sup>3</sup>Note that **ttt** is local only to the **SDIRecorder()** instruction. If a second **SDIRecorder()** instruction is used, it will have its own **ttt**.

### 7.7.15.2.1 Alternate Start Concurrent Measurement Command

Note **aCv** and **aCv!** are different commands — **aCv** does not end with !.

The **SDIRecorder()** aCv command facilitates using the SDI-12 standard Start Concurrent command (aCv!) without the back-to-back measurement sequence normal to the CR3000 implementation of aCv!.

Consider an application wherein four SDI-12 temperature sensors need to be near-simultaneously measured at a five minute interval within a program that scans every five seconds. The sensors requires 95 seconds to respond with data after a measurement request. Complicating the application is the need for minimum power usage, so the sensors must power down after each measurement.

This application provides a focal point for considering several measurement strategies. The simplest measurement is to issue a **M!** measurement command to each sensor as shown in the following CRBasic example:

```
Public BatteryVolt
Public Temp1, Temp2, Temp3, Temp4

BeginProg
   Scan(5,Sec,0,0)

   'Non-SDI-12 measurements here

   SDI12Recorder(Temp1,1,0,"M!",1.0,0)
   SDI12Recorder(Temp2,1,1,"M!",1.0,0)
   SDI12Recorder(Temp3,1,2,"M!",1.0,0)
   SDI12Recorder(Temp4,1,3,"M!",1.0,0)
   NextScan
EndProg
```

However, the code sequence has three problems:

- 1. It does not allow measurement of non-SDI-12 sensors at the required frequency because the **SDI12Recorder()** instruction takes too much time.
- 2. It does not achieve required five-minute sample rate because each **SDI12Recorder()** instruction will take about 95 seconds to complete before the next **SDI12Recorder()** instruction begins, resulting is a real scan rate of about 6.5 minutes.
- 3. There is a 95 s time skew between each sensor measurement.

Problem 1 can be remedied by putting the SDI-12 measurements in a **SlowSequence** scan. Doing so allows the SDI-12 routine to run its course without affecting measurement of other sensors, as follows:

```
Public BatteryVolt
Public Temp(4)
BeginProg
Scan(5,Sec,0,0)
```

```
'Non-SDI-12 measurements here
NextScan

SlowSequence
   Scan(5,Min,0,0)
    SDI12Recorder(Temp(1),1,0,"M!",1.0,0)
    SDI12Recorder(Temp(2),1,1,"M!",1.0,0)
    SDI12Recorder(Temp(3),1,2,"M!",1.0,0)
    SDI12Recorder(Temp(4),1,3,"M!",1.0,0)
    NextScan
   EndSequence
EndProg
```

However, problems 2 and 3 still are not resolved. These can be resolved by using the concurrent measurement command, C!. All measurements will be made at about the same time and execution time will be about 95 seconds, well within the 5 minute scan rate requirement, as follows:

```
Public BatteryVolt
Public Temp(4)

BeginProg

Scan(5,Sec,0,0)
    'Non-SDI-12 measurements here
NextScan

SlowSequence
    Scan(5,Min,0,0)
    SDI12Recorder(Temp(1),1,0,"C!",1.0,0)
    SDI12Recorder(Temp(2),1,1,"C!",1.0,0)
    SDI12Recorder(Temp(3),1,2,"C!",1.0,0)
    SDI12Recorder(Temp(4),1,3,"C!",1.0,0)
    NextScan
EndProg
```

A new problem introduced by the C! command, however, is that it causes high power usage by the CR3000. This application has a very tight power budget. Since the C! command reissues a measurement request immediately after receiving data, the sensors will be in a high power state continuously. To remedy this problem, measurements need to be started with C! command, but stopped short of receiving the next measurement command (hard-coded part of the C! routine) after their data are polled. The SDI12Recorder() instruction C command (not C!) provides this functionality as shown in CRBasic example Using Alternate Concurrent Command (aC) (p. 266). A modification of this program can also be used to allow near-simultaneous measurement of SDI-12 sensors without requesting additional measurements, such as may be needed in an event-driven measurement.

**Note** When only one SDI-12 sensor is attached, that is, multiple sensor measurements do not need to start concurrently, another reliable method for making SDI-12 measurements without affecting the main scan is to use the CRBasic **SlowSequence** instruction and the SDI-12 **M!** command. The main scan will continue to run during the *ttt* time returned by the SDI-

12 sensor. The trick is to synchronize the returned SDI-12 values with the main scan.

**aCv** 

Start alternate concurrent measurement.

Syntax:

aCv

```
CRBasic EXAMPLE 52: Using SDI12Sensor() to Test Cv Command
'This program example demonstrates how to use CRBasic to simulate four SDI-12 sensors. This
program can be used to
'produce measurements to test the CRBasic example Using Alternate Concurrent Command (aC) (p.
Public Temp(4)
DataTable(Temp,True,0)
 DataInterval(0,5,Min,10)
  Sample(4,Temp(),FP2)
EndTable
BeginProg
 Scan(5, Sec, 0, 0)
    PanelTemp(Temp(1),250) 'Measure CR3000 wiring panel temperature to use as base for
                            'simulated temperatures Temp(2), Temp(3), and Temp(4).
   Temp(2) = Temp(1) + 5
   Temp(3) = Temp(1) + 10
   Temp(4) = Temp(1) + 15
   CallTable Temp
  NextScan
  S1owSequence
   Do
      'Note SDI12SensorSetup / SDI12SensorResponse must be renewed
      'after each successful SDI12Recorder() poll.
      SDI12SensorSetup(1,1,0,95)
      Delay(1,95,Sec)
      SDI12SensorResponse(Temp(1))
    Loop
  EndSequence
  SlowSequence
   Do
      SDI12SensorSetup(1,3,1,95)
      Delay(1,95,Sec)
      SDI12SensorResponse(Temp(2))
   Loop
  EndSequence
```

```
SlowSequence
Do
SDI12SensorSetup(1,5,2,95)
Delay(1,95,Sec)
SDI12SensorResponse(Temp(3))
Loop
EndSequence
SlowSequence
Do
SDI12SensorSetup(1,7,3,95)
Delay(1,95,Sec)
SDI12SensorResponse(Temp(4))
Loop
EndSequence
EndProg
```

## CRBasic EXAMPLE 53: Using Alternate Concurrent Command (aC)

```
'This program example demonstrates the use of the special SDI-12 concurrent measurement
'command (aC) when back-to-back measurements are not desired, as can occur in an application
'that has a tight power budget. To make full use of the aC command, measurement control
'logic is used.
'Declare variables
Dim X
Public RunSDI12
Public Cmd(4)
Public Temp_Tmp(4)
Public Retry(4)
Public IndDone(4)
Public Temp_Meas(4)
Public GroupDone
'Main Program
BeginProg
'Preset first measurement command to C!
 For X = 1 To 4
   cmd(X) = "C!"
 Next X
  'Set five-second scan rate
  Scan(5,Sec,0,0)
    'Other measurements here
    'Set five-minute SDI-12 measurement rate
   If TimeIntoInterval(0,5,Min) Then RunSDI12 = True
    'Begin measurement sequence
   If RunSDI12 = True Then
      For X = 1 To 4
       Temp\_Tmp(X) = 2e9
                                            'when 2e9 changes, indicates a change
      Next X
```

```
'Measure SDI-12 sensors
      SDI12Recorder(Temp\_Tmp(1),1,0,cmd(1),1.0,0)
      SDI12Recorder(Temp\_Tmp(2),1,1,cmd(2),1.0,0)
      SDI12Recorder(Temp\_Tmp(3),1,2,cmd(3),1.0,0)
      SDI12Recorder(Temp\_Tmp(4),1,3,cmd(4),1.0,0)
      'Control Measurement Event
      For X = 1 To 4
        If cmd(X) = "C!" Then Retry(X) = Retry(X) + 1
        If Retry(X) > 2 Then IndDone(X) = -1
        'Test to see if ttt expired. If ttt not expired, load "1e9" into first variable
        'then move to next instruction. If ttt expired, issue aDv! command(s).
        If ((Temp\_Tmp(X) = 2e9) OR (Temp\_Tmp(X) = 1e9)) Then
          cmd(X) = "C"
                                               'Start sending "C" command.
                                              'Comms failed or sensor not attached
        ElseIf(Temp_Tmp(X) = NAN) Then
          cmd(X) = "C!"
                                              'Start measurement over
        Else 'C!/C command sequence complete
          Move(Temp_Meas(X),1,Temp_Tmp(X),1) 'Copy measurements to SDI_Val(10)
          cmd(X) = "C!"
                                              'Start next measurement with "C!"
          IndDone(X) = -1
        EndIf
      Next X
      'Summarize Measurement Event Success
      For X = 1 To 4
        GroupDone = GroupDone + IndDone(X)
      Next X
      'Stop current measurement event, reset controls
      If GroupDone = -4 Then
        RunSDI12 = False
        GroupDone = 0
        For X = 1 To 4
          IndDone(X) = 0
          Retry(X) = 0
        Next X
      Flse
        GroupDone = 0
      EndIf
    EndIf
                                              'End of measurement sequence
  NextScan
EndProg
```

## 7.7.15.2.2 SDI-12 Extended Command Support

**SDI12Recorder()** sends any string enclosed in quotation marks in the *Command* parameter. If the command string is a non-standard SDI-12 command, any response is captured into the variable assigned to the *Destination* parameter, so long as that variable is declared **As String**. CRBasic example *Use of an SDI-12 Extended Command (p. 268)* shows appropriate code for sending an extended SDI-12 command and receiving the response. The extended command feature has no built-in provision for responding with follow-up commands. However, the

program can be coded to parse the response and issue subsequent SDI-12 commands based on a customized evaluation of the response. See *Serial I/O Input Programming Basics (p. 311)*.

## CRBasic EXAMPLE 54: Using an SDI-12 Extended Command

```
'This program example demonstrates the use of SDI-12 extended commands. In this example,
'a temperature measurement, tt.tt, is sent to a CH200 Charging Regulator using the command
'XTtt.tt!'. The response from the CH200 should be 'OOK', if 0 is the SDI-12 address.

'Declare Variables
Public PTemp As Float
Public SDI12command As String

'Main Program
BeginProg
Scan(20,Sec,3,0)
PanelTemp(PTemp,250)
SDI12command = "XT" & FormatFloat(PTemp, "%4.2f") & "!"
SDI12Recorder(SDI12result,1,0,SDI12command,1.0,0)
NextScan
EndProg
```

#### 7.7.15.3 SDI-12 Sensor Mode

The CR3000 can be programmed to act as an SDI-12 recording device or as an SDI-12 sensor.

For troubleshooting purposes, responses to SDI-12 commands can be captured in programmed mode by placing a variable declared **As String** in the variable parameter. Variables not declared **As String** will capture only numeric data.

Another troubleshooting tool is the terminal-mode snoop utility, which allows monitoring of SDI-12 traffic. Enter terminal mode as described in SDI-12 Transparent Mode (p. 255), issue CRLF (<Enter> key) until CR3000> prompt appears. Type W and then <Enter>. Type 9 in answer to Select:, 100 in answer to Enter timeout (secs):, Y to ASCII (Y)?. SDI-12 communications are then opened for viewing.

The SDI12SensorSetup() / SDI12SensorResponse() instruction pair programs the CR3000 to behave as an SDI-12 sensor. A common use of this feature is the transfer of data from the CR3000 to other Campbell Scientific dataloggers over a single-wire interface (terminal configured for SDI-12 to terminal configured for SDI-12), or to transfer data to a third-party SDI-12 recorder.

Details of using the **SDI12SensorSetup()** / **SDI12SensorResponse()** instruction pair can be found in the *CRBasic Editor Help*. Other helpful tips include:

Concerning the *Reps* parameter in the **SDI12SensorSetup()**, valid *Reps* when expecting an **aMx!** command range from 0 to 9. Valid *Reps* when expecting an **aCx!** command are 0 to 20. The *Reps* parameter is not range-checked for valid entries at compile time. When the SDI-12 recorder receives the sensor response of **atttn** to a **aMx!** command, or **atttnn** to a **aCx!** command, only the first digit **n**, or the first two digits **nn**, are used. For example, if *Reps* is mis-programmed as

123, the SDI-12 recorder will accept only a response of  $\mathbf{n} = 1$  when issuing an  $\mathbf{aMx!}$  command, or a response of  $\mathbf{nn} = 12$  when issuing an  $\mathbf{aCx!}$  command.

When programmed as an SDI-12 sensor, the CR3000 will respond to SDI-12 commands **M**, **MC**, **C**, **CC**, **R**, **RC**, **V**, **?**, and **I**. See table *SDI-12 Commands for Transparent Mode (p. 257)* for full command syntax. The following rules apply:

- A CR3000 can be assigned only one SDI-12 address per SDI-12 port. For example, a CR3000 will not respond to both 0M! AND 1M! on SDI-12 port C1. However, different SDI-12 ports can have unique SDI-12 addresses. Use a separate SlowSequence for each SDI-12 port configured as a sensor.
- 2. The CR3000 will handle additional measurement (**aMx!**) commands. When an SDI-12 recorder issues **aMx!** commands as shown in CRBasic example SDI-12 Sensor Setup (p. 269), measurement results are returned as listed in table SDI-12 Sensor Setup Results (p. 270).

```
CRBasic EXAMPLE 55: SDI-12 Sensor Setup
```

```
'This program example demonstrates the use of the SDI12SensorSetup()/SDI12SensorResponse()
'instruction pair to program the CR3000 to emulate an SDI-12 sensor. A common use of this
'feature is the transfer of data from the CR3000 to SDI-12 compatible instruments, including
'other Campbell Scientific dataloggers, over a single-wire interface (SDI-12 port to
'SDI-12 port). The recording datalogger simply requests the data using the aDO! command.
Public PanelTemp
Public Batt volt
Public SDI_Source(10)
BeainProa
  Scan(5, Sec, 0, 0)
    PanelTemp(PanelTemp, 250)
    Battery(batt_volt)
                                             'temperature, degrees C
    SDI_Source(1) = PanelTemp
    SDI_Source(2) = batt_volt
                                             'primary power, volts dc
    SDI_Source(3) = PanelTemp * 1.8 + 32
                                             'temperature, degrees F
    SDI_Source(4) = batt_volt
                                             'primary power, volts dc
    SDI_Source(5) = PanelTemp
                                             'temperature, degrees C
    SDI_Source(6) = batt_volt * 1000
                                             'primary power, millivolts dc
    SDI_Source(7) = PanelTemp * 1.8 + 32
                                             'temperature in degrees F
    SDI_Source(8) = batt_volt * 1000
                                             'primary power, millivolts dc
    SDI_Source(9) = Status.SerialNumber
                                             'serial number
    SDI_Source(10) = Status.LithiumBattery
                                             'data backup battery, V
NextScan
  S1owSequence
    Dο
      SDI12SensorSetup(10,1,0,1)
     Delay(1,500,mSec)
      SDI12SensorResponse(SDI_Source)
    Loop
  EndSequence
EndProg
```

TABLE 36: SDI-12 Sensor Configuration CRBasic Example — Results					
Measurement Command from SDI-12 Recorder	Source Variables Accessed from the CR3000 acting as a SDI-12 Sensor	Contents of Source Variables			
0M!	Source(1), Source(2)	Temperature °C, battery voltage			
<i>0M0!</i>	Same as <i>0M!</i>				
0M1!	Source(3), Source(4)	Temperature °F, battery voltage			
0M2!	Source(5), Source(6)	Temperature °C, battery mV			
0M3!	Source(7), Source(8)	Temperature °F, battery mV			
0M4!	Source(9), Source(10)	Serial number, lithium battery voltage			

## 7.7.15.4 SDI-12 Power Considerations

When a command is sent by the CR3000 to an SDI-12 probe, all probes on the same SDI-12 port will wake up. However, only the probe addressed by the datalogger will respond. All other probes will remain active until the timeout period expires.

## Example:

Probe: Water Content

## Power Usage:

• Quiescent: 0.25 mA

• Measurement: 120 mA

• Measurement time: 15 s

• Active: 66 mA

• Timeout: 15 s

Probes 1, 2, 3, and 4 are connected to SDI-12 / control port C1.

The time line in table *Example Power Usage Profile for a Network of SDI-12 Probes* (p. 271) shows a 35 second power-usage profile example.

For most applications, total power usage of 318 mA for 15 seconds is not excessive, but if 16 probes were wired to the same SDI-12 port, the resulting

power draw would be excessive. Spreading sensors over several SDI-12 terminals will help reduce power consumption.

Time into Measuremen t Process (s)	Command	All Probes Awake	Time Out Expires	Probe 1 (mA <sup>1</sup> )	Probe 2 (mA <sup>1</sup> )	Probe 3 (mA <sup>1</sup> )	Probe 4 (mA <sup>1</sup> )	Total mA
Sleep				0.25	0.25	0.25	0.25	1
1	1M!	Yes		120	66	66	66	318
2–14				120	66	66	66	318
15			Yes	120	66	66	66	318
16	1D0!	Yes		66	66	66	66	264
17–29				66	66	66	66	264
30			Yes	66	66	66	66	264
Sleep				0.25	0.25	0.25	0.25	1

<sup>&</sup>lt;sup>1</sup> Current use:

0.25 mA = sleep

66 mA = awake

120 mA = measuring

# 7.7.16 Compiling: Conditional Code

This feature circumvents system filters that look at file extensions for specific loggers; it makes possible the writing of a single file of code to run on multiple models of CRBasic dataloggers.

When a CRBasic user program is sent to the CR3000, an exact copy of the program is saved as a file on the *CPU: drive (p. 442).* A binary version of the program, the "operating program", is created by the CR3000 compiler and written to *Operating Memory (p. 443, http://www.).* This is the program version that runs the CR3000.

CRBasic allows definition of conditional code, preceded by a hash character (#), in the CRBasic program that is compiled into the operating program depending on the conditional settings. In addition, all Campbell Scientific dataloggers (except the CR200X) accept program files, or **Include()** instruction files, with .DLD extensions.

**Note** Do not confuse CRBasic files with .DLD extensions with files of .DLD type used by legacy Campbell Scientific dataloggers.

As an example, pseudo code using this feature might be written as:

For example, this logic allows a simple change of a constant to direct, which measurement instructions to include.

CRBasic Editor features a pre-compile option that enables the creation of a CRBasic text file with only the desired conditional statements from a larger master program. This option can also be used at the pre-compiler command line by using -p <outfile name>. This feature allows the smallest size program file possible to be sent to the CR3000, which may help keep costs down over very expensive comms links.

CRBasic example *Conditional Code (p. 272)* shows a sample program that demonstrates use of conditional compilation features in CRBasic. Within the program are examples showing the use of the predefined **LoggerType** constant and associated predefined datalogger constants (6, 800, 1000, and 3000).

```
CRBasic EXAMPLE 56: Conditional Code
'This program example demonstrates program compilation than is conditional on datalogger
'model and program speed. Key instructions include #If, #ElseIf, #Else and #EndIf.
'Set program options based on:
  LoggerType, which is a constant predefined in the CR3000 operating system
  ProgramSpeed, which is defined in the following statement:
Const ProgramSpeed = 2
#If ProgramSpeed = 1
 Const ScanRate = 1
                                             '1 second
  Const Speed = "1 Second"
#ElseIf ProgramSpeed = 2
 Const ScanRate = 10
                                            '10 seconds
 Const Speed = "10 Second"
#ElseIf ProgramSpeed = 3
 Const ScanRate = 30
                                             '30 seconds
 Const Speed = "30 Second"
 Const ScanRate = 5
                                             '5 seconds
 Const Speed = "5 Second"
#EndIf
```

```
'Public Variables
Public ValueRead, SelectedSpeed As String * 50
'Main Program
BeginProg
  'Return the selected speed and logger type for display.
  #If LoggerType = 3000
    SelectedSpeed = "CR3000 running at " & Speed & " intervals."
  #ElseIf LoggerType = 1000
    SelectedSpeed = "CR1000 running at " & Speed & " intervals."
  #ElseIf LoggerType = 800
    SelectedSpeed = "CR800 running at " & Speed & " intervals."
  #ElseIf LoggerType = 6
    SelectedSpeed = "CR6 running at " & Speed & " intervals."
    SelectedSpeed = "Unknown Logger " & Speed & " intervals."
  #EndIf
  'Open the serial port
  SerialOpen(ComC1,9600,10,0,10000)
  'Main Scan
  Scan(ScanRate, Sec, 0, 0)
    'Measure using different parameters and a different SE channel depending
    'on the datalogger type the program is running in.
    #If LoggerType = 3000
      'This instruction is used if the datalogger is a CR3000
      VoltSe(ValueRead,1,mV1000,22,0,0,_50Hz,0.1,-30)
    #ElseIf LoggerType = 1000
      'This instruction is used if the datalogger is a CR1000
     VoltSe(ValueRead, 1, mV2500, 12, 0, 0, _50Hz, 0.1, -30)
    #ElseIf LoggerType = 800
      'This instruction is used if the datalogger is a CR800 Series
     VoltSe(ValueRead,1,mV2500,3,0,0,_50Hz,0.1,-30)
    #ElseIf LoggerType = 6
      'This instruction is used if the datalogger is a CR6 Series
      VoltSe(ValueRead, 1, mV1000, U3, 0, 0, 50, 0.1, -30)
      ValueRead = NAN
    #EndIf
 NextScan
EndProg
```

# 7.7.17 Measurement: RTD, PRT, PT100, PT1000

Related Topics:

- CRBasic Editor Help for PRTCalc()
- Resistance Measurements Details (p. 367)

This manual includes this discussion of PRTs because of the following:

- Many applications need the accuracy of a PRT.
- PRT procedures confuse many users.

 PRTs are not usually manufactured ready to use for most CR3000 PRT setups.

This section gives procedures and diagrams for many circuit setups. It also has relatively simplified examples of each circuit type and associated CRBasic programming.

## 7.7.17.1 Measurement Theory (PRT)

RTDs (resistance temperature detectors) are resistive devices made of platinum, nickel, copper, or other material. Platinum RTDs, known as PRTs (platinum resistance thermometers) are very accurate temperature measurement sensors. This discussion focuses on the  $100~\Omega$  PRT. Apply the following principles to other RTDs.

- A PRT element is a specialized resistor with two connection points. Most PRTs are either  $100 \Omega$  or  $1000 \Omega$ . This number is the resistance the PRT has at  $0 \, ^{\circ}\text{C}$ .
- The resistance of a PRT increases as it is warmed. Industrial standards
  define how PRTs respond to temperature; see PRT Callendar-Van Dusen
  Coefficients (p. 300).
- There are many ways to measure a PRT with a CR3000 datalogger. When using Vx terminals, the most direct route is to measure a four-wire PRT in a three-wire half bridge. [When using IX terminals, the most direct route is to connect a four wire PRT directly to the CR3000. Other ways to measure a PRT are listed in TABLE: PRT Measurement Circuit Overview (p. 274).
- Better excitation accuracy results if the highest possible excitation is
  used. Better measurement resolution results if the voltage output range
  from the PRT spans the analog-input voltage range of the CR3000.
  Better measurement accuracy occurs when the output signal can be kept
  as large as possible. Procedures in the following example balance these
  best practices.
- A feature of PRT measurements is the ratio RS/RS<sub>0</sub>, where RS is the PRT resistance now and RS<sub>0</sub> is the PRT resistance at 0 °C. RS/RS<sub>0</sub> makes it easy to apply the results of an ice-bath calibration to a temperature measurement. For jobs that do not need veryhigh accuracy, skip the calibration and assume that PRT resistance at 0 °C is either 100  $\Omega$  or 1000  $\Omega$ .

TABLE 38: PRT Measurement Circuit Overview					
Configuration	Features	Note			
Voltage Excitation Four-wire half-bridge (p. 277)	<ul> <li>High accuracy over long leads</li> <li>More input terminals: four per sensor</li> <li>Slower: four differential sub measurements per measurement</li> </ul>	Best voltage excitation configuration			
Three-wire half-bridge (p. 281)	<ul> <li>Good accuracy over long leads.</li> <li>Fewer input terminals: two per sensor</li> <li>Faster: two single-ended sub measurements per measurement</li> </ul>	Costs less to build			
Four-wire full-bridge (p. 285)	<ul> <li>High resolution response to change</li> <li>More complicated to build</li> <li>Two input terminals per sensor</li> <li>Two differential sub measurements per measurement</li> </ul>	<ul> <li>Best over short leads.</li> <li>Best resolution since the bridge balances at the temperature-range midpoint.</li> </ul>			
Current excitation     Basic four-wire circuit	<ul> <li>Minimizes errors due to voltage drop with long leads.</li> <li>Uses off-the-shelf PRTs</li> <li>More tolerant of lower-grade wiring</li> <li>Two input terminals per sensor</li> </ul>	Simplest to use			
Full-bridge circuit	<ul> <li>Minimizes errors due to voltage drop over long leads.</li> <li>More tolerant of lower-grade wiring</li> <li>Two input terminals per sensor</li> </ul>	Best overall			

# 7.7.17.2 General Procedure (PRT)

Following is a general procedure for using a PRT:

- 1. Build circuit.
- 2. Wire circuit to the CR3000.
- 3. Calculate excitation voltage or current.
- 4. Calibrate PRT.
- 5. Measure PRT and convert output to temperature.

Several procedures follow that step you through use of common resistive-bridge configurations to measure a 100  $\Omega$  PRT (a.k.a, PT100). Use the following data to help you understand the examples:

#### Procedure Data

• Units used in examples: mV (millivolts), mA (milliamperes), and m $\Omega$  (milliohms)

- RTD type for examples:  $100 \Omega$  PRT (a.k.a, PT100),  $\alpha = 0.00385$
- Temperature measurement range for examples: -40 to 60 °C
- General forms of Callander-Van Dusen equations using CRBasic notation:
  - o  $T = g * K^4 + h * K^3 + i * K^2 + j * K$  (temperatures < 0°C)
  - $0 \quad T = (SQRT(d * (RS/RS0) + e) a) / f \quad (temperature \ge 0^{\circ}C)$

TABLE 39: PT100 Temperature and ideal resistances (RS); $\alpha = 0.00385^{1}$						
	RS <sub>-40</sub> RS <sub>0</sub> RS <sub>10</sub> RS <sub>60</sub>					
°C	-40	0	10	60		
mΩ	84270	100000	103900	123240		
<sup>1</sup> Commonly available tables provide these resistance values.						

TABLE 40: Callandar-Van Dusen Coefficients for PT100, $\alpha = 0.00385$			
Constants	Coefficient		
a	3.9083000E-03		
d	-2.3100000E-06		
e	1.7584810E-05		
f	-1.1550000E-06		
g	1.7909000E+00		
h	-2.9236300E+00		
i	9.1455000E+00		
j	2.5581900E+02		


TABLE 41: Input Ranges (mV)					
CR6	CR800/CR1000	CR3000			
±5000	±5000	±5000			
±1000	±2500	±1000			
±200	±250	±200			
	±25	±50			
	±7.5	±20			
	±2.5				

TABLE 42: Input Limits (mV)				
CR6	CR800/CR1000	CR3000		
±5000	±5000	±5000		

TABLE 43: Excitation		
CR6	CR800/CR1000	CR3000
±2500 mV	±2500 mV	±5000 mV
±2.000 mA	n/a	±2.500 mA

# 7.7.17.3 Example: 100 $\Omega$ PRT in Four-Wire Half Bridge with Voltage Excitation (PT100 / BrHalf4W() )

FIGURE 67: PT100 BrHalf4W() Four-Wire Half-Bridge Schematic

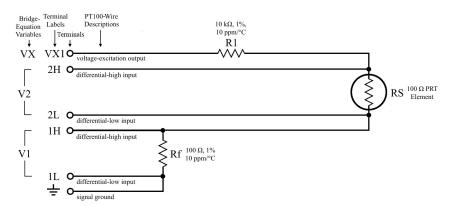

## Procedure Data

TABLE 45: Bridge Resistor Values (mg	$\Omega$ )
R1	Rf
10000000	100000

#### **Procedure**

#### 1. Build circuit<sup>1</sup>:

- a. Use FIGURE: PT100 BrHalf4W() Four-Wire Half-Bridge Schematic (p. 277) as a template.
- b. Rf should approximately equal the resistance of the PT100 at 0  $^{\circ}$ C. Use a 1%, 10 ppm/ $^{\circ}$ C resistor.

#### 2. Wire circuit to datalogger:

Use FIGURE: PT100 BrHalf4W() Four-Wire Half-Bridge Schematic (p. 277) as the wiring diagram.

#### 3. Calculate excitation voltage<sup>2</sup>:

Use the following equation to calculate the best excitation voltage (VX) for the measurement range -40 to 60 °C. The equation reduces the absolute result by 1% to allow for resistor inaccuracy:

$$VX_{max} = (VS_{max} \cdot (Rf + RS_{max} + R1) / RS_{max}) \cdot 0.99$$

where,

 $VS_{max} = 50 \text{ mV}$  (maximum voltage in the  $\pm 50 \text{ mV}$  input range)

 $Rf = 100000 \text{ m}\Omega (100 \Omega)$ 

 $R1 = 10000000 \text{ m}\Omega (10 \text{ k}\Omega)$ 

 $RS_{max} = 123240 \text{ m}\Omega \text{ (PT100 at } 60 \text{ °C)}^3$ 

so,

$$VX_{max} = 4160 \text{ mV}$$

#### 4. Calibrate the PT100:

If the PRT accuracy specification is good enough, and you trust it, assume  $RS_0 = 100000 \ m\Omega$ . Otherwise, do the following procedure:

- a. Enter CRBasic EXAMPLE: PT100 BrHalf4W() Four-Wire Half-Bridge Calibration (p. 280) into the CR3000. It is already programmed with the excitation voltage from step 3.
- b. Place the PRT in an ice bath (0 °C).
- c. Measure the PRT. If you are doing a dry run, assume the result of  $\mathbf{BrHalf4W}() = X_0 = 0.01000$ .

d. Calculate RS<sub>0</sub>

$$RS_0 = X_0 \cdot Rf = 100000 \text{ m}\Omega$$

Wow! We are lucky to have a perfect PRT! In the real world, PRT resistance at 0 °C will probably land on either side of 100  $\Omega$ .

#### 5. Measure the sensor:

If you are doing a dry run, assume the temperature is 10 °C.

- a. Enter CRBasic EXAMPLE: PT100 BrHalf4W() Four-Wire Half-Bridge Measurement (p. 280) into the CR3000. It is already programmed with the excitation voltage from step 3 and RS<sub>0</sub> from step 4.
- b. Place PT100 in medium to measure.
- c. Measure with **BrHalf4W()**. If you are doing a dry run, assume the result of **Resistance()** =  $X_{10} = 1.039$ .
- d. Calculate RS<sub>10</sub>:

$$RS_{10} = X_{10} \cdot Rf = 103900$$

6. Calculate RS<sub>10</sub>/RS<sub>0</sub>, K, and temperature:

a. 
$$RS_{10}/RS_0 = 1.039$$

b. 
$$K = (RS_{10}/RS_0)-1 = 0.039$$

c. 
$$T = g * K^4 + h * K^3 + i * K^2 + j * K = 9.99 °C$$

d. 
$$T = (SQRT(d * (RS_{10}/RS_0) + e) - a) / f = 9.99 °C$$

<sup>&</sup>lt;sup>1</sup> A Campbell Scientific terminal-input module (TIM) can be used to complete the resistive bridge circuit. Refer to the appendix *Passive-Signal Conditioners* — *List (p. 605)*.

<sup>&</sup>lt;sup>2</sup> The magnitude of the excitation voltage does not matter in mathematical terms because the result of the measurement is a ratio rather than an absolute magnitude, but it does matter in terms of reducing the effect of electromagnetic noise and of losing of resolution. A maximum excitation helps drown out noise. A minimum input-voltage range helps preserve resolution.

<sup>&</sup>lt;sup>3</sup> Get this value from a PRT resistance-to-temperature table

## CRBasic Programs and Notes

```
CRBasic EXAMPLE 57: PT100 BrHalf4W() Four-Wire Half-Bridge Calibration
'This program example demonstrates the calibration of a 100-ohm PRT (PT100) in a four-wire
'half bridge with voltage excitation. See adjacent procedure and schematic.
'Declare constants and variables:
Const Rf = 100000 'Value of bridge resistor
Public X 'Raw output from the bridge
Public RSO 'Calculated PT100 resistance at 0 °C
BeginProg
 Scan(1,Sec,0,0)
....'Measure X:
    'BrHalf4W(Dest,Reps,Range1,Range2,DiffChan,ExChan,MeasPEx,ExmV,RevEx,RevDiff,
   ' SettlingTime,Integ,Mult,Offset)
   BrHalf4W(X,1,mV50,mV50,1,Vx1,1,4160,True,True,0,250,1,0)
    'Calculate RSO:
   RS0 = X * Rf
 NextScan
EndProg
```

#### CRBasic EXAMPLE 58: PT100 BrHalf4W() Four-Wire Half-Bridge Measurement

```
'This program example demonstrates the measurement of a 100-ohm PRT in a four-wire
'half bridge using current excitation. See previous procedure and schematic.
'Declare constants and variables:
Const Rf = 100000 'Value of bridge resistor
Const RSO = 100000 'Resistance of PT100 at 0 °C from calibration program
Public X 'Raw output from the bridge
Public RS 'Calculated PT100 resistance
Public RS_RSO 'Calculated ratio of RS/RSO
Public DegC 'Calculated temperature
BeginProg
 Scan(1, Sec, 0, 0)
....'Measure X:
    'BrHalf4W(Dest,Reps,Range1,Range2,DiffChan,ExChan,MeasPEx,ExmV,RevEx,RevDiff,
   ' SettlingTime,Integ,Mult,Offset)
   BrHalf4W(X,1,mV50,mV50,1,Vx1,1,4160,True,True,0,250,1,0)
    'Calculate RS and RS/RSO:
   RS = X * Rf
   RS_RSO = RS/RSO
....'Calculate temperature from RS_RSO:
    'PRTCalc(Dest, Reps, Source, PRTType, Mult, Offset)
   PRTCalc(DegC,1,RS_RS0,1,1.0,0)
 NextScan
EndProg
```

#### Notes

Why use four-wire half-bridge?

Use a four-wire half-bridge when lead resistance is more than a few thousandths of an ohm, such as occurs with long lead lengths.

Why use 10 kΩ series resistor?

Referring to figure PT100 BrHalf4W() Four-Wire Half-Bridge Schematic (p. 277), the 10 k $\Omega$  series resistor allows the use of a higher-excitation voltage and a low analog voltage input range.

• Why use high excitation and low range?


High excitation and low range minimize the effects of signal noise.

• Why use a bridge resistor near value of PT100?

By using a bridge resistor (Rf) that is close in value to that of the PT100 (RS), the differential measurement of V2 (voltage drop across PRT) can be made on the same range as the differential measurement of V1 (voltage drop across Rf). Using the same range eliminates range translation errors that can arise from variances in the 0.01% range translation resistors internal to the CR3000.

# 7.7.17.4 Example: 100 $\Omega$ PRT in Three-Wire Half Bridge with Voltage Excitation (PT100 / BrHalf3W() )

FIGURE 68: PT100 BrHalf3W() Three-Wire Half-Bridge Schematic

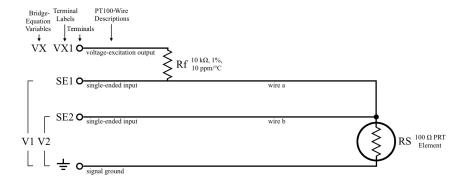

## **Procedure Information**

```
TABLE 46: BrHalf3W() Three-Wire Half-Bridge Equations X = RS / Rf RS = Rf \cdot X VX = VS/(RS/(Rf + RS))
```

TABLE 47: Bridge Resistor Values (mΩ)
Rf
100000

#### **Procedure**

#### 1. Build circuit<sup>1</sup>:

- a. Use FIGURE: PT100 BrHalf3W() Three-Wire Half-Bridge Schematic (p. 281) as a template.
- b. For Rf, choose a 1%, 10 ppm/°C, 10000000 m $\Omega$  (10 k $\Omega$  resistor).

#### 2. Wire circuit to datalogger:

Use FIGURE: PT100 BrHalf3W() Three-Wire Half-Bridge Schematic (p. 281) as the wiring diagram.

#### 3. Calculate excitation voltage:

Use the following equation to calculate the best excitation voltage (VX) for the measurement range of -40 to 60 °C. The equation reduces the absolute result by 1% to allow for resistor inaccuracy:

$$VX_{max} = VS_{max} / (RS_{max} / (Rf + RS_{max})) \cdot 0.99$$

where,

 $VS_{max} = 50 \text{ mV}$  (maximum voltage in the  $\pm 50$  input range)

 $Rf = 100000000 \text{ m}\Omega$ 

 $RS_{max} = 123240 \text{ m}\Omega \text{ (PT00 at 60 °C)}^2$ 

so,

$$VX_{max} = 1626420334066 \text{ mV}$$

#### 4. Calibrate the PT100:

If the PRT accuracy specification is good enough, and you trust it, assume  $RS_0 = 100000 \text{ m}\Omega$ . Otherwise, do the following procedure:

- a. Enter CRBasic EXAMPLE: PT100 BrHalf3W() Three-Wire Half-Bridge Calibration (p. 284) into the CR3000. It is already programmed with the excitation voltage from step 3.
- b. Place the PRT in an ice bath (0 °C).

c. Measure the PRT. If you are doing a dry run, assume the result of **BrHalf3W()** =  $X_0$ . = 0.01000

d. Calculate RS<sub>0</sub>

$$RS_0 = X_0 \cdot Rf = 100000 \text{ m}\Omega$$

Wow! We are lucky to have a perfect PRT! In the real world, PRT resistance at 0 °C will probably land on either side of 100  $\Omega$ .

#### 5. Measure the sensor:

If you are doing a dry run, assume the temperature is 10 °C.

- a. Enter CRBasic EXAMPLE: PT100 BrHalf3W() Three-Wire Half-Bridge Measurement (p. 284) into the CR3000. It is already programmed with the excitation voltage from step 3 and RS<sub>0</sub> from step 4.
- b. Place PT100 in medium to measure.
- c. Measure with **BrHalf3W()**. If you are doing a dry run, assume the result of **BrHalf3W()** =  $X_0 = 0.01039$ .
- d. Calculate RS<sub>10</sub>:

$$RS_{10} = X_{10} \cdot Rf = 103900$$

6. Calculate RS<sub>10</sub>/RS<sub>0</sub>, K, and temperature:

a. 
$$RS_{10}/RS_0 = 1.039$$

b. 
$$K = (RS_{10}/RS_0)-1 = 0.039$$

c. 
$$T = g * K^4 + h * K^3 + i * K^2 + j * K = 9.99 °C$$

d. 
$$T = (SQRT(d * (RS_{10}/RS_0) + e) - a) / f = 9.99 °C$$

<sup>&</sup>lt;sup>1</sup> A Campbell Scientific terminal-input module (TIM) can be used to complete the resistive bridge circuit. Refer to the appendix *Passive-Signal Conditioners* — *List (p. 605)*.

<sup>&</sup>lt;sup>4</sup> Get this value from a PRT-resistance-to-temperature table

## CRBasic Programs and Notes

# CRBasic EXAMPLE 59: PT100 BrHalf3W() Three-Wire Half-Bridge Calibration 'This program example demonstrates the calibration of a 100-ohm PRT (PT100) in a three-wire 'half bridge with voltage excitation. See previous procedure and schematic. 'Declare constants and variables: Const Rf = 10000000 'Value of bridge resistor Public X 'Raw output from the bridge Public RSO 'Calculated PT100 resistance at 0 °C BeginProg Scan(1,Sec,0,0) ....'Measure X: 'BrHalf3W(Dest,Reps,Range,SEChan,ExChan,MeasPEx,ExmV,RevEx,SettlingTime, Integ,Mult,Offset) BrHalf3W(X,1,mV50,1,Vx1,1,4066,True,0,250,1,0) 'Calculate RSO: RS0 = Rf \* XNextScan **EndProg**

#### CRBasic EXAMPLE 60: PT100 BrHalf3W() Three-Wire Half-Bridge Measurement


```
'This program example demonstrates the measurement of a 100-ohm PRT (PT100) in a three-wire
'half bridge with voltage excitation. See adjacent procedure and schematic.
'Declare constants and variables:
Const Rf = 10000000 'Value of bridge resistor
Const RSO = 100000 'Resistance of PT100 at 0 °C from calibration program
Public X 'Raw output from the bridge
Public RS 'Calculated PT100 resistance
Public RS_RSO 'Calculated ratio RS/RSO
Public DegC 'Calculated temperature
BeginProg
 Scan(1, Sec, 0, 0)
....'Measure X:
    'BrHalf3W(Dest,Reps,Range,SEChan,ExChan,MeasPEx,ExmV,RevEx,SettlingTime,
              Integ,Mult,Offset)
   BrHalf3W(X,1,mV50,1,Vx1,1,4066,True,0,250,1,0)
    'Calculate RS and RS_RSO:
   RS = X * Rf
   RS_RSO = RS/RSO
....'Calculate temperature from RS_RSO:
    'PRTCalc(Dest, Reps, Source, PRTType, Mult, Offset)
   PRTCalc(DegC,1,RS_RS0,1,1.0,0)
 NextScan
EndProg
```

#### Notes

- The three-wire half-bridge compensates for lead-wire resistance by assuming that the resistance of wire *a* is the same as the resistance of wire *b* (see *FIGURE: PT100 BrHalf3W() Three-Wire Half-Bridge Schematic (p. 281)*). The maximum difference expected in wire resistance is 2%, but is more likely to be on the order of 1%.
- The average resistance of 22 AWG wire is  $16.5 \Omega$  per 1000 feet, which would give 500 ft lead wires (for example) a nominal resistance of  $8.3 \Omega$ . Two percent of  $8.3 \Omega$  is  $0.17 \Omega$ . Assuming that the greater resistance is in wire b, the resistance measured for the PRT in the ice bath (RS0) is  $100.17 \Omega$ , and the resistance at  $40 \,^{\circ}$ C (RS) is  $115.71 \Omega$ .
- At 40 °C, because of the error from wire *b*, the measured ratio RS/RS0 is 1.1551 while the ratio without the error would be 115.54/100 = 1.1554. As a result, the temperature computed by **PRTCalc()** from the ratio with the error is about 0.43 °C higher than the temperature measured without the error from wire *b*. This source of error does not exist in a four-wire half-bridge configuration.

# 7.7.17.5 Example: 100 $\Omega$ PRT in Four-Wire Full Bridge with Voltage Excitation (PT100 / BrFull())

FIGURE 69: PT100 BrFull() Four-Wire Full-Bridge Schematic

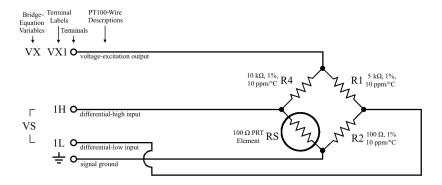

#### **Procedure**

#### 1. Build circuit1:

- a. Use FIGURE: PT100 BrFull() Four-Wire Full-Bridge Schematic (p. 285) as a template.
- b. Choose a 1%, 10 ppm/°C, 5000000  $\Omega$  (5 k $\Omega$ ) resistors for R1 and R4
- c. Balance the bridge.
  - i. Find the midpoint of the temperature range. The range of -40 to 60 °C is selected for this procedure, so the midpoint is 10 °C.

ii. Select a 1% resistor for R2 with a resistance that is approximately equal to the resistance of the PRT at 10 °C. See *Procedure Information* (PT100 BrFull() Full Bridge) (p. 296). Since a 103.9  $\Omega$  resistor is hard to find, use a 100  $\Omega$  resistor. It is close enough. Use 5 ppm/°C resistors. Frequently, all the resistors in a full bridge are submerged in the medium to be measured, so they may see large temperature changes. 5 ppm resistors are more thermally stable than 10 ppm resistors.

#### 2. Wire circuit to datalogger:

Use FIGURE: PT100 BrFull() Four-Wire Full Bridge Schematic (p. 285) as the wiring diagram.

#### 3. Calculate excitation voltage:

Use the following equation to calculate the best excitation voltage (VX) for the measurement range -40 to 60 °C. The equation reduces the absolute result by 1% to allow for resistor inaccuracy:

$$VX_{max} = (VS_{max} / ((RS_{max} / (RS_{max} + R4)) - (R2 / R1 + R2))) \bullet 0.99$$
 where,

 $VS_{max} = 50 \text{ mV}$  (maximum voltage in the  $\pm 50$  input range)

 $R1 = 5000000 \text{ m}\Omega \text{ (5 k}\Omega)$ 

 $R2 = 100000 \text{ m}\Omega (100 \Omega)$ 

 $R4 = 5000000 \text{ m}\Omega (5 \text{ k}\Omega)$ 

 $RS_{max} = 123240 \text{ m}\Omega \text{ (PT100 at 60 °C)}^2$ 

so,

$$VX_{max} = 44972562111243 \text{ mV}$$

#### 4. Calibrate the PT100:

If the PRT accuracy specification is good enough, and you trust it, assume  $RS_0 = 100000 \text{ m}\Omega$ . Otherwise, do the following procedure:

#### CRBasic EXAMPLE 61: PT100 BrFull() Four-Wire Full-Bridge Calibration

```
'This program example demonstrates the calibration of a 100-ohm PRT (PT100) in a four-wire
'full bridge with voltage excitation. See previous procedure and schematic.
'Declare constants and variables:
Const R1 = 5000000 'Value of R1 bridge resistor
Const R2 = 120000 'Value of R2 bridge resistor
Const R4 = 5000000 'Value of R4 bridge resistor
Public X1 'Raw output from the bridge
Public X2 'Calculated intermediate value
Public RSO 'Calculated PT100 resistance at 0 °C
BeginProg
  Scan(1, Sec, 0, 0)
    'Measure X1
    'BrFull(Dest, Reps, Range, DiffChan, ExChan, MeasPEx, ExmV, RevEx, RevDiff, SettlingTime,
            Inteq.Mult.Offset)
    BrFull(X1,1,mV50,1,Vx1,1,5000,True,True,0,250,1,0)
    'Calculate X2:
    X2 = (X1/1000) + (R2/(R1+R2))
    'Calculate RSO:
    RS0 = (R4*X2) / (1-X2)
  NextScan
EndProg
```

into the CR3000. It is already programmed with the excitation voltage from step 3.

b. Place the PRT in an ice bath (0 °C).

c. Measure the PRT. If you are doing a dry run, assume the result of  $\mathbf{BrFull}() = X_0 = 0$ .

d. Calculate RS<sub>0</sub>

$$X2_0 = (X_0 / 1000) + (R2 / (R1 + R2)) = 0.01961$$

$$RS_0 = (R4 \cdot X2_0) / (1 - X2_0) = 100000 \text{ m}\Omega$$

Wow! We are lucky to have a perfect PRT! In the real world, PRT resistance at 0 °C will probably land on either side of 100  $\Omega.$ 

#### 5. Measure the sensor:

If you are doing a dry run, assume the temperature is 10  $^{\circ}$ C.

a. Enter CRBasic EXAMPLE: PT100 BrFull() Four-Wire Full-Bridge Measurement (p. 288) into the CR3000. It is already programmed with the excitation voltage from step 3 and RS<sub>0</sub> from step 4.

b. Place PT100 in medium to measure.

- c. Measure with **BrFull()**. If you are doing a dry run, assume the result of **Resistance()** =  $X_{10} = 0.7491$ .
- d. Calculate RS<sub>10</sub>:

$$X2_{10} = (X_{10} / 1000) + (R2 / (R1 + R2) = 0.02036$$

$$RS_{10} = (R4 \cdot X2_{10}) / (1 - X2_{10}) = 103900$$

6. Calculate RS<sub>10</sub>/RS<sub>0</sub>, K, and temperature:

a. 
$$RS_{10}/RS_0 = 1.039$$

b. 
$$K = (RS_{10}/RS_0)-1 = 0.039$$

c. 
$$T = g * K^4 + h * K^3 + i * K^2 + j * K = 9.99 °C$$

d. 
$$T = (SQRT(d * (RS_{10}/RS_0) + e) - a) / f = 9.99 °C$$

### CRBasic Programs and Notes

```
CRBasic EXAMPLE 62: PT100 BrFull() Four-Wire Full-Bridge Calibration
'This program example demonstrates the calibration of a 100-ohm PRT (PT100) in a four-wire
'full bridge with voltage excitation. See previous procedure and schematic.
'Declare constants and variables:
Const R1 = 5000000 'Value of R1 bridge resistor
Const R2 = 120000 'Value of R2 bridge resistor
Const R4 = 5000000 'Value of R4 bridge resistor
Public X1 'Raw output from the bridge
Public X2 'Calculated intermediate value
Public RSO 'Calculated PT100 resistance at 0 °C
BeginProg
 Scan(1, Sec, 0, 0)
    'Measure X1
    'BrFull(Dest,Reps,Range,DiffChan,ExChan,MeasPEx,ExmV,RevEx,RevDiff,SettlingTime,
            Integ,Mult,Offset)
   BrFull(X1,1,mV50,1,Vx1,1,5000,True,True,0,250,1,0)
    'Calculate X2:
   X2 = (X1/1000) + (R2/(R1+R2))
    'Calculate RSO:
   RS0 = (R4*X2) / (1-X2)
 NextScan
EndProg
```

<sup>&</sup>lt;sup>1</sup> A Campbell Scientific terminal-input module (TIM) can be used to complete the resistive bridge circuit. Refer to the appendix *Passive-Signal Conditioners* — *List (p. 605)*.

<sup>&</sup>lt;sup>4</sup> Get this value from a PRT-resistance-to-temperature table

#### **CRBasic EXAMPLE 63:** PT100 BrFull() Four-Wire Full-Bridge Measurement 'This program example demonstrates the measurement of a 100-ohm PRT (PT100) in a four-wire 'full bridge with voltage excitation. See previous procedure and schematic. 'Declare constants and variables: Const R1 = 5000000 'Value of R1 bridge resistor Const R2 = 120000 'Value of R2 bridge resistor Const R4 = 5000000 'Value of R4 bridge resistor Const RSO = 100000 'Resistance of PT100 at 0 °C from calibration program Public X1 'Raw output from bridge Public X2 'Calculated intermediate value Public RS 'Calculated PT100 resistance Public RS\_RSO 'Calculated ratio RS/RSO Public DegC 'Calculated temperature of PT100 BeginProg Scan(1, Sec, 0, 0) 'Measure X 'BrFull(Dest, Reps, Range, DiffChan, ExChan, MeasPEx, ExmV, RevEx, RevDiff, SettlingTime, Integ,Mult,Offset) BrFull(X1,1,mV50,1,Vx1,1,5000,True,True,0,250,1,0) 'Calculate X2 X2 = (X1/1000) + (R2/(R1+R2))'Calculate RS and RS\_RSO RS = (R4\*X2) / (1-X2) $RS_RS0 = RS/RS0$ ....'Calculate temperature from RS\_RSO: 'PRTCalc(Dest, Reps, Source, PRTType, Mult, Offset) PRTCalc(DegC,1,RS\_RS0,1,1.0,0) NextScan

#### Notes

EndProg

The following relationships are used in, or are related to, the previous procedure.

#### **Maximum Excitation Voltage**

Used:

 $V1_{@maxT}$  = maximum voltage in the CR3000 analog voltage input range

$$VX_{MAX} = V1_{@maxT}/((R3_{@maxT}/(R3_{@maxT}+R4)) - (R2/(R1+R2)))$$

Related:

$$V1_{@maxT} = VX*((R3_{@maxT}/(R3_{@maxT}+R4)) - (R2/(R1+R2)))$$

#### Calibrate PRT

Used:

$$X_{CAL} = (1000*(V1_{CAL}/VX))$$
, where  $(1000*(V1_{CAL}/VX))$  is the output of **BrFull()** with *Mult* = 1, *Offset* = 0

$$X3_{CAL} = (X_{CAL}*0.001) + (R2/(R1+R2))$$

Related:

$$V1_{CAL} = VX*((R3_{CAL}/(R3_{CAL}+R4)) - (R2/(R1+R2)))$$

#### Slope, Offset, and Xp

$$M = 0.001$$

$$B = (R2/(R1+R2))$$

$$Xp = ((1000*(V1/VX))*M+B$$

#### Rs/R0, K, and temperature

$$Rs/R0 = -(R4/((R4*X3_{CAL})/(1-X3_{CAL})))*(Xp/(Xp-1))$$

$$K = (Rs/R0)-1$$

T = (SQRT(d \* (R/R0) + e) - a) / f (see PRT Calculation Standards for coefficients)

or

 $T = g * K^4 + h * K^3 + I * K^2 + j * K$  (see PRT Calculation Standards for coefficients)

#### Resistance of the PRT (R3):

$$R3 = (R4 \cdot X3)/(1 - X3)$$

$$X3 = (X / 1000) + (R2/(R1 + R2))$$


#### **Measurement resolution:**

There is a change of approximately 4 mV from the output at 40 °C to the output at 51 °C, or 400  $\mu$ V / °C. With a resolution of 0.33  $\mu$ V on the ±50 mV range, this means that the temperature resolution is 0.0009 °C.

## 7.7.17.6 Example: 100 $\Omega$ PRT in Four-Wire Basic Circuit (PT100 / Basic Resistance())

This example shows the simplest PRT setup and how to measure multiple PRTs from one U terminal set up for current excitationIX terminal.

#### FIGURE 70: PT100 Resistance() Basic-Circuit Schematic

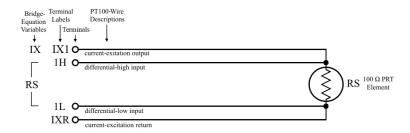

#### **Procedure Information**

### TABLE 48: Resistance() Basic Circuit Equation

#### X = V / IX = RS

#### **Procedure**

#### 1. Build circuit<sup>1</sup>:

a. Use FIGURE: PT100 Resistance() Basic-Circuit Schematic (p. 291) as a template.

b. For Rf, choose a 1%, 10 ppm/°C, 100  $\Omega$  resistor.

#### 2. Wire circuit to datalogger:

Use FIGURE: PT100 Resistance() Basic-Circuit Schematic (p. 291) as the wiring diagram.

#### 3. Calculate excitation current:

Use the following equation to calculate the best excitation current (IX) for the measurement range -40 to 60 °C. The equation reduces the absolute result by 1% to allow for resistor inaccuracy:

$$IX_{max} = (VS_{max} / RS_{min}) \cdot 0.99$$

where,

 $VS_{max} = 50 \text{ mV}$  (max input voltage allowed in  $\pm 50$  input range)

$$RS_{min} = 84270 \text{ m}\Omega (PT100 \text{ at } -40 \text{ }^{\circ}\text{C})^{1}$$

so,

$$IX_{max} = 0.05874 \text{ mA}$$

#### 4. Calibrate the PT100:

If the PRT accuracy specification is good enough, and you trust it, assume  $RS_0 = 100000 \text{ m}\Omega$ . Otherwise, do the following procedure:

- a. Enter *CRBasic EXAMPLE: PT100 Resistance Basic-Circuit Calibration (p.* 293) into the CR3000. It is already programmed with the excitation current from step 3.
- b. Place the PRT in an ice bath (0 °C).
- c. Measure the PRT. If you are doing a dry run, assume the result of **Resistance()** =  $X_0 = 100000$ .
- d. Calculate RS<sub>0</sub>

$$RS_0 = X_0 = 100000 \text{ m}\Omega$$

Wow! We are lucky to have a perfect PRT! In the real world, PRT resistance at 0 °C will probably land on either side of 100  $\Omega$ .

#### 5. Measure the sensor:

If you are doing a dry run, assume the temperature is 10 °C.

- a. Enter CRBasic EXAMPLE: PT100 Resistance() Basic-Circuit Measurement (p. 293) into the CR3000. It is already programmed with the excitation current from step 3 and RS<sub>0</sub> from step 4.
- b. Place PT100 in medium to measure.
- c. Measure with **Resistance()**. If you are doing a dry run, assume the result of **Resistance()** =  $X_{10} = 103900$ .
- d. Calculate RS<sub>10</sub>:

$$RS_{10} = X_{10} = 103900$$

6. Calculate RS<sub>10</sub>/RS<sub>0</sub>, K, and temperature:

a. 
$$RS_{10}/RS_0 = 1.039$$

b. 
$$K = (RS_{10}/RS_0)-1 = 0.039$$

c. 
$$T = g * K^4 + h * K^3 + i * K^2 + j * K = 9.99 °C$$

d. 
$$T = (SQRT(d * (RS_{10}/RS_0) + e) - a) / f = 9.99 °C$$

<sup>&</sup>lt;sup>1</sup> Get this value from a PRT-resistance-to-temperature table

#### **CRBasic Programs and Notes**

```
CRBasic EXAMPLE 64: PT100 Resistance() Basic-Circuit Calibration
'This program example demonstrates the calibration of a 100-ohm PRT (PT100)
'with current excitation. See previous procedure and schematic.
'Declare constants and variables:
Public X 'Raw output from the bridge
Public RSO 'Calculated PT100 resistance at 0
BeginProg
  Scan(1, Sec, 0, 0)
....'Measure X:
    'Resistance(Dest, Reps, Range, InputChan, IExChan, MPE, ExuA, RevEx, RevDiff,
    ' SettlingTime,Integ,Mult,Offset)
    Resistance (X,1,mV50,1,Ix1,1,1000,True,True,0,250,1,0)
    'Calculate RSO:
    RS0 = X
  NextScan
EndProg
```

#### CRBasic EXAMPLE 65: PT100 Resistance() Basic-Circuit Measurement

```
'This program example demonstrates the measurement of 100-ohm PRT (PT100)
'with current excitation. See previous procedure and schematic.
'Declare constants and variables:
Const RSO = 100000 'Resistance of PT100 at 0 °C from calibration program
Public X 'Raw output from the bridge
Public RS 'Calculated PT100 resistance
Public RS_RSO 'Calculated ratio RS/RSO
Public DegC 'Calculated temperature
BeginProg
 Scan(1, Sec, 0, 0)
....'Measure X:
    'Resistance(Dest, Reps, Range, InputChan, IExChan, MPE, ExuA, RevEx, RevDiff,
    ' SettlingTime, Integ, Mult, Offset)
    Resistance(X,1,mV50,1,Ix1,1,1000,True,True,0,250,1,0)
    'Calculate RS and RS_RSO:
    RS = X
    RS_RSO = RS/RSO
....'Calculate temperature from RS_RSO:
    'PRTCalc(Dest, Reps, Source, PRTType, Mult, Offset)
    PRTCalc(DegC,1,RS_RS0,1,1.0,0)
  NextScan
EndProg
```

#### Measuring Multiple PRTs (PT100 Resistance() Basic-Circuit Series)

If you connect only one PRT to a [U] [Ix] terminal configured for current excitation, the previous procedure serves well. However, if multiple PRTs are measured from a single excitation terminal, the sum of voltages output from all PRTs connected to one excitation terminal must not exceed 5000 mV, which is the input limit (InLim) for the CR3000. This limitation also serves to limit the current load on the excitation terminal.

Calculate the maximum number of PRTs for one excitation terminal. Do this by calculating  $IX_{max}$  at several PRT numbers:

$$IX_{max} = ((InLim / (n \cdot RS_{min})) \cdot 0.99$$

where,

InLim = Input Limits = 5000 mV

n = number of PT100 sensors

 $RS_{min}$  = minimum resistance in the temperature range = 84270 m $\Omega$ 


so,


$$IX_{max} = 0.029 \text{ mA } (29 \mu\text{A}) \text{ when } n = 2$$

Other results are tabulated in the following table.

TABLE 49: Number of PT100	
PT100 Number, (n)	Max Excite Current, (IX <sub>max</sub> )
1	0.059 mA
2	0.029 mA
3	0.020 mA
4	0.015 mA
5	0.012 mA
6	0.010 mA

When using a current excitation greater than 1 mA, self-heating of the PRT element becomes a problem. Having your temperature sensor heat itself is far from desirable! You can reduce self-heating by minimizing the *SettlingTime* and *Integ* parameters in the **Resistance()** instruction, and by minimizing measurement frequency, perhaps by increasing the **Scan()** interval.




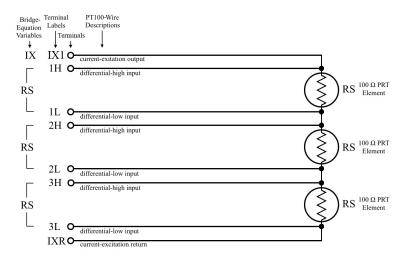

#### CRBasic EXAMPLE 66: PT100 Resistance() Basic-Circuit Measurement 'This program example demonstrates the measurement of 100-ohm PRT (PT100) with 'current excitation. See previous procedure and schematic. 'Declare constants and variables: Const RSO = 100000 'Resistance of PT100 at 0 °C from calibration program Public X(3) 'Raw output from the bridge Public RS(3) 'Calculated PT100 resistance Public RS\_RSO(3) 'Calculated ratio RS/RSO Public DegC(3) 'Calculated temperature Public Cnt 'Counter for For/Next loop BeginProg Scan(1, Sec, 0, 0) ....'Measure X: 'Resistance(Dest, Reps, Range, InputChan, IExChan, MPE, ExuA, RevEx, RevDiff, ' SettlingTime, Integ, Mult, Offset) Resistance(X(),3,mV50,1,Ix1,3,1000,True,True,0,250,1,0) 'Calculate RS and RS\_RSO: For Cnt = 1 To 3RS(Cnt) = X(Cnt) $RS_RSO(Cnt) = RS(Cnt) / RSO$ Next Cnt Cnt = 0....'Calculate temperature from RS\_RSO: 'PRTCalc(Dest, Reps, Source, PRTType, Mult, Offset) PRTCalc(DegC(), 3, RS\_RS0(), 1, 1.0, 0) NextScan EndProg

# 7.7.17.7 Example: 100 $\Omega$ PRT in Four-Wire Full Bridge with Current Excitation (PT100 / Full-Bridge Resistance())

FIGURE 72: PT100 Resistance() Four-Wire Full-Bridge Schematic

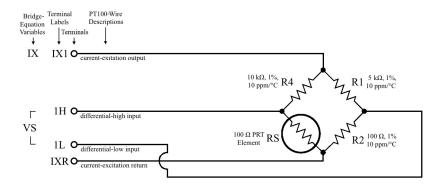

#### **Procedure Information**

# TABLE 50: Four-Wire Half-Bridge Equations for PRT Example X = V1 / IX $X = ((R3 \cdot (R1 + R2)) - (R2 \cdot (R3 + R4))) / (R1 + R2 + R3 + R4)$ $R3 = ((-R2 \cdot R4) - (X \cdot (R1 + R2 + R4))) / (X - R1)$ RB = X / ((R3 / (R3 + R4)) - (R2 / (R1 + R2)))

#### Definitions:

- X is the output of the **Resistance()** equation
- V1 is the voltage output of the bridge at terminals U3 and U4 (this value is used only internally in the CR3000).
- IX is the magnitude of the current (I) excitation.
- R1, R2, R4 are resistor values in the bridge.
- R3 is the resistance of the PRT.
- RB is the resistance of the whole bridge as measured between the IX excitation line and the = ground line.

TABLE 51: Bridge Resistor Values (mΩ)				
R1 R2 R4				
5000000 100000		5000000		

TABLE 52: Resistance() Four-Wire Full-Bridge Bridge-Resistance (RB) Values						
	RS <sub>-40</sub> RS <sub>0</sub> RS <sub>10</sub> RS <sub>60</sub>					
°C	-40	0	10	60		
RB	2551036	2554990	2555969	2560810		

#### **Procedure**

#### 1. Build circuit<sup>1</sup>:

- a. Use FIGURE: PT100 Resistance() Four-Wire Full-Bridge Schematic (p. 296) as a template.
- b. Choose a 1%, 10 ppm/°C, 5000000  $\Omega$  (5 k $\Omega$ ) resistors for R1 and R4
- c. Balance the bridge.
  - i. Find the midpoint of the temperature range. The range of -40 to 60 °C is selected for this procedure, so the midpoint is 10 °C.
  - ii. Select a 1%, 10 ppm/°C resistor for R2 with a resistance that is approximately equal to the resistance of the PRT at 10 °C. See *Procedure Information (PT100 Resistance() Full Bridge) (p. 296).* Since a 103.9  $\Omega$  resistor is hard to find, use a 100  $\Omega$  resistor. It is close enough.

#### 2. Wire circuit to datalogger:

Use FIGURE: PT100 Resistance() Four-Wire Full-Bridge Schematic as the wiring diagram. Wire the current return wire to the current return terminal.

#### 3. Calculate excitation current:

Use the following equation to calculate the best excitation current (IX) for the measurement range -40 to 60 °C. The equation reduces the absolute result by 1% to allow for resistor inaccuracy:

$$IX_{max} = (VS_{max} / RB_{min}) \bullet 0.99$$

where,

 $VS_{max} = 50 \text{ mV}$  (maximum voltage in the  $\pm 50$  input range)

 $RB_{min} = 2551036 \text{ m}\Omega \text{ (PT100 bridge at } -40 \text{ °C)}^2$ 

so,

 $IX_{max} = 0.00196 \text{ mA}$ 

#### 4. Calibrate the PT100:

If the PRT accuracy specification is good enough, and you trust it, assume  $RS_0 = 100000 \text{ m}\Omega$ . Otherwise, do the following procedure:

- a. Enter *CRBasic EXAMPLE: PT100 Resistance() Full-Bridge Calibration (p.* 299) into the CR3000. It is already programmed with the excitation current from step 3.
- b. Place the PRT in an ice bath (0 °C).
- c. Measure the PRT. If you are doing a dry run, assume the result of **Resistance()** =  $X_0$ . = -9785.
- d. Calculate RS<sub>0</sub>:

$$RS_0 = ((-R2 \cdot R4) - (X_0 \cdot (R1 + R2 + R4))) / (X_0 - R1) = 100000 \text{ m}\Omega$$

Wow! We are lucky to have a perfect PRT! In the real world, PRT resistance at 0 °C will probably land on either side of 100  $\Omega$ .

#### 5. Measure the sensor:

If you are doing a dry run, assume the temperature is 10 °C.

- a. Enter *CRBasic EXAMPLE: PT100 Resistance() Full-Bridge Measurement* (p. 299) into the CR3000. It is already programmed with the excitation current and RS<sub>0</sub> from step 4.
- b. Place PT100 in medium to measure.
- c. Measure with **Resistance()**. If you are doing a dry run, assume the result of **Resistance()** =  $X_{10} = -7874$ .
- d. Calculate RS<sub>10</sub>:

$$RS_{10} = ((-R2 \cdot R4) - (X_{10} \cdot (R1 + R2 + R4))) / (X_{10} - R1) = 103900 \text{ m}\Omega$$

6. Calculate  $RS_{10}/RS_0$ , K, and temperature:

a. 
$$RS_{10}/RS_0 = 1.039$$

b. 
$$K = (RS_{10}/RS_0)-1 = 0.039$$

c. 
$$T = g * K^4 + h * K^3 + i * K^2 + j * K = 9.99 °C$$

d. 
$$T = (SQRT(d * (RS_{10}/RS_0) + e) - a) / f = 9.99 °C$$

<sup>&</sup>lt;sup>1</sup> A Campbell Scientific terminal-input module (TIM) can be used to complete the resistive bridge circuit. Refer to the appendix *Passive-Signal Conditioners* — *List* (p. 605).

<sup>&</sup>lt;sup>4</sup> Bridge resistance:  $RB_{min} = X_{-40} / ((RS_{-40} / (RS_{-40} + R4)) - (R2 / (R1 + R2)))$ 

#### **CRBasic Programs and Notes**

```
CRBasic EXAMPLE 67: PT100 Resistance() Four-Wire Full-Bridge Calibration
'This program example demonstrates the calibration of a 100-ohm PRT (PT100) in a four-wire
'full bridge with current excitation. See previous procedure and schematic
'Declare constants and variables:
Const R1 = 5000000 'Value of R1 bridge resistor
Const R2 = 120000 'Value of R2 bridge resistor
Const R4 = 5000000 'Value of R4 bridge resistor
Public X 'Raw output from bridge
Public RSO 'Calculated PT100 resistance at 0 °C
BeainProa
 Scan(1, Sec, 0, 0)
    'Measure X
    'Resistance(Dest, Reps, Range, InputChan, IExChan, MPE, ExuA, RevEx, RevDiff,
    ' SetttlingTime, Integ, Mult, Offset)
    Resistance(X,1,mV50,1,Ix1,1,2,True,True,0,250,1,0)
    'Calculate RSO:
    RSO = ((-R2*R4) - (X*(R1+R2+R4))) / (X-R1)
  NextScan
EndProg
```

#### CRBasic EXAMPLE 68: PT100 Resistance() Four-Wire Full-Bridge Measurement

```
'This program example demonstrates the measurement of a 100-ohm PRT (PT100) in a four-wire
'full bridge with current excitation. See previous procedure and schematic.
'Declare constants and variables:
Const R1 = 5000000 'Value of R1 bridge resistor
Const R2 = 120000 'Value of R2 bridge resistor
Const R4 = 5000000 'Value of R4 bridge resistor
Const RSO = 100000 'Resistance of PT100 at 0 °C from calibration program
Public X 'Raw output from bridge
Public RS 'Calculated PT100 resistance
Public RS_RSO 'Calculate ratio of RS/RSO
Public DegC 'Calculated temperature of PT100
BeginProg
 Scan(1, Sec, 0, 0)
    'Measure X
    'Resistance(Dest, Reps, Range, InputChan, IExChan, MeasPEx, ExuA, RevEx, RevDiff,
    ' SettlingTime, Integ, Mult, Offset)
    Resistance(X,1,mV50,1,Ix1,1,2,True,True,0,250,1,0)
    'Calculate RS and RS_RSO:
    RS = ((-R2*R4) - (X*(R1+R2+R4))) / (X-R1)
    RS_RSO = RS/RSO
....'Calculate temperature from RS_RSO:
    'PRTCalc(Dest, Reps, Source, PRTType, Mult, Offset)
    PRTCalc(DegC,1,RS_RS0,1,1.0,0)
  NextScan
EndProg
```

#### 7.7.17.8 PRT Callendar-Van Dusen Coefficients

As shown in the preceding PRT measurement examples, use the **PRTCalc()** instruction in the CRBasic program to process PRT resistance measurements.

#### NOTE PRT() (not PRTCalc()) is obsolete.

**PRTCalc()** uses the following inverse Callendar-Van Dusen equations to calculate temperature from resistance.

For temperatures <0 °C:

$$T = g \cdot K \cdot j + K^2 \cdot i + K^3 \cdot h + K^4$$
, where  $K = R_S/R_0 - 1$  (Eq. 1)

For temperatures  $\geq 0$  °C:

$$T = (\operatorname{sqrt}(d \cdot R_S/R_0 + e) - a) / f$$
 (Eq. 2)

Eq.1 conforms to US ASTM E1137-04 standard for conversion of resistance to temperature. For temperatures 0 to 650 °C, it introduces <±0.0005 °C error to the measurement. The source of the error is rounding errors in CR3000 math.

Eq. 2 is derived from US ASTM E1137-04 and conforms to other industry standards. For temperatures -200 to 0 °C, it introduces  $<\pm0.003$  °C error to the measurement.

Eq. 1 and Eq. 2 yield approximations of the true linearity of a PRT. The approximation error can be as high as several hundredths of a degree Celsius at different points in the temperature range, and it varies from sensor to sensor. Individual sensors also have errors relative to the ASTM E1137-04 standard. These errors can be as much as  $\pm 0.3$  °C at 0 °C and increasing away from 0 °C. Purchasing high quality PRTs will minimize this error.

The best accuracy comes from calibrated sensors over the range of use. Calibration factors are applied to one or more of the following **PRTCalc()** parameters:

- Source
- Multiplier
- Offset

See the calibration sections in the previous PRT procedures for more information.

The following tables show sets of a, d, e, f, g, h, i, and j coefficients that are used in the Eqs. 1 and 2, depending on the *PRTType* code entered in *PRTCalc()*. Coefficients are rounded to the seventh significant digit to match CR3000 math resolution.

**PRTType** codes depend on the alpha value of the PRT, which is determined and published by the PRT manufacturer.

**TABLE 53:** PRTCalc() PRTType = 1,  $\alpha = 0.00385^1$ 

· · · · · · · · · · · · · · · · · · ·		
Constants	Coefficient	
a	3.9083000E-03	
d	-2.3100000E-06	
e	1.7584810E-05	
f	-1.1550000E-06	
g	1.7909000E+00	
h	-2.9236300E+00	
i	9.1455000E+00	
j	2.5581900E+02	

 $<sup>^1</sup>$  Compliant with the following standards: IEC 60751:2008 (IEC 751), ASTM E1137-04, JIS 1604:1997, EN 60751, DIN43760, BS1904, and others (reference IEC 60751 and ASTM E1137),  $\alpha = 0.00385$ 

**TABLE 54:** PRTCalc() PRTType = 2,  $\alpha = 0.00392^1$ 

Constant	Coefficient
a	3.9786300E-03
d	-2.3452400E-06
e	1.8174740E-05
f	-1.1726200E-06
g	1.7043690E+00
h	-2.7795010E+00
i	8.8078440E+00
j	2.5129740E+02

<sup>&</sup>lt;sup>1</sup> US Industrial Standard,  $\alpha = 0.00392$  (Reference: Logan Enterprises)

**TABLE 55:** PRTCalc() PRTType = 3,  $\alpha = 0.00391^{1}$ 

Constant	Coefficient
a	3.9690000E-03
d	-2.3364000E-06
e	1.8089360E-05
f	-1.1682000E-06
g	1.7010560E+00
h	-2.6953500E+00
i	8.8564290E+00
j	2.5190880E+02

<sup>&</sup>lt;sup>1</sup> US Industrial Standard,  $\alpha = 0.00391$  (Reference: OMIL R84 (2003))

**TABLE 56:** PRTCalc() PRTType = 4,  $\alpha = 0.003916^{1}$ 

Constant	Coefficient
a	3.9739000E-03
d	-2.3480000E-06
e	1.8139880E-05
f	-1.1740000E-06
g	1.7297410E+00
h	-2.8905090E+00
i	8.8326690E+00
j	2.5159480E+02

<sup>1</sup> Old Japanese Standard,  $\alpha$  = 0.003916 (Reference: JIS C 1604:1981, National Instruments)

**TABLE 57:** PRTCalc() PRTType = 5,  $\alpha = 0.00375^1$ 

Constant	Coefficient
a	3.8100000E-03
d	-2.4080000E-06
e	1.6924100E-05
f	-1.2040000E-06
g	2.1790930E+00

**TABLE 57:** PRTCalc() PRTType = 5,  $\alpha = 0.00375^1$ 

Constant	Coefficient
h	-5.4315860E+00
i	9.9196550E+00
j	2.6238290E+02

<sup>&</sup>lt;sup>1</sup> Honeywell Industrial Sensors,  $\alpha = 0.00375$  (Reference: Honeywell)

**TABLE 58:** PRTCalc() PRTType = 6,  $\alpha = 0.003926^{1}$ 

Constant	Coefficient
a	3.9848000E-03
d	-2.3480000E-06
e	1.8226630E-05
f	-1.1740000E-06
g	1.6319630E+00
h	-2.4709290E+00
i	8.8283240E+00
j	2.5091300E+02

<sup>&</sup>lt;sup>1</sup> Standard ITS-90 SPRT,  $\alpha = 0.003926$  (Reference: Minco / Instrunet)

#### 7.7.17.9 Self-Heating and Resolution

Programming the CR3000 to make a PRT measurement requires a judgment call. To maximize measurement resolution, the excitation voltage must be maximized. However, to minimize self-heating of the PRT element, excitation voltage must be minimized. Keeping the voltage drop across the PRT to  $\leq\!25$  mV addresses both concerns since self-heating is normally less than 0.001°C in still air. To maximize the measurement resolution, optimize the excitation voltage (Vx) such that the voltage drop across the PRT spans, but does not exceed, the voltage input range.

#### 7.7.18 Serial I/O: Capturing Serial Data

The CR3000 communicates with smart sensors that deliver measurement data through serial data protocols.

**Read More** See *Comms and Data Retrieval (p. 466)* for background on CR3000 serial communications.

#### 7.7.18.1 Introduction

Serial denotes transmission of bits (1s and 0s) sequentially, or "serially." A byte is a packet of sequential bits. RS-232 and TTL standards use bytes containing eight bits each. Consider an instrument that transmits the byte "11001010" to the CR3000. The instrument does this by translating "11001010" into a series of higher and lower voltages, which it transmits to the CR3000. The CR3000 receives and reconstructs these voltage levels as "11001010." Because an RS-232 or TTL standard is adhered to by both the instrument and the CR3000, the byte successfully passes between them.

If the byte is displayed on a terminal as it was received, it will appear as an ASCII / ANSI character or control code. Table ASCII / ANSI Equivalents (p. 304) shows a sample of ASCII / ANSI character and code equivalents.

TABLE 59: ASCII / ANSI Equivalents

Byte Received	ASCII Character Displayed	Decimal ASCII Code	Hex ASCII Code
00110010	2	50	32
1100010	ь	98	62
00101011	+	43	2b
00001101	cr	13	d
00000001	©	1	1

**Read More** See ASCII / ANSI Table for a complete list of ASCII / ANSI codes and their binary and hex equivalents.

The face value of the byte, however, is not what is usually of interest. The manufacturer of the instrument must specify what information in the byte is of interest. For instance, two bytes may be received, one for character 2, the other for character b. The pair of characters together, "2b", is the hexadecimal code for "+", "+" being the information of interest. Or, perhaps, the leading bit, the MSB (Most Significant Bit), on each of two bytes is dropped, the remaining bits combined, and the resulting "super byte" translated from the remaining bits into a decimal value. The variety of protocols is limited only by the number of instruments on the market. For one in-depth example of how bits may be translated into usable information, see *FP2 Data Format* (p. 599).

**Note** ASCII / ANSI control character ff-form feed (binary 00001100) causes a terminal screen to clear. This can be frustrating for a developer who prefers to see information on a screen, rather than a blank screen. Some third party terminal emulator programs, such as *Procomm*, are useful tools in serial I/O development since they handle this and other idiosyncrasies of serial communication.

When a standardized serial protocol is supported by the CR3000, such as PakBus or Modbus, translation of bytes is relatively easy and transparent. However, when bytes require specialized translation, specialized code is required in the CRBasic program, and development time can extend into several hours or days.

#### 7.7.18.2 I/O Ports

The CR3000 supports two-way serial communication with other instruments through ports listed in table *CR3000 Serial Ports (p. 305)*. A serial device will often be supplied with a nine-pin D-type connector serial port. Check the manufacture's pinout for specific information. In many cases, the standard nine-pin RS-232 scheme is used. If that is the case then the following apply:

Connect sensor RX (receive, pin 2) to a U or C terminal set up for Tx (C1, C3, C5, C7).

- Connect sensor TX (transmit, pin 3) to a U or C terminal set up for **Rx** (C2, C4, C6, C8)
- Connect sensor ground (pin 5) to datalogger ground (G terminal)

**Note** Rx and Tx lines on nine-pin connectors are sometimes switched by the manufacturer.

TARI	E 60.	CR3000	Serial	Ports

Serial Port	Voltage Level	Logic
<b>RS-232</b> (9 pin)	RS-232	Full-duplex asynchronous RS- 232
<b>CS I/O</b> (9 pin)	TTL	Full-duplex asynchronous RS- 232
COM1 (C1 – C2)	TTL	Full-duplex asynchronous RS- 232/TTL
COM2 (C3 – C4)	TTL	Full-duplex asynchronous RS- 232/TTL
COM3 (C5 – C6)	TTL	Full-duplex asynchronous RS- 232/TTL
COM4 (C7 – C8)	TTL	Full-duplex asynchronous RS- 232/TTL
C1	5 Vdc	SDI-12
С3	5 Vdc	SDI-12
C5	5 Vdc	SDI-12
C7	5 Vdc	SDI-12
C1, C2, C3	5 Vdc	SDM (used with Campbell Scientific peripherals only)

#### **7.7.18.3 Protocols**

PakBus is the protocol native to the CR3000 and transparently handles routine point-to-point and network communications among PCs and Campbell Scientific dataloggers. Modbus and DNP3 are industry-standard networking SCADA protocols that optionally operate in the CR3000 with minimal user configuration. PakBus®, Modbus, and DNP3 operate on the RS-232, CS I/O, and four COM ports. SDI-12 is a protocol used by some smart sensors that requires minimal configuration on the CR3000.

**Read More** See SDI-12 Sensor Support — Details (p. 420), PakBus Comms — Overview (p. 82), DNP3 — Details (p. 475), and Modbus — Details (p. 476).

Many instruments require non-standard protocols to communicate with the CR3000.

**Note** If an instrument or sensor optionally supports SDI-12, Modbus, or DNP3, consider using these protocols before programming a custom protocol. These higher-level protocols are standardized among many manufacturers and are easy to use relative to a custom protocol. SDI-12, Modbus, and DNP3 also support addressing systems that allow multiplexing of several sensors on a single communication port, which makes for more efficient use of resources.

#### 7.7.18.4 Glossary of Serial I/O Terms

Term: asynchronous

The transmission of data between a transmitting and a receiving device occurs as a series of zeros and ones. For the data to be "read" correctly, the receiving device must begin reading at the proper point in the series. In asynchronous communication, this coordination is accomplished by having each character surrounded by one or more start and stop bits which designate the beginning and ending points of the information (see *synchronous (p. 558)*).

Indicates the sending and receiving devices are not synchronized using a clock signal.

Term: baud rate

The rate at which data are transmitted.

Term: big endian

"Big end first." Placing the most significant integer at the beginning of a numeric word, reading left to right. The processor in the CR3000 is MSB, or puts the most significant integer first. See the appendix *Endianness (p. 601)*.

Term: cr

Carriage return

Term: data bits

Number of bits used to describe the data, and fit between the start and stop bits. Sensors typically use 7 or 8 data bits.

Term: duplex

A serial communication protocol. Serial communications can be simplex, half-duplex, or full-duplex.

Reading list: simplex (p. 555), duplex (p. 307), half duplex (p. 541), and full duplex (p. 540).

Term: If

Line feed. Often associated with carriage return (<cr>). <cr><lf>.

Term: little endian

"Little end first." Placing the most significant integer at the end of a numeric word, reading left to right. The processor in the CR3000 is MSB, or puts the most significant integer first. See *Endianness (p. 601)*.

Term: LSB

Least significant bit (the trailing bit). See the Endianness (p. 601).

Term: marks and spaces

RS-232 signal levels are inverted logic compared to TTL. The different levels are called marks and spaces. When referenced to signal ground, the valid RS-232 voltage level for a mark is -3 to -25, and for a space is +3 to +25 with -3 to +3 defined as the transition range that contains no information. A mark is a logic 1 and negative voltage. A space is a logic 0 and positive voltage.

Term: MSB

Most significant bit (the leading bit). See Endianness (p. 601).

Term: RS-232C

Refers to the standard used to define the hardware signals and voltage levels. The CR3000 supports several options of serial logic and voltage levels including RS-232 logic at TTL levels and TTL logic at TTL levels.

Term: RX

Receive

Term: SP

Space

Term: start bit

Is the bit used to indicate the beginning of data.

Term: stop bit

Is the end of the data bits. The stop bit can be 1, 1.5 or 2.

Term: TX

Transmit

#### 7.7.18.5 Serial I/O CRBasic Programming

To transmit or receive RS-232 or TTL signals, a serial port (see table *CR3000 Serial Ports* (p. 305)) must be opened and configured through CRBasic with the **SerialOpen()** instruction. The **SerialClose()** instruction can be used to close the serial port. Below is practical advice regarding the use of **SerialOpen()** and **SerialClose()**. Program CRBasic example *Receiving an RS-232 String* (p. 315) shows the use of **SerialOpen()**. Consult *CRBasic Editor Help* for more information.

SerialOpen(COMPort,BaudRate,Format,TXDelay,BufferSize)

- **COMPort** Refer to *CRBasic Editor Help* for a complete list of COM ports available for use by **SerialOpen()**.
- BaudRate Baud rate mismatch is frequently a problem when developing a new application. Check for matching baud rates. Some developers prefer to use a fixed baud rate during initial development. When set to -nnnn (where nnnn is the baud rate) or 0, auto baud-rate detect is enabled. Autobaud is useful when using the CS I/O and RS-232 ports since it allows ports to be simultaneously used for sensor and PC comms.

- Format Determines data type and if PakBus<sup>®</sup> communications can occur on the COM port. If the port is expected to read sensor data and support normal PakBus<sup>®</sup> telemetry operations, use an auto-baud rate argument (0 or -nnnn) and ensure this option supports PakBus<sup>®</sup> in the specific application.
- **BufferSize** The buffer holds received data until it is removed. **SerialIn()**, **SerialInRecord()**, and **SerialInBlock()** instructions are used to read data from the buffer to variables. Once data are in variables, string manipulation instructions are used to format and parse the data.

**SerialClose()** must be executed before **SerialOpen()** can be used again to reconfigure the same serial port, or before the port can be used to communicate with a PC.

#### 7.7.18.5.1 Serial I/O Programming Basics

#### SerialOpen()1

- Closes PPP (if active)
- Returns TRUE or FALSE when set equal to a Boolean variable
- Be aware of buffer size (ring memory)

#### SerialClose()

- Examples of when to close
  - Reopen PPP
  - o Finished setting new settings in a Hayes modem
  - o Finished dialing a modem
- Returns TRUE or FALSE when set equal to a Boolean variable

#### SerialFlush()

- Puts the read and write pointers back to the beginning
- Returns TRUE or FALSE when set equal to a Boolean variable

#### SerialIn()<sup>1</sup>

- Can wait on the string until it comes in
- Timeout is renewed after each character is received
- SerialInRecord() tends to obsolete SerialIn().
- Buffer-size margin (one extra record + one byte)

#### SerialInBlock()1

- For binary data (perhaps integers, floats, data with NULL characters).
- Destination can be of any type.
- Buffer-size margin (one extra record + one byte).

#### SerialOutBlock()<sup>1,3</sup>

- Binary
- Can run in pipeline mode inside the digital measurement task (along with SDM instructions) if the **COMPort** parameter is set to a constant such as **COM1**, **COM2**, **COM3**, or **COM4**, and the number of bytes is also entered as a constant.

#### SerialOut()

- Use for ASCII commands and a known response, such as Hayes-modem commands.
- If open, returns the number of bytes sent. If not open, returns 0.

#### SerialInRecord()<sup>2</sup>

- Can run in pipeline mode inside the digital measurement task (along with SDM instructions) if the **COMPort** parameter is set to a constant argument such as **COM1**, **COM2**, **COM3**, or **COM4**, and the number of bytes is also entered as a constant.
- Simplifies synchronization with one way.
- Simplifies working with protocols that send a "record" of data with known start and/or end characters, or a fixed number of records in response to a poll command.
- If a start and end word is not present, then a time gap is the only remaining separator of records. Using COM1, COM2, COM3, or COM4 coincidentally detects a time gap of >100 bits if the records are less than 256 bytes.
- Buffer size margin (one extra record + one byte).

<sup>&</sup>lt;sup>1</sup> Processing instructions

<sup>&</sup>lt;sup>2</sup> Measurement instruction in the pipeline mode

<sup>&</sup>lt;sup>3</sup> Measurement instruction if expression evaluates to a constant

#### 7.7.18.5.2 Serial I/O Input Programming Basics

Applications with the purpose of receiving data from another device usually include the following procedures. Other procedures may be required depending on the application.

- 1. Know what the sensor supports and exactly what the data are. Most sensors work well with TTL voltage levels and RS-232 logic. Some things to consider:
  - o Become thoroughly familiar with the data to be captured.
  - o Can the sensor be polled?
  - O Does the sensor send data on its own schedule?
  - Are there markers at the beginning or end of data? Markers are very useful for identifying a variable length record.
  - Does the record have a delimiter character such as a comma, space, or tab? Delimiters are useful for parsing the received serial string into usable numbers.
  - Will the sensor be sending multiple data strings? Multiple strings usually require filtering before parsing.
  - O How fast will data be sent to the CR3000?
  - o Is power consumption critical?
  - O Does the sensor compute a checksum? Which type? A checksum is useful to test for data corruption.
- 2. Open a serial port with **SerialOpen()**.
  - Example:

SerialOpen(Com1,9600,0,0,10000)

- o Designate the correct port in CRBasic.
- o Correctly wire the device to the CR3000.
- o Match the port baud rate to the baud rate of the device in CRBasic (use a fixed baud rate rather than autobaud when possible).
- 3. Receive serial data as a string with SerialIn() or SerialInRecord().
  - Example:
    SerialInRecord(Com2, SerialInString, 42,0,35,"",01)
  - o Declare the string variable large enough to accept the string.

```
— Example:
Public SerialInString As String * 25
```

Observe the input string in the input string variable in a *numeric* monitor (p. 547).

Note SerialIn() and SerialInRecord() both receive data. SerialInRecord() is best for receiving streaming data. SerialIn() is best for receiving discrete blocks.

- 4. Parse (split up) the serial string using **SplitStr()** 
  - o Separates string into numeric and / or string variables.
  - Example:

```
SplitStr(InStringSplit,SerialInString,"",2,0)
```

- O Declare an array to accept the parsed data.
- Example:
  Public InStringSplit(2) As String
- Example:
  Public SplitResult(2) As Float

#### 7.7.18.5.3 Serial I/O Output Programming Basics

Applications with the purpose of transmitting data to another device usually include the following procedures. Other procedures may be required depending on the application.

- 1. Open a serial port with **SerialOpen()** to configure it for communications.
  - Parameters are set according to the requirements of the communication link and the serial device.
  - Example:

```
SerialOpen(Com1,9600,0,0,10000)
```

- o Designate the correct port in CRBasic.
- o Correctly wire the device to the CR3000.
- o Match the port baud rate to the baud rate of the device in CRBasic.
- Use a fixed baud rate (rather than auto baud) when possible.
- 2. Build the output string.
  - o Example:

```
SerialOutString = "*" & "27.435" & "," & "56.789" & "#"
```

- Tip concatenate (add) strings together using & instead of +.
- Tip use CHR() instruction to insert ASCII / ANSI characters into a string.
- 3. Output string via the serial port (SerialOut() or SerialOutBlock() command).
  - o Example:

```
SerialOut(Com1, SerialOutString, "", 0, 100)
```

- Declare the output string variable large enough to hold the entire concatenation.
- o Example:

```
Public SerialOutString As String * 100
```

• SerialOut() and SerialOutBlock() output the same data, except that SerialOutBlock() transmits null values while SerialOut() strings are terminated by a null value.

#### 7.7.18.5.4 Serial I/O Translating Bytes

One or more of three principle data formats may end up in the **SerialInString()** variable (see examples in **Serial Input Programming Basics (p. 311)**). Data may be combinations or variations of these. The instrument manufacturer must provide the rules for decoding the data

• Alpha-numeric — Each digit represents an alpha-numeric value. For example, R = the letter R, and 2 = decimal 2. This is the easiest protocol to translate since the encode and translation are identical. Normally, the CR3000 is programmed to parse (split) the string and place values in variables.

Example string from humidity, temperature, and pressure sensor:

```
SerialInString = "RH= 60.5 %RH T= 23.7 °C Tdf= 15.6 °C Td=
15.6 °C a= 13.0 g/m3          x= 11.1          g/kg          Tw= 18.5 °C H20=
17889 ppmV   pw=17.81 hPa pws          29.43 hPa h= 52.3 kJ/kg          dT=
8.1 °C"
```

Hex Pairs — Bytes are translated to hex pairs, consisting of digits 0 to 9 and letters a to f. Each pair describes a hexadecimal ASCII / ANSI code. Some codes translate to alpha-numeric values, others to symbols or non-printable control characters.

Example sting from temperature sensor:

```
SerialInString = "23 30 31 38 34 0D"

which translates to

#01 84 cr
```

• Binary — Bytes are processed on a bit-by-bit basis. Character 0 (Null, &b00) is a valid part of binary data streams. However, the CR3000 uses Null terminated strings, so anytime a Null is received, a string is terminated. The termination is usually premature when reading binary data. To remedy this problem, use SerialInBlock() or SerialInRecord() when reading binary data. The input string variable must be an array set As Long data type, for example:

Dim SerialInString As Long

#### 7.7.18.5.5 Serial I/O Memory Considerations

Several points regarding memory should be considered when receiving and processing serial data.

• **Serial buffer:** The serial port buffer, which is declared in **SerialOpen()**, must be large enough to hold all data a device will send. The buffer holds the data for subsequent transfer to variables. Allocate extra memory to the buffer when needed, but recognize that memory added to the buffer reduces *final-data memory (p. 539)*.

**Note** Concerning **SerialInRecord()** running in pipeline mode with **NBytes** (number of bytes) parameter = 0:

For the digital measurement sequence to know how much room to allocate in **Scan()** *buffers* (default of 3), **SerialInRecord()** allocates the buffer size specified by **SerialOpen()** (default 10,000, an overkill), or default 3 • 10,000 = 30 kB of buffer space. So, while making sure enough bytes are allocated in **SerialOpen()** (the number of bytes per record • ((records/Scan)+1) + at least one extra byte), there is reason not to make the buffer size too large. (Note that if the *NumberOfBytes* parameter is non-zero, then **SerialInRecord()** allocates only this many bytes instead of the number of bytes specified by **SerialOpen()**).

- Variable Declarations Variables used to receive data from the serial buffer can be declared as **Public** or **Dim**. Declaring variables as **Dim** has the effect of consuming less comms bandwidth. When public variables are viewed in software, the entire **Public** table is transferred at the update interval. If the **Public** table is large, comms bandwidth can be taxed such that other data tables are not collected
- String Declarations String variables are memory intensive.
   Determine how large strings are and declare variables just large enough to hold the string. If the sensor sends multiple strings at once, consider declaring a single string variable and read incoming strings one at a time.

The CR3000 adjusts upward the declared size of strings. One byte is always added to the declared length, which is then increased by up to another three bytes to make the length divisible by four.

Declared string length, not number of characters, determines the memory consumed when strings are written to memory. Consequently, large strings not filled with characters waste significant memory.

#### 7.7.18.5.6 Serial I/O Example I

CRBasic example *Receiving an RS-232 String (p. 315)* is provided as an exercise in serial input / output programming. The example only requires the CR3000 and a single-wire jumper between **COM1 Tx** and **COM2 Rx**. The program simulates a temperature and relative humidity sensor transmitting RS-232 (simulated data comes out of **COM1** as an alpha-numeric string).

#### CRBasic EXAMPLE 69: Receiving an RS-232 String 'This program example demonstrates CR3000 serial I/O features by: ' 1. Simulating a serial sensor ' 2. Transmitting a serial string via COM1 TX. 'The serial string is received at COM2 RX via jumper wire. Simulated 'air temperature = 27.435 F, relative humidity = 56.789 %. 'Wiring: 'COM1 TX (C1) ---- COM2 RX (C4) 'Serial Out Declarations Public TempOut As Float Public RhOut As Float 'Declare a string variable large enough to hold the output string. Public SerialOutString As String \* 25 'Serial In Declarations 'Declare a string variable large enough to hold the input string Public SerialInString As String \* 25 'Declare strings to accept parsed data. If parsed data are strictly numeric, this 'array can be declared as Float or Long Public InStringSplit(2) As String Alias InStringSplit(1) = TempIn Alias InStringSplit(2) = RhIn 'Main Program BeginProg 'Simulate temperature and RH sensor TempOut = 27.435'Set simulated temperature to transmit RhOut = 56.789'Set simulated relative humidity to transmit Scan(5,Sec, 3, 0) 'Serial Out Code 'Transmits string "\*27.435,56.789#" out COM1 SerialOpen(Com1,9600,0,0,10000) 'Open a serial port 'Build the output string SerialOutString = "\*" & TempOut & "," & RhOut & "#"

```
'Output string via the serial port
SerialOut(Com1, SerialOutString, "", 0, 100)

'Serial In Code
'Receives string "27.435,56.789" via COM2
'Uses * and # character as filters
SerialOpen(Com2,9600,0,0,10000) 'Open a serial port

'Receive serial data as a string
'42 is ASCII code for "*", 35 is code for "#"
SerialInRecord(Com2, SerialInString, 42,0,35,"",01)

'Parse the serial string
SplitStr(InStringSplit(), SerialInString, "",2,0)

NextScan
EndProg
```

#### 7.7.18.6 Serial I/O Application Testing

A common problem when developing a serial I/O application is the lack of an immediately available serial device with which to develop and test programs. Using *HyperTerminal*, a developer can simulate the output of a serial device or capture serial input.

**Note** *HyperTerminal* is provided as a utility with *Windows XP* and earlier versions of Windows. *HyperTerminal* is not provided with later versions of Windows, but can be purchased separately from http://www.hilgraeve.com. HyperTerminal automatically converts binary data to ASCII on the screen. Binary data can be captured, saved to a file, and then viewed with a hexadecimal editor. Other terminal emulators are available from third-party vendors that facilitate capture of binary or hexadecimal data.

#### 7.7.18.6.1 Configure HyperTerminal

Create a *HyperTerminal* instance file by clicking **Start** | **All Programs** | **Accessories** | **Communications** | **HyperTerminal**. The windows in the figures *HyperTerminal Connection Description* (p. 317) through *HyperTerminal ASCII Setup* (p. 318) are presented. Enter an instance name and click **OK**.

FIGURE 73: HyperTerminal New Connection Description



FIGURE 74: HyperTerminal Connect-To Settings



FIGURE 75: HyperTerminal COM Port Settings Tab: Click File | Properties | Settings | ASCII Setup... and set as shown.


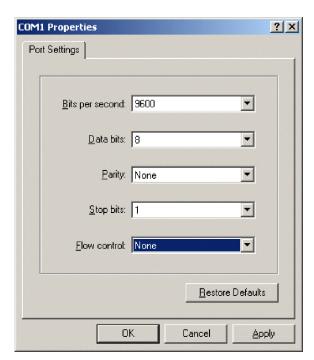



FIGURE 76: HyperTerminal ASCII Setup

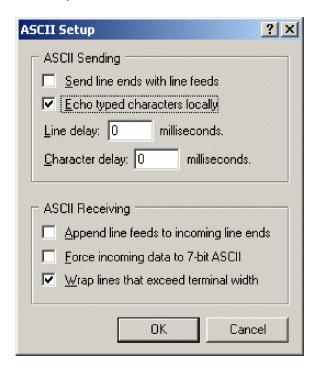

#### 7.7.18.6.2 Create Send-Text File

Create a file from which to send a serial string. The file shown in the figure *HyperTerminal Send-Text File Example* (p. 319) will send the string [2008:028:10:36:22]C to the CR3000. Use *Notepad* (Microsoft *Windows* utility) or some other text editor that will not place hidden characters in the file.

FIGURE 77: HyperTerminal Send-Text File Example

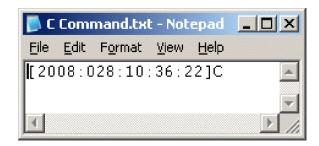


To send the file, click **Transfer** | **Send Text File** | **Browse** for file, then click **OK**.

#### 7.7.18.6.3 Create Text-Capture File

Figure HyperTerminal Text-Capture File Example (p. 319) shows a HyperTerminal capture file with some data. The file is empty before use commences.

FIGURE 78: HyperTerminal Text-Capture File Example

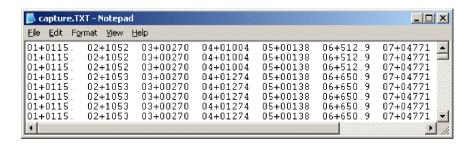

Engage text capture by clicking on **Transfer** | **Capture Text** | **Browse**, select the file, and then click **OK**.

#### 7.7.18.6.4 Serial I/O Example II

CRBasic example *Measure Sensors / Send RS-232 Data (p. 320)* illustrates a use of CR3000 serial I/O features.

Example — An energy company has a large network of older CR510 dataloggers into which new CR3000 dataloggers are to be incorporated. The CR510 dataloggers are programmed to output data in the legacy Campbell Scientific Printable ASCII format, which satisfies requirements of the customer's data

acquisition network. The network administrator prefers to synchronize the CR510 clocks from a central computer using the legacy Campbell Scientific C command. The CR510 datalogger is hard-coded to output printable ASCII and recognize the C command. CR3000 dataloggers, however, require custom programming to output and accept these same ASCII strings. A similar program can be used to emulate CR10X and CR23X dataloggers.

Solution — CRBasic example *Measure Sensors / Send RS-232 Data (p. 320)* imports and exports serial data with the CR3000 RS-232 port. Imported data are expected to have the form of the legacy Campbell Scientific time set C command. Exported data has the form of the legacy Campbell Scientific Printable ASCII format.

**Note** The nine-pin RS-232 port can be used to download the CR3000 program if the **SerialOpen()** baud rate matches that of the *datalogger* support software (p. 614). However, two-way PakBus® communications will cause the CR3000 to occasionally send unsolicited PakBus® packets out the RS-232 port for at least 40 seconds after the last PakBus® communication. This will produce some "noise" on the intended data-output signal.

Monitor the CR3000 RS-232 port with *HyperTerminal* as described in the section *Configure HyperTerminal* (p. 316). Send C-command file to set the clock according to the text in the file.

**Note** The *HyperTerminal* file will not update automatically with actual time. The file only simulates a clock source for the purposes of this example.

# 'port. Imported data are expected to have the form of the legacy Campbell Scientific 'time set C command: ' [YR:DAY:HR:MM:SS]C 'Exported data has the form of the legacy Campbell Scientific Printable ASCII format: ' 01+0115. 02+135 03+00270 04+7999 05+00138 06+07999 07+04771 'Declarations 'Visible Variables Public StationID Public KWH\_In

'This program example demonstrates the import and export serial data via the CR3000 RS-232

CRBasic EXAMPLE 70: Measure Sensors / Send RS-232 Data

Public KVarH\_I Public KWHHold Public KVarHold Public KWHH Public KvarH

Public InString As String \* 25 Public OutString As String \* 100

```
'Hidden Variables
Dim i, rTime(9), OneMinData(6), OutFrag(6) As String
Dim InStringSize, InStringSplit(5) As String
Dim Date, Month, Year, DOY, Hour, Minute, Second, uSecond
Dim LeapMOD4, LeapMOD100, LeapMOD400
Dim Leap4 As Boolean, Leap100 As Boolean, Leap400 As Boolean
Dim LeapYear As Boolean
Dim ClkSet(7) As Float
'One Minute Data Table
DataTable(OneMinTable,true,-1)
 OpenInterval
                             'sets interval same as found in CR510
 DataInterval(0,1,Min,10)
 Totalize(1, KWHH, FP2,0)
 Sample(1, KWHHold, FP2)
 Totalize(1, KvarH, FP2,0)
  Sample(1, KVarHold,FP2)
  Sample(1, StationID,FP2)
EndTable
'Clock Set Record Data Table
DataTable(ClockSetRecord, True, -1)
 Sample(7,ClkSet(),FP2)
EndTable
'Subroutine to convert date formats (day-of-year to month and date)
Sub DOY2MODAY
  'Store Year, DOY, Hour, Minute and Second to Input Locations.
  Year = InStringSplit(1)
  DOY = InStringSplit(2)
  Hour = InStringSplit(3)
  Minute = InStringSplit(4)
  Second = InStringSplit(5)
  uSecond = 0
  'Check if it is a leap year:
  'If Year Mod 4 = 0 and Year Mod 100 <> 0, then it is a leap year OR
  'If Year Mod 4 = 0, Year Mod 100 = 0, and Year Mod 400 = 0, then it
  'is a leap year
  LeapYear = 0
                                     'Reset leap year status location
  LeapMOD4 = Year MOD 4
  LeapMOD100 = Year MOD 100
  LeapMOD400 = Year MOD 400
  If LeapMOD4 = 0 Then Leap4 = True Else Leap4 = False
  If LeapMOD100 = 0 Then Leap100 = True Else Leap100 = False
  If LeapMOD400 = 0 Then Leap400 = True Else Leap400 = False
```

```
If Leap4 = True Then
 LeapYear = True
 If Leap100 = True Then
   If Leap400 = True Then
      LeapYear = True
      LeapYear = False
   EndIf
 EndIf
E1se
 LeapYear = False
EndIf
'If it is a leap year, use this section.
If (LeapYear = True) Then
 Select Case DOY
   Case Is < 32
      Month = 1
      Date = DOY
   Case Is < 61
      Month = 2
      Date = DOY + -31
   Case Is < 92
      Month = 3
      Date = DOY + -60
   Case Is < 122
      Month = 4
      Date = DOY + -91
   Case Is < 153
      Month = 5
      Date = DOY + -121
   Case Is < 183
      Month = 6
      Date = DOY + -152
   Case Is < 214
      Month = 7
      Date = DOY + -182
   Case Is < 245
      Month = 8
      Date = DOY + -213
   Case Is < 275
     Month = 9
     Date = DOY + -244
   Case Is < 306
     Month = 10
      Date = DOY + -274
   Case Is < 336
     Month = 11
      Date = DOY + -305
   Case Is < 367
      Month = 12
      Date = DOY + -335
 EndSelect
```

```
'If it is not a leap year, use this section.
   Select Case DOY
     Case Is < 32
       Month = 1
       Date = DOY
     Case Is < 60
       Month = 2
       Date = DOY + -31
     Case Is < 91
       Month = 3
       Date = DOY + -59
     Case Is < 121
       Month = 4
       Date = DOY + -90
     Case Is < 152
       Month = 5
       Date = DOY + -120
     Case Is < 182
       Month = 6
       Date = DOY + -151
     Case Is < 213
       Month = 7
       Date = DOY + -181
     Case Is < 244
       Month = 8
       Date = DOY + -212
     Case Is < 274
       Month = 9
       Date = DOY + -243
     Case Is < 305
       Month = 10
       Date = DOY + -273
     Case Is < 336
       Month = 11
       Date = DOY + -304
     Case Is < 366
       Month = 12
       Date = DOY + -334
   EndSelect
 EndIf
EndSub
BeginProg
 StationID = 4771
 Scan(1, Sec, 3, 0)
    '////////////Measurement Section/////////////////
    'PulseCount(KWH_In, 1, 1, 2, 0, 1, 0) 'Activate this line in working program
   KWH_In = 4.5
                          'Simulation -- delete this line from working program
   'PulseCount(KVarH_I, 1, 2, 2, 0, 1, 0) 'Activate this line in working program
                          'Simulation -- delete this line from working program
```

```
KWHH = KWH_In
KvarH = KVarH_I
KWHHold = KWHH + KWHHold
KVarHold = KvarH + KVarHold
CallTable OneMinTable
SerialOpen(ComRS232,9600,0,0,10000)
'////////Serial Time Set Input Section/////////
'Accept old C command -- [2008:028:10:36:22]C -- parse, process, set
'clock (Note: Chr(91) = "[", Chr(67) = "C")
SerialInRecord(ComRS232,InString,91,0,67,InStringSize,01)
If InStringSize <> 0 Then
  SplitStr(InStringSplit,InString,"",5,0)
  Call DOY2MODAY
                                    'Call subroutine to convert day-of-year
                                    'to month & day
 ClkSet(1) = Year
 C1kSet(2) = Month
 ClkSet(3) = Date
 ClkSet(4) = Hour
 C1kSet(5) = Minute
 C1kSet(6) = Second
 C1kSet(7) = uSecond
  'Note: C1kSet array requires year, month, date, hour, min, sec, msec
 ClockSet(ClkSet())
 CallTable(ClockSetRecord)
EndIf
'Construct old Campbell Scientific Printable ASCII data format and output to COM1
'Read datalogger clock
RealTime(rTime)
If TimeIntoInterval(0,5,Sec) Then
  'Load OneMinData table data for processing into printable ASCII
 GetRecord(OneMinData(),OneMinTable,1)
  'Assign +/- Sign
 For i=1 To 6
   If OneMinData(i) < 0 Then</pre>
      'Note: chr45 is - sign
     OutFrag(i)=CHR(45) & FormatFloat(ABS(OneMinData(i)),"%05g")
      'Note: chr43 is + sign
     OutFrag(i)=CHR(43) & FormatFloat(ABS(OneMinData(i)), "%05g")
   EndIf
 Next i
  'Concatenate Printable ASCII string, then push string out RS-232
  '(first 2 fields are ID, hhmm):
 OutString = "01+0115." & " 02+" & FormatFloat(rTime(4), "%02.0f") & _
   FormatFloat(rTime(5),"%02.0f")
 OutString = OutString & " 03" & OutFrag(1) & " 04" & OutFrag(2) & _
   " 05" & OutFrag(3)
 OutString = OutString & " 06" & OutFrag(4) & " 07" & OutFrag(5) & _
   CHR(13) & CHR(10) & "" 'add CR LF null
```

```
'Send printable ASCII string out RS-232 port
SerialOut(ComRS232,OutString,"",0,220)
EndIf

NextScan
EndProg
```

#### 7.7.18.7 Serial I/O Q & A

**Q**: I am writing a CR3000 program to transmit a serial command that contains a null character. The string to transmit is:

```
CHR(02) + CHR(01) + "CWGT0" + CHR(03) + CHR(00) + CHR(13) + CHR(10)
```

How does the logger handle the null character? Is there a way that we can get the logger to send this?

A: Strings created with CRBasic are NULL terminated. Adding strings together means the second string will start at the first null it finds in the first string.

Use **SerialOutBlock()** instruction, which lets you send null characters, as shown below.

```
SerialOutBlock(COMRS232, CHR(02) + CHR(01) + "CWGT0" +
CHR(03),8)
SerialOutBlock(COMRS232, CHR(0),1)
SerialOutBlock(COMRS232, CHR(13) + CHR(10),2)
```

Q: Please summarize when the CR3000 powers the RS-232 port. I get that there is an "always on" setting. How about when there are beacons? Does the **SerialOpen()** instruction cause other power cycles?

A: The RS-232 port is left on under the following conditions:

- When the setting **RS-232Power** (p. 589) is set
- When a **SerialOpen()** with argument *COMRS232* is used in the program

Both conditions power-up the interface and leave it on with no timeout. If **SerialClose()** is used after **SerialOpen()**, the port is powered down and in a state waiting for characters to come in.

Under normal operation, the port is powered down waiting for input. After receiving input, there is a 40 second software timeout that must expire before shutting down. The 40 second timeout is generally circumvented when communicating with the *datalogger support software* (p. 91) because the software sends information as part of the protocol that lets the CR3000 know that it can shut down the port.

When in the "dormant" state with the interface powered down, hardware is configured to detect activity and wake up, but there is the penalty of losing the first character of the incoming data stream. PakBus® takes this into consideration in the "ring packets" that are preceded with extra sync bytes at the start of the

packet. For this reason **SerialOpen()** leaves the interface powered up so no incoming bytes are lost.

When the CR3000 has data to send with the RS-232 port, if the data are not a response to a received packet, such as sending a beacon, it will power up the interface, send the data, and return to the "dormant" state with no 40 second timeout.

**Q**: How can I reference specific characters in a string?

A: The third 'dimension' of a string variable provides access to that part of the string after the position specified. For example, if

```
TempData = "STOP"
then,
TempData(1,1,2) = "TOP"
TempData(1,1,3) = "OP"
```

TempData(1,1,1) = "STOP"

To handle single-character manipulations, declare a string with a size of 1. This single-character string is then used to search for specific characters. In the following example, the first character of string *LargerString* is determined and used to control program logic:

```
Public TempData As String * 1
  TempData = LargerString
  If TempData = "S" Then...
```

A single character can be retrieved from any position in a string. The following example retrieves the fifth character of a string:

```
Public TempData As String * 1
TempData = LargerString(1,1,5)
```

Q: How can I get SerialIn(), SerialInBlock(), and SerialInRecord() to read extended characters?

A: Open the port in binary mode (mode 3) instead of PakBus-enabled mode (mode 0).

Q: Tests with an oscilloscope showed the sensor was responding quickly, but the data were getting held up in the internals of the CR3000 somewhere for 30 ms or so. Characters at the start of a response from a sensor, which come out in 5 ms, were apparently not accessible by the program for 30 ms or so; in fact, no data were in the serial buffer for 30 ms or so.

A: As a result of internal buffering in the CR3000 and / or external interfaces, data may not appear in the serial port buffer for a period ranging up to 50 ms (depending on the serial port being used). This should be kept in mind when setting timeouts for the **SerialIn()** and **SerialOut()** instructions, or user-defined timeouts in constructs using the **SerialInChk()** instruction.

**Q**: What are the termination conditions that will stop incoming data from being stored?

#### A: Termination conditions:

- TerminationChar argument is received
- MaxNumChars argument is met
- TimeOut argument is exceeded

**SerialIn()** does NOT stop storing when a Null character (&h00) is received (unless a NULL character is specified as the termination character). As a string variable, a NULL character received will terminate the string, but nevertheless characters after a NULL character will continue to be received into the variable space until one of the termination conditions is met. These characters can later be accessed with **MoveBytes()** if necessary.

**Q**: How can a variable populated by **SerialIn()** be used in more than one sequence and still avoid using the variable in other sequences when it contains old data?

**A**: A simple caution is that the destination variable should not be used in more than one sequence to avoid using the variable when it contains old data. However, this is not always possible and the root problem can be handled more elegantly.

When data arrives independent from execution of the CRBasic program, such as occurs with streaming data, measures must be taken to ensure that the incoming data are updated in time for subsequent processes using that data. When the task of writing data is separate from the task of reading data, you should control the flow of data with deliberate control features such as the use of flags or a time-stamped weigh point as can be obtained from a data table.

There is nothing unique about **SerialIn()** with regard to understanding how to correctly write to and read from global variables using multiple sequences. **SerialIn()** is writing into an array of characters. Many other instructions write into an array of values (characters, floats, or longs), such as **Move()**, **MoveBytes()**, **GetVariables()**, **SerialInRecord()**, **SerialInBlock()**. In all cases, when writing to an array of values, it is important to understand what you are reading, if you are reading it asynchronously, in other words reading it from some other task that is polling for the data at the same time as it is being written, whether that other task is some other machine reading the data, like *LoggerNet*, or a different sequence, or task, within the same machine. If the process is relatively fast, like the **Move()** instruction, and an asynchronous process is reading the data, this can be even worse because the "reading old data" will happen less often but is more insidious because it is so rare.

# 7.7.19 String Operations

String operations are performed using CRBasic string functions.

# 7.7.19.1 String Operators

The table *String Operators (p. 328)* lists and describes available string operators. String operators are case sensitive.

TABLE 61: String Operators			
Operator	Description		
&	Concatenates strings. Forces numeric values to strings before concatenation.  Example  1 & 2 & 3 & "a" & 5 & 6 & 7 = "123a567"		
+	Adds numeric values until a string is encountered. When a string is encountered, it is appended to the sum of the numeric values. Subsequent numeric values are appended as strings.  Example:  1 + 2 + 3 + "a" + 5 + 6 + 7 = "6a567"		
	"Subtracts" NULL ("") from the end of ASCII characters for conversion to an ASCII code (LONG data type).  Example:  "a" - "" = 97  ASCII codes of the first characters in each string are compared. If the difference between the codes is zero, codes for the next characters are compared. When unequal codes or NULL are encountered (NULL terminates all strings), the difference between the last compared ASCII codes is returned.  Examples:  Note — ASCII code for a = 97, b = 98, c = 99, d = 100, e = 101, and all strings end with NULL.  Difference between NULL and NULL  "abc" - "abc" = 0  Difference between e and c  "abe" - "abc" = 2  Difference between c and b  "ace" - "abe" = 1  Difference between d and NULL  "abcd" - "abc" = 100		

TABLE 61: String Operators				
Operator	De	escription		
<,>,<>,<=, >=,=	ASCII codes of the first characters in each string are compared. If the difference between the codes is zero, codes for the next characters are compared. When unequal codes or NULL are encountered (NULL terminates all strings), the requested comparison is made. If the comparison is true, -1 or <b>True</b> is returned. If false, <b>0</b> or <b>False</b> is returned. Examples:			
	Expression	Result		
	x = "abc" = "abc" x = "abe" = "abc" x = "ace" > "abe"	x = -1 or True		
	x = "abe" = "abc"	x = 0 or False		
	x = "ace" > "abe"	x = -1 or True		

# 7.7.19.2 String Concatenation

Concatenation is the building of strings from other strings ("abc123"), characters ("a" or **chr()**), numbers, or variables. The table *String Concatenation Examples* (p. 329) lists some expressions and expected results. CRBasic example *Concatenation of Numbers and Strings* (p. 329) demonstrates several concatenation examples.

When non-string values are concatenated with strings, once a string is encountered, all subsequent operands will first be converted to a string before the + operation is performed. When working with strings, exclusive use of the & operator ensures that no string value will be converted to an integer.

TABLE 62: String Concatenation Examples				
Expression	Comments	Result		
Str(1) = 5.4 + 3 + " Volts"	Add floats, concatenate strings	"8.4 Volts"		
Str(2) = 5.4 & 3 & " Volts"	Concatenate floats and strings	"5.43 Volts"		
Lng(1) = "123"	Convert string to long	123		
Lng(2) = 1+2+"3"	Add floats to string / convert to long	33		
Lng(3) = "1"+2+3	Concatenate string and floats	123		
Lng(4) = 1&2&"3"	Concatenate floats and string	123		

```
CRBasic EXAMPLE 71: Concatenation of Numbers and Strings

'This program example demonstrates the concatenation of numbers and strings to variables
'declared As Float and As String.

'Declare Variables
Public Num(12) As Float
Public Str(2) As String
Dim I
```

```
BeginProg
 Scan(1, Sec, 0, 0)
   I = 0 'Set I to zero
    'Data type of the following destination variables is Float
    'because Num() array is declared As Float.
   I += 1 'Increment I by 1 to clock through sequential elements of the Num() array
    'As shown in the following expression, if all parameter are numbers, the result
    'of using '+' is a sum of the numbers:
   Num(I) = 2 + 3 + 4
    'Following are examples of using '+' and '*' when one or more parameters are strings.
    'Parameters are processed in the standard order of operations. In the order of
    'operation, once a string or an '&' is processed, all following parameters will
    'be processed (concatenated) as strings:
   I += 1
   Num(I) = "1" + 2 + 3 + 4
                                             '= 1234
   I += 1
                                             '= 1234
   Num(I) = 1 + "2" + 3 + 4
   I += 1
                                             ′= 334
   Num(I) = 1 + 2 + "3" + 4
   I += 1
   Num(I) = 1 + 2 + 3 + "4"
                                             '= 64
   I += 1
   Num(I) = 1 + 2 + "3" + 4 + 5 + "6"
                                             '= 33456
   I += 1
   Num(I) = 1 + 2 + "3" + (4 + 5) + "6"
                                             '= 3396
   I += 1
   Num(I) = 1 + 2 + "3" + 4 * 5 + "6"
                                             '= 33206
   I += 1
   Num(I) = 1 & 2 + 3 + 4
                                             '= 1234
   I += 1
   Num(I) = 1 + 2 + 3 & 4
                                              '= 64
    'If a non-numeric string is attempted to be processed into a float destination,
    'operations are truncated at that point
   I += 1
   Num(I) = 1 + 2 + "hey" + 4 + 5 + "6"
   I += 1
   Num(I) = 1 + 2 + "hey" + (4 + 5) + "6" '= 3
    'The same rules apply when the destination is of data type String, except in the
    'case wherein a non-numeric string is encountered as follows. Data type of the
    'following destination variables is String because Str() array is declared As String.
   I = 0
   Str(I) = 1 + 2 + "hey" + 4 + 5 + "6"
                                             '= 3hev456
   Str(I) = 1 + 2 + "hey" + (4 + 5) + "6"
                                             '= 3hey96
 NextScan
EndProg
```

# 7.7.19.3 String NULL Character

All strings are automatically NULL terminated. NULL is the same as **Chr**(0) or "", counts as one of the characters in the string. Assignment of just one character is that character followed by a NULL, unless the character is a NULL.

TABLE 63: String NULL Character Examples				
Expression	Comments	Resul t		
LongVar(5) = "#"-""	Subtract NULL, ASCII code results	35		
LongVar(6) = StrComp("#","")	Also subtracts NULL	35		

#### Example:

Objective:

Insert a NULL character into a string, and then reconstitute the string.

Given:

$$StringVar(3) = "123456789"$$

Execute:

Results:

but,

so,

```
StringVar(5) = StringVar(3,1,4+1)
'"56789"
StringVar(6) = StringVar(3) + 4 + StringVar(3,1,4+1)
'"123456789"
```

Some smart sensors send strings containing NULL characters. To manipulate a string that has NULL characters within it (in addition to being terminated with another NULL), use **MoveBytes()** instruction.

# 7.7.19.4 Inserting String Characters

#### **Example:**

Objective:

Use MoveBytes() to change "123456789" to "123A56789"

Given:

try (does not work):

Instead, use:

```
StringVar(7) = MoveBytes(Strings(7,1,4),0,"A",0,1) 'Result is "123A56789"
```

### 7.7.20 Subroutines

A subroutine is a group of programming instructions that is called by, but runs outside of, the main program. Subroutines are used for the following reasons:

- To reduce program length. Subroutine code can be executed multiple times in a program scan.
- To ease integration of proven code segments into new programs.
- To compartmentalize programs to improve organization.

By executing the **Call()** instruction, the main program can call a subroutine from anywhere in the program.

A subroutine has access to all *global variables* (p. 541). Variables *local* (p. 544) to a subroutine are declared within the subroutine instruction. Local variables can be aliased (as of 4/2013; OS 26) but are not displayed in the **Public** table. Global and local variables can share the same name and not conflict. If global variables are passed to local variables of different type, the same type conversion rules apply as apply to conversions among variables declared as **Public** or **Dim**. See *Expressions with Numeric Data Types* (p. 171) for conversion types.

**Note** To avoid programming conflicts, pass information into local variables and / or define some global variables and use them exclusively by a subroutine.

CRBasic example *Subroutine with Global and Local Variables (p. 333)* shows the use of global and local variables. Variables **counter()** and **pi\_product** are global. Variable **i** sub is global but used exclusively by subroutine **process**. Variables

**j()** and *OutVar* are local since they are declared as parameters in the **Sub()** instruction.

```
Sub process(j(4) AS Long,OutVar).
```

Variable **j()** is a four-element array and variable **OutVar** is a single-element array. The call statement,

```
Call ProcessSub (counter(1),pi_product)
```

passes five values into the subroutine: **pi\_product** and four elements of array **counter()**. Array **counter()** is used to pass values into, and extract values from, the subroutine. The variable **pi\_product** is used to extract a value from the subroutine.

**Call()** passes the values of all listed variables into the subroutine. Values are passed back to the main scan at the end of the subroutine.

#### **CRBasic EXAMPLE 72:** Subroutine with Global and Local Variables

```
'This program example demonstrates the use of global and local variables with subroutines.
'Global variables are those declared anywhere in the program as Public or Dim.
'Local variables are those declared in the Sub() instruction.
'Program Function: Passes two variables to a subroutine. The subroutine increments each
'variable once per second, multiplies each by pi, then passes results back to the main
'program for storage in a data table.
'Global variables (Used only outside subroutine by choice)
'Declare Counter in the Main Scan.
Public counter(2) As Long
'Declare Product of PI * counter(2).
Public pi_product(2) As Float
'Global variable (Used only in subroutine by choice)
'For / Next incrementor used in the subroutine.
Public i_sub As Long
'Declare Data Table
DataTable(pi_results,True,-1)
 Sample(1,counter(),IEEE4)
EndTable
'Declare Subroutine
'Declares j(4) as local array (can only be used in subroutine)
Sub ProcessSub (j(2) As Long,OutVar(2) As Float)
 For i\_sub = 1 To 2
    j(i\_sub) = j(i\_sub) + 1
    'Processing to show functionality
   OutVar(i\_sub) = j(i\_sub) * 4 * ATN(1)
                                              '(Tip: 4 * ATN(1) = pi to IEEE4 precision)
 Next i_sub
EndSub
```

```
BeginProg
  counter(1) = 1
  counter(2) = 2
  Scan(1,Sec,0,0)

  'Pass Counter() array to j() array, pi_pruduct() to OutVar()
    Call ProcessSub (counter(),pi_product())
    CallTable pi_results

  NextScan
EndProg
```

# 8. Operation

#### Related Topics:

- Quickstart (p. 37)
- Specifications (p. 95)
- Installation (p. 97)
- Operation (p. 335)

#### 8.1 Measurements — Details

#### Related Topics:

- Sensors Quickstart (p. 37)
- Measurements Overview (p. 67)
- Measurements Details (p. 335)
- Sensors Lists (p. 609)

Several features give the CR3000 the flexibility to measure most sensor types. Some sensors require precision excitation or a source of power. See *Switched-Voltage Output* — *Details (p. 424)*.

# 8.1.1 Time Keeping — Details

#### Related Topics:

- Time Keeping Overview (p. 67)
- Time Keeping Details (p. 335)

—Measurement of time is an essential function of the CR3000. Time measurement with the on-board clock enables the CR3000 to attach time stamps to data, measure the interval between events, and time the initiation of control functions.

# **8.1.1.1 Time Stamps**

A measurement without an accurate time reference has little meaning. Data on the CR3000 are stored with time stamps. How closely a time stamp corresponds to the actual time a measurement is taken depends on several factors.

The time stamp in common CRBasic programs matches the time at the beginning of the current scan as measured by the real-time clock in the CR3000. If a scan starts at 15:00:00, data output during that scan will have a time stamp of 15:00:00 regardless of the length of the scan or when in the scan a measurement is made. The possibility exists that a scan will run for some time before a measurement is made. For instance, a scan may start at 15:00:00, execute time-consuming code, then make a measurement at 15:00:00.51. The time stamp attached to the measurement, if the CallTable() instruction is called from within the Scan() / NextScan construct, will be 15:00:00, resulting in a time-stamp skew of 510 ms.

Time-stamp skew is not a problem with most applications because,

- program execution times are usually short, so time stamp skew is only a few milliseconds. Most measurement requirements allow for a few milliseconds of skew.
- data processed into averages, maxima, minima, and so forth are composites of several measurements. Associated time stamps only reflect the time the last measurement was made and processing calculations were completed, so the significance of the exact time a specific sample was measured diminishes.

Applications measuring and storing sample data wherein exact time stamps are required can be adversely affected by time-stamp skew. Skew can be avoided by

- Making measurements in the scan before time-consuming code.
- Programming the CR3000 such that the time stamp reflects the system time rather than the scan time. When CallTable() is executed from within the Scan() / NextScan construct, as is normally done, the time stamp reflects scan time. By executing the CallTable() instruction outside the Scan() / NextScan construct, the time stamp will reflect system time instead of scan time. CRBasic example Time Stamping with System Time (p. 336) shows the basic code requirements. The DataTime() instruction is a more recent introduction that facilitates time stamping with system time. See topics concerning data table declarations in CRBasic Editor Help for more information.

```
CRBasic EXAMPLE 73: Time Stamping with System Time
'This program example demonstrates the time stamping of data with system time instead of
'the default use of scan time (time at which a scan started).
'Declare Variables
Public value
'Declare data table
DataTable(Test,True,1000)
  Sample(1,Value,FP2)
EndTable
SequentialMode
BeginProg
  Scan(1, Sec, 10, 0)
    'Delay -- in an operational program, delay may be caused by other code
   Delay(1,500,mSec)
    'Measure Value -- can be any analog measurement
    PanelTemp(Value,0)
    'Immediately call SlowSequence to execute CallTable()
   TriggerSequence(1,0)
  NextScan
```

```
'Allow data to be stored 510 ms into the Scan with a s.51 time stamp
SlowSequence
Do
WaitTriggerSequence
CallTable(Test)
Loop
EndProg
```

Other time-processing CRBasic instructions are governed by these same rules. Consult *CRBasic Editor Help* for more information on specific instructions.

# 8.1.2 Analog Measurements — Details

Related Topics:

- Analog Measurements Overview (p. 67)
- Analog Measurements Details (p. 337)

The CR3000 measures the following sensor analog output types:

- Voltage
  - o Single-ended
  - o Differential
- Current (using a resistive shunt)
- Resistance
- Full-bridge
- Half-bridge

Sensor connection is to H/L terminals configured for differential (DIFF) or single-ended (SE) inputs. For example, differential channel 1 is comprised of terminals 1H and 1L, with 1H as high and 1L as low.

# 8.1.2.1 Voltage Measurement Quality

**Read More** Consult the following technical papers at www.campbellsci.com/app-notes for in-depth treatments of several topics addressing voltage measurement quality:

- Preventing and Attacking Measurement Noise Problems
- Benefits of Input Reversal and Excitation Reversal for Voltage Measurements
- Voltage Measurement Accuracy, Self- Calibration, and Ratiometric Measurements
- Estimating Measurement Accuracy for Ratiometric Measurement Instructions.

The following topics discuss methods of generally improving voltage measurements. Related information for special case voltage measurements (*thermocouples (p. 355), current loops (p. 380), resistance (p. 367),* and *strain (p. 378))* is located in sections for those measurements.

#### Single-Ended or Differential?

Deciding whether a differential or single-ended measurement is appropriate is usually, by far, the most important consideration when addressing voltage measurement quality. The decision requires trade-offs of accuracy and precision, noise cancelation, measurement speed, available measurement hardware, and fiscal constraints.

In broad terms, analog voltage is best measured differentially because these measurements include noise reduction features, listed below, that are not included in single-ended measurements.

- Passive Noise Rejection
  - No voltage reference offset
  - Common-mode noise rejection, which filters capacitively coupled noise
- Active Noise Rejection
  - Input reversal
  - Review Input and Excitation Reversal (p. 350) for details
  - Increases by twice the input reversal signal integration time

Reasons for using single-ended measurements, however, include:

- Not enough differential terminals available. Differential measurements use twice as many H/L terminals as do single-ended measurements.
- Rapid sampling is required. Single-ended measurement time is about half that of differential measurement time.
- Sensor is not designed for differential measurements. Many Campbell
  Scientific sensors are not designed for differential measurement, but the
  draw backs of a single-ended measurement are usually mitigated by large
  programmed excitation and/or sensor output voltages.

Sensors with a high signal-to-noise ratio, such as a relative-humidity sensor with a full-scale output of 0 to 1000 mV, can normally be measured as single-ended without a significant reduction in accuracy or precision.

Sensors with a low signal-to-noise ratio, such as thermocouples, should normally be measured differentially. However, if the measurement to be made does not require high accuracy or precision, such as thermocouples measuring brush-fire temperatures, which can exceed 2500 °C, a single-ended measurement may be appropriate. If sensors require differential measurement, but adequate input

terminals are not available, an analog multiplexer should be acquired to expand differential input capacity.

Because a single-ended measurement is referenced to CR3000 ground, any difference in ground potential between the sensor and the CR3000 will result in an error in the measurement. For example, if the measuring junction of a copperconstantan thermocouple being used to measure soil temperature is not insulated, and the potential of earth ground is 1 mV greater at the sensor than at the point where the CR3000 is grounded, the measured voltage will be 1 mV greater than the true thermocouple output, or report a temperature that is approximately 25 °C too high. A common problem with ground-potential difference occurs in applications wherein external, signal-conditioning circuitry is powered by the same source as the CR3000, such as an ac mains power receptacle. Despite being tied to the same ground, differences in current drain and lead resistance may result in a different ground potential between the two instruments. So, as a precaution, a differential measurement should be made on the analog output from an external signal conditioner; differential measurements MUST be used when the low input is known to be different from ground.

# Integration

The CR3000 incorporates circuitry to perform an analog integration on voltages to be measured prior to the *A-to-D* (*p. 529*) conversion. Integrating the the analog signal removes noise that creates error in the measurement. Slow integration removes more noise than fast integration. When the duration of the integration matches the duration of one cycle of ac power mains noise, that noise is filtered out. The table *Analog Measurement Integration* (*p. 340*) lists valid integration duration arguments.

Faster integration may be preferred to achieve the following objectives:

- Minimize time skew between successive measurements
- Maximize throughput rate
- Maximize life of the CR3000 power supply
- Minimize polarization of polar sensors such as those for measuring conductivity, soil moisture, or leaf wetness. Polarization may cause measurement errors or sensor degradation.
- Improve accuracy of an LVDT measurement. The induced voltage in an LVDT decays with time as current in the primary coil shifts from the inductor to the series resistance; a long integration may result in most of signal decaying before the measurement is complete.

**Note** See White Paper "Preventing and Attacking Measurement Noise Problems" at *www.campbellsci.com*.

The magnitude of the frequency response of an analog integrator is a SIN(x)/x shape, which has notches (transmission zeros) occurring at 1/(integer multiples) of the integration duration. Consequently, noise at 1/(integer multiples) of the integration duration is effectively rejected by an analog integrator. If reversing the

differential inputs or reversing the excitation is specified, there are two separate integrations per measurement; if both reversals are specified, there are four separate integrations.


**TABLE 64: Analog Measurement Integration** 

Integration Time (ms)	Integration Parameter Argument	Comments
0 to 16000 μs	0 to 16000	250 µs is considered fast and normally the minimum
16.667 ms	_60Hz	Filters 60 Hz noise
20 ms	_50Hz	Filters 50 Hz noise

## Ac Power Noise Rejection

Grid or mains power (50 or 60 Hz, 230 or 120 Vac) can induce electrical noise at integer multiples of 50 or 60 Hz. Small analog voltage signals, such as thermocouples and pyranometers, are particularly susceptible. CR3000 voltage measurements can be programmed to reject (filter) 50 Hz or 60 Hz related noise. Noise is rejected by using a signal integration time that is relative to the length of the ac noise cycle, as illustrated in the figure *Ac Power Noise Rejection Techniques (p. 340).* 

FIGURE 79: Ac Power Noise Rejection Techniques

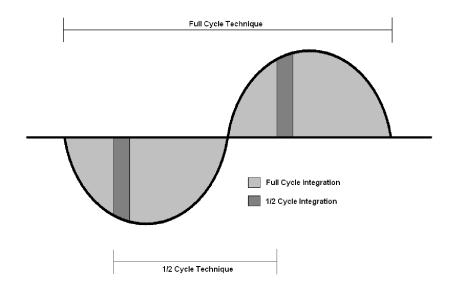

## Ac Noise Rejection on Small Signals

The CR3000 rejects ac power line noise on all voltage ranges except **mV5000** and **mV1000** by integrating the measurement over exactly one full ac cycle before *A-to-D (p. 529)* conversion as listed in table *Ac Noise Rejection on Small Signals (p. 341)*.

TABLE 65: Ac Noise Rejection on Small Signals <sup>1</sup>				
Ac Power Line Frequency	Measurement Integration Duration	CRBasic Integration Code		
60 Hz	16.667 ms	_60Hz		
50 Hz 20 ms <b>50Hz</b>				
Applies to all analog input voltage ranges except <i>mV1000</i> and <i>mV5000</i> .				

#### Ac Noise Rejection on Large Signals

If rejecting ac-line noise when measuring with the 1000 mV (mV1000) and 5000 mV (mV5000) ranges, the CR3000 makes two fast measurements separated in time by one-half line cycle. A 60 Hz half cycle is 8333 µs, so the second measurement must start 8333 µs after the first measurement integration began. The A-to-D conversion time is approximately 170 µs, leaving a maximum input-settling time of approximately 8160 µs (8333 µs – 170 µs). If the maximum input-settling time is exceeded, 60 Hz line-noise rejection will not occur. For 50 Hz rejection, the maximum input settling time is approximately 9830 µs (10,000 µs – 170 µs). The CR3000 does not prevent or warn against setting the settling time beyond the half-cycle limit. Table Ac Noise Rejection on Large Signals (p).

TABLE 66: Ac Noise Rejection on Large Signals <sup>1</sup>					
Ac-Power Line Frequency	Measurement Integration Time	CRBasic Integration Code	Default Settling Time	Maximum Recommended Settling Time <sup>2</sup>	
60 Hz	250 μs • 2	_60Hz	3000 μs	8330 μs	
50 Hz	250 μs • 2	_50Hz	3000 μs	10000 μs	

Applies to analog input voltage ranges mV1000 and mV5000.

- 1. CR3000 turns excitation on, waits 50000 μs, and then makes the first measurement.
- 2. During A-to-D, CR3000 turns off excitation for  $\approx$ 170 µs.
- 3. Excitation is switched on again for one-half cycle, then the second measurement is made.

<sup>&</sup>lt;sup>2</sup> Excitation time and settling time are equal in measurements requiring excitation. The CR3000 cannot excite **VX** or **IX** excitation terminals during A-to-D conversion. The one-half-cycle technique with excitation limits the length of recommended excitation and settling time for the first measurement to one-half-cycle. The CR3000 does not prevent or warn against settling a settling time beyond the one-half-cycle limit. For example, a settling time of up to 50000 μs can be programmed, but the CR3000 will execute the measurement as follows:

#### TABLE 66: Ac Noise Rejection on Large Signals<sup>1</sup>

Restated, when the CR3000 is programmed to use the half-cycle 50 Hz or 60 Hz rejection techniques, a sensor does not see a continuous excitation of the length entered as the settling time before the second measurement — if the settling time entered is greater than one-half cycle. This causes a truncated second excitation. Depending on the sensor used, a truncated second excitation may cause measurement errors.

#### Signal Settling Time

Settling time allows an analog voltage signal to settle closer to the true magnitude prior to measurement. To minimize measurement error, signal settling is needed when a signal has been affected by one or more of the following:

- A small transient originating from the internal multiplexing that connects a CR3000 terminal with measurement circuitry
- A relatively large transient induced by an adjacent excitation conductor on the signal conductor, if present, because of capacitive coupling during a bridge measurement
- Dielectric absorption. 50 Hz or 60 Hz integrations require a relatively long reset time of the internal integration capacitor before the next measurement.

The rate at which the signal settles is determined by the input settling time constant, which is a function of both the source resistance and fixed-input capacitance (3.3 nfd) of the CR3000.

Rise and decay waveforms are exponential. Figure *Input Voltage Rise and Transient Decay (p. 343)* shows rising and decaying waveforms settling closer to the true signal magnitude,  $V_{so}$ . The *Settling Time* parameter of an analog measurement instruction allows tailoring of measurement instruction settling times with 100  $\mu$ s resolution up to 35000  $\mu$ s.

Programmed settling time is a function of arguments placed in the **Settling Time** and **Integ** parameters of a measurement instruction. Argument combinations and resulting settling times are listed in table *CRBasic Measurement Settling Times* (p. 343). Default settling times (those resulting when **Settling Time** =  $\theta$ ) provide sufficient settling in most cases. Additional settling time is often programmed when measuring high-resistance (high-impedance) sensors or when sensors connect to the input terminals by long leads.

Measurement time of a given instruction increases with increasing settling time. For example, a 1 ms increase in settling time for a bridge instruction with input reversal and excitation reversal results in a 4 ms increase in time for the CR3000 to perform the instruction.

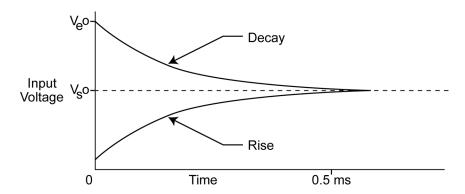


FIGURE 80: Input voltage rise and transient decay

TABLE 67: CRBasic Measurement Settling Times				
SettlingTime Argument	Integ <b>Argument</b>	Resultant Settling Time <sup>1</sup>		
0	250	200 μs		
0	_50Hz	3 ms		
0	_60Hz	3 ms		
integer $\geq 100$	integer	μs entered in <b>SettlingTime</b> argument		

<sup>1</sup> 200 μs is the minimum settling time required to meet CR3000 resolution specifications.

#### Settling Errors

When sensors require long lead lengths, use the following general practices to minimize settling errors:

- Do not use wire with PVC-insulated conductors. PVC has a high dielectric constant, which extends input settling time.
- Where possible, run excitation leads and signal leads in separate shields to minimize transients.

When measurement speed is not a prime consideration, additional time can be used to ensure ample settling time. The settling time required can be measured with the CR3000.

• When relatively large resistances are measured (> 1000 ohms), or relatively long cable lengths are used (> 50 feet) with sensors requiring current excitation, a 0.1 μf feed-forward capacitor should be placed between the **IX** and **IXR** to prevent excessive *ringing* (p. 553). With this capacitor present, a minimum of 3 ms is recommended for the **Settling Time** parameter in the measurement instruction. The capacitor

simply connects between the **IX** terminal and the **IXR** terminal. The capacitor has no polarity.

• In difficult cases, settling error can be measured as described in *Measuring Settling Time* (p. 344).

#### Measuring Settling Time

Settling time for a particular sensor and cable can be measured with the CR3000. Programming a series of measurements with increasing settling times will yield data that indicate at what settling time a further increase results in negligible change in the measured voltage. The programmed settling time at this point indicates the settling time needed for the sensor / cable combination.

CRBasic example *Measuring Settling Time* (p. 344) presents CRBasic code to help determine settling time for a pressure transducer using a high-capacitance semiconductor. The code consists of a series of full-bridge measurements (**BrFull()**) with increasing settling times. The pressure transducer is placed in steady-state conditions so changes in measured voltage are attributable to settling time rather than changes in pressure. Reviewing *CRBasic Programming* — *Details* (p. 129) may help in understanding the CRBasic code in the example.

The first six measurements are shown in table First Six Values of Settling Time Data (p. 345). Each trace in figure Settling Time for Pressure Transducer (p. 345) contains all twenty PT() mV/V values (left axis) for a given record number, along with an average value showing the measurements as percent of final reading (right axis). The reading has settled to 99.5% of the final value by the fourteenth measurement, which is contained in variable PT(14). This is suitable accuracy for the application, so a settling time of 1400 µs is determined to be adequate.

# CRBasic EXAMPLE 74: Measuring Settling Time 'This program example demonstrates the measurement of settling time using a single 'measurement instruction multiple times in succession. In this case, the program measures 'the temperature of the CR3000 wiring panel. Public RefTemp 'Declare variable to receive instruction BeginProg Scan(1,Sec,3,0) PanelTemp(RefTemp, 250) 'Instruction to make measurement NextScan EndProg measures the settling time of a sensor measured with a differential 'voltage measurement Public PT(20) 'Variable to hold the measurements DataTable(Settle,True,100) Sample(20,PT(),IEEE4) EndTable

```
BeginProg
  Scan(1, Sec, 3, 0)
    BrFull(PT(1),1,mV20,1,Vx1,2500,True,True,100, 250,1.0,0)
    BrFull(PT(2),1,mV20,1,Vx1,2500,True,True,200, 250,1.0,0)
    BrFull(PT(3),1,mV20,1,Vx1,2500,True,True,300, 250,1.0,0)
    BrFull(PT(4),1,mV20,1,Vx1,2500,True,True,400, 250,1.0,0)
    BrFull(PT(5),1,mV20,1,Vx1,2500,True,True,500, 250,1.0,0)
    BrFull(PT(6),1,mV20,1,Vx1,2500,True,True,600, 250,1.0,0)
    BrFull(PT(7),1,mV20,1,Vx1,2500,True,True,700, 250,1.0,0)
    BrFull(PT(8),1,mV20,1,Vx1,2500,True,True,800, 250,1.0,0)
    BrFull(PT(9),1,mV20,1,Vx1,2500,True,True,900, 250,1.0,0)
    BrFull(PT(10),1,mV20,1,Vx1,2500,True,True,1000, 250,1.0,0)
    BrFull(PT(11),1,mV20,1,Vx1,2500,True,True,1100, 250,1.0,0)
    BrFull(PT(12),1,mV20,1,Vx1,2500,True,True,1200, 250,1.0,0)
    BrFull(PT(13),1,mV20,1,Vx1,2500,True,True,1300, 250,1.0,0)
    BrFull(PT(14),1,mV20,1,Vx1,2500,True,True,1400, 250,1.0,0)
    BrFull(PT(15),1,mV20,1,Vx1,2500,True,True,1500, 250,1.0,0)
    BrFull(PT(16),1,mV20,1,Vx1,2500,True,True,1600, 250,1.0,0)
    BrFull(PT(17),1,mV20,1,Vx1,2500,True,True,1700, 250,1.0,0)
    BrFull(PT(18),1,mV20,1,Vx1,2500,True,True,1800, 250,1.0,0)
    BrFull(PT(19),1,mV20,1,Vx1,2500,True,True,1900, 250,1.0,0)
    BrFull(PT(20),1,mV20,1,Vx1,2500,True,True,2000, 250,1.0,0)
    CallTable Settle
  NextScan
EndProg
```

FIGURE 81: Settling Time for Pressure Transducer

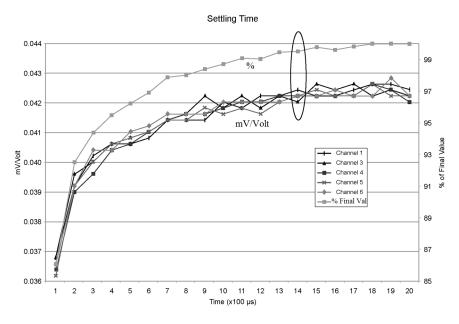


TABLE 68: First Six Values of Settling Time Data							
TIMESTAMP	REC	PT(1)	PT(2)	PT(3)	PT(4)	PT(5)	PT(6)
		Smp	Smp	Smp	Smp	Smp	Smp
1/3/2000 23:34	0	0.03638599	0.03901386	0.04022673	0.04042887	0.04103531	0.04123745
1/3/2000 23:34	1	0.03658813	0.03921601	0.04002459	0.04042887	0.04103531	0.0414396
1/3/2000 23:34	2	0.03638599	0.03941815	0.04002459	0.04063102	0.04042887	0.04123745
1/3/2000 23:34	3	0.03658813	0.03941815	0.03982244	0.04042887	0.04103531	0.04103531
1/3/2000 23:34	4	0.03679027	0.03921601	0.04022673	0.04063102	0.04063102	0.04083316

#### **Open-Input Detect**

**Note** The information in this section is highly technical. It is not necessary for the routine operation of the CR3000.

#### Summary

- An option to detect an open-input, such as a broken sensor or loose connection, is available in the CR3000.
- The option is selected by appending a **C** to the **Range** code.
- Using this option, the result of a measurement on an open connection will be **NAN** (not a number).

A useful option available to single-ended and differential measurements is the detection of open inputs due to a broken or disconnected sensor wire. This prevents otherwise undetectable measurement errors. Range codes appended with C enable open-input detect for all input ranges. See *TABLE: Analog Input Voltage Ranges and Options* (p. 381).

Appending the *Range* code with a C results in a 50  $\mu$ s internal connection of the V+ input of the PGIA to a large over-voltage. The V- input is connected to ground. Upon disconnecting the inputs, the true input signal is allowed to settle and the measurement is made normally. If the associated sensor is connected, the signal voltage is measured. If the input is open (floating), the measurement will over-range since the injected over-voltage will still be present on the input, with NAN as the result.

Range codes and applicable over-voltage magnitudes are found in *TABLE: Range Code Option C Over-Voltages* (p. 347).

The *C* option may not work, or may not work well, in the following applications:

• If the input is not a truly open circuit, such as might occur on a wet cut cable end, the open circuit may not be detected because the input capacitor discharges through external leakage to ground to a normal voltage within the settling time of the measurement. This problem is worse when a long settling time is selected, as more time is given for the input capacitors to discharge to a "normal" level.

- If the open circuit is at the end of a very long cable, the test pulse (300 mV) may not charge the cable (with its high capacitance) up to a voltage that generates NAN or a distinct error voltage. The cable may even act as an aerial and inject noise which also might not read as an error voltage.
- The sensor may "object" to the test pulse being connected to its output, even for 100 µs. There is little or no risk of damage, but the sensor output may be caused to temporarily oscillate. Programming a longer settling time in the CRBasic measurement instruction to allow oscillations to decay before the A-to-D conversion may mitigate the problem.

TABLE 69: Range-Code Option C Over-Voltages				
Input Range	Over-Voltage			
±20 mV ±50 mV ±200 mV	300 mV			
±1000 mV	1200 mV			
±5000 mV	5200 mV			

# Offset Voltage Compensation

#### **Related Topics**

- Auto Self-Calibration Overview (p. 93)
- Auto Self-Calibration Details (p. 373)
- Auto Self-Calibration Errors (p. 515)
- Offset Voltage Compensation (p. 347)
- Factory Calibration (p. 90)
- Factory Calibration or Repair Procedure (p. 500)

#### **Summary**

Measurement offset voltages are unavoidable, but can be minimized.

Offset voltages originate with:

- · Ground currents
- Seebeck effect
- · Residual voltage from a previous measurement

#### Remedies include:

- Connect power grounds to power ground terminals (G)
- Use input reveral (RevDiff = True) with differential measurements
- · Automatic offset compensation for differential measurements when

#### RevDiff = False

 Automatic offset compensation for single-ended measurements when MeasOff = False

- Better offset compensation when *MeasOff* = *True*
- Excitation reversal (RevEx = True)
- Longer settling times

Voltage offset can be the source of significant error. For example, an offset of 3  $\mu V$  on a 2500 mV signal causes an error of only 0.00012%, but the same offset on a 0.25 mV signal causes an error of 1.2%. The primary sources of offset voltage are ground currents and the Seebeck effect.

Single-ended measurements are susceptible to voltage drop at the ground terminal caused by return currents from another device that is powered from the CR3000 wiring panel, such as another manufacturer's comms modem, or a sensor that requires a lot of power. Currents >5 mA are usually undesirable. The error can be avoided by routing power grounds from these other devices to a power ground G terminal on the CR3000 wiring panel, rather than using a signal ground (\(\frac{1}{2}\)) terminal. Ground currents can be caused by the excitation of resistive-bridge sensors, but these do not usually cause offset error. These currents typically only flow when a voltage excitation is applied. Return currents associated with voltage excitation cannot influence other single-ended measurements because the excitation is usually turned off before the CR3000 moves to the next measurement. However, if the CRBasic program is written in such a way that an excitation terminal is enabled during an unrelated measurement of a small voltage, an offset error may occur.

The Seebeck effect results in small thermally induced voltages across junctions of dissimilar metals as are common in electronic devices. Differential measurements are more immune to these than are single-ended measurements because of passive voltage cancelation occurring between matched high and low pairs such as 1H/1L. So use differential measurements when measuring critical low-level voltages, especially those below 200 mV, such as are output from pyranometers and thermocouples. Differential measurements also have the advantage of an input reversal option, *RevDiff*. When *RevDiff* is *True*, two differential measurements are made, the first with a positive polarity and the second reversed. Subtraction of opposite polarity measurements cancels some offset voltages associated with the measurement.

Single-ended and differential measurements without input reversal use an offset voltage measurement with the PGIA inputs grounded. For differential measurements without input reversal, this offset voltage measurement is performed as part of the routine auto-calibration of the CR3000. Single-ended measurement instructions VoltSE() and TCSe() MeasOff parameter determines whether the offset voltage measured is done at the beginning of measurement instruction, or as part of self-calibration. This option provides you with the opportunity to weigh measurement speed against measurement accuracy. When MeasOff = True, a measurement of the single-ended offset voltage is made at the beginning of the VoltSE() instruction. When MeasOff = False, an offset voltage measurement is made during self-calibration. For slowly fluctuating offset voltages, choosing MeasOff = True for the VoltSE() instruction results in better offset voltage performance.

Ratiometric measurements use an excitation voltage or current to excite the sensor during the measurement process. Reversing excitation polarity also reduces offset voltage error. Setting the *RevEx* parameter to *True* programs the measurement for excitation reversal. Excitation reversal results in a polarity change of the measured voltage so that two measurements with opposite polarity can be subtracted and divided by 2 for offset reduction similar to input reversal for differential measurements. Ratiometric differential measurement instructions allow both *RevDiff* and *RevEx* to be set *True*. This results in four measurement sequences:

- positive excitation polarity with positive differential input polarity
- negative excitation polarity with positive differential input polarity
- positive excitation polarity with negative differential input polarity
- positive excitation polarity then negative excitation differential input polarity

For ratiometric single-ended measurements, such as a **BrHalf()**, setting RevEx = True results in two measurements of opposite excitation polarity that are subtracted and divided by 2 for offset voltage reduction. For RevEx = False for ratiometric single-ended measurements, an offset-voltage measurement is made during the self-calibration.

When analog voltage signals are measured in series by a single measurement instruction, such as occurs when VoltSE() is programmed with *Reps* = 2 or more, measurements on subsequent terminals may be affected by an offset, the magnitude of which is a function of the voltage from the previous measurement. While this offset is usually small and negligible when measuring large signals, significant error, or NAN, can occur when measuring very small signals. This effect is caused by dielectric absorption of the integrator capacitor and cannot be overcome by circuit design. Remedies include the following:

- Program longer settling times
- Use an individual instruction for each input terminal, the effect of which is to reset the integrator circuit prior to filtering.
- Avoid preceding a very small voltage input with a very large voltage input in a measurement sequence if a single measurement instruction must be used.

TABLE: Offset Voltage Compensation Options (p. 349) lists some of the tools available to minimize the effects of offset voltages.

TABLE 70: Offset Voltage Compensation Options					
CRBasic Measurement Instruction	<i>Input Reversal</i> (RevDiff =True)	Excitation Reversal (RevEx = True)	Measure Offset During Measurement (MeasOff = True)	Measure Offset During Background Calibration (RevDiff = False) (RevEx = False) (MeasOff = False)	
AM25T()	✓	✓		<b>√</b>	
BrHalf()		✓		✓	
BrHalf3W()		✓		✓	
BrHalf4W()	✓	✓		✓	
BrFull()	✓	✓		✓	

TABLE 70: Offset Voltage Compensation Options				
CRBasic Measurement Instruction	<i>Input Reversal</i> (RevDiff =True)	Excitation Reversal (RevEx = True)	Measure Offset During Measurement (MeasOff = True)	Measure Offset During Background Calibration (RevDiff = False) (RevEx = False) (MeasOff = False)
BrFull6W()	✓	✓		✓
Resistance()	✓	✓		✓
TCDiff()	✓			✓
TCSe()			✓	✓
Therm107()		✓		✓
Therm108()		✓		✓
Therm109()		✓		✓
VoltDiff()	✓			✓
VoltSe()			✓	✓

#### Input and Excitation Reversal

Reversing inputs (differential measurements) or reversing polarity of excitation voltage (bridge measurements) cancels stray voltage offsets. For example, if 3  $\mu V$  offset exists in the measurement circuitry, a 5 mV signal is measured as 5.003 mV. When the input or excitation is reversed, the second sub-measurement is - 4.997 mV. Subtracting the second sub-measurement from the first and then dividing by 2 cancels the offset:

```
5.003 \text{ mV} - (-4.997 \text{ mV}) = 10.000 \text{ mV}

10.000 \text{ mV} / 2 = 5.000 \text{ mV}
```

When the CR3000 reverses differential inputs or excitation polarity, it delays the same settling time after the reversal as it does before the first sub-measurement. So, there are two delays per measurement when either *RevDiff* or *RevEx* is used. If both *RevDiff* and *RevEx* are *True*, four sub-measurements are performed; positive and negative excitations with the inputs one way and positive and negative excitations with the inputs reversed. The automatic procedure then is as follows,

- 1. Switches to the measurement terminals
- 2. Sets the excitation, and then settle, and then **measure**
- 3. Reverse the excitation, and then settles, and then measure
- 4. Reverse the excitation, reverse the input terminals, settle, **measure**
- 5. Reverse the excitation, settle, measure

There are four delays per **measure**. The CR3000 processes the four sub-measurements into the reported measurement. In cases of excitation reversal, excitation time for each polarity is exactly the same to ensure that ionic sensors do not polarize with repetitive measurements.

**Read More** A white paper entitled "The Benefits of Input Reversal and Excitation Reversal for Voltage Measurements" is available at *www.campbellsci.com*.

# Ground Reference Offset Voltage

When *MeasOff* is enabled (= *True*), the CR3000 measures the offset voltage of the ground reference prior to each **VoltSe()** or **TCSe()** measurement. This offset voltage is subtracted from the subsequent measurement.

#### From Auto Self-Calibration

If *RevDiff*, *RevEx*, or *MeasOff* is disabled (= *False*), offset voltage compensation is continues to be automatically performed, albeit less effectively, by using measurements from the auto self-calibration. Disabling *RevDiff*, *RevEx*, or *MeasOff* speeds up measurement time; however, the increase in speed comes at the cost of accuracy because of the following:

- 1 RevDiff, RevEx, and MeasOff are more effective.
- 2 Auto self-calibrations are performed only periodically, so more time skew occurs between the auto self-calibration offsets and the measurements to which they are applied.

**Note** When measurement duration must be minimal to maximize measurement frequency, consider disabling *RevDiff*, *RevEx*, and *MeasOff* when CR3000 module temperatures and return currents are slow to change.

#### Time Skew Between Measurements

Time skew between consecutive voltage measurements is a function of settling and integration times, A-to-D conversion, and the number entered into the *Reps* parameter of the **VoltDiff()** or **VoltSE()** instruction. A close approximation is:

time skew = settling time + integration time + A-to-D conversion time + reps

where A-to-D conversion time equals 125  $\mu$ s. If reps (repetitions) > 1 (multiple measurements by a single instruction), no additional time is required. If reps = 1 in consecutive voltage instructions, add 15  $\mu$ s per instruction.

#### Measurement Accuracy

**Read More** For an in-depth treatment of accuracy estimates, see the technical paper *Measurement Error Analysis* soon available at *www.campbellsci.com/app-notes*.

Accuracy describes the difference between a measurement and the true value. Many factors affect accuracy. This section discusses the affect percent-orreading, offset, and resolution have on the accuracy of the measurement of an analog voltage sensor signal. Accuracy is defined as follows:

accuracy = percent-of-reading + offset

where percents-of-reading are tabulated in the table *Analog Voltage Measurement Accuracy (p. 352)*, and offsets are tabulated in the table *Analog Voltage Measurement Offsets (p. 352)*.

**Note** Error discussed in this section and error-related specifications of the CR3000 do not include error introduced by the sensor or by the transmission of the sensor signal to the CR3000.

TABLE 71: Analog Voltage Measurement Accuracy <sup>1</sup>				
0 to 40 °C	−25 to 50 °C	−55 to 85 °C²		
±(0.04% of reading + offset)	±(0.07% of reading + offset)	±(0.09% of reading + offset)		

<sup>&</sup>lt;sup>1</sup> Assumes the CR3000 is within factory specifications

<sup>&</sup>lt;sup>2</sup> Available only with purchased extended temperature option (-XT)

TABLE 72: Analog Voltage Measurement Offsets					
Differential Measurement With Input Reversal	Differential Measurement Without Input Reversal	Single-Ended			
1.5 • Basic Resolution + 1.0 μV	3 • Basic Resolution + 2.0 μV	3 • Basic Resolution + 3.0 μV			

**Note** — the value for Basic Resolution is found in the table *Analog Voltage Measurement Resolution (p. 352).* 

TABLE 73: Analog Voltage Measurement Resolution					
Input Voltage Range (mV)	Differential Measurement With Input Reversal (μV)	Basic Resolution (μV)			
±5000	83.33	167			
±1000	16.67	33.4			
±200	3.33	6.67			
±50	0.83	1.67			
±20	0.33	0.67			

Note — see Specifications (p. 95) for a complete tabulation of measurement resolution


As an example, figure *Voltage Measurement Accuracy Band Example (p. 354)* shows changes in accuracy as input voltage changes on the  $\pm 1000$  and  $\pm 5000$  input ranges. Percent-of-reading is the principle component, so accuracy improves as input voltage decreases. Offset is small, but could be significant in applications wherein the sensor-signal voltage is very small, such as is encountered with thermocouples.

Offset depends on measurement type and voltage-input range. Offsets equations are tabulated in table *Analog Voltage Measurement Offsets (p. 352)*. For example, for a differential measurement with input reversal on the  $\pm 5000$  mV input range, the offset voltage is calculated as follows:

offset = 1.5 • Basic Resolution + 1.0 
$$\mu$$
V  
= (1.5 • 83.33  $\mu$ V) + 1.0  $\mu$ V  
= 126  $\mu$ V

where Basic Resolution is taken from the table *Analog Voltage Measurement Resolution (p. 352)*.

FIGURE 82: Example voltage measurement accuracy band, including the effects of percent of reading and offset, for a differential measurement with input reversal at a temperature between 0 to 40 °C.

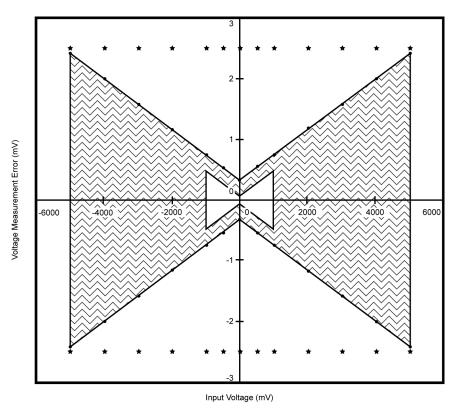

# Measurement Accuracy Example

The following example illustrates the effect percent-of-reading and offset have on measurement accuracy. The effect of offset is usually negligible on large signals:

#### Example:

- Sensor-signal voltage: ≈5000 mV
- CRBasic measurement instruction: VoltDiff()
- Programmed input-voltage range (*Range*): *mV5000 (*±5000 mV)
- Input measurement reversal: *True*
- CR3000 circuitry temperature: 10°C

Accuracy of the measurement is calculated as follows:

accuracy = percent-of-reading + offset

```
where percent-of\text{-reading} = 5000 \text{ mV} \bullet \pm 0.04\% = \pm 2 \text{ mV} and offset = (1.5 \bullet 167 \text{ }\mu\text{V}) + 1 \text{ }\mu\text{V} = 0.252 \text{ mV} Therefore, accuracy = \pm 2 \text{ mV} + 0.251 \text{ mV} = \pm 2.252 \text{ mV}
```

#### Electronic Noise

Electronic "noise" can cause significant error in a voltage measurement, especially when measuring voltages less than 200 mV. So long as input limitations are observed, the PGIA ignores voltages, including noise, that are common to each side of a differential-input pair. This is the common-mode voltage. Ignoring (rejecting or canceling) the common-mode voltage is an essential feature of the differential input configuration that improves voltage measurements.

Figure PGIA with Input Signal Decomposition (p. 383), illustrates the common-mode component ( $V_{cm}$ ) and the differential-mode component ( $V_{dm}$ ) of a voltage signal.  $V_{cm}$  is the average of the voltages on the V+ and V- inputs. So,  $V_{cm} = (V++V-)/2$  or the voltage remaining on the inputs when  $V_{dm} = 0$ . The total voltage on the V+ and V- inputs is given as  $V+=V_{cm}+V_{dm}/2$ , and  $V_L=V_{cm}-V_{dm}/2$ , respectively.

# 8.1.2.2 Thermocouple Measurements — Details

#### Related Topics:

- Thermocouple Measurements Details
- Thermocouple Measurements Instructions

Thermocouple measurements are special case voltage measurements.

**Note** Thermocouples are inexpensive and easy to use. However, they pose several challenges to the acquisition of accurate temperature data, particularly when using external reference junctions. Campbell Scientific **strongly encourages** you to carefully evaluate the section *Thermocouple Error Analysis (p. 356)*. An introduction to thermocouple measurements is located in the section *Tutorial: Measuring a Thermocouple (p. 42)*.

The micro-volt resolution and low-noise voltage measurement capability of the CR3000 is well suited for measuring thermocouples. A thermocouple consists of two wires, each of a different metal or alloy, joined at one end to form the measurement junction. At the opposite end, each lead connects to terminals of a voltage measurement device, such as the CR3000. These connections form the reference junction. If the two junctions (measurement and reference) are at different temperatures, a voltage proportional to the difference is induced in the wires. This phenomenon is known as the Seebeck effect. Measurement of the voltage between the positive and negative terminals of the voltage-measurement device provides a direct measure of the temperature difference between the measurement and reference junctions. A third metal (e.g., solder or CR3000 terminals) between the two dissimilar-metal wires form parasitic-thermocouple junctions, the effects of which cancel if the two wires are at the same temperature. Consequently, the two wires at the reference junction are placed in close proximity so they remain at the same temperature. Knowledge of the reference junction temperature provides the determination of a reference junction compensation voltage, corresponding to the temperature difference between the reference junction and 0°C. This compensation voltage, combined with the measured thermocouple voltage, can be used to compute the absolute temperature of the thermocouple junction. To facilitate thermocouple measurements, a thermistor is integrated into the CR3000 wiring panel for measurement of the reference junction temperature by means of the **PanelTemp()** instruction.

TCDiff() and TCSe() thermocouple instructions determine thermocouple temperatures using the following sequence. First, the temperature (°C) of the reference junction is determined. Next, a reference junction compensation voltage is computed based on the temperature difference between the reference junction and 0°C. If the reference junction is the CR3000 analog-input terminals, the temperature is conveniently measured with the PanelTemp() instruction. The actual thermocouple voltage is measured and combined with the reference junction compensation voltage. It is then used to determine the thermocouple-junction temperature based on a polynomial approximation of NIST thermocouple calibrations.

# 8.1.2.2.1 Thermocouple Error Analysis

The error in the measurement of a thermocouple temperature is the sum of the errors in the reference junction temperature measurement plus the temperature-to-voltage polynomial fit error, the non-ideal nature of the thermocouple (deviation from standards published in NIST Monograph 175), the thermocouple-voltage measurement accuracy, and the voltage-to-temperature polynomial fit error (difference between NIST standard and CR3000 polynomial approximations). The discussion of errors that follows is limited to these errors in calibration and measurement and does not include errors in installation or matching the sensor and thermocouple type to the environment being measured.

#### Panel Temperature Error

The panel temperature thermistor (Betatherm 10K3A1A) is just under the panel in the center of the two rows of analog input terminals. It has an interchangeability specification of 0.1 °C for temperatures between 0 and 70 °C. Below freezing and at higher temperatures, this specification is degraded. Combined with possible errors in the completion-resistor measurement and the Steinhart and Hart equation

used to calculate the temperature from resistance, the accuracy of panel temperature is estimated in *FIGURE*: Panel Temperature Error Summary (p. 358). In summary, error is estimated at  $\pm$  0.1 °C over 0 to 40 °C,  $\pm$  0.3 °C from –25 to 50 °C, and  $\pm$  0.8 °C from –55 to 85 °C.

The error in the reference temperature measurement is a combination of the error in the thermistor temperature and the difference in temperature between the panel thermistor and the terminals the thermocouple is connected to. The terminal strip cover should always be used when making thermocouple measurements. It insulates the terminals from drafts and rapid fluctuations in temperature as well as conducting heat to reduce temperature gradients. In a typical installation where the CR3000 is in a weather-tight enclosure not subject to violent swings in temperature or uneven solar radiation loading, the temperature difference between the terminals and the thermistor is likely to be less than 0.2 °C.

With an external driving gradient, the temperature gradients on the input panel can be much worse. For example, the CR3000 was placed in a controlled temperature chamber. Thermocouples in terminals at the ends and middle of each analog terminal strip measured the temperature of an insulated aluminum bar outside the chamber. The temperature of this bar was also measured by another datalogger. Differences between the temperature measured by one of the thermocouples and the actual temperature of the bar are due to the temperature difference between the terminals the thermocouple is connected to and the thermistor reference (the figures have been corrected for thermistor errors). FIGURE: Panel Temperature Gradients (Low to High) (p. 358) shows the errors when the chamber was changed from low temperature to high in approximately 15 minutes. FIGURE: Panel Temperature Gradients (High to Low) (p. 359) shows the results when going from high temperature to low. During rapid temperature changes, the panel thermistor will tend to lag behind terminal temperature because it is mounted deeper in the CR3000.

Panel Temperature Error Summary

Panel Temperature Error Summary

O.8

Sum of Worst-Case Errors

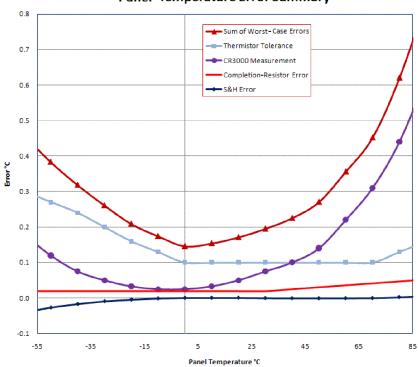
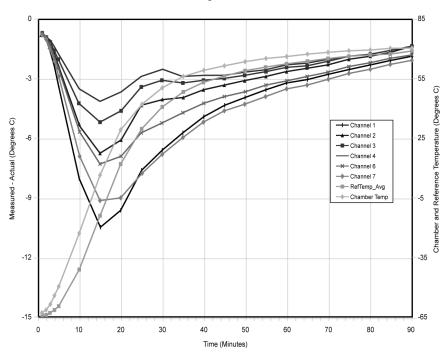


FIGURE 84: Panel Temperature Gradients (low temperature to high)

Reference - Temperature Errors Due to Panel Gradient Chamber Changed from -65° to +70° C



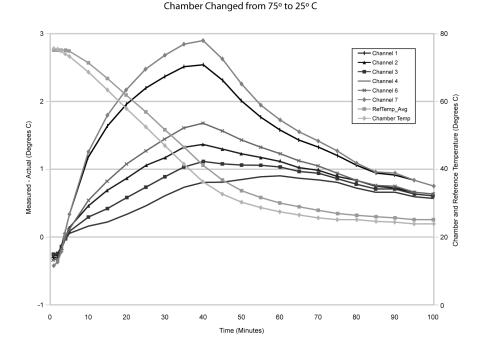


FIGURE 85: Panel Temperature Gradients (high temperature to low)

Reference-Temperature Errors Due to Panel Gradient

# Thermocouple Limits of Error

The standard reference that lists thermocouple output voltage as a function of temperature (reference junction at 0°C) is the NIST (National Institute of Standards and Technology) Monograph 175 (1993). ANSI (American National Standards Institute) has established limits of error on thermocouple wire which is accepted as an industry standard (ANSI MC 96.1, 1975). Table *Limits of Error for Thermocouple Wire* (p. 360) gives the ANSI limits of error for standard and special grade thermocouple wire of the types accommodated by the CR3000.

When both junctions of a thermocouple are at the same temperature, no voltage is generated, a result of the law of intermediate metals. A consequence of this is that a thermocouple cannot have an offset error; any deviation from a standard (assuming the wires are each homogeneous and no secondary junctions exist) is due to a deviation in slope. In light of this, the fixed temperature-limits of error (e.g.,  $\pm 1.0~^{\circ}\text{C}$  for type T as opposed to the slope error of 0.75% of the temperature) in the table above are probably greater than one would experience when considering temperatures in the environmental range (i.e., the reference junction, at 0°C, is relatively close to the temperature being measured, so the absolute error — the product of the temperature difference and the slope error — should be closer to the percentage error than the fixed error). Likewise, because thermocouple calibration error is a slope error, accuracy can be increased when the reference junction temperature is close to the measurement temperature. For the same reason differential temperature measurements, over a small temperature gradient, can be extremely accurate.

To quantitatively evaluate thermocouple error when the reference junction is not fixed at 0°C limits of error for the Seebeck coefficient (slope of thermocouple

voltage vs. temperature curve) are needed for the various thermocouples. Lacking this information, a reasonable approach is to apply the percentage errors, with perhaps 0.25% added on, to the difference in temperature being measured by the thermocouple.

TABLE 74: Limits of Error for Thermocouple Wire (Reference Junction at 0°C)					
Thermocouple	Temperature	Limits of Error (Whichever is greater)			
Туре	Range °C	Standard	Special		
Т	-200 to 0	± 1.0 °C or 1.5%			
	0 to 350	± 1.0 °C or 0.75%	± 0.5 °C or 0.4%		
J	0 to 750	± 2.2 °C or 0.75%	± 1.1 °C or 0.4%		
Е	-200 to 0	± 1.7 °C or 1.0%			
	0 to 900	± 1.7 °C or 0.5%	± 1.0 °C or 0.4%		
K	-200 to 0	± 2.2 °C or 2.0%			
	0 to 1250	± 2.2 °C or 0.75%	± 1.1 °C or 0.4%		
R or S	0 to 1450	± 1.5 °C or 0.25%	± 0.6 °C or 0.1%		
В	800 to 1700	± 0.5%	Not Established.		

# Thermocouple Voltage Measurement Error

Thermocouple outputs are extremely small — 10 to 70  $\mu$ V per °C. Unless high resolution input ranges are used when programming, the CR3000, accuracy and sensitivity are compromised. Table *Voltage Range for Maximum Thermocouple Resolution (p. 360)* lists high resolution ranges available for various thermocouple types and temperature ranges. The following four example calculations of thermocouple input error demonstrate how the selected input voltage range impacts the accuracy of measurements. Figure *Input Error Calculation (p. 361)* shows from where various values are drawn to complete the calculations. See Measurement Accuracy for more information on measurement accuracy and accuracy calculations.

When the thermocouple measurement junction is in electrical contact with the object being measured (or has the possibility of making contact) a differential measurement should be made to avoid ground looping.

Thermocouple Type and Temperature Range (°C)	Temperature Range (°C) for±20 mV Input Range	Temperature Range (°C) for ±50 mV Input Range	Temperature Range (°C) for ±200 mV Input Range
T: –270 to 400	-270 to 395	not used	not used
E: –270 to 1000	-270 to 300	-270 to 675	>675
K: –270 to 1372	-270 to 500	-270 to 1250	>1250
J: –210 to 1200	-210 to 385	-210 to 885	>885
B: –0 to 1820	0 to 1820	not used	not used
R: -50 to 1768	-50 to 1690	-50 to 1768	not used
S: -50 to 1768	-50 to 1768	not used	not used
N: –270 to 1300	-270 to 595	-270 to 1300	not used

# FIGURE 86: Input Error Calculation

# Thermocouple Measurement Specifics

Conditions:

Temperature = 45° C

Reference Temperature = 25° C

Delta T = 20° C

Output Multiplier at 45° C = 42.4  $\mu$ V ° C<sup>-1</sup>

Thermocouple Output =  $20^{\circ}$  C \*  $42.4 \mu V {\circ} C^{-1} = 830.7 \mu V$ 

# **CR3000 Specifications**

RANGES, RESOLUTION: 16-bit basic resolution (Basic Res). Resolution of DF measurements with input reversal is half the Basic Res (17-bits).

DF Res (μV) <sup>2</sup>	Basic Res (μV)
83.33	167
16.67	33.3
3.33	6.67
0.83	1.67
0.33	0.67
	83.33 16.67 3.33 0.83

<sup>1</sup>Range overhead of ~9% exists on all ranges to guarantee that the full-scale range values will not cause overrange.

<sup>2</sup>Resolution of DF measurements with input reversal.

#### ACCURACY3:

 $\pm$ (0.04% of reading + offset), 0° to 40°C

 $\pm (0.07\% \text{ of reading} + \text{offset}), -25^{\circ} \text{ to } 50^{\circ}\text{C}$  $\pm (0.09\% \text{ of reading} + \text{offset}), -40^{\circ} \text{ to } 85^{\circ}\text{C} \text{ (-XT only)}$ 

<sup>3</sup>Accuracy does not include sensor and measurement noise. Offsets are defined as:

Offset for DF w/ input reversal=1.5·Basic Res + 1.0  $\mu$ V Offset for DF w/o input reversal = 3-Basic Res +  $2.0 \mu V$ Offset for SE =  $3 \cdot Basic Res + 5.0 \mu V$ 

# **Example 1. Input Error Calculation**

 $\mu V Error = Gain Term + Offset Term$ =  $(830.7 \mu V * 0.07\%) + (1.5 * 0.67 \mu V + 1.0 \mu V)$  $= 0.581 \,\mu\text{V} + 2.01 \,\mu\text{V}$  $= 2.59 \,\mu\text{V} (= 0.061^{\circ}\,\text{C})$ 

# Input Error Examples: Type T Thermocouple @ 45°C

These examples demonstrate that in the environmental temperature range, inputoffset error is much greater than input-gain error because a small input range is used.

#### **Conditions:**

CR3000 module temperature, -25 to 50 °C

Temperature = 45 °C

Reference temperature = 25 °C

Delta T (temperature difference) = 20 °C

Thermocouple output multiplier at 45 °C = 42.4  $\mu V$  °C<sup>-1</sup>

Thermocouple output =  $20^{\circ}\text{C} \cdot 42.4 \ \mu\text{V} \ ^{\circ}\text{C}^{\text{-1}} = 830.7 \ \mu\text{V}$ 

Input range =  $\pm 20 \text{ mV}$ 

### **Error Calculations with Input Reversal = True**

$$\mu$$
V error = gain term + offset term  
= (830.7  $\mu$ V • 0.07%) + (1.5 • 0.67  $\mu$ V + 1.0  $\mu$ V)  
= 0.581  $\mu$ V + 2.01  $\mu$ V  
= 2.59  $\mu$ V (= 0.061 °C)

#### **Error Calculations with Input Reversal = False**

$$\mu$$
V Error = gain term + offset term  
= (830.7  $\mu$ V • 0.07%) + (3 • 0.67  $\mu$ V + 2.0  $\mu$ V)  
= 0.581  $\mu$ V + 4.01  $\mu$ V  
= 4.59  $\mu$ V (= 0.11 °C)

# Input Error Examples: Type K Thermocouple @ 1300°C

Error in the temperature due to inaccuracy in the measurement of the thermocouple voltage increases at temperature extremes, particularly when the temperature and thermocouple type require using the  $\pm 200|250$  mV range. For example, assume type K (chromel-alumel) thermocouples are used to measure temperatures around  $1300^{\circ}\text{C}$ .

These examples demonstrate that at temperature extremes, input offset error is much less than input gain error because the use of a larger input range is required.

#### **Conditions**

CR3000 module temperature, -25 to 50 °C

Temperature = 1300 °C

Reference temperature =  $25 \, ^{\circ}$ C

Delta T (temperature difference) = 1275 °C

Thermocouple output multiplier at 1300 °C = 34.9  $\mu$ V °C<sup>-1</sup>

Thermocouple output = 1275 °C • 34.9  $\mu$ V °C<sup>-1</sup> = 44500  $\mu$ V

Input range =  $\pm 200 \text{ mV}$ 

#### **Error Calculations with Input Reversal = True**

$$\mu$$
V error = gain term + offset term  
=  $(44500 \ \mu\text{V} * 0.07\%) + (1.5 * 6.67 \ \mu\text{V} + 1.0 \ \mu\text{V})$   
=  $31.2 \ \mu\text{V} + 11.0 \ \mu\text{V}$   
=  $42.2 \ \mu\text{V} (= 1.21 \ ^{\circ}\text{C})$ 

### **Error Calculations with Input Reversal = False**

$$\mu$$
V error = gain term + offset term 
$$= (44500 \ \mu\text{V} * 0.07\%) + (3 * 6.67 \ \mu\text{V} + 2.0 \ \mu\text{V})$$
 = 31.2  $\mu$ V + 22.0  $\mu$ V 
$$= 1.52 \ \mu$$
V (= 1.52 °C)

### **Ground Looping Error**

When the thermocouple measurement junction is in electrical contact with the object being measured (or has the possibility of making contact), a differential measurement should be made to avoid ground looping.

#### Noise Error

The typical input noise on the  $\pm 20$  mV range for a differential measurement with 16.67 ms integration and input reversal is 0.19  $\mu$ V RMS. On a type-T thermocouple (approximately 40  $\mu$ V/°C), this is 0.005°C.

**Note** This is an RMS value; some individual readings will vary by greater than this.

# Thermocouple Polynomial Error

NIST Monograph 175 gives high-order polynomials for computing the output voltage of a given thermocouple type over a broad range of temperatures. To speed processing and accommodate the CR3000 math and storage capabilities, four separate 6th-order polynomials are used to convert from volts to temperature over the range covered by each thermocouple type. The table *Limits of Error on CR3000 Thermocouple Polynomials (p. 364)* gives error limits for the thermocouple polynomials.

TABLE '	TABLE 76: Limits of Error on CR3000 Thermocouple Polynomials			
TC Type		Range °C		Limits of Error °C Relative to NIST Standards
T	-270	to	400	
	-270	to	-200	18 @ –270
	-200	to	-100	±0.08
	-100	to	100	±0.001
	100	to	400	±0.015
J	-150	to	760	±0.008
	-100	to	300	±0.002
Е	-240	to	1000	
	-240	to	-130	±0.4
	-130	to	200	±0.005
	200	to	1000	±0.02
K	-50	to	1372	
	-50	to	950	±0.01
	950	to	1372	±0.04

### Reference Junction Error

Thermocouple instructions **TCDiff()** and **TCSe()** include the parameter *TRef* to incorporate the reference junction temperature into the measurement. A reference junction compensation voltage is computed from *TRef* as part of the thermocouple instruction, based on the temperature difference between the reference junction and 0 °C. The polynomials used to determine the reference junction compensation voltage do not cover the entire thermocouple range, as illustrated in tables *Limits of Error on CR3000 Thermocouple Polynomials (p. 364)* and *Reference Temperature Compensation Range and Polynomial Error (p. 365)*. Substantial errors in the reference junction compensation voltage will result if the reference junction temperature is outside of the polynomial-fit ranges given.

The reference junction temperature measurement can come from a **PanelTemp()** instruction or from any other temperature measurement of the reference junction. The standard and extended (-XT) operating ranges for the CR3000 are -25 to 50 °C and -40 to 85 °C, respectively. These ranges also apply to the reference junction temperature measurement using **PanelTemp()**.

Two sources of error arise when the reference temperature is out of the polynomial-fit range. The most significant error is in the calculated compensation voltage; however, a small error is also created by non-linearities in the Seebeck coefficient.

TABLE 77: Reference Temperature Compensation Range and Error			
ТС Туре	Range °C	Limits of Error °C <sup>1</sup>	
T	-100 to 100	± 0.001	
Е	-150 to 206	$\pm~0.005$	
J	-150 to 296	± 0.005	
K	-50 to 100	± 0.01	
<sup>1</sup> Relative to ITS-90 Standard in NIST Monograph 175			

# Thermocouple Error Summary

Errors in the thermocouple- and reference-temperature linearizations are extremely small, and error in the voltage measurement is negligible.

The magnitude of the errors discussed in *Error Analysis (p. 356)* show that the greatest sources of error in a thermocouple measurement are usually,

- The typical (and industry accepted) manufacturing error of thermocouple wire
- The reference temperature

The table *Thermocouple Error Examples (p. 365)* tabulates the relative magnitude of these errors. It shows a worst case example where,

- A temperature of 45 °C is measured with a type-T thermocouple and all errors are maximum and additive:
- Reference temperature is 25 °C, but it is indicating 25.1 °C.
- The terminal to which the thermocouple is connected is 0.05 °C cooler than the reference thermistor (0.15 °C error).

TABLE 78: Thermocouple Error Examples					
	Error: °C : % of Total Error				
Source	Differential without Input Reversal 250 µs Integration		Differential with Input Reversal 50/60 Hz Rejection Integration		
	ANSI TC Error (1 °C)	TC Error 1% Slope	ANSI TC Error (1 °C)	TC Error 1% Slope	
Reference Temperature	0.15° : 11.5%	0.15° : 29.9%	0.15° : 12.2%	0.15° : 34.7%	
TC Output	1.0° : 76.8%	0.2° : 39.8%	1.0°: 81.1%	0.2° : 46.3%	
Voltage Measurement	0.12° : 9.2%	0.12° : 23.9%	0.07° : 5.7%	0.07° : 16.2%	
Noise	0.03°: 2.3%	0.03° : 6.2%	0.01°: 0.8%	0.01° : 2.3%	
Reference Linearization	0.001°: 0.1%	0.001°: 0.2%	0.001°: 0.1%	0.001°: 0.25%	
Output Linearization	0.001°: 0.1%	0.001°: 0.2%	0.001°: 0.1%	0.001°: 0.25%	
Total Error	1.302° : 100%	0.502° : 100%	1.232° : 100%	0.432° : 100%	

### 8.1.2.2.2 Use of External Reference Junction


An external junction in an insulated box is often used to facilitate thermocouple connections. It can reduce the expense of thermocouple wire when measurements are made long distances from the CR3000. Making the external junction the reference junction, which is preferable in most applications, is accomplished by running copper wire from the junction to the CR3000. Alternatively, the junction box can be used to couple extension-grade thermocouple wire to the thermocouples, with the **PanelTemp()** instruction used to determine the reference junction temperature.

Extension-grade thermocouple wire has a smaller temperature range than standard thermocouple wire, but it meets the same limits of error within that range. One situation in which thermocouple extension wire is advantageous is when the junction box temperature is outside the range of reference junction compensation provided by the CR3000. This is only a factor when using type K thermocouples, since the upper limit of the reference compensation polynomial fit range is 100 °C and the upper limit of the extension grade wire is 200 °C. With the other types of thermocouples, the reference compensation polynomial-fit range equals or is greater than the extension-wire range. In any case, errors can arise if temperature gradients exist within the junction box.

Figure Diagram of a Thermocouple Junction Box (p. 367) illustrates a typical junction box wherein the reference junction is the CR3000. Terminal strips are a different metal than the thermocouple wire. Thus, if a temperature gradient exists between A and A' or B and B', the junction box will act as another thermocouple in series, creating an error in the voltage measured by the CR3000. This thermoelectric-offset voltage is also a factor when the junction box is used as the reference junction. This offset can be minimized by making the thermal conduction between the two points large and the distance small. The best solution when extension-grade wire is being connected to thermocouple wire is to use connectors which clamp the two wires in contact with each other.

When an external-junction box is also the reference junction, the points A, A', B, and B' need to be very close in temperature (isothermal) to measure a valid reference temperature, and to avoid thermoelectric-offset voltages. The box should contain elements of high thermal conductivity, which will act to rapidly equilibrate any thermal gradients to which the box is subjected. It is not necessary to design a constant-temperature box. It is desirable that the box respond slowly to external-temperature fluctuations. Radiation shielding must be provided when a junction box is installed in the field. Care must also be taken that a thermal gradient is not induced by conduction through the incoming wires. The CR3000 can be used to measure the temperature gradients within the junction box.

FIGURE 87: Diagram of a Thermocouple Junction Box



### 8.1.2.3 Resistance Measurements — Details

### Related Topics:

- Resistance Measurements Specifications
- Resistance Measurements Overview (p. 72)
- Resistance Measurements Details (p. 367)
- Measurement: RTD, PRT, PT100, PT1000 (p. 273)

By supplying a precise and known voltage to a resistive-bridge circuit and measuring the returning voltage, resistance can be calculated.

CRBasic instructions for measuring resistance include:

```
BrHalf() — half-bridge
BrHalf3W() — three-wire half-bridge
BrHalf4W() — four-wire half-bridge
BrFull() — four-wire full-bridge
BrFull6W() — six-wire full-bridge
Resistance() — current-excitation resistance
```

**Read More** Available resistive-bridge completion modules are listed in *Signal Conditioners* — *List* (p. 605).

The CR3000 has six CRBasic bridge-measurement instructions. Table Resistive-Bridge Circuits with Voltage Excitation (p. 368) and table Resistive-Bridge Circuits with Current Excitation shows ideal circuits and related equations. In the diagrams, resistors labeled  $R_{\rm s}$  are normally the sensors and those labeled  $R_{\rm f}$  are normally precision fixed (static) resistors. CRBasic example Four-Wire Full-Bridge Measurement (p. 370) lists CRBasic code that measures and processes four-wire full-bridge circuits.

Offset voltages compensation applies to bridge measurements. In addition to **RevDiff** and **MeasOff** parameters discussed in **Offset Voltage Compensation** (p. 347), CRBasic bridge measurement instructions include the **RevEx** parameter that provides the option to program a second set of measurements with the excitation polarity reversed. Much of the offset error inherent in bridge measurements is canceled out by setting **RevDiff**, **MeasOff**, and **RevEx** to **True**.

Measurement speed can be slowed when using **RevDiff**, **MeasOff**, and **RevEx**. When more than one measurement per sensor are necessary, such as occur with the **BrHalf3W()**, **BrHalf4W()**, and **BrFull6W** instructions, input and excitation reversal are applied separately to each measurement. For example, in the four-wire half-bridge (**BrHalf4W()**), when excitation is reversed, the differential measurement of the voltage drop across the sensor is made with excitation at both polarities and then excitation is again applied and reversed for the measurement of the voltage drop across the fixed resistor. Further, the results of measurement instructions (X) must be processed further to obtain the resistance value. This processing requires additional program execution time.

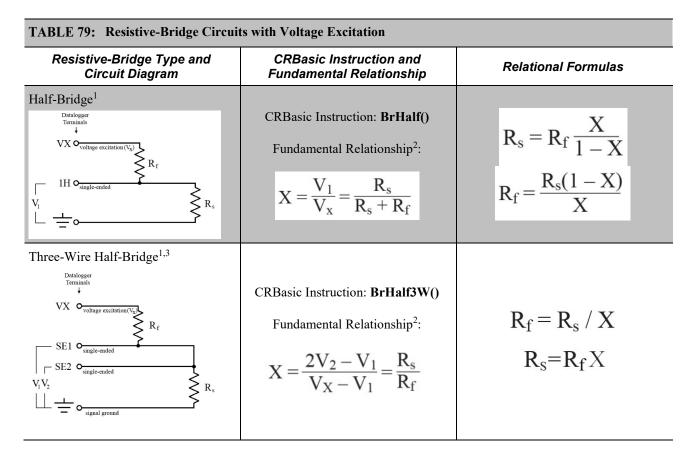


TABLE 79: Resistive-Bridge Circuits with Voltage Excitation				
Resistive-Bridge Type and Circuit Diagram	CRBasic Instruction and Fundamental Relationship	Relational Formulas		
Four-Wire Half-Bridge 1,3  Datalogger Terminals  VX O voltage excitation (V <sub>X</sub> )  2HO differential high  V <sub>2</sub> 1HO differential low  1HO differential low  ILL O differential low  signal ground	CRBasic Instruction: <b>BrHalf4W()</b> Fundamental Relationship <sup>2</sup> : $X = \frac{V_2}{V_1} = \frac{R_s}{R_f}$	$R_s = R_f X$ $R_f = R_s / X$		
Full-Bridge <sup>1,3</sup> Datalogger Terminals	CRBasic Instruction: <b>BrFull()</b>	These relationships apply to <b>BrFull()</b> and <b>BrFull6W()</b> .		
$\begin{array}{c} VX  \bullet_{\text{voltage excitation } (V_X)} \\ & R_4 \\ & R_1 \\ & R_4 \\ & R_5 \\ & R_2 \\ & R_2 \\ & R_4 \\ & R_4 \\ & R_4 \\ & R_5 \\ & R_6 \\ & R_$	Fundamental Relationship <sup>2</sup> : $X = 1000 \frac{V_1}{V_x}$ $= 1000 \left(\frac{R_3}{R_3 + R_4} - \frac{R_2}{R_1 + R_2}\right)$	$X_1 = \frac{-X}{1000} + \frac{R_3}{R_3 + R_4}$ $R_1 = \frac{R_2(1 - X_1)}{X_1}$		
Six-Wire Full-Bridge  Datalogger Terminals  VXO voltage excitation (V <sub>x</sub> )  —1H O differential high  V <sub>1</sub> —1L O differential low  —2H O differential low  R <sub>3</sub> R <sub>2</sub> — o signal ground	CRBasic Instruction: <b>BrFull6W()</b> Fundamental Relationship <sup>2</sup> : $X = 1000 \frac{V_2}{V_1}$ $= 1000 \left( \frac{R_3}{R_3 + R_4} - \frac{R_2}{R_1 + R_2} \right)$	$R_{2} = \frac{R_{1}X_{1}}{1 - X_{1}}$ $X_{2} = \frac{X}{1000} + \frac{R_{2}}{R_{1} + R_{2}}$ $R_{3} = \frac{R_{4}X_{2}}{1 - X_{2}}$ $R_{4} = \frac{R_{3}(1 - X_{2})}{X_{2}}$		

 $<sup>^{1}</sup>$ Key:  $V_{x}$  = excitation voltage;  $V_{1}$ ,  $V_{2}$  = sensor return voltages;  $R_{f}$  = fixed, bridge or completion resistor;  $R_{s}$  = variable or sensing resistor.

<sup>&</sup>lt;sup>2</sup>Where X = result of the CRBasic bridge measurement instruction with a multiplier of 1 and an offset of 0.

<sup>&</sup>lt;sup>3</sup>See the appendix *Resistive Bridge Modules (p. 606)* for a list of available terminal input modules to facilitate this measurement.

TABLE 80: Resistive-Bridge Circuits with Current Excitation <sup>1</sup>				
Resistive-Bridge Type and Circuit Diagram	CRBasic Instruction and Fundamental Relationship	Relational Formulas		
Datalogger Tenninals  IX O current excitation (I <sub>x</sub> )  H O differential high  V <sub>1</sub> L O differential low  IXR O excitation return	CRBasic instruction: <b>Resistance()</b> .  Fundamental relationship <sup>3</sup> : $X = \frac{V}{I_X} = R_s$			
Full Bridge <sup>2</sup> Datalogger Terminals	CRBasic Instruction: <b>Resistance()</b> Fundamental relationship <sup>3</sup> :	$R_1 = \frac{-R_2R_4 - X(R_2 + R_3 + R_4)}{X - R_3}$		
$\begin{array}{c} \text{IX}  \bullet  & \\ \text{current excitation}  (I_X) \\ \text{H}  \bullet  & \\ \text{differential high} \\ \text{V}_1 \\ \text{L}  \bullet  & \\ \text{differential low} \\ \text{IXR}  \bullet  & \\ \text{excitation return} \end{array}$	$X = \frac{V_1}{I_X}$ $= R_{bridge} \left( \frac{R_3}{R_3 + R_4} - \frac{R_2}{R_1 + R_2} \right)$ $= \frac{R_3(R_1 + R_2) - R_2(R_3 + R_4)}{R_1 + R_2 + R_3 + R_4}$	$R_{2} = \frac{R_{1}R_{3} - X(R_{1} + R_{3} + R_{4})}{X + R_{4}}$ $R_{3} = \frac{-R_{2}R_{4} - X(R_{1} + R_{2} + R_{4})}{X - R_{1}}$ $R_{4} = \frac{R_{1}R_{3} - X(R_{1} + R_{2} + R_{3})}{X + R_{2}}$		

<sup>&</sup>lt;sup>1</sup> See *Current Excitation Cabling (p. 421)* for precautions to consider when measuring resistances > 1000  $\Omega$  or sensors with leads > 50 feet.

 $<sup>^{2}</sup>$  Key:  $I_{x}$  = excitation current; IxR = Current Return;  $V_{1}$  = sensor return voltage;  $R_{s}$  = "variable" or "sensing" resistor.

 $<sup>^{3}</sup>$  Where X = result of the CRBasic bridge measurement instruction with a multiplier of 1 and an offset of 0.

```
CRBasic EXAMPLE 75: Four-Wire Full-Bridge Measurement and Processing
'This program example demonstrates the measurement and processing of a four-wire resistive
'full bridge. In this example, the default measurement stored in variable X is
'deconstructed to determine the resistance of the R1 resistor, which is the variable
'resistor in most sensors that have a four-wire full-bridge as the active element.
'Declare Variables
Public X
Public X1
Public R1
Public R2 = 1000
                                                   'Resistance of fixed resistor R2
Public R3 = 1000
                                                   'Resistance of fixed resistor R2
Public R4 = 1000
                                                   'Resistance of fixed resistor R4
'Main Program
BeginProg
  Scan(500, mSec, 1, 0)
    'Full Bridge Measurement:
    BrFull(X,1,mV2000,1,Vx1,1,2500,True,True,0,_60Hz,1.0,0.0)
   X1 = ((-1 * X) / 1000) + (R3 / (R3 + R4))
   R1 = (R2 * (1 - X1)) / X1
  NextScan
EndProg
```

#### 8.1.2.3.1 Ac Excitation

Some resistive sensors require ac excitation. Ac excitation is defined as excitation with equal positive (+) and negative (-) duration and magnitude. These include electrolytic tilt sensors, soil moisture blocks, water-conductivity sensors, and wetness-sensing grids. The use of single polarity dc excitation with these sensors can result in polarization of sensor materials and the substance measured. Polarization may cause erroneous measurement, calibration changes, or rapid sensor decay.

Other sensors, for example, LVDTs (linear variable differential transformers), require ac excitation because they require inductive coupling to provide a signal. Dc excitation in an LVDT will result in no measurement.

CRBasic bridge-measurement instructions have the option to reverse polarity to provide ac excitation by setting the *RevEx* parameter to *True*.

**Note** Take precautions against ground loops when measuring sensors that require ac excitation. See *Ground Looping in Ionic Measurements* (p. 111).

# 8.1.2.3.2 Accuracy — Resistance Measurements

**Read More** Consult the following technical papers at www.campbellsci.com/app-notes for in-depth treatments of several topics addressing voltage measurement quality:

- Preventing and Attacking Measurement Noise Problems
- Benefits of Input Reversal and Excitation Reversal for Voltage

#### Measurements

- Voltage Measurement Accuracy, Self- Calibration, and Ratiometric Measurements
- Estimating Measurement Accuracy for Ratiometric Measurement Instructions.

**Note** Error discussed in this section and error-related specifications of the CR3000 do not include error introduced by the sensor or by the transmission of the sensor signal to the CR3000.

The accuracy specifications for ratiometric-resistance measurements are summarized in the tables *Ratiometric-Resistance Measurement Accuracy (p. 372)*.

TABLE 81: Ratiometric-Resistance Measurement Accuracy				
0 to 40 °C				
$\pm (0.02\% \text{ of voltage}$ measurement + offset) <sup>1</sup>	$\pm (0.025\% \text{ of voltage} \\ \text{measurement} + \text{offset})^{1}$	$\pm (0.03\% \text{ of voltage}$ measurement + offset) <sup>1</sup>		

<sup>&</sup>lt;sup>1</sup>Voltage measurement is variable V<sub>1</sub> or V<sub>2</sub> in the table *Resistive-Bridge Circuits with Voltage Excitation* (p. 368). Offset is the same as that for simple analog voltage measurements. See the table *Analog Voltage Measurement Offsets* (p. 352).

Assumptions that support the ratiometric-accuracy specification include:

- CR3000 is within factory calibration specification.
- Excitation voltages less than 500 mV and excitation currents less than 500 μA are reversed during the excitation phase of the measurement.
- Effects due to the following are not included in the specification:
  - o Bridge-resistor errors
  - Sensor noise
  - Measurement noise
- Resistance measured with Resistance() instruction is determined from Vs/Ix, where excitation current Ix is measured across a 1000 Ω, ±0.005% @ 25 °C, 2 ppm/°C TCR internal resistor.

For a full treatise on the accuracy of ratiometric measurements, consult the technical paper *Estimating Measurement Accuracy for Ratiometric Measurement Instructions* at www.campbellsci.com/app-notes.

# 8.1.2.4 Auto Self-Calibration — Details

#### **Related Topics**

- Auto Self-Calibration Overview (p. 93)
- Auto Self-Calibration Details (p. 373)
- Auto Self-Calibration Errors (p. 515)
- Offset Voltage Compensation (p. 347)
- Factory Calibration (p. 90)
- Factory Calibration or Repair Procedure (p. 500)

The CR3000 auto self-calibrates to compensate for changes caused by changing operating temperatures and aging. Disable auto self-calibration when it interferes with execution of very fast programs and less accuracy can be tolerated.

With auto self-calibration disabled, measurement accuracy over the operational temperature range is specified as less accurate by a factor of 10. That is, over the extended temperature range of -40 °C to 85 °C, the accuracy specification of  $\pm 0.12\%$  of reading can degrade to  $\pm 1\%$  of reading with auto self-calibration disabled. If the temperature of the CR3000 remains the same, there is little calibration drift if auto-calibration is disabled. Auto self-calibration can become disabled when the scan rate is too small. It can be disabled by the CRBasic program when using the **Calibrate()** instruction.

**Note** The CR3000 is equipped with an internal voltage reference used for calibration. The voltage reference should be periodically checked and re-calibrated by Campbell Scientific for applications with critical analog voltage measurement requirements. A minimum two-year recalibration cycle is recommended.

Unless a **Calibrate()** instruction is present, the CR3000 auto self-calibrates during spare time in the background as a *slow sequence* (p. 166) with a segment of the calibration occurring every four seconds. If there is insufficient time to do the auto self-calibration because of a scan-consuming user program, the CR3000 will display the following warning at compile time: **Warning: Background calibration is disabled**.

### 8.1.2.4.1 Auto Self-Calibration Process

The composite transfer function of the *PGIA* (p. 384) and *A-to-D* (p. 529) converter of the CR3000 is described by the following equation:

$$COUNTS = G \cdot Vin + B$$

where COUNTS is the result from an A-to-D conversion, G is the voltage gain for a given input range, Vin is the input voltage connected to V+ and V-, and B is the internally measured offset voltage.

Auto self-calibration calibrates only the G and B values necessary to run a given CRBasic program, resulting in a program dependent number of auto self-calibration segments ranging from a minimum of six to a maximum of 91. A typical number of segments required in auto self-calibration is 20 for analog ranges and one segment for the wiring-panel temperature measurement, totaling

21 segments. So,  $(21 \text{ segments}) \cdot (4 \text{ s / segment}) = 84 \text{ s per complete auto self-calibration}$ . The worst-case is  $(91 \text{ segments}) \cdot (4 \text{ s / segment}) = 364 \text{ s per complete auto self-calibration}$ .

During instrument power-up, the CR3000 computes calibration coefficients by averaging ten complete sets of auto self-calibration measurements. After power up, newly determined G and B values are low-pass filtered as follows:

Next Value = 
$$(1/5) \cdot (\text{new value}) + (4/5) \cdot (\text{old value})$$

This results in the following settling percentages:

- 20% for 1 new value,
- 49% for 3 new values
- 67% for 5 new values
- 89% for 10 new values
- 96% for 14 new values

If this rate of update is too slow, the **Calibrate()** instruction can be used. The **Calibrate()** instruction computes the necessary G and B values every scan without any low-pass filtering.

For a **VoltSe()** instruction, B is determined as part of auto self-calibration only if the parameter MeasOff = 0. An exception is B for **VoltSe()** on the  $\pm 2500$  input range with a 250  $\mu$ s integration, which is always determined in auto self-calibration for use internally. For a **VoltDiff()** instruction, B is determined as part of auto self-calibration only if the parameter RevDiff = 0.

**VoltSe()** and **VoltDiff()** instructions, on a given input range with the same integration durations, use the same G values but different B values. The five input-voltage ranges ( $\pm 5000 \text{ mV}$ ,  $\pm 1000 \text{ mV}$ ,  $\pm 200 \text{ mV}$ , and  $\pm 50 \text{ mV}$ ), in combination with the three most common integration durations (250 µs, 50 Hz half-cycle, and 60 Hz half-cycle) result in a maximum of 15 different gains (G), and 15 offsets for **VoltSe()** measurements (B), and 15 offsets for **VoltDiff()** measurements (B) to be determined during auto self-calibration (maximum of 45 values). These values can be viewed in the **Status** table, with entries identified as listed in table *CalGain() Field Descriptions* (p. 375)

Auto self-calibration can be overridden with the **Calibrate()** instruction, which forces a calibration for each execution, and does not employ low-pass filtering on the newly determined G and B values. The **Calibrate()** instruction has two parameters: **CalRange** and **Dest. CalRange** determines whether to calibrate only the necessary input ranges for a given CRBasic program (**CalRange** = 0) or to calibrate all input ranges (**CalRange**  $\neq$  0). The **Dest** parameter should be of sufficient dimension for all returned G and B values, which is a minimum of two for the auto self-calibration of **VoltSE()** including B (offset) for the  $\pm$ 5000 mV input range with first 250  $\mu$ s integration, and a maximum of 45 for all inputvoltage ranges used and possible integration durations.

An example use of the **Calibrate()** instruction programmed to calibrate all input ranges is given in the following CRBasic code snip:

'Calibrate(Dest,Range)
Calibrate(cal(1),true)

where **Dest** is an array of 45 variables, and **Range**  $\neq 0$  to calibrate all input ranges. Results of this command are listed in the table **Calibrate()** Instruction Results (p. 376).

**TABLE 82:** CalGain() Field Descriptions

Field	±mV Input Range	Integration	
CalGain(1)	5000	250 ms	
CalGain(2)	1000	250 ms	
CalGain(3)	200	250 ms	
CalGain(4)	50	250 ms	
CalGain(5)	20	250 ms	
CalGain(6)	5000	60 Hz Rejection	
CalGain(7)	1000	60 Hz Rejection	
CalGain(8)	200	60 Hz Rejection	
CalGain(9)	50	60 Hz Rejection	
CalGain(10)	20	60 Hz Rejection	
CalGain(11)	5000	50 Hz Rejection	
CalGain(12)	1000	50 Hz Rejection	
CalGain(13)	200	50 Hz Rejection	
CalGain(14)	50	50 Hz Rejection	
CalGain(15)	20	50 Hz Rejection	

TABLE 83: CalSeOffset() Field Descriptions ±mV Input Integration Range CalSeOffset(1) 5000 250 ms CalSeOffset(2) 1000 250 ms CalSeOffset(3) 200 250 ms CalSeOffset(4) 50 250 ms CalSeOffset(5) 20 250 ms

TABLE 83: CalSeOffset() Field Descriptions			
	±mV Input Range	Integration	
CalSeOffset(6)	5000	60 Hz Rejection	
CalSeOffset(7)	1000	60 Hz Rejection	
CalSeOffset(8)	200	60 Hz Rejection	
CalSeOffset(9)	50	60 Hz Rejection	
CalSeOffset(10)	20	60 Hz Rejection	
CalSeOffset(11)	5000	50 Hz Rejection	
CalSeOffset(12)	1000	50 Hz Rejection	
CalSeOffset(13)	200	50 Hz Rejection	
CalSeOffset(14)	50	50 Hz Rejection	
CalSeOffset(15)	20	50 Hz Rejection	

TABLE 84: CalDiffOffset() Field Descriptions				
Field	±mV Input Range	Integration		
CalDiffOffset(1)	5000	250 ms		
CalDiffOffset(2)	1000	250 ms		
CalDiffOffset(3)	200	250 ms		
CalDiffOffset(4)	50	250 ms		
CalDiffOffset(5)	20	250 ms		
CalDiffOffset(6)	5000	60 Hz Rejection		
CalDiffOffset(7)	1000	60 Hz Rejection		
CalDiffOffset(8)	200	60 Hz Rejection		
CalDiffOffset(9)	50	60 Hz Rejection		
CalDiffOffset(10)	20	60 Hz Rejection		
CalDiffOffset(11)	5000	50 Hz Rejection		
CalDiffOffset(12)	1000	50 Hz Rejection		
CalDiffOffset(13)	200	50 Hz Rejection		
CalDiffOffset(14)	50	50 Hz Rejection		
CalDiffOffset(15)	20	50 Hz Rejection		

TABLE 85:	Calibrate() Instruction	Results			
Call		Descriptions of	Array Elements		
Cal() Array Field	Differential (Diff) Single-Ended (SE)	Offset or Gain	±mV Input Range	Integration	Typical Value
1	SE	Offset	5000	250 ms	±25 LSB
2	Diff	Offset	5000	250 ms	±25 LSB
3		Gain	5000	250 ms	-1.67 mV/LSB
4	SE	Offset	1000	250 ms	±25 LSB
5	Diff	Offset	1000	250 ms	±25 LSB
6		Gain	1000	250 ms	-0.0333 mV/LSB
7	SE	Offset	200	250 ms	±30 LSB
8	Diff	Offset	200	250 ms	±30 LSB
9		Gain	200	250 ms	-0.00667 mV/LSB
10	SE	Offset	50	250 ms	±30 LSB
11	Diff	Offset	50	250 ms	±30 LSB
12		Gain	50	250 ms	-0.00167 mV/LSB
13	SE	Offset	20	250 ms	±35 LSB
14	Diff	Offset	20	250 ms	±35 LSB
15		Gain	20	250 ms	-0.00067 mV/LSB
16	SE	Offset	5000	60-Hz Rejection	±25 LSB
17	Diff	Offset	5000	60-Hz Rejection	±25 LSB
18		Gain	5000	60-Hz Rejection	-0.167 mV/LSB
19	SE	Offset	1000	60-Hz Rejection	±25 LSB
20	Diff	Offset	1000	60-Hz Rejection	±25 LSB
21		Gain	1000	60-Hz Rejection	-0.0333 mV/LSB
22	SE	Offset	200	60-Hz Rejection	±30 LSB
23	Diff	Offset	200	60-Hz Rejection	±30 LSB
24		Gain	200	60-Hz Rejection	-0.00667 mV/LSB
25	SE	Offset	50	60-Hz Rejection	±30 LSB
26	Diff	Offset	50	60-Hz Rejection	±30 LSB
27		Gain	50	60-Hz Rejection	-0.00167 mV/LSB
28	SE	Offset	20	60-Hz Rejection	±35 LSB
29	Diff	Offset	20	60-Hz Rejection	±35 LSB
30		Gain	20	60-Hz Rejection	-0.00067 mV/LSB

Cal()						
Array Field	Array Differential (Diff)		±mV Input Range	Integration	Typical Value	
31	SE	Offset	5000	50-Hz Rejection	±25 LSB	
32	Diff	Offset	5000	50-Hz Rejection	±25 LSB	
33		Gain	5000	50-Hz Rejection	-0.167 mV/LSB	
34	SE	Offset	1000	50-Hz Rejection	±25 LSB	
35	Diff	Offset	1000	1000 50-Hz Rejection ±25 I		
36		Gain	1000	50-Hz Rejection	-0.0333 mV/LSB	
37	SE	Offset	200	50-Hz Rejection ±30 LSB		
38	Diff	Offset	200	50-Hz Rejection	±30 LSB	
39		Gain	200	50-Hz Rejection	-0.00667 mV/LSB	
40	SE	Offset	50	50-Hz Rejection	±30 LSB	
41	Diff	Offset	50	50-Hz Rejection	±30 LSB	
42		Gain	50 50-Hz Rejection		-0.00167 mV/LSB	
43	SE	Offset	20	20 50-Hz Rejection ±35 LS		
44	Diff	Offset	20 50-Hz Rejecti		±35 LSB	
45		Gain	20	50-Hz Rejection	-0.00067 mV/LSB	

### 8.1.2.5 Strain Measurements — Details

#### Related Topics:

- Strain Measurements Overview (p. 74)
- Strain Measurements Details (p. 378)
- FieldCalStrain() Examples (p. 243)

A principal use of the four-wire full bridge is the measurement of strain gages in structural stress analysis. **StrainCalc()** calculates microstrain ( $\mu\epsilon$ ) from the formula for the particular strain bridge configuration used. All strain gages supported by **StrainCalc()** use the full-bridge schematic. In strain-gage parlance, 'quarter-bridge', 'half-bridge' and 'full-bridge' refer to the number of active elements in the full-bridge schematic. In other words, a quarter-bridge strain gage has one active element, a half-bridge has two, and a full-bridge has four.

**StrainCalc()** requires a bridge-configuration code. The table **StrainCalc()** *Instruction Equations (p. 379)* shows the equation used by each configuration code. Each code can be preceded by a dash (-). Use a code without the dash when the bridge is configured so the output decreases with increasing strain. Use a dashed code when the bridge is configured so the output increases with increasing strain. A dashed code sets the polarity of  $V_r$  to negative.

TABLE 86: StrainCalc() Instruction Equations				
StrainCalc() BrConfig Code	Configuration			
	Quarter-bridge strain gage <sup>1</sup> :			
1	$\mu \epsilon = \frac{-4*10^6 V_r}{GF(1+2V_r)}$			
2	Half-bridge strain gage <sup>1</sup> . One gage parallel to strain, the other at 90° to strain:			
2	$\mu \varepsilon = \frac{-4*10^{6} V_{r}}{GF[(1+v)-2V_{r}(v-1)]}$			
	Half-bridge strain gage. One gage parallel to $+\mathbf{E}$ , the other parallel to $-\mathbf{E}^1$ :			
3	$\mu \varepsilon = \frac{-2*10^6 \text{Vr}}{\text{GF}}$			
	Full-bridge strain gage. Two gages parallel to $+\mathbf{\mathcal{E}}$ , the other two parallel to $-\mathbf{\mathcal{E}}^1$ :			
4	$\mu \varepsilon = \frac{-10^6 \text{Vr}}{\text{GF}}$			
_	Full-bridge strain gage. Half the bridge has two gages parallel to $+\mathcal{E}$ and $-\mathcal{E}$ , and the other half to $+\mathcal{V}\mathcal{E}$ and $-\mathcal{V}\mathcal{E}$			
5	$\mu \varepsilon = \frac{-2*10^6 \text{Vr}}{\text{GF}(\nu+1)}$			
	Full-bridge strain gage. Half the bridge has two gages parallel to $+\mathbf{E}$ and $-\mathbf{V}\mathbf{E}$ , and the other half to $-\mathbf{V}\mathbf{E}$ and $+\mathbf{E}$			
6	$\mu \varepsilon = \frac{-2*10^{6} V_{r}}{GF[(\nu+1)-V_{r}(\nu-1)]}$			
1	,			

• *V*: Poisson's Ratio (0 if not applicable)

- GF: Gage Factor
- V<sub>r</sub>: 0.001 (Source-Zero) if BRConfig code is positive (+)
- $\bullet \ \ V_r \!\!:\! -0.001$  (Source-Zero) if BRConfig code is negative (–) and where:
- "source": the result of the full-bridge measurement (X =  $1000 \cdot V_1 / V_x$ ) when multiplier = 1 and offset = 0.
- "zero": gage offset to establish an arbitrary zero (see **FieldCalStrain()** in *FieldCal() Examples (p. 232)*).

StrainCalc Example: See FieldCalStrain() Examples (p. 243).

#### 8.1.2.6 Current Measurements — Details

#### Related Topics:

- Current Measurements Overview (p. 72)
- Current Measurements Details (p. 380)

For a complete treatment of current-loop sensors (4 to 20 mA, for example), please consult the following publications available at www.campbellsci.com/appnotes:

- Current Output Transducers Measured with Campbell Scientific Dataloggers (2MI-B)
- CURS100 100 Ohm Current Shunt Terminal Input Module

The CR3000 is equipped to make resistive-bridge measurements with current excitation. See *Resistance Measurements* — *Details (p. 367)* for more information.

# 8.1.2.7 Voltage Measurements — Details

#### Related Topics:

- Voltage Measurements Specifications
- Voltage Measurements Overview (p. 68)
- Voltage Measurements Details (p. 380)

# 8.1.2.7.1 Voltage Measurement Limitations

**Caution** Sustained voltages in excess of  $\pm 8.6$  V applied to terminals configured for analog input can temporarily corrupt all analog measurements.

**Warning** Sustained voltages in excess of  $\pm 16$  V applied to terminals configured for analog input will damage CR3000 circuitry.

### Voltage Ranges

#### Related Topics:

- Voltage Measurements Specifications
- Voltage Measurements Overview (p. 68)
- Voltage Measurements Details (p. 380)

In general, use the smallest fixed-input range that accommodates the full-scale output of the sensor. This results in the best measurement accuracy and resolution.

The CR6 has fixed input ranges for voltage measurements and an auto-range to automatically determine the appropriate input voltage range for a given measurement. The table *Analog Voltage Input Ranges and Options (p. 381)* lists these input ranges and codes.

An approximate 9% range overhead exists on fixed input voltage ranges. In other words, over-range on the  $\pm 1000$  mV input range occurs at approximately 1090 mV and -1090 mV. The CR3000 indicates a measurement over-range by returning a **NAN** (not a number) for the measurement.

### Automatic Range Finding

For signals that do not fluctuate too rapidly, range argument *AutoRange* allows the CR3000 to automatically choose the voltage range. *AutoRange* makes two measurements. The first measurement determines the range to use. It is made with a 250  $\mu s$  integration on the  $\pm 5000$  mV range. The second measurement is made using the range determined from the first. Both measurements use the settling time entered in the *SettlingTime* parameter. Auto-ranging optimizes resolution but takes longer than a measurement on a fixed range because of the two-measurement sequences.

An auto-ranged measurement will return **NAN** ("not a number") if the voltage exceeds the range picked by the first measurement. To avoid problems with a signal on the edge of a range, *AutoRange* selects the next larger range when the signal exceeds 90% of a range.

Use auto-ranging for a signal that occasionally exceeds a particular range, for example, a type-J thermocouple measuring a temperature usually less than 476 °C ( $\pm 20$  mV range) but occasionally as high as 500 °C ( $\pm 50$  mV range). *AutoRange* should not be used for rapidly fluctuating signals, particularly signals traversing multiple voltage ranges rapidly. The possibility exists that the signal can change ranges between the internal range check and the actual measurement.

TABLE 87: Analog Voltage Input Ranges and Options				
Range Code	Description			
mV5000 <sup>1</sup>	measures voltages between ±5000 mV			
mV1000 <sup>2</sup>	measures voltages between ±1000 mV			
mV200 <sup>2</sup>	measures voltages between ±200 mV			
$mV50^2$	measures voltages between $\pm 50~\text{mV}$			
mV20 <sup>2</sup>	measures voltages between ±20 mV			
AutoRange	datalogger determines the most suitable range			
$^{1}$ Append with $C$ to enable common-mode null / open-input detect and set				

Append with *C* to enable common-mode null / open-input detect and set excitation to full-scale DAC (~2700 mV) (Example: *mV5000C*)

TABLE 87: Analog Voltage Input Ranges and Options				
Range Code	Description			
<sup>2</sup> Append with $C$ to enable common-mode null / open-input detect (Example: $mV200C$ )				

# Input Limits / Common-Mode Range

Related Topics:

- Voltage Measurements Specifications
- Voltage Measurements Overview (p. 68)
- Voltage Measurements Details (p. 380)

**Note** This section contains advanced information not required for normal operation of the CR3000.

### **Summary**

- Voltage input limits for measurement are ±5 Vdc. *Input Limits* is the specification listed in *Specifications* (p. 95).
- Common-mode range is not a fixed number. It varies with respect to the magnitude of the input voltage.
- The CR3000 has features that help mitigate some of the effects of signals that exceed the *Input Limits* specification or the common-mode range.


With reference to the figure *PGIA* with Input-Signal Decomposition (p. 383), the PGIA processes the voltage difference between V+ and V−. It ignores the common-mode voltage, or voltages that are common to both inputs. The figure shows the applied input voltage decomposed into a common-mode voltage ( $V_{cm}$ ) and the differential-mode component ( $V_{dm}$ ) of a voltage signal.  $V_{cm}$  is the average of the voltages on the V+ and V− inputs. So,  $V_{cm} = (V_{cm} + V_{cm})/2$  or the voltage remaining on the inputs when  $V_{dm} = 0$ . The total voltage on the V+ and V− inputs is given as  $V_{cm} = V_{cm} + V_{dm}/2$ , and  $V_{cm} = V_{cm} - V_{dm}/2$ , respectively.

The PGIA ignores or rejects common-mode voltages as long as voltages at V+ and V- are within the *Input Limits* specification, which for the CR6 is  $\pm 5$  Vdc relative to ground. Input voltages wherein V+ or V-, or both, are beyond the  $\pm 5$  Vdc limit may suffer from undetected measurement errors. The *Common-Mode Range* defines the range of common-mode voltages that are not expected to induce undetected measurement errors. *Common-Mode Range* is different than *Input Limits* when the differential mode voltage in non-negligible. The following relationship is derived from the PGIA figure as:

Common-Mode Range =  $\pm 5 \text{ Vdc} - |V_{dm}/2|$ .

The conclusion follows that the common-mode range is not a fixed number, but instead decreases with increasing differential voltage. For differential voltages that are small compared to the input limits, common-mode range is essentially equivalent to *Input Limits*. Yet for a 5000 mV differential signal, the common-mode range is reduced to  $\pm 2.5$  Vdc, whereas *Input Limits* are always  $\pm 5$  Vdc. Consequently, the term *Input Limits* is used to specify the valid voltage range of the V+ and V- inputs into the PGIA.

FIGURE 88: PGIA with Input Signal Decomposition

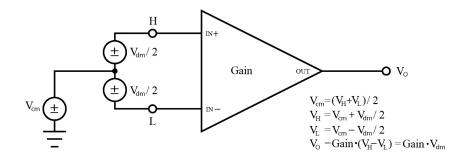


# 8.1.2.7.2 Voltage Measurement Mechanics

# Measurement Sequence

An analog voltage measurement as illustrated in the figure *Simplified Voltage Measurement Sequence (p. 383)*, proceeds as follows:

- 1. Switch
- 2. Settle
- 3. Amplify
- 4. Integrate
- 5. A to D (successive approximation)
- 6. Measurement scaled with multiplier and offset
- 7. Scaled value placed in memory

FIGURE 89: Simplified voltage measurement sequence.

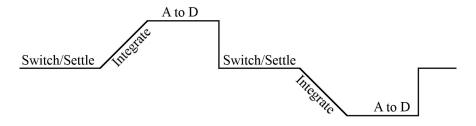


Voltage measurements are made using a successive approximation *A-to-D* (p. 529) converter to achieve a resolution of 16 bits. Prior to the A-to-D, a high impedance programmable-gain instrumentation amplifier (PGIA) amplifies the signal. See figure *Programmable Gain Input Amplifier* (PGIA) (p. 384). The CRBasic program controls amplifier gain and configuration — either single-ended input or differential input. Internal multiplexers route individual terminals to the PGIA.

*Timing (p. 160)* of measurement tasks is precisely controlled. The measurement schedule is determined at compile time and loaded into memory.

Using two different voltage-measurement instructions with the same voltage range takes about twice as long as using one instruction with two repetitions.

See table Parameters That Control Measurement Sequence and Timing (p. 385).

FIGURE 90: Programmable Gain Input Amplifier (PGIA): H to V+, L to V-, VH to V+, VL to V- correspond to text.

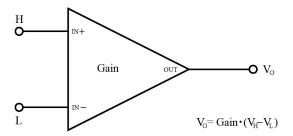

A voltage measurement proceeds as follows:

- 1. Set PGIA gain for the voltage range selected with the CRBasic measurement instruction parameter *Range*.
- 2. Turn on excitation to the level selected with *ExmV*.
- 3. Multiplex selected terminals (*InChan*) to the PGIA and delay for the entered settling time (*SettlingTime*).
- 4. Integrate the signal (see *Measurement Integration (p. 385)* ) and perform the Ato-D conversion.
- 5. Repeat for excitation reversal and input reversal as determined by parameters *RevEx* and *RevDiff*.
- 6. Apply multitplier (Mult) and offset (Offset) to measured result.

See Basic Voltage Measurements — Specifications for measurement speeds.

The CR3000 measures analog voltage by integrating the input signal for a fixed duration and then holding the integrated value during the successive approximation analog-to-digital (A-to-D) conversion. The CR3000 can make and

store measurements from up to 14 differential or 28 single-ended channels configured from H/L terminals at the minimum scan interval of 10 ms (100 Hz) using fast-measurement-programming techniques as discussed in *Measurement:* Fast Analog Voltage (p. 248). The maximum conversion rate is 2000 per second (2 kHz) for measurements made on a one single-ended channel.

**TABLE 88:** Parameters that Control Measurement Sequence and Timing

CRBasic Instruction Parameter	Action		
MeasOfs	Correct ground offset on single-ended measurements.		
SettlingTime	Sensor input settling time.		
Integ	Duration of input signal integration.		
RevDiff	Reverse high and low differential inputs.		
RevEx	Reverse polarity of excitation voltage.		

# Measurement Integration

Integrating the signal removes noise that creates error in the measurement. Slow integration removes more noise than fast integration. Integration time can be modified to reject 50 Hz and 60 Hz mains-power line noise.

Fast integration may be preferred at times to,

- minimize time skew between successive measurements.
- maximize throughput rate.
- maximize life of the CR3000 power supply.
- minimize polarization of polar sensors such as those for measuring conductivity, soil moisture, or leaf wetness. Polarization may cause measurement errors or sensor degradation.

improve accuracy of an LVDT measurement. The induced voltage in an LVDT decays with time as current in the primary coil shifts from the inductor to the series resistance; a long integration time may result in most of signal decaying before the measurement is complete.

### Single-Ended Measurements — Details

# Related Topics:

- Single-Ended Measurements Overview (p. 70)
- Single-Ended Measurements Details (p. 385)

With reference to the figure *Programmable Gain Input Amplifier (PGIA) (p. 384)*, during a single-ended measurement, the high signal (H) is routed to V+. The low signal (L) is automatically connected internally to signal ground with the low signal tied to ground ( $\stackrel{\bot}{=}$ ) at the wiring panel. V+ corresponds to odd or even numbered SE terminals on the CR3000 wiring panel. The single-ended configuration is used with the following CRBasic instructions:

- VoltSE()
- BrHalf()
- BrHalf3W()
- TCSE()
- Therm107()
- Therm108()
- Therm109()
- Thermistor()

#### Differential Measurements — Details

#### Related Topics:

- Differential Measurements Overview (p. 71)
- Differential Measurements Details (p. 386)

Using the figure *Programmable Gain Input Amplifier (PGIA)* (p. 384), for reference, during a differential measurement, the high signal (H) is routed to V+ and the low signal (L) is routed to V-.

An **H** terminal of an **H**/**L** terminal pair differential corresponds to V+. The **L** terminal corresponds to V-. The differential configuration is used with the following CRBasic instructions:

- VoltDiff()
- BrFull()
- BrFull6W()
- BrHalf4W()
- TCDiff()

# 8.1.2.7.3 Voltage Measurement Quality

**Read More** Consult the following technical papers at www.campbellsci.com/app-notes for in-depth treatments of several topics addressing voltage measurement quality:

- Preventing and Attacking Measurement Noise Problems
- Benefits of Input Reversal and Excitation Reversal for Voltage Measurements
- Voltage Measurement Accuracy, Self- Calibration, and Ratiometric Measurements
- Estimating Measurement Accuracy for Ratiometric Measurement Instructions.

The following topics discuss methods of generally improving voltage measurements. Related information for special case voltage measurements (*thermocouples (p. 355), current loops (p. 380), resistance (p. 367),* and *strain (p. 378))* is located in sections for those measurements.

# Single-Ended or Differential?

Deciding whether a differential or single-ended measurement is appropriate is usually, by far, the most important consideration when addressing voltage measurement quality. The decision requires trade-offs of accuracy and precision, noise cancelation, measurement speed, available measurement hardware, and fiscal constraints.

In broad terms, analog voltage is best measured differentially because these measurements include noise reduction features, listed below, that are not included in single-ended measurements.

- Passive Noise Rejection
  - o No voltage reference offset
  - Common-mode noise rejection, which filters capacitively coupled noise
- Active Noise Rejection
  - o Input reversal
  - Review *Input and Excitation Reversal* (p. 350) for details
  - Increases by twice the input reversal signal integration time

Reasons for using single-ended measurements, however, include:

- Not enough differential terminals available. Differential measurements use twice as many H/L terminals as do single-ended measurements.
- Rapid sampling is required. Single-ended measurement time is about half that of differential measurement time.
- Sensor is not designed for differential measurements. Many Campbell Scientific sensors are not designed for differential measurement, but the draw backs of a single-ended measurement are usually mitigated by large programmed excitation and/or sensor output voltages.

•

Sensors with a high signal-to-noise ratio, such as a relative-humidity sensor with a full-scale output of 0 to 1000 mV, can normally be measured as single-ended without a significant reduction in accuracy or precision.

Sensors with a low signal-to-noise ratio, such as thermocouples, should normally be measured differentially. However, if the measurement to be made does not require high accuracy or precision, such as thermocouples measuring brush-fire temperatures, which can exceed 2500 °C, a single-ended measurement may be appropriate. If sensors require differential measurement, but adequate input terminals are not available, an analog multiplexer should be acquired to expand differential input capacity.

Because a single-ended measurement is referenced to CR3000 ground, any difference in ground potential between the sensor and the CR3000 will result in an error in the measurement. For example, if the measuring junction of a copperconstantan thermocouple being used to measure soil temperature is not insulated, and the potential of earth ground is 1 mV greater at the sensor than at the point where the CR3000 is grounded, the measured voltage will be 1 mV greater than the true thermocouple output, or report a temperature that is approximately 25 °C too high. A common problem with ground-potential difference occurs in applications wherein external, signal-conditioning circuitry is powered by the same source as the CR3000, such as an ac mains power receptacle. Despite being tied to the same ground, differences in current drain and lead resistance may result in a different ground potential between the two instruments. So, as a precaution, a differential measurement should be made on the analog output from an external signal conditioner; differential measurements MUST be used when the low input is known to be different from ground.

## Integration

The CR3000 incorporates circuitry to perform an analog integration on voltages to be measured prior to the *A-to-D* (p. 529) conversion. Integrating the the analog signal removes noise that creates error in the measurement. Slow integration removes more noise than fast integration. When the duration of the integration matches the duration of one cycle of ac power mains noise, that noise is filtered out. The table *Analog Measurement Integration* (p. 340) lists valid integration duration arguments.

Faster integration may be preferred to achieve the following objectives:

- Minimize time skew between successive measurements
- Maximize throughput rate
- Maximize life of the CR3000 power supply
- Minimize polarization of polar sensors such as those for measuring conductivity, soil moisture, or leaf wetness. Polarization may cause measurement errors or sensor degradation.

 Improve accuracy of an LVDT measurement. The induced voltage in an LVDT decays with time as current in the primary coil shifts from the inductor to the series resistance; a long integration may result in most of signal decaying before the measurement is complete.

**Note** See White Paper "Preventing and Attacking Measurement Noise Problems" at *www.campbellsci.com*.

The magnitude of the frequency response of an analog integrator is a SIN(x)/x shape, which has notches (transmission zeros) occurring at 1/(integer multiples) of the integration duration. Consequently, noise at 1/(integer multiples) of the integration duration is effectively rejected by an analog integrator. If reversing the differential inputs or reversing the excitation is specified, there are two separate integrations per measurement; if both reversals are specified, there are four separate integrations.

**TABLE 89:** Analog Measurement Integration

Integration Time (ms)	Integration Parameter Argument	Comments	
0 to 16000 μs	0 to 16000	250 µs is considered fast and normally the minimum	
16.667 ms	_60Hz	Filters 60 Hz noise	
20 ms	_50Hz	Filters 50 Hz noise	

### Ac Power Noise Rejection

Grid or mains power (50 or 60 Hz, 230 or 120 Vac) can induce electrical noise at integer multiples of 50 or 60 Hz. Small analog voltage signals, such as thermocouples and pyranometers, are particularly susceptible. CR3000 voltage measurements can be programmed to reject (filter) 50 Hz or 60 Hz related noise. Noise is rejected by using a signal integration time that is relative to the length of the ac noise cycle, as illustrated in the figure *Ac Power Noise Rejection Techniques (p. 340).* 

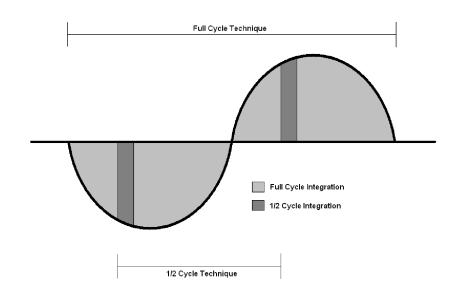


FIGURE 91: Ac Power Noise Rejection Techniques

# Ac Noise Rejection on Small Signals

The CR3000 rejects ac power line noise on all voltage ranges except **mV5000** and **mV1000** by integrating the measurement over exactly one full ac cycle before *A*-to-D (p. 529) conversion as listed in table *Ac Noise Rejection on Small Signals* (p. 341).

TABLE 90: Ac Noise Rejection on Small Signals <sup>1</sup>						
Ac Power Line Measurement CRBasic Integration Frequency Integration Duration Code						
60 Hz	16.667 ms	_60Hz				
50 Hz 20 ms _ <b>50Hz</b>						
<sup>1</sup> Applies to all analog input voltage ranges except <i>mV1000</i> and <i>mV5000</i> .						

### Ac Noise Rejection on Large Signals

If rejecting ac-line noise when measuring with the 1000 mV ( $\it{mV1000}$ ) and 5000 mV ( $\it{mV5000}$ ) ranges, the CR3000 makes two fast measurements separated in time by one-half line cycle. A 60 Hz half cycle is 8333 µs, so the second measurement must start 8333 µs after the first measurement integration began. The A-to-D conversion time is approximately 170 µs, leaving a maximum input-settling time of approximately 8160 µs (8333 µs – 170 µs). If the maximum input-settling time is exceeded, 60 Hz line-noise rejection will not occur. For 50 Hz rejection, the maximum input settling time is approximately 9830 µs (10,000 µs – 170 µs). The CR3000 does not prevent or warn against setting the settling time beyond the half-cycle limit. Table  $\it{Ac}$  Noise Rejection on Large Signals ( $\it{p}$ . 341) lists details of the half-cycle ac-power line-noise rejection technique.

	TABLE 91: Ac Noise Rejection on Large Signals <sup>1</sup>						
Ac-Power Line Frequency		Measurement Integration Time	CRBasic Integration Code	Default Settling Time	Maximum Recommended Settling Time <sup>2</sup>		
	60 Hz	250 μs • 2	_60Hz	3000 μs	8330 μs		
	50 Hz	250 μs • 2	_50Hz	3000 μs	10000 μs		

<sup>&</sup>lt;sup>1</sup> Applies to analog input voltage ranges *mV1000* and *mV5000*.

- 1. CR3000 turns excitation on, waits 50000 µs, and then makes the first measurement.
- 2. During A-to-D, CR3000 turns off excitation for  $\approx$ 170 µs.
- 3. Excitation is switched on again for one-half cycle, then the second measurement is made.

Restated, when the CR3000 is programmed to use the half-cycle 50 Hz or 60 Hz rejection techniques, a sensor does not see a continuous excitation of the length entered as the settling time before the second measurement — if the settling time entered is greater than one-half cycle. This causes a truncated second excitation. Depending on the sensor used, a truncated second excitation may cause measurement errors.

# Signal Settling Time

Settling time allows an analog voltage signal to settle closer to the true magnitude prior to measurement. To minimize measurement error, signal settling is needed when a signal has been affected by one or more of the following:

- A small transient originating from the internal multiplexing that connects a CR3000 terminal with measurement circuitry
- A relatively large transient induced by an adjacent excitation conductor on the signal conductor, if present, because of capacitive coupling during a bridge measurement
- Dielectric absorption. 50 Hz or 60 Hz integrations require a relatively long reset time of the internal integration capacitor before the next measurement.

The rate at which the signal settles is determined by the input settling time constant, which is a function of both the source resistance and fixed-input capacitance (3.3 nfd) of the CR3000.

Rise and decay waveforms are exponential. Figure *Input Voltage Rise and Transient Decay (p. 343)* shows rising and decaying waveforms settling closer to the true signal magnitude,  $V_{so}$ . The *Settling Time* parameter of an analog measurement instruction allows tailoring of measurement instruction settling times with 100  $\mu$ s resolution up to 35000  $\mu$ s.

<sup>&</sup>lt;sup>2</sup> Excitation time and settling time are equal in measurements requiring excitation. The CR3000 cannot excite **VX** or **IX** excitation terminals during A-to-D conversion. The one-half-cycle technique with excitation limits the length of recommended excitation and settling time for the first measurement to one-half-cycle. The CR3000 does not prevent or warn against setting a settling time beyond the one-half-cycle limit. For example, a settling time of up to 50000 μs can be programmed, but the CR3000 will execute the measurement as follows:

Programmed settling time is a function of arguments placed in the **Settling Time** and **Integ** parameters of a measurement instruction. Argument combinations and resulting settling times are listed in table *CRBasic Measurement Settling Times* (p. 343). Default settling times (those resulting when **Settling Time** =  $\theta$ ) provide sufficient settling in most cases. Additional settling time is often programmed when measuring high-resistance (high-impedance) sensors or when sensors connect to the input terminals by long leads.

Measurement time of a given instruction increases with increasing settling time. For example, a 1 ms increase in settling time for a bridge instruction with input reversal and excitation reversal results in a 4 ms increase in time for the CR3000 to perform the instruction.

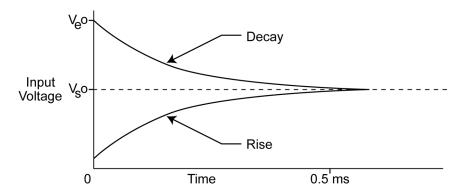


FIGURE 92: Input voltage rise and transient decay

TABLE 92: CRBasic Measurement Settling Times					
SettlingTime Argument	Integ <b>Argument</b>	Resultant Settling Time <sup>1</sup>			
0	250	200 μs			
0	_50Hz	3 ms			
0	_60Hz	3 ms			
integer ≥ <i>100</i>	integer	μs entered in <b>SettlingTime</b> argument			

# Settling Errors

specifications.

When sensors require long lead lengths, use the following general practices to minimize settling errors:

<sup>1</sup> 200 μs is the minimum settling time required to meet CR3000 resolution

• Do not use wire with PVC-insulated conductors. PVC has a high dielectric constant, which extends input settling time.

 Where possible, run excitation leads and signal leads in separate shields to minimize transients.

When measurement speed is not a prime consideration, additional time can be used to ensure ample settling time. The settling time required can be measured with the CR3000.

- When relatively large resistances are measured (> 1000 ohms), or relatively long cable lengths are used (> 50 feet) with sensors requiring current excitation, a 0.1 μf feed-forward capacitor should be placed between the **IX** and **IXR** to prevent excessive *ringing* (p. 553). With this capacitor present, a minimum of 3 ms is recommended for the *SettlingTime* parameter in the measurement instruction. The capacitor simply connects between the **IX** terminal and the **IXR** terminal. The capacitor has no polarity.
- In difficult cases, settling error can be measured as described in *Measuring Settling Time (p. 344).*

### Measuring Settling Time

Settling time for a particular sensor and cable can be measured with the CR3000. Programming a series of measurements with increasing settling times will yield data that indicate at what settling time a further increase results in negligible change in the measured voltage. The programmed settling time at this point indicates the settling time needed for the sensor / cable combination.

CRBasic example *Measuring Settling Time* (p. 344) presents CRBasic code to help determine settling time for a pressure transducer using a high-capacitance semiconductor. The code consists of a series of full-bridge measurements (**BrFull()**) with increasing settling times. The pressure transducer is placed in steady-state conditions so changes in measured voltage are attributable to settling time rather than changes in pressure. Reviewing *CRBasic Programming* — *Details* (p. 129) may help in understanding the CRBasic code in the example.

The first six measurements are shown in table First Six Values of Settling Time Data (p. 345). Each trace in figure Settling Time for Pressure Transducer (p. 345) contains all twenty PT() mV/V values (left axis) for a given record number, along with an average value showing the measurements as percent of final reading (right axis). The reading has settled to 99.5% of the final value by the fourteenth measurement, which is contained in variable PT(14). This is suitable accuracy for the application, so a settling time of 1400 µs is determined to be adequate.

```
CRBasic EXAMPLE 76: Measuring Settling Time
'This program example demonstrates the measurement of settling time using a single
'measurement instruction multiple times in succession. In this case, the program measures
'the temperature of the CR3000 wiring panel.
Public RefTemp 'Declare variable to receive instruction
BeginProg
  Scan(1, Sec, 3, 0)
    PanelTemp(RefTemp, 250) 'Instruction to make measurement
EndProg measures the settling time of a sensor measured with a differential
'voltage measurement
Public PT(20)
                                              'Variable to hold the measurements
DataTable(Settle,True,100)
 Sample(20,PT(),IEEE4)
EndTable
BeginProg
  Scan(1, Sec, 3, 0)
    BrFull(PT(1),1,mV20,1,Vx1,2500,True,True,100, 250,1.0,0)
   BrFull(PT(2),1,mV20,1,Vx1,2500,True,True,200, 250,1.0,0)
    BrFull(PT(3),1,mV20,1,Vx1,2500,True,True,300, 250,1.0,0)
    BrFull(PT(4),1,mV20,1,Vx1,2500,True,True,400, 250,1.0,0)
    BrFull(PT(5),1,mV20,1,Vx1,2500,True,True,500, 250,1.0,0)
    BrFull(PT(6),1,mV20,1,Vx1,2500,True,True,600, 250,1.0,0)
    BrFull(PT(7),1,mV20,1,Vx1,2500,True,True,700, 250,1.0,0)
    BrFull(PT(8),1,mV20,1,Vx1,2500,True,True,800, 250,1.0,0)
    BrFull(PT(9),1,mV20,1,Vx1,2500,True,True,900, 250,1.0,0)
    BrFull(PT(10),1,mV20,1,Vx1,2500,True,True,1000, 250,1.0,0)
    BrFull(PT(11),1,mV20,1,Vx1,2500,True,True,1100, 250,1.0,0)
    BrFull(PT(12),1,mV20,1,Vx1,2500,True,True,1200, 250,1.0,0)
    BrFull(PT(13),1,mV20,1,Vx1,2500,True,True,1300, 250,1.0,0)
    BrFull(PT(14),1,mV20,1,Vx1,2500,True,True,1400, 250,1.0,0)
    BrFull(PT(15),1,mV20,1,Vx1,2500,True,True,1500, 250,1.0,0)
    BrFull(PT(16),1,mV20,1,Vx1,2500,True,True,1600, 250,1.0,0)
    BrFull(PT(17),1,mV20,1,Vx1,2500,True,True,1700, 250,1.0,0)
   BrFull(PT(18),1,mV20,1,Vx1,2500,True,True,1800, 250,1.0,0)
   BrFull(PT(19),1,mV20,1,Vx1,2500,True,True,1900, 250,1.0,0)
   BrFull(PT(20),1,mV20,1,Vx1,2500,True,True,2000, 250,1.0,0)
   CallTable Settle
 NextScan
EndProg
```

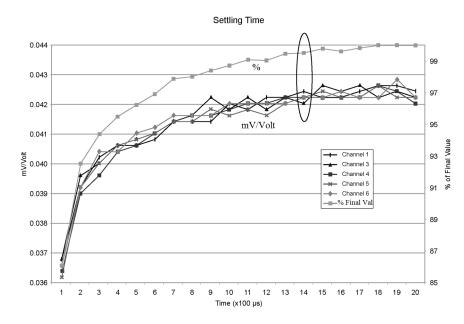


FIGURE 93: Settling Time for Pressure Transducer

TABLE 93: First	TABLE 93: First Six Values of Settling Time Data						
TIMESTAMP	REC	PT(1)	PT(2)	PT(3)	PT(4)	PT(5)	PT(6)
		Smp	Smp	Smp	Smp	Smp	Smp
1/3/2000 23:34	0	0.03638599	0.03901386	0.04022673	0.04042887	0.04103531	0.04123745
1/3/2000 23:34	1	0.03658813	0.03921601	0.04002459	0.04042887	0.04103531	0.0414396
1/3/2000 23:34	2	0.03638599	0.03941815	0.04002459	0.04063102	0.04042887	0.04123745
1/3/2000 23:34	3	0.03658813	0.03941815	0.03982244	0.04042887	0.04103531	0.04103531
1/3/2000 23:34	4	0.03679027	0.03921601	0.04022673	0.04063102	0.04063102	0.04083316

# **Open-Input Detect**

**Note** The information in this section is highly technical. It is not necessary for the routine operation of the CR3000.

### **Summary**

- An option to detect an open-input, such as a broken sensor or loose connection, is available in the CR3000.
- The option is selected by appending a C to the Range code.
- Using this option, the result of a measurement on an open connection will be **NAN** (not a number).

A useful option available to single-ended and differential measurements is the detection of open inputs due to a broken or disconnected sensor wire. This prevents otherwise undetectable measurement errors. Range codes appended

with *C* enable open-input detect for all input ranges. See *TABLE*: Analog Input Voltage Ranges and Options (p. 381).

Appending the *Range* code with a C results in a 50  $\mu$ s internal connection of the V+ input of the PGIA to a large over-voltage. The V- input is connected to ground. Upon disconnecting the inputs, the true input signal is allowed to settle and the measurement is made normally. If the associated sensor is connected, the signal voltage is measured. If the input is open (floating), the measurement will over-range since the injected over-voltage will still be present on the input, with NAN as the result.

Range codes and applicable over-voltage magnitudes are found in *TABLE: Range Code Option C Over-Voltages (p. 347).* 

The *C* option may not work, or may not work well, in the following applications:

- If the input is not a truly open circuit, such as might occur on a wet cut cable end, the open circuit may not be detected because the input capacitor discharges through external leakage to ground to a normal voltage within the settling time of the measurement. This problem is worse when a long settling time is selected, as more time is given for the input capacitors to discharge to a "normal" level.
- If the open circuit is at the end of a very long cable, the test pulse (300 mV) may not charge the cable (with its high capacitance) up to a voltage that generates NAN or a distinct error voltage. The cable may even act as an aerial and inject noise which also might not read as an error voltage.
- The sensor may "object" to the test pulse being connected to its output, even for 100 µs. There is little or no risk of damage, but the sensor output may be caused to temporarily oscillate. Programming a longer settling time in the CRBasic measurement instruction to allow oscillations to decay before the A-to-D conversion may mitigate the problem.

TABLE 94: Range-Code Option C Over-Voltages				
Input Range	Over-Voltage			
±20 mV ±50 mV ±200 mV	300 mV			
±1000 mV	1200 mV			
±5000 mV	5200 mV			

## Offset Voltage Compensation

#### Related Topics

- Auto Self-Calibration Overview (p. 93)
- Auto Self-Calibration Details (p. 373)
- Auto Self-Calibration Errors (p. 515)
- Offset Voltage Compensation (p. 347)
- Factory Calibration (p. 90)
- Factory Calibration or Repair Procedure (p. 500)

#### **Summary**

Measurement offset voltages are unavoidable, but can be minimized.

Offset voltages originate with:

- · Ground currents
- Seebeck effect
- · Residual voltage from a previous measurement

#### Remedies include:

- Connect power grounds to power ground terminals (G)
- Use input reveral (**RevDiff** = **True**) with differential measurements
- · Automatic offset compensation for differential measurements when

#### RevDiff = False

 Automatic offset compensation for single-ended measurements when MeasOff = False

- Better offset compensation when *MeasOff* = *True*
- Excitation reversal (*RevEx* = *True*)
- Longer settling times

Voltage offset can be the source of significant error. For example, an offset of 3  $\mu V$  on a 2500 mV signal causes an error of only 0.00012%, but the same offset on a 0.25 mV signal causes an error of 1.2%. The primary sources of offset voltage are ground currents and the Seebeck effect.

Single-ended measurements are susceptible to voltage drop at the ground terminal caused by return currents from another device that is powered from the CR3000 wiring panel, such as another manufacturer's comms modem, or a sensor that requires a lot of power. Currents >5 mA are usually undesirable. The error can be avoided by routing power grounds from these other devices to a power ground G terminal on the CR3000 wiring panel, rather than using a signal ground (\(\frac{+}{-}\)) terminal. Ground currents can be caused by the excitation of resistive-bridge sensors, but these do not usually cause offset error. These currents typically only flow when a voltage excitation is applied. Return currents associated with voltage excitation cannot influence other single-ended measurements because the excitation is usually turned off before the CR3000 moves to the next measurement. However, if the CRBasic program is written in such a way that an excitation terminal is enabled during an unrelated measurement of a small voltage, an offset error may occur.

The Seebeck effect results in small thermally induced voltages across junctions of dissimilar metals as are common in electronic devices. Differential measurements are more immune to these than are single-ended measurements

because of passive voltage cancelation occurring between matched high and low pairs such as 1H/1L. So use differential measurements when measuring critical low-level voltages, especially those below 200 mV, such as are output from pyranometers and thermocouples. Differential measurements also have the advantage of an input reversal option, *RevDiff*. When *RevDiff* is *True*, two differential measurements are made, the first with a positive polarity and the second reversed. Subtraction of opposite polarity measurements cancels some offset voltages associated with the measurement.

Single-ended and differential measurements without input reversal use an offset voltage measurement with the PGIA inputs grounded. For differential measurements without input reversal, this offset voltage measurement is performed as part of the routine auto-calibration of the CR3000. Single-ended measurement instructions VoltSE() and TCSe() MeasOff parameter determines whether the offset voltage measured is done at the beginning of measurement instruction, or as part of self-calibration. This option provides you with the opportunity to weigh measurement speed against measurement accuracy. When MeasOff = True, a measurement of the single-ended offset voltage is made at the beginning of the VoltSE() instruction. When MeasOff = False, an offset voltage measurement is made during self-calibration. For slowly fluctuating offset voltages, choosing MeasOff = True for the VoltSE() instruction results in better offset voltage performance.

Ratiometric measurements use an excitation voltage or current to excite the sensor during the measurement process. Reversing excitation polarity also reduces offset voltage error. Setting the *RevEx* parameter to *True* programs the measurement for excitation reversal. Excitation reversal results in a polarity change of the measured voltage so that two measurements with opposite polarity can be subtracted and divided by 2 for offset reduction similar to input reversal for differential measurements. Ratiometric differential measurement instructions allow both *RevDiff* and *RevEx* to be set *True*. This results in four measurement sequences:

- positive excitation polarity with positive differential input polarity
- negative excitation polarity with positive differential input polarity
- positive excitation polarity with negative differential input polarity
- positive excitation polarity then negative excitation differential input polarity

For ratiometric single-ended measurements, such as a **BrHalf()**, setting RevEx = True results in two measurements of opposite excitation polarity that are subtracted and divided by 2 for offset voltage reduction. For RevEx = False for ratiometric single-ended measurements, an offset-voltage measurement is made during the self-calibration.

When analog voltage signals are measured in series by a single measurement instruction, such as occurs when **VoltSE()** is programmed with **Reps** = **2** or more, measurements on subsequent terminals may be affected by an offset, the magnitude of which is a function of the voltage from the previous measurement. While this offset is usually small and negligible when measuring large signals, significant error, or **NAN**, can occur when measuring very small signals. This

effect is caused by dielectric absorption of the integrator capacitor and cannot be overcome by circuit design. Remedies include the following:

- Program longer settling times
- Use an individual instruction for each input terminal, the effect of which is to reset the integrator circuit prior to filtering.
- Avoid preceding a very small voltage input with a very large voltage input in a measurement sequence if a single measurement instruction must be used.

TABLE: Offset Voltage Compensation Options (p. 349) lists some of the tools available to minimize the effects of offset voltages.

TABLE 95: Offset Voltage Compensation Options				
CRBasic Measurement Instruction	<i>Input Reversal</i> (RevDiff =True)	Excitation Reversal (RevEx = True)	Measure Offset During Measurement (MeasOff = True)	Measure Offset During Background Calibration (RevDiff = False) (RevEx = False) (MeasOff = False)
AM25T()	✓	✓		<b>√</b>
BrHalf()		✓		✓
BrHalf3W()		✓		✓
BrHalf4W()	✓	✓		✓
BrFull()	✓	✓		✓
BrFull6W()	✓	✓		✓
Resistance()	✓	✓		✓
TCDiff()	✓			✓
TCSe()			✓	✓
Therm107()		✓		✓
Therm108()		<b>✓</b>		✓
Therm109()		✓		✓
VoltDiff()	✓			✓
VoltSe()			✓	✓

## Input and Excitation Reversal

Reversing inputs (differential measurements) or reversing polarity of excitation voltage (bridge measurements) cancels stray voltage offsets. For example, if 3  $\mu V$  offset exists in the measurement circuitry, a 5 mV signal is measured as 5.003 mV. When the input or excitation is reversed, the second sub-measurement is –

4.997 mV. Subtracting the second sub-measurement from the first and then dividing by 2 cancels the offset:

```
5.003 \text{ mV} - (-4.997 \text{ mV}) = 10.000 \text{ mV}

10.000 \text{ mV} / 2 = 5.000 \text{ mV}
```

When the CR3000 reverses differential inputs or excitation polarity, it delays the same settling time after the reversal as it does before the first sub-measurement. So, there are two delays per measurement when either *RevDiff* or *RevEx* is used. If both *RevDiff* and *RevEx* are *True*, four sub-measurements are performed; positive and negative excitations with the inputs one way and positive and negative excitations with the inputs reversed. The automatic procedure then is as follows.

- 1. Switches to the measurement terminals
- 2. Sets the excitation, and then settle, and then measure
- 3. Reverse the excitation, and then settles, and then measure
- 4. Reverse the excitation, reverse the input terminals, settle, measure
- 5. Reverse the excitation, settle, measure

There are four delays per **measure**. The CR3000 processes the four sub-measurements into the reported measurement. In cases of excitation reversal, excitation time for each polarity is exactly the same to ensure that ionic sensors do not polarize with repetitive measurements.

**Read More** A white paper entitled "The Benefits of Input Reversal and Excitation Reversal for Voltage Measurements" is available at *www.campbellsci.com*.

#### Ground Reference Offset Voltage

When *MeasOff* is enabled (= *True*), the CR3000 measures the offset voltage of the ground reference prior to each **VoltSe()** or **TCSe()** measurement. This offset voltage is subtracted from the subsequent measurement.

#### From Auto Self-Calibration

If *RevDiff*, *RevEx*, or *MeasOff* is disabled (= *False*), offset voltage compensation is continues to be automatically performed, albeit less effectively, by using measurements from the auto self-calibration. Disabling *RevDiff*, *RevEx*, or *MeasOff* speeds up measurement time; however, the increase in speed comes at the cost of accuracy because of the following:

- 1 RevDiff, RevEx, and MeasOff are more effective.
- 2 Auto self-calibrations are performed only periodically, so more time skew occurs between the auto self-calibration offsets and the measurements to which they are applied.

**Note** When measurement duration must be minimal to maximize measurement frequency, consider disabling *RevDiff*, *RevEx*, and *MeasOff* when CR3000 module temperatures and return currents are slow to change.

### Time Skew Between Measurements

Time skew between consecutive voltage measurements is a function of settling and integration times, A-to-D conversion, and the number entered into the *Reps* parameter of the **VoltDiff()** or **VoltSE()** instruction. A close approximation is:

time skew = settling time + integration time + A-to-D conversion time + reps

where A-to-D conversion time equals 125  $\mu$ s. If reps (repetitions) > 1 (multiple measurements by a single instruction), no additional time is required. If reps = 1 in consecutive voltage instructions, add 15  $\mu$ s per instruction.

### Measurement Accuracy

**Read More** For an in-depth treatment of accuracy estimates, see the technical paper *Measurement Error Analysis* soon available at *www.campbellsci.com/app-notes*.

Accuracy describes the difference between a measurement and the true value. Many factors affect accuracy. This section discusses the affect percent-orreading, offset, and resolution have on the accuracy of the measurement of an analog voltage sensor signal. Accuracy is defined as follows:

accuracy = percent-of-reading + offset

where percents-of-reading are tabulated in the table *Analog Voltage Measurement Accuracy (p. 352)*, and offsets are tabulated in the table *Analog Voltage Measurement Offsets (p. 352)*.

**Note** Error discussed in this section and error-related specifications of the CR3000 do not include error introduced by the sensor or by the transmission of the sensor signal to the CR3000.

TABLE 96: Analog Voltage Measurement Accuracy <sup>1</sup>			
0 to 40 °C			
±(0.04% of reading + offset)	±(0.07% of reading + offset)	±(0.09% of reading + offset)	

<sup>&</sup>lt;sup>1</sup> Assumes the CR3000 is within factory specifications

<sup>&</sup>lt;sup>2</sup> Available only with purchased extended temperature option (-XT)

TABLE 97: Analog Voltage Measurement Offsets			
Differential Measurement With Input Reversal  Differential Measurement Without Input Reversal		Single-Ended	
1.5 • Basic Resolution + 1.0 μV	3 • Basic Resolution + 2.0 μV	3 • Basic Resolution + 3.0 μV	

**Note** — the value for Basic Resolution is found in the table *Analog Voltage Measurement Resolution* (p. 352).

TABLE 98: Analog Voltage Measurement Resolution			
Input Voltage Range (mV)	Differential Measurement With Input Reversal (μV)	Basic Resolution (μV)	
±5000	83.33	167	
±1000	16.67	33.4	
±200	3.33	6.67	
±50	0.83	1.67	
±20	0.33	0.67	

Note — see *Specifications* (p. 95) for a complete tabulation of measurement resolution


As an example, figure *Voltage Measurement Accuracy Band Example (p. 354)* shows changes in accuracy as input voltage changes on the  $\pm 1000$  and  $\pm 5000$  input ranges. Percent-of-reading is the principle component, so accuracy improves as input voltage decreases. Offset is small, but could be significant in applications wherein the sensor-signal voltage is very small, such as is encountered with thermocouples.

Offset depends on measurement type and voltage-input range. Offsets equations are tabulated in table *Analog Voltage Measurement Offsets (p. 352)*. For example, for a differential measurement with input reversal on the  $\pm 5000$  mV input range, the offset voltage is calculated as follows:

offset = 1.5 • Basic Resolution + 1.0 
$$\mu$$
V = (1.5 • 83.33  $\mu$ V) + 1.0  $\mu$ V = 126  $\mu$ V

where Basic Resolution is taken from the table *Analog Voltage Measurement Resolution (p. 352)*.

FIGURE 94: Example voltage measurement accuracy band, including the effects of percent of reading and offset, for a differential measurement with input reversal at a temperature between 0 to 40 °C.

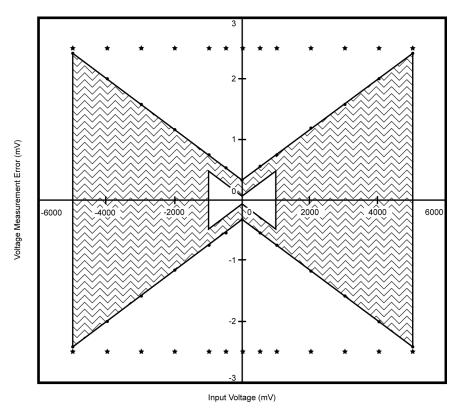

# Measurement Accuracy Example

The following example illustrates the effect percent-of-reading and offset have on measurement accuracy. The effect of offset is usually negligible on large signals:

### Example:

- Sensor-signal voltage: ≈5000 mV
- CRBasic measurement instruction: VoltDiff()
- Programmed input-voltage range (*Range*): *mV5000* (±5000 mV)
- Input measurement reversal: *True*
- CR3000 circuitry temperature: 10°C

Accuracy of the measurement is calculated as follows:

accuracy = percent-of-reading + offset

where  $percent-of\text{-reading} = 5000 \text{ mV} \bullet \pm 0.04\%$   $= \pm 2 \text{ mV}$  and  $offset = (1.5 \bullet 167 \text{ }\mu\text{V}) + 1 \text{ }\mu\text{V}$  = 0.252 mV Therefore,  $accuracy = \pm 2 \text{ mV} + 0.251 \text{ mV}$   $= \pm 2.252 \text{ mV}$ 

### Electronic Noise

Electronic "noise" can cause significant error in a voltage measurement, especially when measuring voltages less than 200 mV. So long as input limitations are observed, the PGIA ignores voltages, including noise, that are common to each side of a differential-input pair. This is the common-mode voltage. Ignoring (rejecting or canceling) the common-mode voltage is an essential feature of the differential input configuration that improves voltage measurements.

Figure PGIA with Input Signal Decomposition (p. 383), illustrates the common-mode component ( $V_{cm}$ ) and the differential-mode component ( $V_{dm}$ ) of a voltage signal.  $V_{cm}$  is the average of the voltages on the V+ and V- inputs. So,  $V_{cm} = (V++V-)/2$  or the voltage remaining on the inputs when  $V_{dm} = 0$ . The total voltage on the V+ and V- inputs is given as  $V+=V_{cm}+V_{dm}/2$ , and  $V_L=V_{cm}-V_{dm}/2$ , respectively.

## 8.1.3 Pulse Measurements — Details

### Related Topics:

- Pulse Measurements Specifications
- Pulse Measurements Overview (p. 74)
- Pulse Measurements Details (p. 404)

**Read More** Review the *PULSE COUNTERS* (p. 404) and Pulse on C Terminals sections in *Specifications* (p. 95). Review pulse measurement programming in *CRBasic Editor Help* for the **PulseCount()** and **TimerIO()** instructions.

**Note** Peripheral devices are available from Campbell Scientific to expand the number of pulse input channels measured by the CR3000. See *Measurement and Control Peripherals* — *List (p. 604).* 

The figure *Pulse Sensor Output Signal Types (p. 75)* illustrates pulse signal types measurable by the CR3000:

- low-level ac
- high-frequency
- switch closure

The figure Switch Closure Pulse Sensor (p. 405) illustrates the basic internal circuit and the external connections of a switch closure pulse sensor. The table Pulse Measurements: Terminals and Programming (p. 406) summarizes available measurements, terminals available for those measurements, and the CRBasic instructions used. The number of terminals configurable for pulse input is determined from the table CR3000 Terminal Definitions (p. 60).

FIGURE 95: Pulse Sensor Output Signal Types


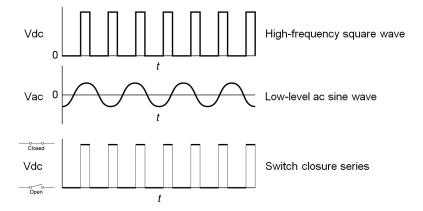


FIGURE 96: Switch Closure Pulse Sensor

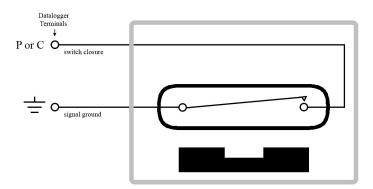

Terminals Configurable for Low-Level Ac Input CAMPBELL SCIENTIFIC CR3000 Terminals Configurable for Switch-Closure and

FIGURE 97: Terminals Configurable for Pulse Input

High-Frequency Input

TABLE 99: Pulse Measurements: Terminals and Programming			
Measurement	P Terminals	C Terminals	CRBasic Instruction
Low-level ac, counts	✓		PulseCount()
Low-level ac, Hz	✓		PulseCount()
Low-level ac, running average	✓		PulseCount()
High frequency, counts	✓	✓	PulseCount()
High frequency, Hz	✓	✓	PulseCount()
High frequency, running average	✓	✓	PulseCount()
Switch closure, counts	✓	✓	PulseCount()
Switch closure, Hz	✓	✓	PulseCount()
Switch closure, running average	✓	✓	PulseCount()
Calculated period		✓	TimerIO()
Calculated frequency		✓	TimerIO()
Time from edge on previous port		✓	TimerIO()

TABLE 99: Pulse Measurements: Terminals and Programming			
P C CRBasic Measurement Terminals Terminals Instruction			
Time from edge on port 1		✓	TimerIO()
Count of edges		✓	TimerIO()
Pulse count, period		✓	TimerIO()
Pulse count, frequency		✓	TimerIO()

## 8.1.3.1 Pulse Measurement Terminals

#### P Terminals

• Input voltage range = -20 to 20 V

If pulse input voltages exceed  $\pm 20$  V, third-party external-signal conditioners should be employed. Under no circumstances should voltages greater than 50 V be measured.

### C Terminals

• Input voltage range = -8 to 16 Vdc

C terminals configured for pulse input have a small 25 ns input RC-filter time constant between the terminal block and the CMOS input buffer, which allows for high-frequency pulse measurements up to 250 kHz and edge counting up to 400 kHz. The CMOS input buffer recognizes inputs  $\geq$ 3.8 V as being high and inputs  $\leq$ 1.2 V as being low.

Open-collector (bipolar transistors) or open-drain (MOSFET) sensors are typically measured as frequency sensors. C terminals can be conditioned for open collector or open drain with an external pull-up resistor as shown in figure Connecting Switch Closures to C Terminals Configured for Control. The pull-up resistor counteracts an internal 100 k $\Omega$  pull-down resistor, allowing inputs to be pulled to >3.8 V for reliable measurements.

### 8.1.3.2 Low-Level Ac Measurements — Details

#### Related Topics:

- Low-Level Ac Input Modules Overview (p. 431)
- Low-Level Ac Measurements Details (p. 407)
- Pulse Input Modules List (p. 604)

Low-level ac (sine-wave) signals can be measured on **P** terminals. Sensors that commonly output low-level ac include:

Ac generator anemometers

Measurements include the following:

- Counts
- Frequency (Hz)
- Running average

Rotating magnetic-pickup sensors commonly generate ac voltage ranging from thousandths of volts at low-rotational speeds to several volts at high-rotational speeds. Terminals configured for low-level ac input have in-line signal conditioning for measuring signals ranging from 20 mV RMS (±28 mV peak-to-peak) to 14 V RMS (±20 V peak-to-peak).

#### P Terminals

- Maximum input frequency is dependent on input voltage:
  - o 1.0 to 20 Hz at 20 mV RMS
  - o 0.5 to 200 Hz at 200 mV RMS
  - 0.3 to 10 kHz at 2000 mV RMS
  - 0.3 to 20 kHz at 5000 mV RMS
- CRBasic instruction: PulseCount()

Internal ac coupling is used to eliminate dc-offset voltages of up to  $\pm 0.5$  Vdc.

### C Terminals

Low-level ac signals cannot be measured directly by C terminals. Refer to *Pulse Input Modules* — *List (p. 604)* for information on peripheral terminal expansion modules available for converting low-level ac signals to square-wave signals.

## 8.1.3.3 High-Frequency Measurements

High-frequency (square-wave) signals can be measured on **P** or **C** terminals. Common sensors that output high-frequency include:

- Photo-chopper anemometers
- Flow meters

Measurements include counts, frequency in hertz, and running average. Refer to the section *Frequency Resolution* (p. 409) for information about how the resolution of a frequency measurement can be different depending on whether the measurement is made with the **PulseCount()** or **TimerIO()** instruction.

#### P Terminals

• Maximum input frequency = 250 kHz

• CRBasic instructions: PulseCount()

High-frequency pulse inputs are routed to an inverting CMOS input buffer with input hysteresis. The CMOS input buffer is at output  $\bf 0$  level with inputs  $\geq 2.2~\rm V$  and at output  $\bf 1$  level with inputs  $\leq 0.9~\rm V$ . An internal  $100~\rm k\Omega$  resistor is automatically connected to the terminal to pull it up to  $5~\rm Vdc$ . This pull-up resistor accommodates open-collector (open-drain) output devices.

### C Terminals

Maximum input frequency = <1 kHz</li>

• CRBasic instructions: PulseCount(), TimerIO()

# 8.1.3.3.1 Frequency Resolution

Resolution of a frequency measurement made with the PulseCount() instruction is calculated as

$$FR = \frac{1}{S}$$

where

FR = resolution of the frequency measurement (Hz)

S = scan interval of CRBasic program

Resolution of a frequency measurement made with the TimerIO() instruction is

$$FR = \frac{R/E}{P * (P + (R/E))}$$

where

FR = frequency resolution of the measurement (Hz)

R = timing resolution of the **TimerIO()** measurement = 136 ns

P = period of input signal (seconds). For example, P = 1 / 1000 Hz = 0.001

E = Number of rising edges per scan or 1, whichever is greater.

TABLE 100: Example: E for a 10 Hz input signal				
Scan	Rising Edge / Scan	E		
5.0	50	50		
0.5	5	5		
0.05	0.5	1		

**TimerIO()** instruction measures frequencies of  $\leq 1$  kHz with higher frequency resolution over short (sub-second) intervals. In contrast, sub-second frequency measurement with **PulseCount()** produce measurements of lower resolution. Consider a 1 kHz input. Table *Frequency Resolution Comparison (p. 410)* lists frequency resolutions to be expected for a 1 kHz signal measured by **TimerIO()** and **PulseCount()** at 0.5 s and 5.0 s scan intervals.

Increasing a measurement interval from 1 s to 10 s, either by increasing the scan interval (when using **PulseCount()**) or by averaging (when using **PulseCount()** or **TimerIO()**), improves the resulting frequency resolution from 1 Hz to 0.1 Hz. Averaging can be accomplished by the **Average()**, **AvgRun()**, and **AvgSpa()** instructions. Also, **PulseCount()** has the option of entering a number greater than *I* in the *POption* parameter. Doing so enters an averaging interval in milliseconds for a direct running-average computation. However, use caution when averaging. Averaging of any measurement reduces the certainty that the result truly represents a real aspect of the phenomenon being measured.

TABLE 101: Frequency Resolution Comparison				
0.5 s Scan 5.0 s Scan				
PulseCount(), POption=1	FR = 2 Hz	FR = 0.2  Hz		
TimerIO(), Function=2	FR = 0.0011  Hz	FR = 0.00011  Hz		

## 8.1.3.3.2 Frequency Measurement Q & A

**Q**: When more than one pulse is in a scan interval, what does **TimerIO()** return when configured for a frequency measurement? Does it average the measured periods and compute the frequency from that (f = 1/T)? For example,

```
Scan(50,mSec,10,0)
TimerIO(WindSpd(),11111111,00022000,60,Sec)
```

A: In the background, a 32-bit-timer counter is saved each time the signal transitions as programmed (rising or falling). This counter is running at a fixed high frequency. A count is also incremented for each transition. When the TimerIO() instruction executes, it uses the difference of time between the edge prior to the last execution and the edge prior to this execution as the time difference. The number of transitions that occur between these two times divided by the time difference gives the calculated frequency. For multiple edges occurring between execution intervals, this calculation does assume that the frequency is not varying over the execution interval. The calculation returns the average regardless of how the signal is changing.

### 8.1.3.4 Switch Closure and Open-Collector Measurements

Switch closure and open-collector signals can be measured on **P** or **C** terminals. Mechanical-switch closures have a tendency to bounce before solidly closing. Unless filtered, bounces can cause multiple counts per event. The CR3000 automatically filters bounce. Because of the filtering, the maximum switch

closure frequency is less than the maximum high-frequency measurement frequency. Sensors that commonly output a switch closure or open-collector signal include:

- Tipping-bucket rain gages
- Switch closure anemometers
- Flow meters

Data output options include counts, frequency (Hz), and running average.

#### P Terminals

An internal  $100 \text{ k}\Omega$  pull-up resistor pulls an input to 5 Vdc with the switch open, whereas a switch closure to ground pulls the input to 0 V. An internal hardware debounce filter has a 3.3 ms time-constant. Connection configurations are illustrated in table.

• Maximum input frequency = 90 Hz

## CRBasic instruction: PulseCount()

An internal  $100~\text{k}\Omega$  pull-up resistor pulls an input to 5 Vdc with the switch open, whereas a switch closure to ground pulls the input to 0 V. An internal hardware debounce filter has a 3.3 ms time-constant. Connection configurations are illustrated in table.

- Maximum input frequency = 90 Hz
- CRBasic instruction: PulseCount()

### C Terminals

Switch closure mode is a special case edge-count function that measures dry-contact-switch closures or open collectors. The operating system filters bounces. Connection configurations are illustrated in table *Switch Closures and Open Collectors* (p. 413).

- Maximum input frequency = 150 Hz
- CRBasic instruction: PulseCount()

# 8.1.3.5 Edge Timing

Edge time and period can be measured on **P** or **C** terminals. Applications for edge timing include:

 Measurements for feedback control using pulse-width or pulse-duration modulation (PWM/PDM). Measurements include time between edges expressed as frequency (Hz) or period  $(\mu s)$ .

#### C Terminals

- Maximum input frequency <1 kHz</li>
- CRBasic instruction: TimerIO()
- Rising or falling edges of a square-wave signal are detected:
  - o Rising edge transition from <1.5 Vdc to >3.5 Vdc.
  - o Falling edge transition from >3.5 Vdc to <1.5 Vdc.
- Edge-timing resolution is approximately 136 ns.

# 8.1.3.6 Edge Counting

Edge counts can be measured on C terminals.

### C Terminals

- Maximum input frequency 400 kHz
- CRBasic instruction: TimerIO()
- Rising or falling edges of a square-wave signal are detected:
  - o Rising edge transition from <1.5 Vdc to >3.5 Vdc.
  - o Falling edge transition from >3.5 Vdc to <1.5 Vdc.

## 8.1.3.7 Timer Input on I/O NAN Conditions


- NAN is the result of a TimerIO() measurement if one of the following occurs:
  - Timeout expires
  - The signal frequency is too fast (> 3 KHz). When a C terminal experiences a too fast frequency, the CR3000 operating system disables the interrupt that is capturing the precise time until the next scan is serviced. This is done so that the CR3000 processor does not get occupied by excessive interrupts. A small RC filter retrofitted to the sensor switch should fix the problem.

## 8.1.3.8 Pulse Measurement Tips


Basic connection of pulse-output sensors is illustrated in table *Switch Closures* and *Open Collectors* (p. 413, p. 413).

The **PulseCount()** instruction, whether measuring pulse inputs on **P** or **C** terminals, uses dedicated 24-bit counters to accumulate all counts over the programmed scan interval. The resolution of pulse counters is one count or 1 Hz. Counters are read at the beginning of each scan and then cleared. Counters will overflow if accumulated counts exceed 16,777,216, resulting in erroneous measurements.


- Counts are the preferred **PulseCount()** output option when measuring the number of tips from a tipping-bucket rain gage or the number of times a door opens. Many pulse-output sensors, such as an emometers and flow meters, are calibrated in terms of frequency (*Hz (p. 542)*) so are usually measured using the **PulseCount()** frequency-output option.
- Accuracy of PulseCount() is limited by a small scan-interval error of ±(3 ppm of scan interval + 10 μs), plus the measurement resolution error of ±1 / (scan interval). The sum is essentially ±1 / (scan interval).
- Use the *LLAC4* (p. 604) module to convert non-TTL-level signals, including low-level ac signals, to TTL levels for input into C terminals.
- As shown in the table *Switch Closures and Open Collectors (p. 413)*, **C** terminals, with regard to the 6.2 V Zener diode, have an input resistance of 100 k $\Omega$  with input voltages < 6.2 Vdc. For input voltages  $\geq$  6.2 Vdc, **C** terminals have an input resistance of only 220  $\Omega$ .

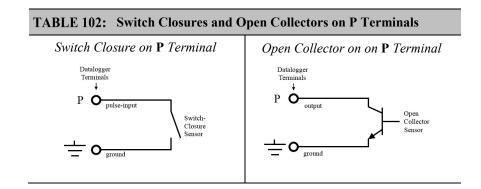

#### **TABLE 103: Switch Closures and Open Collectors**

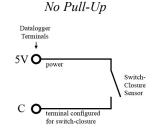

Switch Closure on C Terminal:

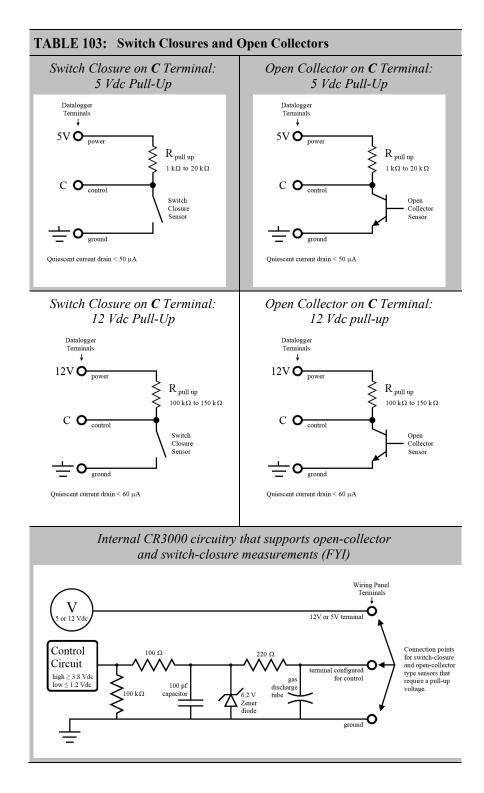

# 8.1.3.8.1 Pay Attention to Specifications

Pay attention to specifications. Take time to understand the signal to be measured and compatible input terminals and CRBasic instructions. *TABLE:* Three Specifications Differing Between P and C Terminals (p. 415) compares

specifications for pulse input terminals to emphasize the need for matching the proper device to the application.

TABLE 104: Three Specifications Differing Between P and C Terminals				
P Terminal		C Terminal		
High-Frequency Maximum	250 kHz	400 kHz		
Input Voltage Maximum	20 Vdc	16 Vdc		
State Transition Thresholds	Count upon transition from <0.9 Vdc to >2.2 Vdc	Count upon transition from <1.2 Vdc to >3.8 Vdc		

## 8.1.3.8.2 Input Filters and Signal Attenuation

**P** and **C** terminals configured for pulse input have internal filters that reduce electronic noise, which can cause false counts. However, input filters attenuate (reduce) the amplitude (voltage) of the signal. Attenuation is a function of the frequency of the signal. Higher-frequency signals are attenuated more. If a signal is attenuated enough, it may not pass the detection thresholds required by the pulse count circuitry.

The metric for filter effectiveness is  $\tau$ , the filter time constant. The higher the  $\tau$  value, the less noise that gets through the filter. But, the higher the  $\tau$  value, the lower the signal frequency must be to pass the detection thresholds.

Detection thresholds,  $\tau$  values, and low-level ac pulse input ranges are listed in *TABLE: Time Constants (p. 415)* 

A deduction from the specifications is that while a C terminal measured with the **TimerIO()** frequency measurement may be superior for clean signals, a P terminal filter (much higher  $\tau$ ) may be required to get a measurement on an electronically noisy signal.


SPEC For example, increasing voltage is required for low-level ac inputs to overcome filter attenuation on **P** terminals configured for low-level ac: 8.5 ms time constant filter (19 Hz 3 dB frequency) for low-amplitude signals; 1 ms time constant (159 Hz 3 dB frequency) for larger (> 0.7 V) amplitude signals.

For example, the amplitude reduction that results from  $\tau$  in high-frequency pulse input mode is illustrated in figure *FIGURE*: Amplitude Reduction of Pulse Count Waveform (p. 416).

TABLE 105: Time Constants (τ)		
Measurement	τ	
P terminal low-level ac mode	TABLE: Low-Level Ac Amplitude and Maximum Measured Frequency (p. 416)	
P terminal high-frequency mode	1.2	
P terminal switch closure mode	3300	
C terminal high-frequency mode	0.025	
C terminal switch closure mode	0.025	

TABLE 106: Low-Level Ac Pules Input Ranges		
Sine Wave Input (mV RMS)	Maximum Frequency (Hz)	
20	20	
200	200	
2000	10,000	
5000	20,000	

FIGURE 98: Amplitude reduction of pulse count waveform (before and after 1  $\mu$ s  $\mu$ s time-constant filter)

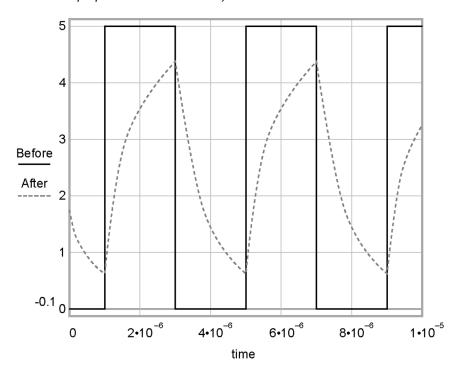

# 8.1.4 Vibrating Wire Measurements — Details

#### Related Topics:

- Vibrating Wire Measurements Specifications
- Vibrating Wire Measurements Overview (p. 77)
- Vibrating Wire Measurements Details (p. 417)


The CR3000 can measure vibrating wire or vibrating-strip sensors, including strain gages, pressure transducers, piezometers, tilt meters, crack meters, and load cells. These sensors are used in structural, hydrological, and geotechnical applications because of their stability, accuracy, and durability. The CR3000 can measure vibrating wire sensors through specialized interface modules. More sensors can be measured by using multiplexers (see *Analog Input Modules — List* (p. 604)).

The figure *Vibrating Wire Sensor* (p. 417) illustrates how a basic sensor is put together. To make a measurement, plucking and pickup coils are excited with a *swept frequency* (p. 558). The ideal behavior then is that all non-resonant frequencies quickly decay, and the resonant frequency continues. As the resonant frequency cuts the lines of flux in the pickup coil, the same frequency is induced on the signal wires in the cable connecting the sensor to the CR3000 or interface.

Measuring the resonant frequency by means of period averaging is the classic technique, but Campbell Scientific has developed static and dynamic spectral-analysis techniques (*VSPECT (p. 562)*) that produce superior noise rejection, higher resolution, diagnostic data, and, in the case of dynamic VSPECT, measurements up to 333.3 Hz.

A resistive-thermometer device (thermistor or RTD), which is included in most vibrating wire sensor housings, can be measured to compensate for temperature errors in the measurement.

FIGURE 99: Vibrating Wire Sensor



### 8.1.4.1 Time-Domain Measurement

Although obsolete in many applications, time-domain period-averaging vibrating wire measurements can be made on **H** L terminals. The **VibratingWire()** instruction makes the measurement. Measurements can be made directly on these terminals, but usually are made through a vibrating wire interface that amplifies and conditions the vibrating wire signal and provides inputs for embedded thermistors or RTDs. Interfaces of this type are no longer available from Campbell Scientific.

For most applications, the advanced techniques of static and dynamic VSPECT measurements are preferred.

# 8.1.5 Period Averaging — Details

#### Related Topics:

- · Period Average Measurements Specifications
- Period Average Measurements Overview (p. 76)
- Period Average Measurements Details (p. 418)

The CR3000 can measure the period of a signal on a **SE** terminal. The specified number of cycles is timed with a resolution of 68 ns, making the resolution of the period measurement 68 ns divided by the number of cycles chosen.

The measurement is performed as follows: low-level signals are amplified prior to a voltage comparator. The internal voltage comparator is referenced to the programmed threshold. The threshold parameter allows referencing the internal voltage comparator to voltages other than 0 V. For example, a threshold of 2500 mV allows a 0 to 5 Vdc digital signal to be sensed by the internal comparator without the need for additional input conditioning circuitry. The threshold allows direct connection of standard digital signals, but it is not recommended for small-amplitude sensor signals.

For sensor amplitudes less than 20 mV peak-to-peak, a dc blocking capacitor is recommended to center the signal at CR3000 ground (threshold = 0). Figure *Input Conditioning Circuit for Period Averaging (p. 419)* shows an example circuit.

A threshold other than zero results in offset voltage drift, limited accuracy ( $\approx \pm 10 \text{ mV}$ ), and limited resolution ( $\approx 1.2 \text{ mV}$ ).

The minimum pulse-width requirements increase (maximum frequency decreases) with increasing gain. Signals larger than the specified maximum for a range will saturate the gain stages and prevent operation up to the maximum specified frequency. As shown in the schematics, back-to-back diodes are recommended to limit large amplitude signals to within the input signal ranges.

**Caution** Noisy signals with slow transitions through the voltage threshold have the potential for extra counts around the comparator switch point. A voltage comparator with 20 mV of hysteresis follows the voltage gain stages. The effective input-referred hysteresis equals 20 mV divided by the selected voltage gain. The effective input referred hysteresis on the  $\pm$  25 mV range is 2 mV; consequently, 2 mV of noise on the input signal could cause extraneous counts. For best results, select the largest input range (smallest gain) that meets the minimum input signal requirements.

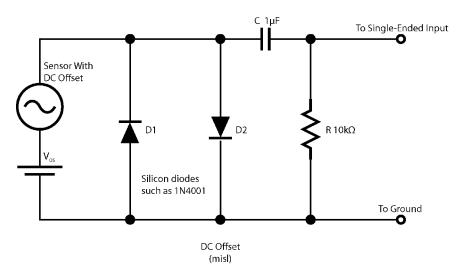


FIGURE 100: Input Conditioning Circuit for Period Averaging

# 8.1.6 Reading Smart Sensors — Details

Related Topics:

- Reading Smart Sensors Overview (p. 77)
- Reading Smart Sensors Details (p. 419)

### 8.1.6.1 RS-232 and TTL — Details

Related Topics:

- RS-232 and TTL Details (p. 419)
- Serial I/O (p. 303)

The CR3000 can receive and record most TTL (0 to 5 Vdc) and true RS-232 data from devices such as smart sensors. See the table *CR3000 Terminal Definitions* (p. 60) for those terminals and serial ports configurable for either TTL or true RS-232 communications. Use of the **CS I/O** port for true RS-232 communications requires use of an interface device. See *Hardware*, *Single-Connection Comms Devices* — *List* (p. 611). If additional serial inputs are required, serial input expansion modules can be connected. See *Serial I/O Modules* — *List* (p. 605). Serial data are usually captured as text strings, which are then parsed (split up) as defined in the CRBasic program.

**Note** When connecting serial sensors to a **C** terminal configured as Rx, the sensor power consumption may increase by a few milliamps due to voltage clamps in the CR3000. An external resistor may need to be added in series to the Rx line to limit the current drain, although this is not advisable at very high baud rates. See figure *Circuit to Limit C Terminal Input to 5 Volts Dc (p. 420)*.

**Note C** terminals configured as Tx transmit only 0 to 5 Vdc logic. However, **C** terminals configured as Rx read most true RS-232 signals. When connecting serial sensors to a **C** terminal configured as Rx, the sensor power consumption may increase by a few milliamps due to voltage clamps in the CR3000. An external resistor may need to be added in series to the Rx line to limit the current drain, although this is not advisable at very high baud rates. See *Circuit to Limit C Terminal Input to 5 Volts* (p. 420).

 $\begin{array}{c} \text{Datalogger} \\ \text{Terminals} \\ \downarrow \\ \text{COM} \\ \text{TX} \\ \hline \\ \text{TIL RS-232} \\ \end{array} \\ \begin{array}{c} 1 \text{ k}\Omega \\ \\ \text{sensor signal} \\ \\ 4.7 \text{ V zener diode} \\ \end{array}$ 

FIGURE 101: Circuit to Limit C Terminal Input to 5 Vdc

## 8.1.6.2 SDI-12 Sensor Support — Details

#### Related Topics:

- SDI-12 Sensor Support Overview (p. 78)
- SDI-12 Sensor Support Details (p. 420)
- Serial I/O: SDI-12 Sensor Support Programming Resource (p. 255)

SDI-12 is a communication protocol developed to transmit digital data from smart sensors to data-acquisition units. It is a simple protocol, requiring only a single communication wire. Typically, the data-acquisition unit also supplies power (12 Vdc and ground) to the SDI-12 sensor. **SDI12Recorder()** instruction communicates with SDI-12 sensors on terminals configured for SDI-12 input. See the table *CR3000 Terminal Definitions* (p. 60) to determine those terminals configurable for SDI-12 communications.

## 8.1.7 Field Calibration — Overview

### Related Topics:

- Field Calibration Overview (p. 79)
- Field Calibration Details (p. 229)

Calibration increases accuracy of a measurement device by adjusting its output, or the measurement of its output, to match independently verified quantities. Adjusting sensor output directly is preferred, but not always possible or practical. By adding **FieldCal()** or **FieldCalStrain()** instructions to the CR3000 CRBasic program, measurements of a linear sensor can be adjusted by modifying the programmed multiplier and offset applied to the measurement without modifying or recompiling the CRBasic program.

# 8.1.8 Cabling Effects — Details

Related Topics:

- Cabling Effects Overview (p. 79)
- Cabling Effects Details (p. 421)

Sensor cabling can have significant effects on sensor response and accuracy. This is usually only a concern with sensors acquired from manufacturers other than Campbell Scientific. Campbell Scientific sensors are engineered for optimal performance with factory-installed cables.

## 8.1.8.1 Analog Sensor Cabling

Cable length in analog sensors is most likely to affect the signal settling time. For more information, see *Signal Settling Time* (p. 342).


## 8.1.8.2 Current Excitation Cabling

When relatively large resistances are measured (> 1000 ohms), or relatively long cable lengths are used (> 50 feet) with sensors requiring current excitation, a 0.1 µf feed-forward capacitor should be placed between the **IX** and **IXR** to prevent excessive *ringing* (p. 553). With this capacitor present, a minimum of 3 ms is recommended for the **Settling Time** parameter in the measurement instruction. The capacitor simply connects between the **IX** terminal and the **IXR** terminal. The capacitor has no polarity.

## 8.1.8.3 Pulse Sensor Cabling

Because of the long interval between switch closures in tipping-bucket rain gages, appreciable capacitance can build up between wires in long cables. A built-up charge can cause arcing when the switch closes and so shorten switch life. As shown in figure *Current-Limiting Resistor in a Rain Gage Circuit (p. 421)*, a  $100~\Omega$  resistor is connected in series at the switch to prevent arcing. This resistor is installed on all rain gages currently sold by Campbell Scientific.

FIGURE 102: Current-Limiting Resistor in a Rain Gage Circuit



## 8.1.8.4 RS-232 Sensor Cabling

RS-232 sensor cable lengths should be limited to 50 feet.

## 8.1.8.5 SDI-12 Sensor Cabling

The SDI-12 standard allows cable lengths of up to 200 feet. Campbell Scientific does not recommend SDI-12 sensor lead lengths greater than 200 feet; however, longer lead lengths can sometimes be accommodated by increasing the wire gage or powering the sensor with a second 12 Vdc power supply placed near the sensor.

# 8.1.9 Synchronizing Measurements — Details

Related Topics:

- Synchronizing Measurements Overview (p. 79)
- Synchronizing Measurements Details (p. 422)

## 8.1.9.1 Synchronizing Measurement in the CR3000 — Details

Measurements are sychnronized in the CR3000 by the task sequencer. See *Execution and Task Priority* (p. 160).

# 8.1.9.2 Synchronizing Measurements in a Datalogger Network — Details

Large numbers of sensors, cable length restrictions, or long distances between measurement sites may require use of multiple CR3000s.

Techniques outlined below enable network administrators to synchronize CR3000 clocks and measurements in a CR3000 network.

Care should be taken when a clock-change operation is planned. Any time the CR3000 clock is changed, the deviation of the new time from the old time may be sufficient to cause a skipped record in data tables. Any command used to synchronize clocks should be executed after any **CallTable()** instructions and timed so as to execute well clear of data output intervals.

Techniques to synchronize measurements across a network include:

1. LoggerNet (p. 91) – when reliable comms are common to all CR3000s in a network, the LoggerNet automated clock check provides a simple time synchronization function. Accuracy is limited by the system clock on the PC running the LoggerNet server. Precision is limited by network transmission latencies. LoggerNet compensates for latencies in many comms systems and can achieve synchronies of <100 ms deviation. Errors of 2 to 3 second may be seen on very busy RF connections or long distance internet connections.

**Note** Common PC clocks are notoriously inaccurate. Information available at <a href="http://www.nist.gov/pml/div688/grp40/its.cfm">http://www.nist.gov/pml/div688/grp40/its.cfm</a> gives some good pointers on keeping PC clocks accurate.

- 2. Digital trigger a digital trigger, rather than a clock, can provide the synchronization signal. When cabling can be run from CR3000 to CR3000, each CR3000 can catch the rising edge of a digital pulse from the master CR3000 and synchronize measurements or other functions, using the WaitDigTrig() instructions, independent of CR3000 clocks or data time stamps. When programs are running in pipeline mode, measurements can be synchronized to within a few microseconds. See WaitDigTrig Scans (p. 166).
- 3. PakBus (p. 82) commands the CR3000 is a PakBus device, so it is capable of being a node in a PakBus network. Node clocks in a PakBus network are synchronized using the **SendGetVariable()**, **ClockReport()**, or **PakBusClock()** commands. The CR3000 clock has a resolution of 10 ms, which is the resolution used by PakBus clock-sync functions. In networks without routers, repeaters, or retries, the communication time will cause an additional error (typically a few 10s of milliseconds). PakBus clock commands set the time at the end of a scan to minimize the chance of skipping a record to a data table. This is not the same clock check process used by LoggerNet as it does not use average round trip calculations to try to account for network connection latency.
- 4. Radios A PakBus enabled radio network has an advantage over Ethernet in that ClockReport() can be broadcast to all dataloggers in the network simultaneously. Each will set its clock with a single PakBus broadcast from the master. Each datalogger in the network must be programmed with a PakBusClock() instruction.

**Note** Use of PakBus clock functions re-synchronizes the **Scan()** instruction. Use should not exceed once per minute. CR3000 clocks drift at a slow enough rate that a **ClockReport()** once per minute should be sufficient to keep clocks within 30 ms of each other.

With any synchronization method, care should be taken as to when and how things are executed. Nudging the clock can cause skipped scans or skipped records if the change is made at the wrong time or changed by too much.

- 5. GPS clocks in CR3000s can be synchronized to within about 10 ms of each other using the GPS() instruction. CR3000s built since October of 2008 (serial numbers ≥ [3168]) can be synchronized within a few microseconds of each other and within ≈200 μs of UTC. While a GPS signal is available, the CR3000 essentially uses the GPS as its continuous clock source, so the chances of jumps in system time and skipped records are minimized.
- 6. Ethernet any CR3000 with a network connection (internet, GPRS, private network) can synchronize its clock relative to Coordinated Universal Time (UTC) using the **NetworkTimeProtocol()** instruction. Precisions are usually maintained to within 10 ms. The NTP server could be another logger or any NTP server (such as an email server or nist.gov). Try to use a local server something where communication latency is low, or, at least, consistent. Also, try not to execute the **NetworkTimeProtocol()** at the top of a scan; try to ask for the server time between even seconds.

# 8.2 Switched-Voltage Output — Details

#### Related Topics:

- Switched Voltage Output Specifications
- Switched Voltage Output Overview (p. 62)
- Switched Voltage Output Details (p. 424)
- Current Source and Sink Limits (p. 424)
- PLC Control Overview (p. 91)
- PLC Control Modules Overview (p. 430)
- PLC Control Modules Lists (p. 607)

The CR3000 wiring panel is a convenient power distribution device for powering sensors and peripherals that require a 5 Vdc, or 12 Vdc source. It has two continuous 12 Vdc terminals (12V), two program-controlled, switched, 12 Vdc terminals (SW12), and one continuous 5 Vdc terminal (5V). SW12, 12V, and 5V terminals limit current internally for protection against accidental short circuits. Voltage on the 12V and SW12 terminals can vary widely and will fluctuate with the dc supply used to power the CR3000, so be careful to match the datalogger power supply to the requirements of the sensors. The 5V terminal is internally regulated to within  $\pm 4\%$ , which is good regulation as a power source, but typically not adequate for bridge sensor excitation. *TABLE: Current Sourcing Limits (p. 424)* lists the current limits of 12V and 5V terminals. Greatly reduced output voltages on these terminals may occur if the current limits are exceeded. See *Terminals Configured for Control (p. 428)* for more information.

TABLE 107: Current Source and Sink Limits			
Terminal	Limit <sup>1</sup>		
VX or EX (voltage excitation) <sup>2</sup>	±50 mA maximum		
IX (current excitation)	±2500 μA maximum		
CAO (continuous analog voltage output)	±15 mA maximum		
SW12V <sup>3</sup>	< 900 mA @ 20°C		
	< 630 mA @ 50°C		
	< 450 mA @ 70°C		
	< 360 mA @ 85°C		
12V + SW12V (combined) <sup>4</sup>	< 1.85 A @ 20°C		
	< 1.33 A @ 50°C		
	< 1.00 A @ 70°C		
	< 0.74 A @ 85°C		
5V + CS I/O (combined) <sup>5</sup>	< 200 mA		

<sup>&</sup>lt;sup>1</sup> Source is positive amperage (+); sink is negative amperage (-).

<sup>&</sup>lt;sup>2</sup> Exceeding current limits will cause voltage output to become unstable. Voltage should stabilize once current is again reduced to within stated limits.

<sup>&</sup>lt;sup>3</sup> A polyfuse is used to limit power. Result of overload is a voltage drop. To reset, disconnect and allow circuit to cool.

TABLE 107: Current Source and Sink Limits	
Terminal	Limit <sup>1</sup>

<sup>&</sup>lt;sup>4</sup> Polyfuse protected. See footnote 3.

# 8.2.1 Switched-Voltage Excitation

Four switched, analog-output (excitation) terminals (VX1 to VX4) operate under program control to provide  $\pm 5000$  mV dc excitation. Check the accuracy specification of terminals configured for excitation in *Specifications (p. 95)* to understand their limitations. Specifications are applicable only for loads not exceeding  $\pm 25$  mA.

CRBasic instructions that control voltage excitation include the following:

- BrFull()
- BrFull6W()
- BrHalf()
- BrHalf3W()
- BrHalf4W()
- ExciteV()

**Note** Square-wave ac excitation for use with polarizing bridge sensors is configured with the *RevEx* parameter of the bridge instructions.

# 8.2.2 Switched-Current Excitation (IX Terminals)

Three switched, current-output terminals (**IX1**, **IX2**, and **IX3**), each used in conjunction with a common return (**IXR**) terminal, operate under program control to provide  $-2500~\mu\text{A}$  to  $+2500~\mu\text{A}$  for making resistance measurements. Check the accuracy specification of these terminals in *Specifications* (p. 95) to understand their limitations. CRBasic instructions that control current excitation include the following:

- ExciteI()
- Resistance()

See *Current Excitation Cabling* (p. 421) for precautions when measuring resistances  $> 1000 \Omega$  or sensors with leads > 50 feet.

<sup>&</sup>lt;sup>5</sup> Current is limited by a current limiting circuit, which holds the current at the maximum by dropping the voltage when the load is too great.

# 8.2.3 Continuous-Regulated (5V Terminal)

The 5V terminal is regulated and remains near 5 Vdc ( $\pm 4\%$ ) so long as the CR3000 supply voltage remains above 9.6 Vdc. It is intended for power sensors or devices requiring a 5 Vdc power supply. It is not intended as an excitation source for bridge measurements. However, measurement of the 5V terminal output, by means of jumpering to an analog input on the same CR3000), will facilitate an accurate bridge measurement if 5V must be used.

**Note** Table *Current Source and Sink Limits* (p. 424) has more information on excitation load capacity.

# 8.2.4 Continuous-Analog Out (CAO Terminal)

Continuous analog out (CAO) terminals are regulated and remain near the set voltage ( $\pm 4\%$ ) so long as the CR3000 supply voltage remains above 10 Vdc. Measurement of the output from CAO (by means of jumpering to an analog input on the same CR3000) enables an accurate bridge measurement if a CAO terminal must be used for excitation.

The CAO sample capacitor is a good example of capacitor dielectric absorption, a phenomenon wherein a capacitor charge / discharge time is greatly increased because of a small percentage of dielectric molecules being quite slow to respond. The CR3000 CAO circuitry uses polypropylene capacitors for the sampling capacitor, which have the lowest dielectric absorption of commonly available capacitors, yet the effect is still noticeable for large step changes in the CAO output voltage. Hence a default 2.6 ms charge time is employed in the CAO instruction to minimize dielectric absorption errors following CAO voltage step changes. Using fast update (see *FastUpdate* parameter in **ExciteCAO()** instruction) following a large step change can result in a fairly large (5% or so) CAO setting error for the first scan, with the error being reduced upon subsequent scans after the step change.

# 8.2.5 Continuous-Unregulated Voltage (12V Terminal)

Use 12V terminals to continuously power devices that require 12 Vdc. Voltage on the 12V terminals will change with CR3000 supply voltage.

Caution Voltage levels at the 12V and switched SW12 terminals, and pin 8 on the CS I/O port, are tied closely to the voltage levels of the main power supply. For example, if the power received at the POWER IN 12V and G terminals is 16 Vdc, the 12V and SW12 terminals, and pin 8 on the CS I/O port, will supply 16 Vdc to a connected peripheral. If the connected peripheral or sensor is not designed for that voltage level, it may be damaged.

# 8.2.6 Switched-Unregulated Voltage (SW12 Terminal)

The **SW12** terminals are often used to power devices such as sensors that require 12 Vdc during measurement. Current sourcing must be limited to 900 mA or less

at 20 °C. Voltage on a **SW12** terminal will change with CR3000 supply voltage. CRBasic instruction **SW12()** controls the **SW12** terminals. Configure **SW12()** as a measurement or processing task in the instruction. Use it as a processing task when controlling power to SDI-12 and serial sensors that use **SDI12Recorder()** or **SerialIn()** instructions respectively. CRBasic programming using **IF THEN** constructs to control **SW12**, such as when used for cell phone control, should also use the **SW12()** instruction. See *Execution and Task Priority (p. 160)*.

A 12 Vdc switching circuit designed to be driven by a C terminal is available from Campbell Scientific. It is listed in *Relay Drivers* — *List (p. 608)*.

## 8.3 PLC Control — Details

### Related Topics:

- PLC Control Overview (p. 91)
- PLC Control Modules Overview (p. 430)
- PLC Control Modules Lists (p. 607)
- Switched Voltage Output Specifications
- Switched Voltage Output Overview (p. 62)
- Switched Voltage Output Details (p. 424)
- Current Source and Sink Limits (p. 424)

The CR3000 can control instruments and devices such as the following:

- Wireless cellular modem to conserve power.
- GPS receiver to conserve power.
- Trigger a water sampler to collect a sample.
- Trigger a camera to take a picture.
- Activate an audio or visual alarm.
- Move a head gate to regulate water flows in a canal system.
- Control pH dosing and aeration for water quality purposes.
- Control a gas analyzer to stop operation when temperature is too low.
- Control irrigation scheduling.

Controlled devices can be physically connected to C terminals, usually through an external relay driver, or the SW12V (p. 426) terminal. C terminals can be set low (0 Vdc) or high (5 Vdc) using PortSet() or WriteIO() instructions. Control modules are available to expand and augment CR3000 control capacity. On / off and proportional control modules are available. See appendix PLC Control Modules — List (p. 607).

Tips for writing a control program:

- Short Cut programming wizard has provisions for simple on/off control.
- PID control can be done with the CR3000.

Control decisions can be based on time, an event, or a measured condition.

### Example:

In the case of a cell modem, control is based on time. The modem requires 12 Vdc power, so connect its power wire to the CR3000 SW12V terminal. The following code snip turns the modem on for ten minutes at the top of the hour using the TimeIntoInterval() instruction embedded in an If/Then logic statement:

```
If TimeIntoInterval(0,60,Min) Then PortSet(9,1) 'Port "9" is the SW12V Port. Turn phone on. If TimeIntoInterval(10,60,Min) Then PortSet(9,0) 'Turn phone off.
```

**TimeIsBetween()** returns **TRUE** if the CR3000 real-time clock falls within the specified range; otherwise, the function returns **FALSE**. Like **TimeIntoInterval()**, **TimeIsBetween()** is often embedded in an **If/Then** logic statement, as shown in the following code snip.

```
If TimeIsBetween(0,10,60,Min) Then
  SW12(1) 'Turn phone on.
Else
  SW12(0) 'Turn phone off.
EndIf
```

**TimeIsBetween()** returns **TRUE** for the entire interval specified whereas **TimeIntoInterval()** returns **TRUE** only for the one scan that matches the interval specified.

For example, using the preceding code snips, if the CRBasic program is sent to the datalogger at one minute past the hour, the **TimeIsBetween()** instruction will evaluate as **TRUE** on its first scan. The **TimeIntoInterval()** instruction will evaluate as **TRUE** at the top of the next hour (59 minutes later).

Note START is inclusive and STOP is exclusive in the range of time that will return a TRUE result. For example:
 TimeIsBetween(0,10,60,Min) will return TRUE at 8:00:00.00 and FALSE at 08:10:00.00.

# 8.3.1 Terminals Configured for Control

C terminals can be configured as output ports to set low (0 Vdc, turn off) or high (5 Vdc, turn on) using the **PortSet()** or **WriteIO()** instructions. Ports **C4**, **C5**, and **C7** can be configured for pulse width modulation with maximum periods of 36.4 s, 9.1 s, and 2.27 s, respectively. A terminal configured for digital I/O is normally used to operate an external relay-driver circuit because the port itself has limited drive capacity. Current sourcing for drive capcitiy is determined by the 5 Vdc supply and a 330  $\Omega$  output resistance. It is expressed as:

$$V_o = 4.9 \text{ V} - (330 \Omega \cdot I_o)$$

Where  $V_0$  is the drive limit, and  $I_0$  is the current required by the external device. Figure Current Sourcing from C Terminals Configured for Control (p. 429) plots the relationship.

(N) about 1.5 1.0 0.5 0.0 0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 Output Current (mA)

FIGURE 103: Current sourcing from C terminals configured for control

# 8.4 Measurement and Control Peripherals — Details

### Related Topics:

- Measurement and Control Peripherals Overview (p. 86)
- Measurement and Control Peripherals Details (p. 429)
- Measurement and Control Peripherals Lists (p. 604)

Peripheral devices expand the CR3000 input and output capacities. Some peripherals are designed as SDM (synchronous devices for measurement) or CDM (CPI devices for measurement). SDM and CDM devices are intelligent peripherals that receive instruction from, and send data to, the CR3000 using proprietary communication protocols through SDM terminals and CPI interfaces. The following sections discuss peripherals according to measurement types.

# 8.4.1 Analog Input Modules

**Read More** For more information see appendix *Analog Input Modules* — *List (p. 604).* 

Mechanical and solid-state multiplexers are available to expand the number of analog sensor inputs. Multiplexers are designed for single-ended, differential, bridge-resistance, or thermocouple inputs.

# 8.4.2 Analog Output Modules

**Read More** For more information see appendix *Continuous Analog Output (CAO) Modules — List (p. 607).* 

The CR3000 can scale measured or processed values and transfer these values in digital form to either its on-board CAO ports or to an analog output device. The analog output device performs a digital-to-analog conversion to output an analog voltage or current. The output level is maintained until updated by the CR3000.

## 8.4.3 PLC Control Modules — Overview

#### Related Topics:

- PLC Control Overview (p. 91)
- PLC Control Modules Overview (p. 430)
- PLC Control Modules Lists (p. 607)
- Switched Voltage Output Specifications
- Switched Voltage Output Overview (p. 62)
- Switched Voltage Output Details (p. 424)
- Current Source and Sink Limits (p. 424)

Controlling power to an external device is a common function of the CR3000. On-board control terminals and peripheral devices are available for binary (on / off) or analog (variable) control. A switched, 12 Vdc terminal (**SW12V**) is also available. See *Switched-Unregulated (Nominal 12 Volt)* (p. 426).

## 8.4.3.1 Relays and Relay Drivers

Read More See Relay Drivers Modules — List (p. 608).

Several relay drivers are manufactured by Campbell Scientific. Compatible, inexpensive, and reliable single-channel relay drivers for a wide range of loads are also available from electronic vendors such as *Crydom*, *Newark*, *and Mouser* (p. 565).

## 8.4.3.2 Component-Built Relays

Figure Relay Driver Circuit with Relay (p. 431) shows a typical relay driver circuit in conjunction with a coil driven relay, which may be used to switch external power to a device. In this example, when the terminal configured for control is set high, 12 Vdc from the datalogger passes through the relay coil, closing the relay which completes the power circuit and turns on the fan.

In other applications, it may be desirable to simply switch power to a device without going through a relay. Figure *Power Switching without Relay (p. 431)* illustrates this. If the device to be powered draws in excess of 75 mA at room temperature (limit of the 2N2907A medium power transistor), the use of a relay is required.

FIGURE 104: Relay Driver Circuit with Relay


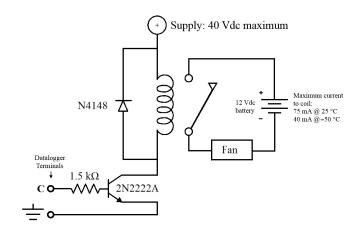


FIGURE 105: Power Switching without Relay

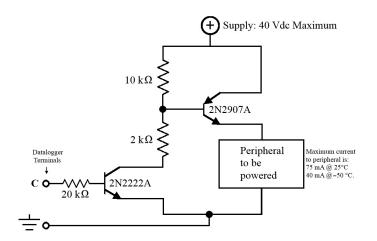

# 8.4.4 Pulse Input Modules

Read More For more information see Pulse Input Modules — List (p. 604).

Pulse input expansion modules are available for switch-closure, state, pulse count and frequency measurements, and interval timing.

# 8.4.4.1 Low-Level Ac Input Modules — Overview

### Related Topics:

- Low-Level Ac Input Modules Overview (p. 431)
- Low-Level Ac Measurements Details (p. 407)
- Pulse Input Modules List (p. 604)

Low-level ac input modules increase the number of low-level ac signals a CR3000 can monitor by converting low-level ac to high-frequency pulse.

### 8.4.5 Serial I/O Modules — Details

**Read More** For more information see appendix *Serial I/O Modules List* (p. 605).

Capturing input from intelligent serial-output devices can be challenging. Several Campbell Scientific serial I/O modules are designed to facilitate reading and parsing serial data.

# 8.4.6 Terminal-Input Modules

Read More See Passive Signal Conditioners — List (p. 605).

Terminal Input Modules (TIMs) are devices that provide simple measurement-support circuits in a convenient package. TIMs include voltage dividers for cutting the output voltage of sensors to voltage levels compatible with the CR3000, modules for completion of resistive bridges, and shunt modules for measurement of analog-current sensors.

# 8.4.7 Vibrating Wire Modules

**Read More** For complete information, see *Vibrating Wire Modules* — *List* (p. 605).

Vibrating wire modules interface vibrating wire transducers to the CR3000.

# 8.5 Datalogger Support Software — Details

#### Related Topics:

- Datalogger Support Software Quickstart (p. 41)
- Datalogger Support Software Overview (p. 91)
- Datalogger Support Software Details (p. 432)
- Datalogger Support Software Lists (p. 614)

Datalogger support software facilitates program generation, editing, data retrieval, and real-time data monitoring.

- PC200W Starter Software is available at no charge at
   www.campbellsci.com/downloads. It supports a transparent RS-232
   connection between PC and CR3000, and includes Short Cut for creating
   CR3000 programs. Tools for setting the datalogger clock, sending
   programs, monitoring sensors, and on-site viewing and collection of data
   are also included.
- LoggerLink Mobile Apps are simple yet powerful tools that allow an iOS or Android device to communicate with IP-enabled CR3000s. The apps

- support field maintenance tasks such as viewing and collecting data, setting the clock, and downloading programs.
- *PC400 Datalogger Support Software* supports a variety of comms options, manual data collection, and data monitoring displays. *Short Cut* and *CRBasic Editor* are included for creating CR3000 programs. *PC400* does not support complex communication options, such as phone-to-RF, PakBus® routing, or scheduled data collection.
- LoggerNet Datalogger Support Software supports combined comms
  options, customized data-monitoring displays, and scheduled data
  collection. It includes Short Cut and CRBasic Editor for creating
  CR3000 programs. It also includes tools for configuring, troubleshooting, and managing datalogger networks. LoggerNet Admin and
  LoggerNet Remote are available for more demanding applications.
- LNLINUX Linux-based LoggerNet Server with LoggerNet Remote provides a solution for those who want to run the LoggerNet server in a Linux environment. The package includes a Linux version of the LoggerNet server and a Windows version of LoggerNet Remote. The Windows-based client applications in LoggerNet Remote are run on a separate computer, and are used to manage the LoggerNet Linux server.
- VISUALWEATHER Weather Station Software supports Campbell Scientific weather stations. Version 3.0 or higher supports custom weather stations or the ET107, ET106, and MetData1 pre-configured weather stations. The software allows you to initialize the setup, interrogate the station, display data, and generate reports from one or more weather stations.

**Note** More information about software available from Campbell Scientific can be found at *www.campbellsci.com*.

# 8.6 Program and OS File Compression Q and A

Q: What is Gzip?

A: Gzip is the GNU zip archive file format. This file format and the algorithms used to create it are open source and free to use for any purpose. Files with the .gz extension have been passed through these data compression algorithms to make them smaller. For more information, go to www.gnu.org.

O: Is there a difference between Gzip and zip?

A: While similar, Gzip and zip use different file compression formats and algorithms. Only program files and OSs compressed with Gzip are compatible with the CR3000.

Q: Why compress a program or operating system before sending it to a CR3000 datalogger?

A: Compressing a file has the potential of significantly reducing its size. Actual reduction depends primarily on the number and proximity of redundant blocks of information in the file. A reduction in file size means fewer bytes are transferred when sending a file to a datalogger. Compression can reduce transfer times significantly over slow or high-latency links, and can reduce line charges when using pay-by-the-byte data plans. Compression is of particular benefit when transmitting programs or OSs over low-baud rate terrestrial radio, satellite, or restricted cellular-data plans.


Q: Does my CR3000 support Gzip?


A: Version 25 of the standard CR3000 operating system supports receipt of Gzip compressed program files and OSs.

Q: How do I Gzip a program or operating system?

A: Many utilities are available for the creation of a Gzip file. This document specifically addresses the use of 7-Zip File Manager. 7-Zip is a free, open source, software utility compatible with Windows<sup>®</sup>. Download and installation instructions are available at http://www.7-zip.org/. Once 7-Zip is installed, creating a Gzip file is as four-step process:

- a) Open 7-Zip.
- b) Drag and drop the program or operating system you wish to compress onto the open window.
- c) When prompted, set the archive format to "Gzip".

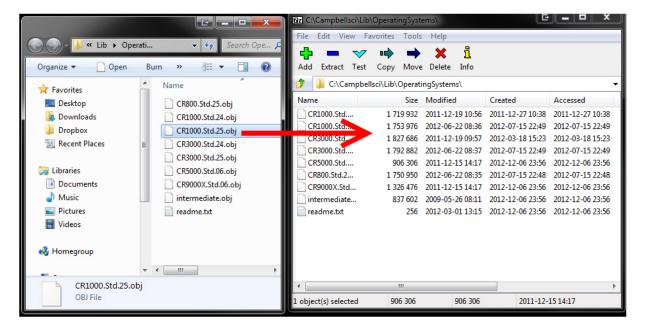

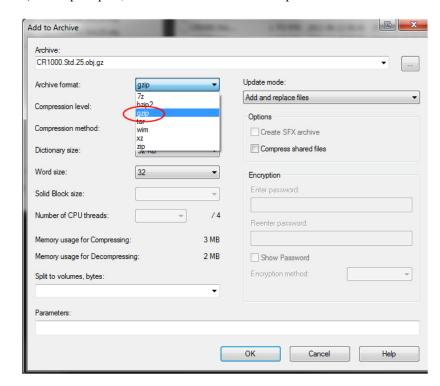

c) When prompted, set the archive format to "Gzip".

## d) Select OK.

The resultant file names will be of the type "myProgram.cr3.gz" and "CR3000.Std.25.obj.gz". Note that the file names end with ".gz". The ".gz" extension must be preceded with the original file extension (.cr3, .obj) as shown.

Q: How do I send a compressed file to the CR3000?

A: A Gzip compressed file can be sent to a CR3000 datalogger by clicking the **Send Program** command in the *datalogger support software (p. 91)*. Compressed programs can also be sent using **HTTP PUT** to the CR3000 web server. The CR3000 will not automatically decompress and use compressed files sent with **File Control**, FTP, or a low-level OS download; however, these files can be manually decompressed by marking as **Run Now** using **File Control**, **FileManage()**, and HTTP.

**Note** Compression has little effect on an encrypted program (see **FileEncrypt()** in the *CRBasic Editor Help*), since the encryption process does not produce a large number of repeatable byte patterns. Gzip has little effect on files that already employ compression such as JPEG or MPEG-4.

TABLE 108: Typical Gzip File Compression Results			
File	Original Size Bytes		
CR3000 operating system	1,753,976	671,626	
Small program	2,600	1,113	
Large program	32,157	7,085	

# 8.7 Security — Details

Related Topics:

- Security Overview (p. 88)
- Security Details (p. 436)

The CR3000 is supplied void of active security measures. By default, RS-232, Telnet, FTP and HTTP services, all of which give high level access to CR3000 data and CRBasic programs, are enabled without password protection.

You may wish to secure your CR3000 from mistakes or tampering. The following may be reasons to concern yourself with datalogger security:

- Collection of sensitive data
- Operation of critical systems
- Networks accessible by many individuals

Some options to secure your datalogger from mistakes or tampering include:

- Sending the latest operating system to the datalogger.
- Disabling unused services and securing those that are used. This includes disabling HTTP, FTP, Telnet, and Ping network services (Device Configuration Utility | Settings Editor | Network Services tab). These services can be used to discover your datalogger on an IP network.
- Setting security codes (see section *Pass-Code Lockout (p. 438)*).
- Setting a PakBus/TCP password. The PakBus TCP password controls access to PakBus communication over a TCP/IP link. PakBusTCP passwords can be set in *Device Configuration Utility*.
- Disabling FTP or setting an FTP username and password in *Device Configuration Utility*.
- Setting a PakBus encryption (AES-128) key in *Device Configuration Utility*. This forces PakBus data to be encrypted during transmission.
- Disabling HTTP or creating a .csipasswd file to secure HTTP/HTTPS (see section .csipasswd (p. 439) for more information).

- Tracking Operating System, Run, and Program signatures.
- Encrypting program files if they contain sensitive information (see CRBasic help FileEncrypt() instruction or use the CRBasic Editor File menu, Save and Encrypt option).
- Hiding program files for extra protection (see CRBasic help **FileManage()** instruction).
- Securing the physical datalogger and power supply under lock and key.
- Monitoring your datalogger for changes by tracking program and operating system signatures, as well as CPU and USR file contents.

**Warning** All security features can be subverted through physical access to the datalogger. If absolute security is a requirement, the physical datalogger must be kept in a secure location.

# 8.7.1 Vulnerabilities

While "security through obscurity" may have provided sufficient protection in the past, Campbell Scientific dataloggers increasingly are deployed in sensitive applications. Devising measures to counter malicious attacks, or innocent tinkering, requires an understanding of where systems can be compromised and how to counter the potential threat.

**Note** Older CR3000 operating systems are more vulnerable to attack than recent updates. Updates can be obtained free of charge at www.campbellsci.com.

The following bullet points outline vulnerabilities:

- LoggerNet
  - All datalogger functions and data are easily accessed via RS-232 and Ethernet using Campbell Scientific datalogger support software.

#### Telnet

- Watch IP traffic in detail. IP traffic can reveal potentially sensitive information such as FTP login usernames and passwords, and server connection details including IP addresses and port numbers.
- Watch serial traffic with other dataloggers and devices. A Modbus capable power meter is an example.
- View data in the Public and Status tables.
- View the datalogger program, which may contain sensitive intellectual property, security codes, usernames, passwords, connection information, and detailed or revealing code comments.

#### FTP

- o Send and change datalogger programs.
- Send data that have been written to a file.

## • HTTP

- Send datalogger programs.
- View table data.
- Get historical records or other files present on the datalogger drive spaces.
- o More access is given when a .csipasswd is in place, so ensure that users with administrative rights have strong log-in credentials.

# 8.7.2 Pass-Code Lockout

Pass-code lockouts (historically known in Campbell Scientific dataloggers simply as "security codes") are the oldest method of securing a datalogger. Pass-code lockouts can effectively lock out innocent tinkering and discourage wannabe hackers on all communication links. However, any serious hacker with physical access to the datalogger or to the communication hardware can, with only minimal trouble, overcome the five-digit pass-codes.

Up to three levels of lockout can be set. Valid pass codes are 1 through 65535 (0 confers no security).

**Note** Although a pass code can be set to a negative value, a positive code must be entered to unlock the CR3000. That positive code will equal 65536 + (negative security code). For example, a security code of -1111 must be entered as 64425 to unlock the CR3000.

Methods of enabling pass-code lockout security include the following:

- Settings Security(1) (p. 589), Security(2) and Security(3) registers are writable variables in the Status table wherein the pass codes for security levels 1 through 3 are written, respectively.
- CR1000KD Keyboard/Display settings
- Device Configuration Utility (DevConfig) Security passwords 1 through 3 are set on the **Deployment** tab.
- SetSecurity() instruction SetSecurity() is only executed at program compile time. It may be placed between the BeginProg and Scan() instructions.

**Note** Deleting **SetSecurity()** from a CRBasic program is not equivalent to **SetSecurity(0,0,0)**. Settings persist when a new program is downloaded that has no **SetSecurity()** instruction.

**Level 1** must be set before **Level 2**. **Level 2** must be set before **Level 3**. If a level is set to 0, any level greater than it will be set to 0. For example, if level 2 is 0 then level 3 is automatically set to 0. Levels are unlocked in reverse order: level 3 before level 2, level 2 before level 1. When a level is unlocked, any level greater than it will also be unlocked, so unlocking level 1 (entering the **Level 1** security code) also unlocks levels 2 and 3.

Functions affected by each level of security are:

- Level 1 Collecting data, setting the clock, and setting variables in the Public table are unrestricted, requiring no security code. If Security1 code is entered, read/write values in the Status table can be changed, and the datalogger program can be changed or retrieved.
- Level 2 Data collection is unrestricted, requiring no security code. If the user enters the **Security2** code, the datalogger clock can be changed and variables in the **Public** table can be changed.
- Level 3 When this level is set, all communication with the datalogger is prohibited if no security code is entered. If Security3 code is entered, data can be viewed and collected from the datalogger (except data suppressed by the TableHide() instruction in the CRBasic program). If Security2 code is entered, data can be collected, public variables can be set, and the clock can be set. If Security1 code is entered, all functions are unrestricted.

## 8.7.3 Passwords

Passwords are used to secure IP based communications. They are set in various comms schemes with the .csipasswd file, CRBasic PakBus instructions, CRBasic TCP/IP instructions, and in CR3000 settings.

## 8.7.3.1 .csipasswd

The .csipasswd file is a file created and edited through *DevConfig (p. 113)*, and which resides on the CPU: drive of the CR3000. It contains credentials (usernames and passwords) required to access datalogger functions over IP comms. See CRBasic Editor Help subject Web Service API for details concerning the .csipasswd file.

#### 8.7.3.2 PakBus Instructions

The following CRBasic PakBus instructions have provisions for password protection:

ModemCallBack()

- SendVariable()
- SendGetVariables()
- SendFile()
- GetVariables()
- GetFile()
- GetDataRecord()

## 8.7.3.3 TCP/IP Instructions

The following CRBasic instructions that service CR3000 IP capabilities have provisions for password protection:

- EMailRecv()
- EMailSend()
- FTPClient()

# 8.7.3.4 Settings — Passwords

Settings, which are accessible with *DevConfig* (p. 113), enable the entry of the following passwords:

- PPP Password
- PakBus/TCP Password
- FTP Password
- TLS Password (Transport Layer Security (TLS) Enabled)
- TLS Private Key Password
- AES-128 Encrypted PakBus Communication Encryption (p. 441) Key

See the section Status, Settings, and DTI (Registers (p. 117)) for more information.

# 8.7.4 File Encryption

Encryption is available for CRBasic program files and provides a means of securing proprietary code or making a program tamper resistant. .CR<X> files, or files specified by the **Include()** instruction, can be encrypted. The CR3000 decrypts program files on the fly. While other file types can be encrypted, no tool is provided for decryption.

The CRBasic Editor encryption facility (Menus | File | Save and Encrypt) creates an encrypted copy of the original file in PC memory. The encrypted file is named after the original, but the name is appended with "\_enc". The original file remains intact. The FileEncrypt() instruction encrypts files already in CR3000 memory. The encrypted file overwrites and takes the name of the original. The Encryption() instruction encrypts the contents of a file with AES128 encryption, and decrypts a file created with encryption provide the correct encryption key is entered.

One use of file encryption may be to secure proprietary code but make it available for copying.

# 8.7.5 Communication Encryption

PakBus is the CR3000 root communication protocol. By encrypting certain portions of PakBus communications, a high level of security is achieved.

# 8.7.6 Hiding Files

The option to hide CRBasic program files provides a means, apart from or in conjunction with file encryption, of securing proprietary code, preventing it from being copied, or making it tamper resistant. .CR<X> files, or files specified by the **Include()** instruction, can be hidden using the **FileHide()** instruction. The CR3000 can locate and use hidden files on the fly, but a listing of the file or the file name are not available for viewing. See *File Management in CR3000 Memory (p. 456)*.

# 8.7.7 Signatures

Recording and monitoring system and program signatures are important components of a security scheme. Read more about use of signatures in *Programming to Use Signatures (p. 179)* and *Signatures: Example Programs (p. 190)*.

# 8.7.8 Read Only Variables

The following example of variable declaration demonstrates how to display a value in numeric display (*Connect* or *RTMC*) or on a CR1000KD but not allow the person viewing it to make changes:

- Var can be viewed and changed
- Reg() and Coil() can only be viewed
- The CRBasic program can read from and write to all variables

```
Public Var
Public Reg(4), Coil(4) as Boolean
ReadOnly Reg, Coil
```

# 8.8 Memory — Details

#### Related Topics:

- Memory Overview (p. 93)
- Memory Details (p. 442)
- Data Storage Devices List (p. 613)
- TABLE: Info Tables and Settings: Memory (p. 575)

# 8.8.1 Storage Media

CR3000 memory consists of four non-volatile storage media:

- Internal battery-backed SRAM
- Internal flash
- Internal serial flash
- External flash (optional flash USB: drive)
- External CompactFlash optional CF card and module (CRD: drive) (p. 613)

Table CR3000 Memory Allocation (p. 442) and table CR3000 SRAM Memory (p. 443, http://www.) illustrate the structure of CR3000 memory around these media. The CR3000 uses and maintains most memory features automatically. However, users should periodically review areas of memory wherein data files, CRBasic program files, and image files reside. See section File Management in CR3000 Memory (p. 456) for more information.

By default, final-storage memory (memory for stored data) is organized as ring memory. When the ring is full, oldest data are overwritten by newest data. The **DataTable()** instruction, however, has an option to set a data table to *Fill and Stop*.

## TABLE 109: CR3000 Memory Allocation

# Memory Sector

Main

Battery-Backed SRAM1 Status.MemorySize (p. 585) Status.MemoryFree (p. 585)

#### Comments

- OS variables
- See following table CR3000 SRAM Memory (p. 443, http://www.) for detail.

# Operating System Flash Memory<sup>2</sup>

- Operating system
- Serial number
- Board revision
- Boot code
- Erased when loading new OS. Boot code erased only if changed.

#### TABLE 109: CR3000 Memory Allocation

Internal Serial Flash3 Status.CPUDriveFree (p. 579)

- Device settings PakBus address and settings, station name. Rebuilt when a setting changes.
- CPU:drive program files, field calibration files, other files not frequently overwritten. When a program is compiled and run, it is copied here automatically for loading on subsequent power-ups. Files accumulate until deleted with **File Control** (p. 539) or the **FilesManage()** instruction. Use USR: drive to store other file types.
- FAT32 file system
- Limited write cycles (100,000)
- Slow serial access

External Flash (Optional)

USB: drive

*USB:* drive (p. 613) — SC115: connects to CR3000 by CS I/O, connects to PC by USB port. FAT32. See appendix *External Memory – List (p. 613)*. Holds program files. Holds a copy of requested final-memory table data as files when **TableFile()** instruction is used. USB: data can be retrieved from the storage device with *Windows Explorer*. USB: drive can facilitate the use of *Powerup.ini (p. 460)*.

External
CompactFlash (p. 532)
(Optional)

CRD: drive (p. 613) — FAT32 recommended. Holds program files. Holds a copy of final-storage table data as files when TableFile() instruction with Option 64 (p. 218) is used (replaces CardOut()). When data are requested by a PC, data first are provided from SRAM. If the requested records have been overwritten in SRAM, data are sent from CRD:. Alternatively, CRD: data can be retrieved in a binary format using datalogger support software File Control (p. 456). Binary files are converted using CardConvert software. 10% of card memory (whichever is smaller) is reserved for program storage. Memory card can facilitate the use of Powerup.ini (p. 460).

<sup>&</sup>lt;sup>1</sup> See TABLE: CR3000 SRAM Memory (p. 443, http://www.)

<sup>&</sup>lt;sup>2</sup> Flash is rated for > 1 million overwrites.

<sup>&</sup>lt;sup>3</sup> Serial flash is rated for 100,000 overwrites (50,000 overwrites on 128 kB units). CRBasic program functions that overwrite memory should use the CRD: or USR: drives to minimize wear of the CPU: drive.

#### TABLE 110: CR3000 SRAM Memory

Use

# Static Memory Operating Settings and Properties CRBasic Program Operating Memory Variables & Constants Final-Storage Memory Communication Memory 1 Communication Memory 2 USR: drive $\leq$ 3.6 MB (4 MB Mem) $\leq 1.5 \text{ MB (2 MB Mem)}$

#### **Comments**

Operational memory used by the operating system. Rebuilt at power-up, program re-compile, and watchdog events.

"Keep" (p. 543) memory. Stores settings such as PakBus address, station name, beacon intervals, neighbor lists, etc. Also stores dynamic properties such as the routing table, communication timeouts, etc.

Stores the currently compiled and running user program. This sector is rebuilt on power-up, recompile, and watchdog events.

Stores variables used by the CRBasic program. These values may persist through power-up, recompile, and watchdog events if the **PreserveVariables** instruction is in the running program.

Stores data. Fills memory remaining after all other demands are satisfied. Configurable as ring or fill-and-stop memory. Compile error occurs if insufficient memory is available for user-allocated data tables. Given lowest priority in SRAM memory allocation.

Construction and temporary storage of PakBus packets.

Constructed Routing Table: list of known nodes and routes to nodes. Routers use more space than leaf nodes because routes to neighbors must be remembered. Increasing the PakBusNodes field in the **Status** table will increase this allocation.

Optionally allocated. Holds image files. Holds a copy of final-storage memory when **TableFile()** (p. 218) instruction used. Provides memory for **FileRead()** and **FileWrite()** operations. Managed in *File Control* (p. 456). Status reported in **Status** table fields **USRDriveSize** (p. 592) and **USRDriveFree** (p. 592).

TABLE III: CR3000 Memory Drives		
Drive	Recommended File Types	
CPU: <sup>1</sup>	cr3, .CAL	
USR:1	cr3, .CAL, images	
USB:	.DAT	
CRD: <sup>2</sup>	Principal use is to expand <i>final-storage memory (p. 539)</i> , but it is also used to store .JPG, cr3, and .DAT	

**TABLE 111: CR3000 Memory Drives** 

<sup>1</sup>The CPU: and USR: drives use the FAT32 file system. There is no limit, beyond practicality and available memory, to the number of files that can be stored. While a FAT file system is subject to fragmentation, performance degradation is not likely to be noticed since the drive has a relatively small amount of solid state RAM and so is accessed very quickly.

<sup>2</sup>The CRD: drive is a CompactFlash card attached to the CR3000 by use of a *CF card storage module (p. 613)*. Cards should be formatted as FAT32 for

# 8.8.1.1 Memory Drives — On-Board

optimal performance.

Data-storage drives are listed in table *CR3000 Memory Drives* (p. 444). Data-table SRAM and the CPU: drive are automatically partitioned for use in the CR3000. The USR: drive can be partitioned as needed. The USB: drive is automatically partitioned when a Campbell Scientific *mass-storage device* (p. 613) is connected. The CRD: drive is automatically partitioned when a memory card is installed.

#### 8.8.1.1.1 Data Table SRAM

Primary storage for measurement data are those areas in SRAM allocated to data tables as detailed in table *CR3000 SRAM Memory* (p. 443, http://www.). Measurement data can be also be stored as discrete files on USR: or USB: by using **TableFile()** instruction.

The CR3000 can be programmed to store each measurement or, more commonly, to store processed values such as averages, maxima, minima, histograms, FFTs, etc. Data are stored periodically or conditionally in data tables in SRAM as directed by the CRBasic program (see *Program Structure* (p. 129)). The **DataTable()** instruction allows the size of a data table to be programmed. Discrete data files are normally created only on a PC when data are retrieved using *datalogger support software* (p. 91).

Data are usually erased from this area when a program is sent to the CR3000. However, when using support software **File Control** menu **Send** (p. 539) command or *CRBasic Editor* **Compile, Save and Send** (p. 534) command, options are available to preserve data when downloading programs.

## 8.8.1.1.2 CPU: Drive

CPU: is the default drive on which programs and calibration files are stored. It is formatted as FAT32. Do not store data on CPU: or premature failure of memory will probably result.

## 8.8.1.1.3 USR: Drive

SRAM can be partitioned to create a FAT32 USR: drive, analogous to partitioning a second drive on a PC hard disk. Certain types of files are stored to USR: to reserve limited CPU: memory for datalogger programs and calibration files. Partitioning also helps prevent interference from data table SRAM. USR: is configured using *DevConfig* settings or **SetStatus()** instruction in a CRBasic program. Partition USR: drive to at least 11264 bytes in 512-byte increments. If the value entered is not a multiple of 512 bytes, the size is rounded up. Maximum size of USR: 2990000 bytes.

USR: is not affected by program recompilation or formatting of other drives. It will only be reset if the USR: drive is formatted, a new operating system is loaded, or the size of USR: is changed. USR: size is changed manually by accessing it in the **Status** table or by loading a CRBasic program with a different USR: drive size entered in a **SetStatus()** or **SetSetting()** instruction. See *CRBasic Program — Setup Tools (p. 118)*.

Measurement data can be stored on USR: as discrete files by using the **TableFile()** instruction. Table *TableFile()* Instruction Data File Formats (p. 449) describes available data-file formats.

**Note** Placing an optional USR: size setting in the CRBasic program overrides manual changes to USR: size. When USR: size is changed manually, the CRBasic program restarts and the programmed size for USR: takes immediate effect.

The USR: drive holds any file type within the constraints of the size of the drive and the limitations on filenames. Files typically stored include image files from cameras (see *Cameras — List (p. 610)*), certain configuration files, files written for FTP retrieval, HTML files for viewing with web access, and files created with the **TableFile()** instruction. Files on USR: can be collected using *datalogger support software (p. 91)* **Retrieve (p. 539)** command, or automatically using the datalogger support software **Setup File Retrieval** tab functions.

Monitor use of available USR: memory to ensure adequate space to store new files. FileManage() command can be used in the CRBasic program to remove files. Files also can be removed using datalogger support software **Delete** (p. 539) command.

Two **Status** table fields monitor use and size of the USR: drive. Bytes remaining are indicated in field **USRDriveFree**. Total size is indicated in field **USRDriveSize**. Memory allocated to USR: drive, less overhead for directory use, is shown in datalogger support software **File Control** (p. 539) window.

#### 8.8.1.1.4 USB: Drive

USB: drive uses *Flash* (p. 540) memory on a Campbell Scientific mass storage device. See *Mass Storage Devices* — *List* (p. 613). Its primary purpose is the storage of ASCII data files. Measurement data can be stored on USB: as discrete files by using the **TableFile()** instruction. See *Table: TableFile()* Instruction Data File Formats (p. 449).

**Caution** Only remove mass-storage devices when the LED is not flashing or lit.

Do the following when using Campbell Scientific mass-storage devices:

- Format as FAT32
- Connect to the CR3000 CS I/O port
- Remove only when inactive or data corruption may result

# 8.8.1.2 Memory Card (CRD: Drive)

### Related Topics:

- Memory Card (CRD: Drive) Overview (p. 81)
- Memory Card (CRD: Drive) Details (p. 447)
- Memory Cards and Record Numbers (p. 453)
- Data Output: Writing High-Frequency Data to Memory Cards (p. 217)
- File System Errors (p. 464)
- Data Storage Devices List (p. 613)
- Data File Format Examples (p. 450)
- Data Storage Drives Table (p. 444)

The CRD: drive uses CompactFlash (CF) card memory cards exclusively. Its primary purpose is the storage of data files in a compact binary format. The CR3000 requires addition of a peripheral card slot. See appendix *Data Storage Devices* — *List (p. 613)*. Purchasing industrial grade memory cards from Campbell Scientific is recommended. Use of consumer grade cards substantially increases the risk of data loss.

**Caution** Use care when inserting or removing memory cards. Removing a card from the module while it is being written to can cause data corruption or damage the card. Before removing the card, press the eject button and wait for the LED to indicate that the card is disabled. You then have 15 seconds to pull the card before normal operations resume. To prevent losing data, collect data from the memory card before sending a program to the datalogger. When a program is sent to the datalogger all data on the memory card may be erased.

Campbell Scientific CF card modules connect to the CR3000 peripheral port. Each has a slot for Type I or Type II CF cards .A maximum of 30 data tables can be created on a memory card.

**Note** CardConvert software, included with mid- and top-level datalogger support software (p. 614), converts binary card data to the standard Campbell Scientific data format.

When a data table is sent to a memory card, a data table of the same name in SRAM is used as a buffer for transferring data to the card. When the card is present, the **Status** table will show the size of the table on the card. If the card is removed, the size of the table in SRAM is shown.

When a new program is compiled that sends data to the memory card, the CR3000 checks if a card is present and if the card has adequate space for the data tables. If no card is present, or if space is inadequate, the CR3000 will warn that the card is not being used. However, the CRBasic program runs anyway and data are stored to SRAM. When a card is inserted later, data accumulated in the SRAM table are copied to the card.

# Formatting Memory Cards

The CR3000 accepts memory cards formatted as FAT16 or FAT32; however, FAT32 is recommended. Otherwise, some functionality, such as the ability to manage large numbers of files (>254) is lost. Older CR3000 operating systems formatted cards as FAT16 or FAT32. Newer operating systems always format cards as FAT32.

Because of the way the FAT32 card format works, you can avoid long CR3000 compile times with a freshly formatted card by first formatting the new card on a PC, then copy a small file to the card from the PC, and then delete the file with the PC. When the small file is copied to the card, the PC updates a sector on the card that which allows the CR3000 program to compile faster. This only needs to be done once when the card is formatted. If you have the CR3000 update the card sector, the first CR3000 program compile with the card can take as long as 30 minutes. After that, compile times will be normal.

TABLE 112: Memory Card States				
CardStatus	CardBytesFree	CompileResults	LED	Status
Card OK	>0			Formatted card inserted, powered up.
	>0		Solid green for 20 s	Card still inserted, but removal button has been pressed.
	-1			CFM100/NL115 removed while logger is running (do not do this).
	>0			Program contains CardOut() or TableFile() with <i>Option 64</i> . Card inserted before power up.
No Card Present	-1			Powered up, no card present.
	-1			Card ejected / physically removed
	-1			Logger started without CFM100 / NL115.
<ul><li>No Card Present</li><li>Card Not Being Used</li></ul>	-1	Compact Flash Module not detected: CardOut not used.		Program contains <b>CardOut()</b> or <b>TableFile()</b> with <b>Option 64</b> . CFM100/NL115 not attached at power up.
	-1		Solid orange	Program contains CardOut() or TableFile() with <i>Option 64</i> . Card not present at power up.
Initializing Table Files!			Dim / fast flashing orange	Program contains CardOut() or TableFile() with <i>Option 64</i> . Card not present at power up. Card inserted after power up. If all goes well, CardStatus will change to Card OK and CardBytesFree (p. 578) will be >0.

# 8.8.2 Data File Formats

Data file format options are available with the **TableFile()** instruction. Time-series data have an option to include header, time stamp and record number. See the table *TableFile() Instruction Data File Formats (p. 449)*. For a format to be compatible with *datalogger support software (p. 91)* graphing and reporting tools, header, time stamps, and record numbers are usually required. Fully compatible formats are indicated with an asterisk. A more detailed discussion of data-file formats is available in the Campbell Scientific publication *LoggerNet Instruction Manual*, which is available at *www.campbellsci.com*.

TABLE 113: TableFile() Instruction Data File Formats				
	_	El	ements Include	ed
TableFile() Format Option	Base File Format	Header Information	Time Stamp	Record Number
$\boldsymbol{\varrho}^1$	TOB1	✓	✓	✓
1	TOB1	✓	✓	

<b>TABLE 113:</b>	TableFile() I	nstruction Data	File Formats	
<b>-</b> ::	_	El	ements Include	ed
TableFile() Format Option	Base File Format	Header Information	Time Stamp	Record Number
2	TOB1	✓		✓
3	TOB1	✓		
4	TOB1		✓	✓
5	TOB1		✓	
6	TOB1			✓
7	TOB1			
<b>8</b> <sup>1</sup>	TOA5	✓	✓	✓
9	TOA5	✓	✓	
10	TOA5	✓		✓
11	TOA5	✓		
12	TOA5		✓	✓
13	TOA5		✓	
14	TOA5			✓
15	TOA5			
<b>16</b> <sup>1</sup>	CSIXML	✓	✓	✓
17	CSIXML	✓	✓	
18	CSIXML	✓		✓
19	CSIXML	✓		
<b>32</b> <sup>1</sup>	CSIJSON	✓	✓	✓
33	CSIJSON	✓	✓	
34	CSIJSON	✓		✓
35	CSIJSON	<b>✓</b>		
<b>64</b> <sup>2</sup>	TOB3			

<sup>&</sup>lt;sup>1</sup>Formats compatible with *datalogger support software* (p. 91) data-viewing and graphing utilities

# Data File Format Examples

TOB1

TOB1 files may contain an ASCII header and binary data. The last line in the example contains cryptic text which represents binary data.

<sup>&</sup>lt;sup>2</sup>See Writing High-Frequency Data to Memory Cards (p. 217) for more information on using option 64.

#### Example:

```
"TOB1","11467","CR1000","11467","CR1000.Std.20","CPU:file format.CR1","61449","Test"
"SECONDS","NANOSECONDS","RECORD","battfivoltfiMin","PTemp"
"SECONDS","NANOSECONDS","RN","",""
"","","","Min","Smp"
"ULONG","ULONG","FP2","FP2"
}Ÿp' E1HŒŸp' E1H-Ÿp' E1HaŸp' E1HI
```

#### TOA5

TOA5 files contain ASCII (p. 530) header and comma-separated data.

#### Example:

```
"TOA5","11467","CR1000","11467","CR1000.Std.20","CPU:file format.CR1","26243","Test"
"TIMESTAMP","RECORD","battfivoltfiMin","PTemp"
"TS","RN","",""
"","","Min","Smp"
"2010-12-20 11:31:30",7,13.29,20.77
"2010-12-20 11:31:45",8,13.26,20.77
"2010-12-20 11:32:00",9,13.29,20.8
```

#### **CSIXML**

CSIXML files contain header information and data in an XML (p. 563) format.

## Example:

```
<?xml version="1.0" standalone="yes"?>
<csixml version="1.0">
<head>
 <environment>
   <station-name>11467</station-name>
   <table-name>Test</table-name>
   <model>CR1000</model>
   <serial-no>11467</serial-no>
   <os-version>CR1000.Std.20</os-version>
   <dld-name>CPU:file format.CR1</dld-name>
 </environment>
 <fields>
   <field name="battfivoltfiMin" type="xsd:float" process="Min"/>
   <field name="PTemp" type="xsd:float" process="Smp"/>
 </fields>
</head>
   <r time="2010-12-20T11:37:45" no="10"><v1>13.29</v1><v2>21.04</v2></r>
   <r time="2010-12-20T11:38:00" no="11"><v1>13.29</v1><v2>21.04</v2></r>
   <r time="2010-12-20T11:38:15" no="12"><v1>13.29</v1><v2>21.04</v2></r>
 </data>
</csixml>
```

#### **CSIJSON**

CSIJSON files contain header information and data in a JSON (p. 543) format.

## Example:

```
"signature": 38611, "environment": {"stationfiname": "11467", "tablefiname": "Test", "model": "CR1000", "serialfino": "11467", "osfiversion": "CR1000.Std.21.03", "progfiname": "CPU:file format.CR1"}, "fields": [{"name": "battfivoltfiMin", "type": "xsd:float", "process": "Smp"}]}, "data": [{"time": "2011-01-06T15:04:15", "no": 0, "vals": [13.28,21.29]}, {"time": "2011-01-06T15:04:45", "no": 1, "vals": [13.28,21.29]}, {"time": "2011-01-06T15:04:45", "no": 2, "vals": [13.28,21.29]}, {"time": "2011-01-06T15:05:00", "no": 3, "vals": [13.28,21.29]}]}
```

#### Data File Format Elements

#### Header

File headers provide metadata that describe the data in the file. A TOA5 header contains the metadata described below. Other data formats contain similar information unless a non-header format option is selected in the **TableFile()** instruction in the CR3000 CRBasic program.

#### Line 1 – Data Origins

Includes the following metadata series: file type, station name, CR3000 model name, CR3000 serial number, OS version, CRBasic program name, program signature, data-table name.

#### Line 2 – Data Field Names

Lists the name of individual data fields. If the field is an element of an array, the name will be followed by a comma-separated list of subscripts within parentheses that identifies the array index. For example, a variable named "values" that is declared as a two-by-two array, i.e.,

```
Public Values(2,2)
```

will be represented by four field names: "values(1,1)", "values(1,2)", "values(2,1)", and "values(2,2)". Scalar (non-array) variables will not have subscripts.

#### Line 3 – Data Units

Includes the units associated with each field in the record. If no units are programmed in the CR3000 CRBasic program, an empty string is entered for that field.

#### Line 4 – Data-Processing Descriptors

Entries describe what type of processing was performed in the CR3000 to produce corresponding data, e.g., Smp indicates samples, Min indicates minima. If there is no recognized processing for a field, it is assigned an empty string. There will be one descriptor for each field name given on Header Line 2.

## Record Element 1 – Timestamp

Data without timestamps are usually meaningless. Nevertheless, the **TableFile()** instruction optionally includes timestamps in some formats.

#### Record Element 2 – Record Number

Record numbers are optionally provided in some formats as a means to ensure data integrity and provide an up-count data field for graphing operations. The maximum record number is &hffffffff (a 32-bit number), then the record number sequence restarts at zero. The CR3000 reports back to the datalogger support software 31 bits, or a maximum of &h7fffffff, then it restarts at 0. For example, if the record number increments once a second, restart at zero will occur about once every 68 years (yes, years).

# 8.8.3 Memory Cards and Record Numbers

#### Related Topics:

- Memory Card (CRD: Drive) Overview (p. 81)
- Memory Card (CRD: Drive) Details (p. 447)
- Memory Cards and Record Numbers (p. 453)
- Data Output: Writing High-Frequency Data to Memory Cards (p. 217)
- File System Errors (p. 464)
- Data Storage Devices List (p. 613)
- Data File Format Examples (p. 450)
- Data Storage Drives Table (p. 444)

The number of records in a data table when CardOut() or TableFile() with *Option 64* is used in a data-table declaration is governed by these rules:

- Memory cards (CRD: drive) and internal memory (CPU) keep copies of data tables in binary TOB3 format. Collectible numbers of records for both CRD: and CPU are reported in **DataRecordSize** entries in the **Status** table.
- 2. In the table definitions advertised to *datalogger support software* (p. 91), the CR3000 advertises the greater of the number of records recorded in the **Status** table, if the tables are not fill-and-stop.
- 3. If either data area is flagged for fill-and-stop, then whichever area stops first causes all final-data storage to stop, even if there is more space allocated in the non-stopped area, and so limiting the number of records to the minimum of the two areas if both are set for fill-and-stop.
- 4. When CardOut() or TableFile() with *Option 64* is present, whether or not a card is installed, the CPU data-table space is allocated a minimum of about 5 KB so that there is at least a minimum buffer space for storing the data to CRD: (which occurs in the background when the CR3000 has a chance to copy data onto the card). So, for example, a data table consisting of one fourbyte sample, not interval driven, 20 bytes per record, including the 16 byte TOB3 header/footer, 258 records are allocated for the internal memory for any program that specifies less than 258 records (again only in the case that CardOut() or TableFile() with *Option 64* is present). Programs that specify more than 258 records report what the user specified with no minimum.

- 5. When CardOut() or TableFile() with *Option 64* is used but the card is not present, zero bytes are reported in the **Status** table.
- 6. In both the internal memory and memory card data-table spaces, about 2 KB of extra space is allocated (about 100 extra records in the above example) so that for the ring memory the possibility is minimized that new data will overwrite the oldest data when datalogger support software tries to collect the oldest data at the same time. These extra records are not reported in the **Status** table and are not reported to the datalogger support software and therefore cannot be collected.
- 7. If the CardOut() or TableFile() with Option 64 instruction is set for fill-andstop, all the space reserved for records on the card is recorded before the writing of final-data to memory stops, including the extra 2 kB allocated to alleviate the conflict of storing the newest data while reading the oldest when the area is not fill-and-stop, or is ringing around. Therefore, if the CPU does not stop earlier, or is ring and not fill-and-stop, then more records will be stored on the card than originally allocated, i.e., about 2 KB worth of records, assuming no lapses. At the point the writing of final-data stops, the CR3000 recalculates the number of records, displays them in the Status table, and advertises a new table definition to the datalogger support software. Further, if the table is storing relatively fast, there might be some additional records already stored in the CPU buffer before final-data storage stops altogether, resulting in a few more records than advertised able to be collected. For example — on a CR3000 storing a four-byte value at a 10 ms rate, the CPU not set to fill-and-stop, CRD: set to fill-and-stop after 500 records — after final-data storage stopped, CRD: had 603 records advertised in the **Status** table (an extra 103 due to the extra 2 KB allocated for ring buffering), but 608 records could be collected since it took 50 ms, or 5 records, to stop the CPU from storing its 5 records beyond when the card was stopped.
- 8. Note that only the CRD: drive will keep storing until all its records are filled; the CPU: drive will stop when the programmed number of records are stored.
- 9. Note that the **O** command in the terminal mode helps to visualize more precisely what CPU: drive and the CRD: drive are doing, actual size allocated, where they are at the present, etc.

# 8.8.4 Resetting the CR3000

A reset is referred to as a "memory reset." Be sure to backup the current CR3000 configuration before a reset in case you need to revert to the old settings.

The following features are available for complete or selective reset of CR3000 memory:

- Full memory reset
- Program send reset
- Manual data-table reset
- Formatting memory drives

# 8.8.4.1 Full Memory Reset

Full memory reset occurs when an operating system is sent to the CR3000 using *DevConfig* or when entering **98765** in the **Status** table field **FullMemReset** (p. 581). A full memory reset does the following:

- Clears and formats CPU: drive (all program files erased)
- Clears SRAM data tables
- Clears **Status**-table elements
- Restores settings to default
- Initializes system variables
- Clears communication memory

Full memory reset does not affect the CRD: drive directly. Subsequent user program uploads, however, can erase CRD:.

Operating systems can also be sent using the program **Send** feature in *datalogger* support software (p. 91). A full reset does not occur in this case. Beginning with CR3000 operating system v.16, settings and fields in the **Status** table are preserved when sending a subsequent operating system by this method; data tables are erased. Rely on this feature only with an abundance of caution when sending an OS to CR3000s in remote, expensive to get to, or difficult-to-access locations.

# 8.8.4.2 Program Send Reset

Final-storage (p. 539) data are erased when user programs are uploaded, unless preserve / erase data options are used. Preserve / erase data options are presented when sending programs using File Control Send (p. 539) command and CRBasic Editor Compile, Save and Send (p. 534). See Preserving Data at Program Send (p. 180) for a more-detailed discussion of preserve / erase data at program send.

## 8.8.4.3 Manual Data-Table Reset

Data-table memory is selectively reset from

- Support software **Station Status** (p. 557) command
- CR1000KD Keyboard/Display: Data | Reset Data Tables

# 8.8.4.4 Formatting Drives

CPU:, USR:, USB:, and CRD: drives can be formatted individually. Formatting a drive erases all files on that drive. If the currently running user program is found on the drive to be formatted, the program will cease running and any SRAM data associated with the program are erased. Drive formatting is performed through datalogger support software *Format (p. 539)* command.

# 8.8.5 File Management in CR3000 Memory

As summarized in table *File Control Functions* (p. 456), files in CR3000 memory (program, data, CAL, image) can be managed or controlled with *datalogger support software* (p. 91), the CR1000KD keyboard/display (see *Keyboard Display* — *Details* (p. 483)), *Web API* (p. 475, p. 475), or *CoraScript* (p. 533). Use of *CoraScript* is described in the *LoggerNet* software manual, which is available at *www.campbellsci.com*. More information on file attributes that enhance datalogger security, see the *Security* — *Overview* (p. 88) section.

TABLE 114: File Control Functions		
File Control Functions	Accessed Through	
Sending programs to the CR3000	Program Send <sup>1</sup> , File Control Send <sup>2</sup> , DevConfig <sup>3</sup> , CR1000KD keyboard/display, or powerup.ini with a Campbell Scientific mass storage device or memory card <sup>4,5</sup> , web API (p. 475) HTTPPut (Sending a File to a Datalogger)	
Setting program file attributes. See File Attributes (p. 457)	File Control <sup>2</sup> ; power-up with Campbell Scientific mass storage device or memory card <sup>5</sup> , FileManage() instruction <sup>6</sup> , web API FileControl	
Sending an OS to the CR3000. Reset CR3000 settings.	DevConfig <sup>3</sup> Send OS tab; DevConfig <sup>3</sup> File Control tab; Campbell Scientific mass storage device or memory card <sup>5</sup>	
Sending an OS to the CR3000. Preserve CR3000 settings.	Send <sup>1</sup> ; DevConfig <sup>3</sup> File Control tab; power-up with Campbell Scientific mass storage device or memory card with default.cr3 file <sup>5</sup> , web API HTTPPut (Sending a File to a Datalogger)	
Formatting CR3000 memory drives	File Control <sup>2</sup> , power-up with Campbell Scientific mass storage device or memory card <sup>5</sup> , web API FileControl	
Retrieving programs from the CR3000	Retrieve <sup>7</sup> , File Control <sup>2</sup> , keyboard with Campbell Scientific mass storage device or memory card <sup>4</sup> , web API NewestFile	
Prescribes the disposition (preserve or delete) of old data files on Campbell Scientific mass storage device or memory card	File Control <sup>2</sup> , power-up with Campbell Scientific mass storage device or memory card <sup>5</sup> , web API (p. 475) FileControl	
Deleting files from memory drives	File Control <sup>2</sup> , power-up with Campbell Scientific mass storage device or memory card <sup>5</sup> , web API FileControl	

TABLE 114: File Control Functions	
File Control Functions	Accessed Through
Stopping program execution	File Control <sup>2</sup> , web API FileControl
Renaming a file	FileRename() <sup>6</sup>
Time-stamping a file	FileTime() <sup>6</sup>
List files	File Control <sup>2</sup> , FileList() <sup>6</sup> , web API ListFiles
Create a data file from a data table	TableFile() <sup>6</sup> , Keyboard/display: Data   Final Storage Data   Copy Data To CRD: <sup>8</sup>
JPEG files manager	CR1000KD Keyboard/Display, LoggerNet   PakBusGraph, web API NewestFile
Hiding files	Web API FileControl
Encrypting files	Web API FileControl
Editing programs	CR1000KD Keyboard/Display
Abort program on power-up	Hold DEL down on datalogger keypad

<sup>&</sup>lt;sup>1</sup> Datalogger support software (p. 91) Program Send (p. 550) command

## 8.8.5.1 File Attributes

A feature of program files is the file attribute. Table CR3000 File Attributes (p. 458) lists available file attributes, their functions, and when attributes are typically used. For example, a program file sent with the support software **Program Send** (p. 550) command, runs a) immediately ("run now"), and b) when power is cycled on the CR3000 ("run on power-up'). This functionality is invoked because **Program Send** sets two CR3000 file attributes on the program file, i.e., **Run Now** and **Run on Power-up**. When together, **Run Now** and **Run on Power-up** are tagged as **Run Always**.

<sup>&</sup>lt;sup>2</sup> Datalogger support software File Control (p. 539) utility

<sup>&</sup>lt;sup>3</sup> Device Configuration Utility (DevConfig) (p. 113) software

<sup>&</sup>lt;sup>4</sup> Manual with Campbell Scientific mass storage device or memory card. See *Data Storage (p. 445)* 

<sup>&</sup>lt;sup>5</sup> Automatic with Campbell Scientific mass storage device or memory card and Powerup.ini. See *Power-up (p. 460)* <sup>6</sup> CRBasic instructions (commands). See data table declarations, *File Management (p. 456)*, and *CRBasic Editor* 

<sup>&</sup>lt;sup>6</sup> CRBasic instructions (commands). See data table declarations, *File Management (p. 456)*, and *CRBasic Editor Help* 

<sup>&</sup>lt;sup>7</sup> Datalogger support software **Retrieve** (p. 539) command

<sup>&</sup>lt;sup>8</sup> Not intended to copy tables already written to the card. Allow the copy of all other tables to either SC115 or card. A simple data copy, no format choice, number or records choice etc. Format will be TOA5 with \_toa5 appended to table name upon successful transfer. You can copy individual files or select the All Tables option (again, this is all tables not already written to the card, so no CardOut() tables or tables that have already been written via TableFile()). Keep in mind toa5 can take a bit to transfer if there is a large amount of data. It is important not to remove the card or the SC115 until the red LED that indicates file writing has stopped flashing. Once the LED has stopped flashing, you can use File Control or remove the card/SC115 to look for the appropriate files with \_toa5.

**Note** Activation of the run-on-power-up file can be prevented by holding down the **Del** key on the CR1000KD Keyboard/Display while the CR3000 is powering up.

TABLE 115: CR3000 File Attributes			
Attribute	Function	Program Send Option that Sets the Attribute	
Run Always (run on power- up + run now)	Runs now and on power-up.	a) Send (p. 539) <sup>1</sup> b) File Control <sup>2</sup> with Run Now and Run on Power-up selected. c) Campbell Scientific mass storage device or memory card power-up <sup>3</sup> using powerup.ini commands 1 and 13 (see table <i>Powerup.ini Commands (p. 462)</i> ).	
Run on Power-up	Runs only on power-up	a) File Control <sup>2</sup> with Run on Power-up selected. b) Campbell Scientific mass storage device or memory card power-up <sup>3</sup> using powerup.ini command 2 (see table <i>Powerup.ini Commands (p. 462)</i> ).	
Run Now	Runs only when file sent to CR3000	a) File Control <sup>2</sup> with Run Now checked. b) Campbell Scientific mass storage device or memory card power-up <sup>3</sup> using powerup.ini commands 6 & 14 (see table Powerup.ini Commands (p. 462)). However, if the external-storage device remains connected, the program loads again from the external-storage device.	

<sup>&</sup>lt;sup>1</sup>Support software program **Send** (p. 539) command. See software Help.

## 8.8.5.2 Files Manager

```
FilesManager := { "(" pakbus-address "," name-prefix "," number-files ")" }.
pakbus-address := number. ; 0 < number < 4095
name-prefix := string.
number_files := number. ; 0 <= number < 10000000</pre>
```

This setting specifies the numbers of files of a designated type that are saved when received from a specified node. There can be up to four such settings. The files are renamed by using the specified file name optionally altered by a serial number inserted before the file type. This serial number is used by the datalogger to know which file to delete after the serial number exceeds the specified number of files to retain. If the number of files is 0, the serial number is not inserted. A

<sup>&</sup>lt;sup>2</sup>Support software *File Control (p. 539)*. See software Help & *Preserving Data at Program Send (p. 180)*.

<sup>&</sup>lt;sup>3</sup>Automatic on power-up of CR3000 with Campbell Scientific mass storage device or memory card and Powerup.ini. See *Power-up* (p. 460).

special node PakBus address of 3210 can be used if the files are sent with FTP protocol, or 3211 if the files are written with CRBasic.

**Note** This setting will operate only on a file whose name is not a null string.

#### Example:

```
(129,CPU:NorthWest.JPG,2)
(130,CRD:SouthEast.JPG,20)
(130,CPU:Message.TXT,0)
```

In the example above, \*.JPG files from node 129 are named CPU:NorthWestnnn.JPG and two files are retained, and \*.JPG files from node 130 are named CRD:SouthEastnnn.JPG, while 20 files are retained. The **nnn** serial number starts at **1** and will advance beyond nine digits. In this example, all \*.TXT files from node 130 are stored with the name CPU:Message.Txt, with no serial number inserted.

A second instance of a setting can be configured using the same node PakBus address and same file type, in which case two files will be written according to each of the two settings. For example,

```
(55,USR:photo.JPG,100)
(55:USR:NewestPhoto.JPG,0)
```

will store two files each time a JPG file is received from node 55. They will be named USR:photonnn.JPG and USR:NewestPhoto.JPG. This feature is used when a number of files are to be retained, but a copy of one file whose name never changes is also needed. The second instance of the file can also be serialized and used when a number of files are to be saved to different drives.

Entering 3212 as the PakBus address activates storing IP trace information to a file. The "number of files" parameter specifies the size of the file. The file is a ring file, so the newest tracing is kept. The boundary between newest and oldest is found by looking at the time stamps of the tracing. Logged information may be out of sequence.

#### Example:

```
(3212, USR:IPTrace.txt, 5000)
```

This syntax will create a file on the USR: drive called IPTrace.txt that will grow to approximately 5 KB in size, and then new data will begin overwriting old data.

## 8.8.5.3 Data Preservation

Associated with file attributes is the option to preserve data in CR3000 memory when a program is sent. This option applies to final-storage data SRAM, memory cards, and *datalogger support software* (p. 91) cache data (p. 534). Depending on the application, retention of data files when a program is downloaded may be desirable. When sending a program to the CR3000 with datalogger support software **Send** command, data are always deleted before the program runs. When the program is sent using support software **File Control Send** (p. 539) command or

CRBasic Editor Compile, Save and Send (p. 534) command, options to preserve (not erase) or not preserve (erase) data are presented. The logic in the following example summarizes the disposition of CR3000 data depending on the data preservation option selected.

```
if "Preserve data if no table changed"
    keep CF data from overwritten program
    if current program = overwritten program
        keep CPU data
        keep cache data
    else
        erase CPU data
        erase cache data
    end if

if "erase CF data"
    erase CF data from overwritten program
    erase CPU data
    erase cache data
```

# 8.8.5.4 Powerup.ini File — Details

Uploading a CR3000 *OS* (p. 547) file or user-program file in the field can be challenging, particularly during weather extremes. Heat, cold, snow, rain, altitude, blowing sand, and distance to hike influence how easily programming with a laptop or palm PC may be. An alternative is to carry the file to the field on a light-weight, external-memory device such as a *USB*: (p. 613) or *CRD*: (p. 613) drive. Steps to download the new OS or CRBasic program from an external-memory drive are:

- 1. Place a text file named **powerup.ini**, with appropriate commands entered in the file, on the external-memory device along with the new OS or CRBasic program file.
- 2. Connect the external device to the CR3000 and then cycle power to the datalogger.

This simple process results in the file uploading to the CR3000 with optional run attributes, such as **Run Now**, **Run on Power Up**, or **Run Always** set for individual files. Simply copying a file to a specified drive with no run attributes, or to format a memory drive, is also possible. Command options for **powerup.ini** options also allow final-storage memory management on memory cards comparable to the *datalogger support software* (p. 91) **File Control** feature.

Options for **powerup.ini** also allow final-storage memory management comparable **File Control** (p. 539). Note that the CRD: drive has priority over the USB: drive.

**Caution** Test the **powerup.ini** file and procedures in the lab before going to the field. Always carry a laptop or mobile device (with datalogger support software) into difficult- or expensive-to-access places as backup.

Powerup.ini commands include the following functions:

- Sending programs to the CR3000.
- Optionally setting run attributes of CR3000 program files.
- Sending an OS to the CR3000.
- Formatting memory drives.
- Deleting data files associated with the previously running program.

When power is connected to the CR3000, it searches for **powerup.ini** and executes the command(s) prior to compiling a program. **Powerup.ini** performs three operations:

- 1. Copies the program file to a memory drive
- 2. Optionally sets a file run attribute (Run Now, Run on Power Up, or Run Always) for the program file.
- 3. Optionally deletes data files stored from the overwritten (just previous) program.
- 4. Formats a specified drive.

Execution of **powerup.ini** takes precedence during CR3000 power-up. Although **powerup.ini** sets file attributes for the uploaded programs, its presence on a drive does not allow those file attributes to control the power-up process. To avoid confusion, either remove the external drive on which **powerup.ini** resides or delete the file after the power-up operation is complete.

# 8.8.5.4.1 Creating and Editing Powerup.ini

**Powerup.ini** is created with a text editor on a PC, then saved on a memory drive of the CR3000. The file is saved to the memory drive, along with the operating system or user program file, using the *datalogger support software* (p. 615) **File Control** | **Send** (p. 539) command.

**Note** Some text editors (such as MicroSoft® WordPad®) will attach header information to the powerup.ini file causing it to abort. Check the text of a powerup.ini file in the CR3000 with the CR1000KD Keyboard/Display to see what the CR3000 actually sees.

Comments can be added to the file by preceding them with a single-quote character ('). All text after the comment mark on the same line is ignored.

#### Syntax

Syntax for **powerup.ini** is:

Command, File, Device

where,

- **Command** is one of the numeric commands in *TABLE: Powerup.ini* Script Commands and Application (p. 462).
- *File* is the accompanying operating system or user program file. File name can be up to 22 characters long.
- **Device** is the CR3000 memory drive to which the accompanying operating system or user program file is copied (usually CPU:). If left blank or with an invalid option, default device will be CPU:. Use the same drive designation as the transporting external device if the preference is to not copy the file.

TABLE 116: Powerup.ini Script Commands and Applications			
Powerup.ini Script Command	Description	Applications	
11	Run always, preserve data	Copies a program file to a drive and sets the run attribute to <b>Run Always</b> . Data on a CF card from the previously running program will be preserved if table structures have not changed. See <i>Preserving Data at Program Send</i> (p. 180).	
2	Run on power-up	Copies a program file to a drive and sets the run attribute to <b>Run Always</b> unless command <b>6</b> or <b>14</b> is used to set a separate <b>Run Now</b> program. See <i>Preserving Data at Program Send</i> (p. 180).	
5	Format	Formats a drive.	
61	Run now, preserve data	Copies a program file to a drive and sets the run attribute to <b>Run Now</b> . Data on a CF card from the previously running program will be preserved if table structures have not changed.	
7	Copy support files	Copies support files, such as <i>Include</i> (p. 542) or program support files, to the CPU: drive before copying the program file with run attributes set to Run always, erase data.	
9	Load OS (File = .obj)	Loads a .obj file to the CPU: drive and then loads the .obj file as the new CR3000 operating system.	

TABLE 116: Powerup.ini Script Commands and Applications		
Powerup.ini Script Command	Description	Applications
13	Run always, erase data	Copies a program to a drive and sets the run attribute to <b>Run Always</b> . Data on a CF card from the previously running program will be erased.
14	Run now, erase files	Copies a program to a drive and sets the run attribute to <b>Run Now</b> . Data on a CF card from the previously running program will be erased.

<sup>&</sup>lt;sup>1</sup> Use **PreserveVariables()** instruction in the CRBasic program in conjunction with powerup.ini script commands 1 and 6 to preserve data and variables.

# Example Power-up.ini Files

```
'Code format and syntax

'Command = numeric power-up command
'File = file associated with the action
'Device = device to which File is copied. Defaults to CPU:

'Command, File, Device
13, Write2CRD_2.cr1,cpu:
```

```
'Run Program on Power-up
'Copy program file pwrup.cr1 from the external drive to CPU:
'File will run only when CR3000 powered-up later.
2,pwrup.cr1,cpu:
```

```
'Format the USR: drive
5,,usr:
```

```
'Send OS on Power-up
'Load an operating system (.obj) file into FLASH as the new OS.
9,CR3000.Std.28.obj
```

```
'Run Program from USB: Drive
'A program file is carried on an external USB: drive.
'Do not copy program file from USB:
'Run program always, erase data.
13,toobigforcpu.cr1,usb:
```

```
'Run a program file always, erase data.
13,pwrup_1.cr1,cpu:
```

```
'Run a program file now, erase data now.
14,run.cr1,cpu:
```

## Power-up.ini Execution

After **powerup.ini** is processed, the following rules determine what CR3000 program to run:

- If the run-now program is changed, then it is the program that runs.
- If no change is made to run-now program, but run-on-power-up program is changed, the new run-on-power-up program runs.
- If neither run-on-power-up nor run-now programs are changed, the previous run-on-power-up program runs.

# 8.8.5.5 File Management Q & A

Q: How do I hide a program file on the CR3000 without using the CRBasic **FileManage()** instruction?

A: Use the *CoraScript (p. 533)* File-Control command, or the *Web API (p. 475*, p. 475) FileControl command.

## 8.8.6 File Names

The maximum size of the file name that can be stored, run as a program, or FTP transferred in the CR3000 is 59 characters. If the name is longer than 59 characters, an **Invalid Filename** error is displayed. If several files are stored, each with a long filename, memory allocated to the root directory can be exceeded before the actual memory of storing files is exceeded. When this occurs, an "insufficient resources or memory full" error is displayed.

# 8.8.7 File System Errors

Table *File System Error Codes (p. 464)* lists error codes associated with the CR3000 file system. Errors can occur when attempting to access files on any of the available drives. All occurrences are rare, but they are most likely to occur when using the CRD: drive.

TABLE 117: File System Error Codes		
Error Code	Description	
1	Invalid format	
2	Device capabilities error	
3	Unable to allocate memory for file operation	
4	Max number of available files exceeded	
5	No file entry exists in directory	
6	Disk change occurred	

<b>TABLE 117:</b> F	ile System Error Codes
Error Code	Description
7	Part of the path (subdirectory) was not found
8	File at EOF
9	Bad cluster encountered
10	No file buffer available
11	Filename too long or has bad chars
12	File in path is not a directory
13	Access permission, opening DIR or LABEL as file, or trying to open file as DIR or mkdir existing file
14	Opening read-only file for write
15	Disk full (can't allocate new cluster)
16	Root directory is full
17	Bad file ptr (pointer) or device not initialized
18	Device does not support this operation
19	Bad function argument supplied
20	Seek out-of-file bounds
21	Trying to mkdir an existing dir
22	Bad partition sector signature
23	Unexpected system ID byte in partition entry
24	Path already open
25	Access to uninitialized ram drive
26	Attempted rename across devices
27	Subdirectory is not empty
31	Attempted write to Write Protected disk
32	No response from drive (Door possibly open)
33	Address mark or sector not found
34	Bad sector encountered
35	DMA memory boundary crossing error
36	Miscellaneous I/O error
37	Pipe size of 0 requested
38	Memory-release error (relmem)
39	FAT sectors unreadable (all copies)
40	Bad BPB sector
41	Time-out waiting for filesystem available

TABLE 117: File System Error Codes	
Error Code	Description
42	Controller failure error
43	Pathname exceeds _MAX_PATHNAME

# 8.8.8 Memory Q & A

Q: Can a user create a program too large to fit on the CPU: drive (>100k) and have it run from the CRD: drive (memory card)?

A: The program does not run from the memory card. However, a very large program (too large to fit on the CPU: drive) can be compiled into CR3000 main memory from the card if the binary form of the compiled program does not exceed the available *main memory* (p. 442).

# 8.9 Data Retrieval and Comms — Details

#### **Related Topics:**

- Data Retrieval and Comms Quickstart (p. 40)
- Data Retrieval and Comms Overview (p. 80)
- Data Retrieval and Comms Details (p. 466)
- Data Retrieval and Comms Peripherals Lists (p. 610)

Comms, in the context of CR3000 operation, is the movement of information between the CR3000 and another computing device, usually a PC. The information can be data, program, files, or control commands.

# 8.9.1 Protocols

The CR3000 communicates with *datalogger support software* (p. 91) and other Campbell Scientific *dataloggers* (p. 603) using the *PakBus* (p. 548) protocol. See *Alternate Comms Protocols* (p. 468) for information on other supported protocols, such as TCP/IP, Modbus, etc.

# 8.9.2 Conserving Bandwidth

Some comms services, such as satellite networks, can be expensive to send and receive information. Best practices for reducing expense include:

- Declare **Public** only those variables that need to be public.
- Be conservative with use of string variables and string variable sizes.
   Make string variables as big as they need to be and no more; remember the minimum is actually 24 bytes. Declare string variables Public and sample string variables into data tables only as needed.

- When using GetVariables() / SendVariables() to send values between dataloggers, put the data in an array and use one command to get the multiple values. Using one command to get 10 values from an array and swath of 10 is much more efficient (requires only 1 transaction) than using 10 commands to get 10 single values (requires 10 transactions).
- Set the CR3000 to be a PakBus router only as needed. When the CR3000 is a router, and it connects to another router like LoggerNet, it exchanges routing information with that router and, possibly (depending on your settings), with other routers in the network.
- Set PakBus beacons and verify intervals properly. For example, there is no need to verify routes every five minutes if communications are expected only every 6 hours.

# 8.9.3 Initiating Comms (Callback)

Comms sessions are usually initiated by a PC. Once comms are established, the PC issues commands to send programs, set clocks, collect data, etc. Because data retrieval is managed by the PC, several PCs can have access to a CR3000 without disrupting the continuity of data. PakBus® allows multiple PCs to communicate with the CR3000 simultaneously when proper comms networks are installed.

Typically, the PC initiates comms with the CR3000 with *datalogger support* software (p. 615). However, some applications require the CR3000 to call back the PC (initiate comms). This feature is called 'Callback'. Special *LoggerNet* (p. 615) features enable the PC to receive calls from the CR3000.

For example, if a fruit grower wants a frost alarm, the CR3000 can contact him by calling a PC, sending an email, text message, or page, or calling him with synthesized-voice over telephone. Callback has been used in applications including Ethernet, land-line telephone, digital cellular, and direct connection. Callback with telephone is well documented in *CRBasic Editor Help* (search term "callback"). For more information on other available Callback features, manuals for various comms hardware may discuss Callback options.

**Caution** When using the ComME com port with non-PakBus protocols, incoming characters can be corrupted by concurrent use of the CS I/O for SDC comms. PakBus comms use a low-level protocol (pause / finish / ready sequence) to stop incoming data while SDC occurs.

Non-PakBus comms include TCP/IP protocols, ModBus, DNP3, and generic, CRBasic-driven use of CS I/O.

Though usually unnoticed, a short burst of SDC comms occurs at power-up and other times when the datalogger is reset, such as when compiling a program or changing settings that require recompiling. This activity is the datalogger querying to see if the CR1000KD Keyboard/Display is available.

When *DevConfig* and *PakBus Graph* retrieve settings, the CR3000 queries to determine what SDC devices are connected. Results of the

query can be seen in the *DevConfig* and *PakBusGraph* settings tables. SDC queries occur whether or not an SDC device is attached.

# 8.10 Alternate Comms Protocols

#### Related Topics:

- Alternate Comms Protocols Overview (p. 82)
- Alternate Comms Protocols Details (p. 468)

The CR3000 communicates with *datalogger support software* (p. 91) and other Campbell Scientific *dataloggers* (p. 603) using the *PakBus* (p. 548) protocol. Modbus, DNP3, TCP/IP, and several industry-specific protocols are also supported. CAN bus is supported when using the Campbell Scientific *SDM-CAN* (p. 610) communication module.

# 8.10.1 TCP/IP — Details

## Related Topics:

- TCP/IP Overview
- TCP/IP Details (p. 468)
- TCP/IP Links List (p. 612)

The following TCP/IP protocols are supported by the CR3000 when using *network links (p. 612)* that use the resident IP stack or when using a cell modem with the PPP/IP key enabled. The following sections include information on some of these protocols:

- DHCP
- DNS
- FTP
- HTML
- HTTP
- •
- Micro-serial server
- Modbus TCP/IP
- NTCIP
- NTP
- PakBus over TCP/IP
- Ping

- POP3
- SMTP
- SNMP
- Telnet
- Web API
- XML
- UDP
- IPv4IPv6
- \_

The most up-to-date information on implementing these protocols is contained in *CRBasic Editor Help*.

**Note** Specific information concerning the use of digital-cellular modems for TCP/IP can be found in Campbell Scientific manuals for those modems. For information on available TCP/IP/PPP devices, refer to the appendix *Network Links* (p. 612) for model numbers. Detailed information

on use of TCP/IP/PPP devices is found in their respective manuals (available at www.campbellsci.com) and CRBasic Editor Help.

## 8.10.1.1 FYIs — OS2; OS28

- TCP/IP info no longer in status table get from datalogger settings.
- CR3000 now adopts auto IP address of 169.254.67.85 (if available) if DHCP server not available or static IP address is not set. This makes it easier for PC to CR3000 ad hoc connections.
- Added limited DNS server capability CR3000 intercepts / respond to cr1000.com
- Added a default public/internet DNS server if none is assigned. This should result in less "why isn't my EmailSend to email.server.com not working?"
- Apologies to those who have figured out how to read our **IPTrace** information it has changed quite a bit.
- Network Time Protocol server not enabled by default. This requires inclusion of **NetworkTimeProtocol()** instruction in the program.

#### 8.10.1.2 DHCP

When connected to a server with a list of IP addresses available for assignment, the CR3000 will automatically request and obtain an IP address through the Dynamic Host Configuration Protocol (DHCP). Once the address is assigned, use *DevConfig*, *PakBusGraph*, *Connect*, or the CR1000KD Keyboard/Display to look in the CR3000 **Status** table to see the assigned IP address. This is shown under the field name *IPInfo*.

#### 8.10.1.3 DNS

The CR3000 provides a Domain Name Server (DNS) client that can query a DNS server to determine if an IP address has been mapped to a hostname. If it has, then the hostname can be used interchangeably with the IP address in some datalogger instructions.

#### 8.10.1.4 FTP Server

The CR3000 automatically runs an FTP server. This allows *Windows Explorer* to access the CR3000 file system with FTP, with drives on the CR3000 being mapped into directories or folders. The root directory on the CR3000 can be any drive, but the USR: drive is usually preferred. USR: is a drive created by allocating memory in the USR: Drive Size box on the Deployment | Advanced tab of the CR3000 service in *DevConfig*. Files can be copied / pasted between drives. Files can be deleted through FTP.

#### 8.10.1.5 FTP Client

The CR3000 can act as an FTP client to send a file or get a file from an FTP server, such as another datalogger or web camera. This is done using the CRBasic **FTPClient()** instruction. Refer to a manual for a Campbell Scientific network link (see *TCP/IP Links — List (p. 612)*), available at *www.campbellsci.com*, or *CRBasic Editor Help* for details and sample programs.

#### 8.10.1.6 HTTP Web Server

### 8.10.1.6.1 Default HTTP Web Server

The CR3000 has a default home page built into the operating system. The home page can be accessed using the following URL:


http:\\ipaddress:80

Note Port 80 is implied if the port is not otherwise specified.

As shown in figure *Preconfigured HTML Home Page (p. 470)*, this page provides links to the newest record in all tables, including the **Status** table, **Public** table, and data tables. Links are also provided for the last 24 records in each data table. If fewer than 24 records have been stored in a data table, the link will display all data in that table.

**Newest-Record** links refresh automatically every 10 seconds. **Last 24-Records** link must be manually refreshed to see new data. Links will also be created automatically for any HTML, XML, and JPEG files found on the CR3000 drives. To copy files to these drives, choose **File Control** from the *datalogger support software* (p. 535) menu.

FIGURE 106: Preconfigured HTML Home Page

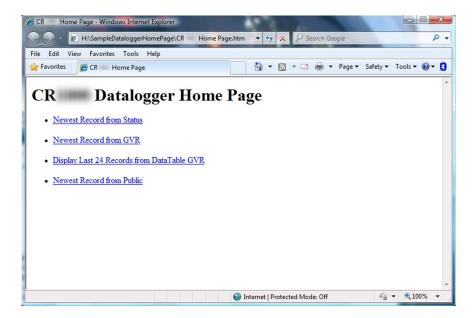

#### 8.10.1.6.2 **Custom HTTP Web Server**

Although the default home page cannot be accessed for editing, it can be replaced with the HTML code of a customized web page. To replace the default home page, save the new home page under the name default.html and copy it to the datalogger. It can be copied to a CR3000 drive with File Control. Deleting default.html will cause the CR3000 to use the original, default home page.

The CR3000 can be programmed to generate HTML or XML code that can be viewed by a web browser. CRBasic example HTML (p. 472) shows how to use the CRBasic instructions WebPageBegin() / WebPageEnd and HTTPOut() to create HTML code. Note that for HTML code requiring the use of quotation marks, CHR(34) is used, while regular quotation marks are used to define the beginning and end of alphanumeric strings inside the parentheses of the **HTTPOut()** instruction. For additional information, see the *CRBasic Editor Help*.


In this example program, the default home page is replaced by using WebPageBegin to create a file called default.html. The new default home page created by the program appears as shown in the figure *Home Page Created using* WebPageBegin() Instruction (p. 471).

The Campbell Scientific logo in the web page comes from a file called **SHIELDWEB2.JPG** that must be transferred from the PC to the CR3000 CPU: drive using **File Control** in the datalogger support software.

A second web page, shown in figure Customized Numeric-Monitor Web Page (p. 472) called "monitor.html" was created by the example program that contains links to the CR3000 data tables.

FIGURE 107: Home Page Created Using WebPageBegin() Instruction

File Edit View Favorites Tools Help 🛅 🔻 🔝 🔻 🖃 📻 🔻 Page 🔻 Safety 🕶 Tools 🕶 🔞 🕶 🚺 ravorites Campbell Scientific CR Datalogger

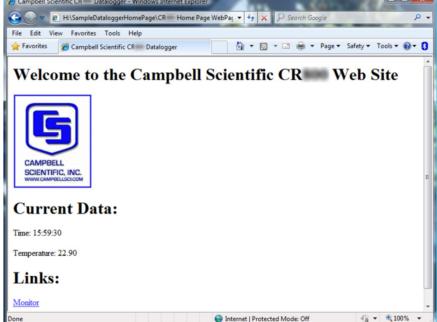

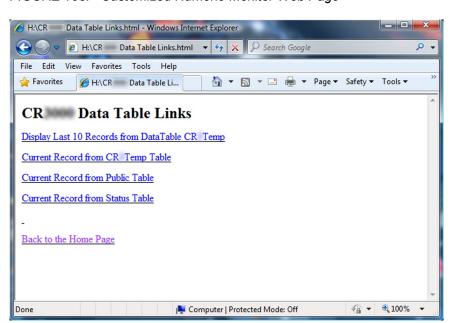


FIGURE 108: Customized Numeric-Monitor Web Page

## CRBasic EXAMPLE 77: Custom Web Page HTML 'This program example demonstrates the creation of a custom web page that resides in the 'WebPageBegin to CR3000. In this example program, the default home page is replaced by 'using create a file called default.html. The graphic in the web page (in this case, the 'Campbell Scientific logo) comes from a file called SHIELDWEB2.JPG. The graphic file 'must be copied to the CR3000 CPU: drive using File Control in the datalogger 'support software. A second web page is created that contains links to the CR3000 'data tables. 'NOTE: The "\_" character used at the end of some lines allows a code statement to be 'wrapped to the next line. Dim Commands As String \* 200 Public Time(9), RefTemp, Public Minutes As String, Seconds As String, Temperature As String DataTable(CRTemp.True.-1) DataInterval(0.1.Min.10) Sample(1,RefTemp,FP2) Average(1,RefTemp,FP2,False) EndTable 'Default HTML Page WebPageBegin("default.html",Commands) HTTPOut("<html>") HTTPOut("<style>body {background-color: oldlace}</style>") HTTPOut("<body><title>Campbell Scientific CR3000 Datalogger</title>") HTTPOut("<h2>Welcome To the Campbell Scientific CR3000 Web Site!</h2>") HTTPOut("")

```
HTTPOut("<a href=" + CHR(34) + "http://www.campbellsci.com" + CHR(34) + ">")
  HTTPOut("<imq src="+ CHR(34) +"/CPU/SHIELDWEB2.jpg"+ CHR(34) + "width=" + _
    CHR(34) +"128"+CHR(34)+"height="+CHR(34)+"155"+ CHR(34) + "class=" + _
    CHR(34) + "style1" + CHR(34) + "/></a>")
 HTTPOut("<h2> Current Data:</h2>")
 HTTPOut("Time: " + time(4) + ":" + minutes + ":" + seconds + "")
 HTTPOut("Temperature: " + Temperature + "")
 HTTPOut("<h2> Links:</h2>")
 HTTPOut("<a href="+ CHR(34) +"monitor.htm1"+ CHR(34)+">Monitor</a>")
 HTTPOut("</body>")
 HTTPOut("</html>")
WebPageEnd
'Monitor Web Page
WebPageBegin("monitor.html", Commands)
  HTTPOut("<html>")
  HTTPOut("<style>body {background-color: oldlace}</style>")
  HTTPOut("<body>")
  HTTPOut("<title>Monitor CR3000 Datalogger Tables</title>")
  HTTPOut("<h2>CR3000 Data Table Links</h2>")
 HTTPOut("<a href="+ CHR(34) + "command=TableDisplay&table=CRTemp&records=10" + _</pre>
    CHR(34)+">Display Last 10 Records from DataTable CR1Temp</a>")
 HTTPOut("<a href="+ CHR(34) + "command=NewestRecord&table=CRTemp"+ CHR(34) + _</pre>
    ">Current Record from CRTemp Table</a>")
  HTTPOut("<a href="+ CHR(34) + "command=NewestRecord&table=Public"+ CHR(34) + _</pre>
    ">Current Record from Public Table</a>")
  HTTPOut("<a href="+ CHR(34) + "command=NewestRecord&table=Status" + CHR(34) + _
    ">Current Record from Status Table</a>")
  HTTPOut("<br><a href="+ CHR(34) +"default.html"+ CHR(34) + ">Back to the Home Page _
    </a>")
 HTTPOut("</body>")
  HTTPOut("</html>")
WebPageEnd
BeginProg
 Scan(1, Sec, 3, 0)
    PanelTemp(RefTemp, 250)
    RealTime(Time())
   Minutes = FormatFloat(Time(5), "%02.0f")
   Seconds = FormatFloat(Time(6), "%02.0f")
   Temperature = FormatFloat(RefTemp, "%02.02f")
   CallTable(CRTemp)
 NextScan
EndProg
```

#### 8.10.1.7 Micro-Serial Server

The CR3000 can be configured to allow serial communication over a TCP/IP port. This is useful when communicating with a serial sensor over Ethernet with microserial server (third-party serial to Ethernet interface) to which the serial sensor is connected. See the network-link manual and the *CRBasic Editor Help* for the **TCPOpen()** instruction for more information.

#### 8.10.1.8 Modbus TCP/IP

The CR3000 can perform Modbus communication over TCP/IP using the Modbus TCP/IP interface. To set up Modbus TCP/IP, specify port 502 as the *ComPort* in

the **ModBusMaster()** and **ModBusSlave()** instructions. See the *CRBasic Editor Help* for more information. See *Modbus — Details (p. 476)*.

#### 8.10.1.9 PakBus Over TCP/IP and Callback

Once the hardware has been configured, basic PakBus communication over TCP/IP is possible. These functions include the following:

- Sending programs
- Retrieving programs
- Setting the CR3000 clock
- Collecting data
- Displaying the current record in a data table

Data callback and datalogger-to-datalogger communications are also possible over TCP/IP. For details and example programs for callback and datalogger-to-datalogger communications, see the network-link manual. A listing of network-link model numbers is found in *Network Links* — *List* (p. 612).

## 8.10.1.10 Ping (IP)

Ping can be used to verify that the IP address for the network device connected to the CR3000 is reachable. To use the Ping tool, open a command prompt on a computer connected to the network and type in:

```
ping xxx.xxx.xxx <Enter>
```

where xxx.xxx.xxx is the IP address of the network device connected to the CR3000.

#### 8.10.1.11 SNMP

Simple Network Management Protocol (SNMP) is a part of the IP suite used by NTCIP and RWIS for monitoring road conditions. The CR3000 supports SNMP when a network device is attached.

#### 8.10.1.12 Telnet

Telnet is used to access the same commands that are available through the support software *terminal emulator* (p. 559). Start a *Telnet* session by opening a DOS command prompt and type in:

Telnet xxx.xxx.xxx <Enter>

where xxx.xxx.xxx is the IP address of the network device connected to the CR3000.

### 8.10.1.13 SMTP

Simple Mail Transfer Protocol (SMTP) is the standard for e-mail transmissions. The CR3000 can be programmed to send e-mail messages on a regular schedule or based on the occurrence of an event.

#### 8.10.1.14 Web API

The CR3000 has a web API. See CRBasic Editor Help for details.

### 8.10.1.15 Web API — Details

The CR3000 web API (Application Programming Interface) is a series of *URL* (p. 560) commands that manage CR3000 resources. The API facilitates the following functions:

- Data Management
  - Collect data
- Control CRBasic program language logic can allow remote access to many control functions by means of changing the value of a variable.
  - Set variables / flags / ports
- Clock Functions Clock functions allow a web client to monitor and set the host CR3000 real time clock. Read the Time Syntax section for more information.
  - Set CR3000 clock
- File Management Web API commands allow a web client to manage files on host CR3000 memory drives. Camera image files are examples of collections often needing frequent management.
  - Send programs
  - Send files
  - Collect files

API commands are also used with Campbell Scientific's RTMC web server datalogger support software (p. 91). Look for the API commands in CRBasic Editor Help.

## 8.10.2 DNP3 — Details

Related Topics:

- DNP3 Overview (p. 83)
- DNP3 Details (p. 475)

See the technical paper *DNP3 with Campbell Scientific Datalogger*, which is available at https://www.campbellsci.com/app-notes.

## 8.10.3 Modbus — Details

The CR3000 supports Modbus master and Modbus slave communications for inclusion in Modbus SCADA networks. Modbus is a widely used SCADA communication protocol that facilitates exchange of information and data between computers / HMI software, instruments (RTUs) and Modbus-compatible sensors. The CR3000 communicates with Modbus over RS-232, (with a RS-232 to RS-485 such as an MD485 adapter), and TCP.

Modbus systems consist of a master (PC), RTU / PLC slaves, field instruments (sensors), and the communication-network hardware. The communication port, baud rate, data bits, stop bits, and parity are set in the Modbus driver of the master and / or the slaves. The CR3000 supports RTU and ASCII communication modes on RS-232 and RS485 connections. It exclusively uses the TCP mode on IP connections.

Field instruments can be queried by the CR3000. Because Modbus has a set command structure, programming the CR3000 to get data from field instruments is much simpler than from serial sensors. Because Modbus uses a common bus and addresses each node, field instruments are effectively multiplexed to a CR3000 without additional hardware.

A CR3000 goes into sleep mode after 40 seconds of communication inactivity. Once asleep, two packets are required before the CR3000 will respond. The first packet awakens the CR3000; the second packet is received as data. This would make a Modbus master fail to poll the CR3000, if not using retries. The CR3000, through *DevConfig* or the **Status** table (see *Info Tables and Settings (p. 567))*, can be set to keep communication ports open and awake, but at higher power usage.

## 8.10.3.1 Modbus Terminology

Table *Modbus to Campbell Scientific Equivalents (p. 476)* lists terminology equivalents to aid in understanding how CR3000s fit into a SCADA system.

TABLE 118: Modbus to Campbell Scientific Equivalents			
Modbus Domain	Data Form	Campbell Scientific Domain	
Coils	Single bit	Ports, flags, boolean variables	
Digital registers	16 bit word	Floating point variables	
Input registers	16 bit word	Floating point variables	
Holding registers	16 bit word	Floating point variables	
RTU / PLC		CR3000	
Master		Usually a computer	
Slave		Usually a CR3000	
Field instrument		Sensor	

## 8.10.3.1.1 Glossary of Modbus Terms

Term: coils (00001 to 09999)

Originally, "coils" referred to relay coils. In CR3000s, coils are exclusively terminals configured for control, software flags, or a Boolean-variable array. Terminal configured for control are inferred if parameter 5 of the **ModbusSlave()** instruction is set to 0. Coils are assigned to Modbus registers **00001** to **09999**.

Term: digital registers 10001 to 19999

Hold values resulting from a digital measurement. Digital registers in the Modbus domain are read-only. In the Campbell Scientific domain, the leading digit in Modbus registers is ignored, and so are assigned together to a single **Dim-** or **Public-**variable array (read / write).

Term: input registers 30001 to 39999

Hold values resulting from an analog measurement. Input registers in the Modbus domain are read-only. In the Campbell Scientific domain, the leading digit in Modbus registers is ignored, and so are assigned together to a single **Dim**- or **Public**- variable array (read / write).

Term: holding registers 40001 to 49999

Hold values resulting from a programming action. Holding registers in the Modbus domain are read / write. In the Campbell Scientific domain, the leading digit in Modbus registers is ignored, and so are assigned together to a single **Dim** or **Public** variable array (read / write).

Term: RTU / PLC

Remote Telemetry Units (RTUs) and Programmable Logic Controllers (PLCs) were at one time used in exclusive applications. As technology increases, however, the distinction between RTUs and PLCs becomes more blurred. A CR3000 fits both RTU and PLC definitions.

## 8.10.3.2 Programming for Modbus

## 8.10.3.2.1 Declarations (Modbus Programming)

Table Modbus Registers: CRBasic Port, Flag, and Variable Equivalents (p. 478) shows the linkage between terminals configured for control, flags and Boolean variables and Modbus registers. Modbus does not distinguish between terminals configured for control, flags, or Boolean variables. By declaring only terminals configured for control, or flags, or Boolean variables, the declared feature is

addressed by default. A typical CRBasic program for a Modbus application declares variables and ports, or variables and flags, or variables and Boolean variables.

TABLE 119: Modbus Registers: CRBasic Port, Flag, and Variable Equivalents				
CRBasic Port, Flag, or Variable	Example CRBasic Declaration	Equivalent Example Modbus Register		
C terminal configured for control	Public Port(8)	00001 to 00008		
Flag	Public Flag(17)	00001 to 00017		
Boolean variable	Public ArrayB(56) as Boolean	00001 to 00056		
Variable	Public ArrayV(20) <sup>1</sup>	40001 to 40040 <sup>1</sup> 30001 to 30040 <sup>1</sup>		

<sup>&</sup>lt;sup>1</sup> Because of byte-number differences, each CR3000 domain variable translates to two Modbus domain input / holding registers.

## 8.10.3.2.2 CRBasic Instructions (Modbus)

Complete descriptions and options of commands are available in *CRBasic Editor Help*.

#### ModbusMaster()

Sets up a CR3000 as a Modbus master to send or retrieve data from a Modbus slave.

Syntax

ModbusMaster(ResultCode, ComPort, BaudRate, ModbusAddr, Function, Variable, Start, Length, Tries, TimeOut)

### ModbusSlave()

Sets up a CR3000 as a Modbus slave device.

Syntax

#### MoveBytes()

Moves binary bytes of data into a different memory location when translating bigendian to little-endian data. See the appendix *Endianness* (p. 601).

Syntax

MoveBytes(Dest, DestOffset, Source, SourceOffset, NumBytes)

### ReadOnly()

Set a variable to read only.

Syntax

ReadOnly()

# 8.10.3.2.3 Addressing (ModbusAddr)

Modbus devices have a unique address in each network. Addresses range from 1 to 247. Address 0 is reserved for universal broadcasts. When using a network of dataloggers in a Modbus over Pakbus configuration, use the same number for both the Modbus address and the PakBus address.

If a slave is to echo back requests to the master, enter the address of the slave as a negative number in **ModbusMaster()**.

## 8.10.3.2.4 Supported Modbus Function Codes

Modbus protocol has many function codes. CR3000 commands support the following.

TABLE 120: Supported Modbus Function Codes			
Code	Name	Description	
01	Read coil/port status	Reads the on/off status of discrete output(s) in the ModBusSlave	
02	Read input status	Reads the on/off status of discrete input(s) in the ModBusSlave	
03	Read holding registers	Reads the binary contents of holding register(s) in the ModBusSlave	
04	Read input registers	Reads the binary contents of input register(s) in the ModBusSlave	
05	Force single coil/port	Forces a single coil/port in the ModBusSlave to either on or off	
06	Write single register	Writes a value into a holding register in the ModBusSlave	
15	Force multiple coils/ports	Forces multiple coils/ports in the ModBusSlave to either on or off	
16	Write multiple registers	Writes values into a series of holding registers in the ModBusSlave	

## 8.10.3.2.5 Reading Inverse Format Modbus Registers

Some Modbus devices require reverse byte order words (CDAB vs. ABCD). This can be true for either floating point, or integer formats. Since a slave CR3000 uses the ABCD format, either the master has to make an adjustment, which is sometimes possible, or the CR3000 needs to output reverse-byte order words. To reverse the byte order in the CR3000, use the **MoveBytes()** instruction as shown in the sample code below.

```
for i = 1 to k
  MoveBytes(InverseFloat(i),2,Float(i),0,2)
  MoveBytes(InverseFloat(i),0,Float(i),2,2)
next
```

In the example above, *InverseFloat(i)* is the array holding the inverse-byte ordered word (CDAB). Array *Float(i)* holds the obverse-byte ordered word (ABCD).

See Endianness (p. 601).

## 8.10.3.2.6 Timing

The timeout is a critical parameter of Modbus communication. The response time of devices is usually not specified by the manufacturer and can range from 100 ms to more than 5 seconds. When the CR3000 is acting as a slave device, it typically responds very quickly. The default timeout in a master device polling the CR3000 will typically not need adjustment from the default. When the CR3000 is acting as a master, the response time of a slave needs particular attention. The best practice is to monitor the communication between the CR3000 and the slave device with the comms sniffer (terminal mode (p. 523) W command). The comms sniffer allows you to see the actual response time of the slave device. The TimeOut parameter of ModbusMaster() can then be adjusted accordingly.

## 8.10.3.3 Troubleshooting (Modbus)

Test Modbus functions on the CR3000 with third party Modbus software. Further information is available at the following links:

- www.simplyModbus.ca/FAQ.htm
- www.Modbus.org/tech.php
- www.lammertbies.nl/comm/info/modbus.html

### 8.10.3.4 Modbus over IP

When the CR3000 acts as the Modbus master, a **TCPOpen()** instruction must precede the **ModbusMaster()** instruction. The connection handle returned by **TCPOpen()** is used for the *ComPort* parameter.

In the case of **ModbusSlave()**, no **TCPOpen()** instruction is needed. Simply use **502** for the *ComPort* parameter.

## 8.10.3.5 Modbus Security

Q: What security options does the CR3000 offer for Modbus?
A: The Modbus protocol itself does not include security features, so the CR3000 does not offer security on **ModbusMaster()** or **ModbusSlave()**. Following are security issues that come up:

- MAC and IP filtering
- Function code filtering
- Privilege mapping rules by client (by port, IP, etc)
- VPN tunneling

There are some third party Modbus security devices available that can be placed between the CR3000 and the rest of the Modbus network. For example, see tofinosecurity.com/products.

Q: Can I make some registers read-only and other registers writable? A: Yes. By default all registers mapped to **ModbusSlave()** are writable. You may make individual registers read-only with the **ReadOnly()** instruction in the CR3000 CRBasic program.

The following example demonstrates how to report data by Modbus but not allow a Modbus client to change register or coil values in the Modbus host:

- Var can be viewed and changed
- Reg() and Coil() can only be viewed
- The CRBasic program can read from and write to all variables

```
Public Var
Public Reg(4), Coil(4) as Boolean
ReadOnly Reg, Coil

BeginProg
   'setup modbus tcp/ip slave
   'readonly instruction above makes reg and coil read only / not
writable
   ModbusSlave(502,0,1,Reg,Coil,2)

Scan(5,Sec,0,0)
   var = var + 1 ' increment var
   MBReg() = MBReg() + 0.1 'increment all the registers
   MBCoil() = (NOT MBCoil()) 'toggle all the coils
NextScan
EndProg
```

#### 8.10.3.6 Modbus Over RS-232 7/E/1

Q: Can Modbus be used over an RS-232 link, 7 data bits, even parity, one stop bit?

A: Yes. Precede ModBusMaster() / ModBusSlave() with SerialOpen() and set the numeric format of the COM port with any of the available formats, including the option of 7 data bits, even parity. SerialOpen() and ModBusMaster() can be used once and placed before Scan().

### 8.10.3.7 Converting Modbus 16-Bit to 32-Bit Longs

Concatenation of two Modbus long 16-bit variables to one Modbus long 32 bit number is shown in the following example:

```
CRBasic EXAMPLE 78: Concatenating Modbus Long Variables
'This program example demonstrates concatenation (splicing) of Long data type variables
'for Modbus operations.
'NOTE: The CR3000 uses big-endian word order.
'Declarations
                                              'Variable to hold the combined 32-bit
Public Combo As Long
Public Register(2) As Long
                                              'Arrav holds two 16-bit ModBus long
                                              'variables
                                              'Register(1) = Least Significant Word
                                              'Register(2) = Most Significant Word
Public Result
                                              'Holds the result of the ModBus master
                                              'query
'Aliases used for clarification
Alias Register(1) = Register_LSW
                                              'Least significant word.
Alias Register(2) = Register_MSW
                                              'Most significant word.
BeginProg
  'If you use the numbers below (un-comment them first)
  'Combo is read as 131073 decimal
  'Register_LSW=&h0001 'Least significant word.
  'Register_MSW=&h0002 ' Most significant word.
  Scan(1, Sec, 0, 0)
    'In the case of the CR3000 being the ModBus master then the
    'ModbusMaster instruction would be used (instead of fixing
    'the variables as shown between the BeginProg and SCAN instructions).
    ModbusMaster(Result, COMRS232, -115200, 5, 3, Register(), -1, 2, 3, 100)
    'MoveBytes (DestVariable, DestOffset, SourceVariable, SourceOffSet,
    'NumberOfBytes)
    MoveBytes(Combo, 2, Register_LSW, 2, 2)
    MoveBytes(Combo, 0, Register_MSW, 2, 2)
  NextScan
EndProg
```

## 8.11 Keyboard/Display — Details

#### Related Topics:

- Keyboard/Display Overview (p. 84)
- Keyboard/Display Details (p. 483)
- Keyboard/Display List (p. 611)
- Custom Menus Overview (p. 85)

Note See Displaying Data: Custom Menus — Details (p. 222).

This section illustrates the use of the integrated keyboard display using default menus. Some keys have special functions as outlined below.

### 8.11.1 Character Set


The keyboard display character set is accessed using one of the following three procedures:

- The 16 keys default to ▲, ▼, ◄, ▶, Home, PgUp, End, PgDn, Del, and Ins.
- To enter numbers, first press **Num Lock**. **Num Lock** stays set until pressed again.
- Above all keys, except **Num Lock** and **Shift**, are characters printed in blue. To enter one of these characters, press **Shift** one to three times to select the position of the character as shown above the key, then press the key. For example, to enter **Y**, press **Shift Shift Shift PgDn**.
- To insert a space (Spc) or change case (Cap), press Shift one to two times for the position, then press BkSpc.
- To insert a character not printed on the keyboard, enter **Ins**, scroll down to **Character**, press **Enter**, then press **△**, **▼**, **◄**, **▶** to scroll to the desired character in the list that is presented, then press **Enter**.

TABLE 121: Special Keyboard/Display Key Functions		
Key	Special Function	
[2] and [8]	Navigate up and down through the menu list one line at a time	
[Enter]	Selects the line or toggles the option of the line the cursor is on	
[Esc]	Back up one level in the menu	
[Home]	Move cursor to top of the list	
[End]	Move cursor to bottom of the list	


TABLE 121: Special Keyboard/Display Key Functions		
Key	Special Function	
[Pg Up]	Move cursor up one screen	
[Pg Dn]	Move cursor down one screen	
[BkSpc]	Delete character to the left	
[Shift]	Change alpha character selected	
[Num Lock]	Change to numeric entry	
[Del]	<ul> <li>Delete</li> <li>When pressed during power up, Del changes the PPP interface to inactive (only if set as RS232). This allows you to get into RS232 for PakBus if PPP is keeping you out.</li> </ul>	
[Ins]	Insert/change graph configuration	
[Graph]	Graph	

FIGURE 109: Keyboard and Display: Navigation

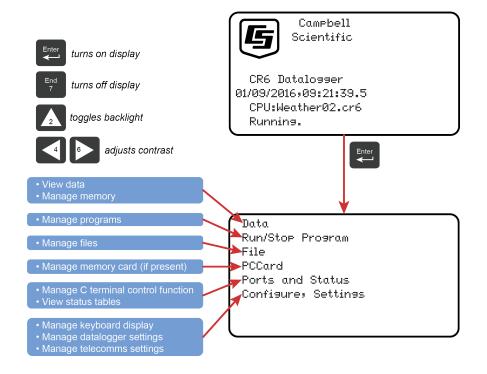

# 8.11.2 Data Display

FIGURE 110: Keyboard and Display: Displaying Data

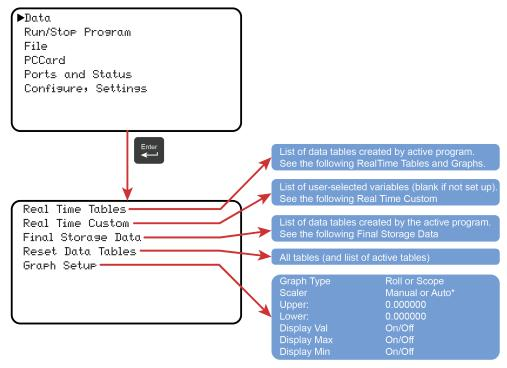


<sup>\*</sup> Scope requires manual scalar

## 8.11.2.1 Real-Time Tables and Graphs

FIGURE 111: CR1000KD Real-Time Tables and Graphs.

List of Data Tables created by the active program. For example,

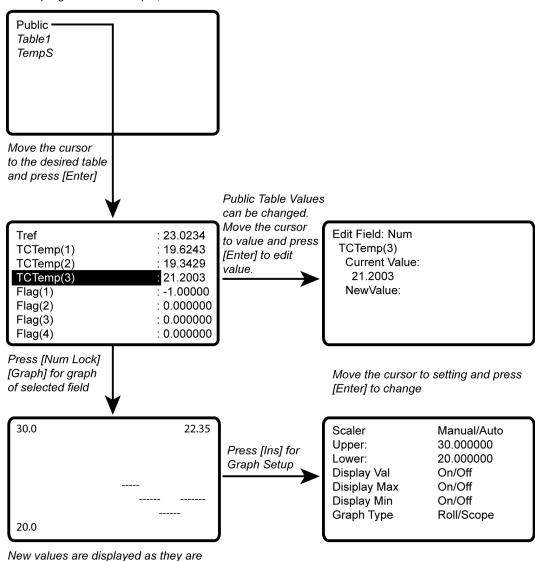

#### 8.11.2.2 Real-Time Custom

stored.

The CR1000KD Keyboard/Display can be configured with a customized real-time display. The CR3000 will keep the setup as long as the defining program is running.

**Read More** Custom menus can also be programmed. See *Displaying Data: Custom Menus* — *Details (p. 222)*.

List of User-Selected Variables Position cursor and press [Enter] List of Data Tables Created by active program. For example, Public Table1 Temps Move the cursor to desired table and press [Enter] Tref TCTemp(1) To add a value, move the cursor to TCTemp(2) the position for the value and press Temp(3) [Enter] Flag(1) Flag(2) Flag(3) Flag(4) Move the cursor to desired field and press [Enter] TCTemp(3) : 24.9496


FIGURE 112: CR1000KD Real-Time Custom

New values are displayed as they are stored.

To delete a field, move the cursor to that field and press [DEL]


## 8.11.2.3 Final-Storage Data

FIGURE 113: Keyboard and Display: Final Storage Data

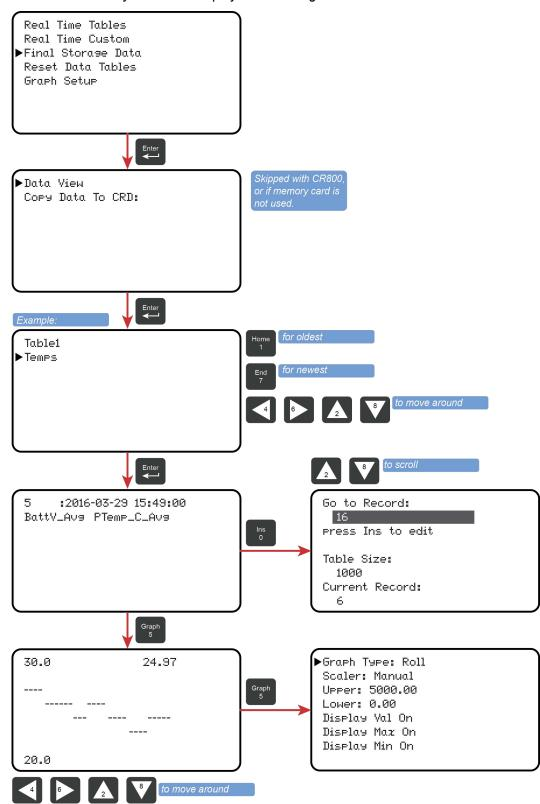


# 8.11.3 Run/Stop Program

FIGURE 114: Keyboard and Display: Run/Stop Program

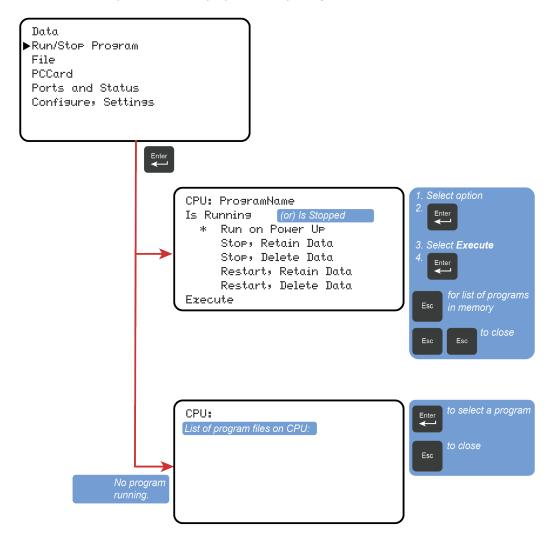

## 8.11.4 File Management

FIGURE 115: Keyboard and Display: File Management

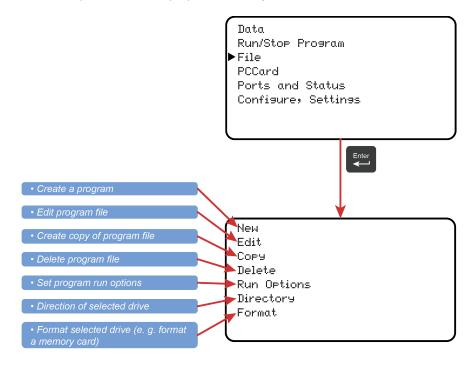

### 8.11.4.1 File Edit


The *CRBasic Editor* is recommended for writing and editing datalogger programs. When making minor changes with the CR1000KD Keyboard/Display, restart the program to activate the changes, but be aware that, unless programmed for otherwise, all variables, etc. will be reset. Remember that the only copy of changes is in the CR3000 until the program is retrieved using datalogger support software or removable memory.

Nеи ▶Edit Copy Delete Run Options Directory Format Enter CPU: ▶ProgramName1 ProgramName2 Save Changes? Yes No Return to Edit Enter CR1000 INSERT ProgramName1 Instruction Function Public TREF, TC(3), Flas(8) Blank Line Block Insert Off DataTable (Temps1, 1000) Sample (1,TREF,IEEE4) Sample (3,TC(),IEEE4) Enter directly or Edit instruction **ENTER** DataTable ▶Edit Instruction • TableName >Temps Blank Line TrigVar Create Block 1 Size 1000 Move cursor to highlight DataTable(Temps,1,1000) Block Commands Sample(1,TREF,IEEE4) Сору Sample(3,TC(),IEEE4) Cut Enter EndTable Delete BeginProg Scan(1,sec,3,0)

FIGURE 116: Keyboard and Display: File Edit

## 8.11.5 PCCard (Memory Card) Management

FIGURE 117: Keyboard and Display: PCCard (Memory Card) Management

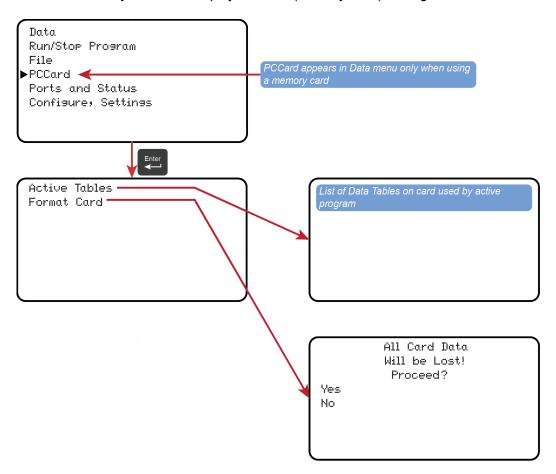


## 8.11.6 Port Status and Status Table

Read More See Info Tables and Settings (p. 567).

FIGURE 118: Keyboard and Display: Port Status and Status Table

## 8.11.7 Settings

FIGURE 119: Keyboard and Display: Settings

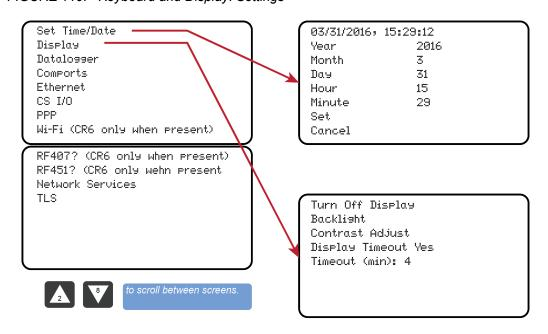

### 8.11.7.1 CR1000KD: Set Time / Date


Move the cursor to time element and press **Enter** to change it. Then move the cursor to **Set** and press **Enter** to apply the change.

## 8.11.7.2 CR1000KD: PakBus Settings

In the **Settings** menu, move the cursor to the PakBus® element and press **Enter** to change it. After modifying, press **Enter** to apply the change.

## 8.11.8 Configure Display

FIGURE 120: Keyboard and Display: Configure Display

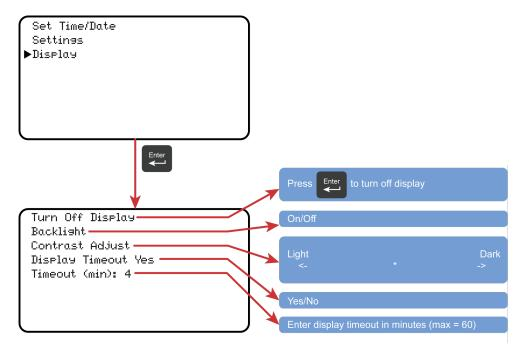

## 8.12 CPI Port and CDM Devices — Details

### Related Topics:

- CPI Port and CDM Devices Overview (p. 66)
- CPI Port and CDM Devices Details (p. 494)

See *Appendix C* in *CDM-VW300 Dynamic Vibrating Wire Analyzers* instruction manual, which is available at *www.campbellsci.com/manuals*.

CPI has the following power levels:

- Off not used
- High power fully active

- Low-power standby whenever possible
- Low-power bus sets bus and modules to low power

## 9. Maintenance — Details

```
Related Topics:

• Maintenance — Overview (p. 89)
```

Maintenance — Details (p. 497)

- Protect the CR3000 from humidity and moisture.
- Replace the internal lithium battery periodically.
- Send to Campbell Scientific for factory calibration every three years.

## 9.1 Protection from Moisture — Details

```
Protection from Moisture — Overview (p. 89)
Protection from Moisture — Details (p. 112)
Protection from Moisture — Products (p. 622)
```

When humidity levels reach the dew point, condensation occurs and damage to CR3000 electronics can result. Effective humidity control is the responsibility of the user. The CR3000 module is protected by a packet of silica gel desiccant, which is installed at the factory. This packet is replaced whenever the CR3000 is repaired at Campbell Scientific. The module should not normally be opened except to replace the internal lithium battery.

Adequate desiccant should be placed in the instrumentation enclosure to provide added protection.

# 9.2 Internal Battery — Details

**CAUTION** Fire, explosion, and severe-burn hazard. Misuse or improper installation of the internal lithium battery can cause severe injury. Do not recharge, disassemble, heat above 100 °C (212 °F), solder directly to the cell, incinerate, or expose contents to water. Dispose of spent lithium batteries properly.

The CR3000 contains a lithium battery that operates the clock and SRAM when the CR3000 is not powered. The CR3000 does not draw power from the lithium battery while it is fully powered by a *power supply (p. 86)*. In a CR3000 stored at room temperature, the lithium battery should last approximately three years (less at temperature extremes). In installations where the CR3000 remains powered, the lithium cell should last much longer.

While powered from an external source, the CR3000 measures the voltage of the lithium battery ever 24 hours. This voltage is displayed in the **Status** table (see *Info Tables and Settings (p. 567))* in the **Lithium Battery** field. A new battery


supplies approximately 3.6 Vdc. Replace the battery when voltage is approximately 2.7 Vdc.

- When the lithium battery is removed (or is allowed to become depleted below 2.7 Vdc and CR3000 primary power is removed), the CRBasic program and most settings are maintained, but the following are lost:
  - o Run-now and run-on power-up settings.
  - Routing and communication logs (relearned without user intervention).
  - o Time. Clock will need resetting when the battery is replaced.
  - Final-memory data tables.


A replacement lithium battery can be purchased from Campbell Scientific or another supplier. Table *Internal Lithium Battery Specifications (p. 498)* lists battery part numbers and key specifications.


TABLE 122: Internal Lithium Battery Specifications			
Manufacturer	Tadiran		
Tadiran Model Number	TL-5902/S		
Campbell Scientific, Inc. pn	13519		
Voltage	3.6 V		
Capacity	1.2 Ah		
Self-discharge rate	1%/year @ 20 °C		
Operating temperature range	−55 to 85 °C		

FIGURE 121: Loosen Thumbscrews

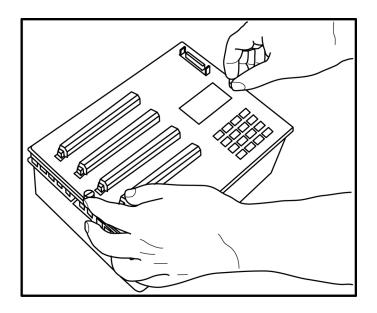

Turn off the CR3000 by switching off power at the switch located on the base, and / or remove the external power connection. Loosen the two thumbscrews on the face of the CR3000 and remove it from the base. If the CR3000 has a battery base, carefully disconnect the internal power plug that connects the base to the CR3000 module.



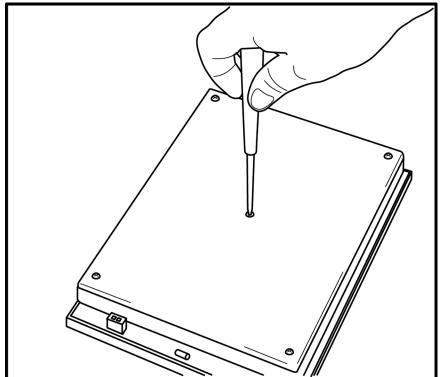

Invert the module onto a non-abrasive surface. Remove the five cover retainer screws. Carefully remove the cover. Gentle use of a small flat point screwdriver to work the cover out of its seat may help.

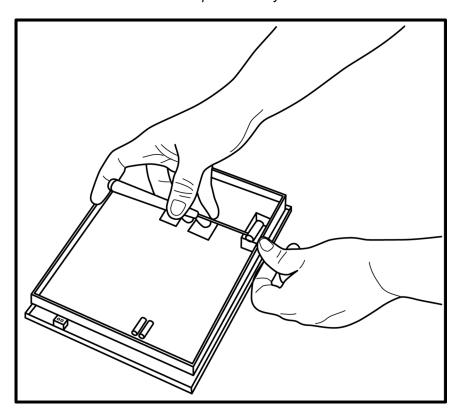


FIGURE 123: Remove and Replace Battery

Remove the lithium battery by gently prying it out with a small flat point screwdriver. Reverse the disassembly procedure to reassemble the CR3000. Take particular care to ensure the back cover is seated tightly before replacing the retainer screws.

# 9.3 Factory Calibration or Repair Procedure

#### **Related Topics**

- Auto Self-Calibration Overview (p. 93)
- Auto Self-Calibration Details (p. 373)
- Auto Self-Calibration Errors (p. 515)
- Offset Voltage Compensation (p. 347)
- Factory Calibration (p. 90)
- Factory Calibration or Repair Procedure (p. 500)

If sending the CR3000 to Campbell Scientific for calibration or repair, consult first with a Campbell Scientific support engineer. If the CR3000 is malfunctioning, be prepared to perform some troubleshooting procedures while on the phone with the support engineer. Many problems can be resolved with a telephone conversation. If calibration or repair is needed, the following procedures should be followed when sending the product:

Products may not be returned without prior authorization. The following contact information is for US and International customers residing in countries served by

Campbell Scientific, Inc. directly. Affiliate companies handle repairs for customers within their territories. Please visit www.campbellsci.com to determine which Campbell Scientific company serves your country.

To obtain a Returned Materials Authorization (RMA), contact CAMPBELL SCIENTIFIC, INC., phone (435) 227-9000. After a support engineer determines the nature of the problem, an RMA number will be issued. Please write this number clearly on the outside of the shipping container. Campbell Scientific's shipping address is:

#### CAMPBELL SCIENTIFIC, INC.

RMA#\_\_\_\_\_ 815 West 1800 North Logan, Utah 84321-1784

For all returns, the customer must fill out a "Statement of Product Cleanliness and Decontamination" form and comply with the requirements specified in it. The form is available from our web site at <a href="www.campbellsci.com/repair">www.campbellsci.com/repair</a>. A completed form must be either emailed to <a href="repair@campbellsci.com">repair@campbellsci.com</a> or faxed to 435-227-9106. Campbell Scientific is unable to process any returns until we receive this form. If the form is not received within three days of product receipt or is incomplete, the product will be returned to the customer at the customer's expense. Campbell Scientific reserves the right to refuse service on products that were exposed to contaminants that may cause health or safety concerns for our employees.

# 10. Troubleshooting

If a system is not operating properly, please contact a Campbell Scientific support engineer for assistance. When using sensors, peripheral devices, or comms hardware, look to the manuals for those products for additional help.

**Note** If a Campbell Scientific product needs to be returned for repair or recalibration, a *Return Materials Authorization* (p. 5) number is first required. Please contact a Campbell Scientific support engineer.

## 10.1 Troubleshooting — Essential Tools

- Multimeter (combination volt meter and resistance meter). Inexpensive (\$20.00) meters are useful. The more expensive meters have additional modes of operation that are useful in some situations.
- Cell or satellite phone with contact information for Campbell Scientific support engineers. Establish a current contact at Campbell Scientific before going to the field. A support engineer may be able to provide you with information that will better prepare you for the field visit.
- Product documentation in a reliable format and easily readable at the installation site. Sun glare, dust, and moisture often make electronic media difficult to use and unreliable.

## 10.2 Troubleshooting — Basic Procedure

- Check the voltage of the primary power source at the POWER IN terminals on the face of the CR3000.
- 2. Check wires and cables for the following:
  - Loose connection points
  - Faulty connectors
  - o Cut wires
  - Damaged insulation, which allows water to migrate into the cable.
     Water, whether or not it comes in contact with wire, can cause system failure. Water may increase the dielectric constant of the cable sufficiently to imped sensor signals, or it may migrate into the sensor, which will damage sensor electronics.
- 3. Check the CRBasic program. If the program was written solely with *Short Cut*, the program is probably not the source of the problem. If the program was written or edited with *CRBasic Editor*, logic and syntax errors could easily have crept into the code. To troubleshoot, create a stripped down version of the program, or break it up into multiple smaller units to test individually. For

example, if a sensor signal-to-data conversion is faulty, create a program that only measures that sensor and stores the data, absent from all other inputs and data. Write these mini-programs before going to the field, if possible.

## 10.3 Troubleshooting — Error Sources

Data acquisition systems are complex, the possible configurations endless, and permutations mind boggling. Nevertheless, by using a systematic approach using the principle of independent verification, the root cause of most errors can be determined and remedies put into effect.

Errors are indicated by multiple means, a few of which actually communicate using the word **Error**. Things that indicate that a closer look should be taken include:

- Error
- NAN
- INF
- Rapidly changing measurements
- Incorrect measurements

These occur in different forms and in different places.

A key concept in troubleshooting is the concept of *independent verification*, which is use of outside references to verify the function of dis-function of a component of the system. For example, a multimeter is an independent measurement device that can be used to check sensor signal, sensor resistance, power supplies, cable continuity, excitation and control outputs, and so forth.

A very good place to start looking for trouble is in the data produced by the system. At the root, you must be able to look at the data and determine if it falls within a reasonable range. For example, consider an application measuring photosynthetic photon flux (PPF). PPF ranges from 0 (dark) to about 2000 µmoles m<sup>-2</sup> s<sup>-1</sup>. If the measured value is less than 0 or greater than 2000, an error is probably being introduced somewhere in the system. If the measured value is 1000 at noon under a clear summer sky, an error is probably being introduced somewhere in the system.

Error sources usually fall into one or more of the following categories:

- CRBasic program
  - if the program was written completely by Short Cut, errors are very rare.
  - if the program was written or edited by a person, errors are much more common.

 Channel assignments, input-range codes, and measurement mode arguments are common sources of error.

#### • Hardware

- o Mis-wired sensors or power sources are common.
- o Damaged hardware
- o Water, humidity, lightning, voltage transients, EMF
- Visible symptoms
- Self-diagnostics
- Watchdog errors
- Firmware
  - Operating system bugs are rare, but possible.
- Datalogger support software
  - o Bugs are uncommon, but do occur.
- Externally caused errors

# 10.4 Troubleshooting — Status Table

Information in the **Status** table lends insight into many problems. *Info Tables and Settings (p. 567)* documents **Status** table fields and provides some insights as to how to use the information in troubleshooting.

Review *Status Table as Debug Resource* (p. 510). Many of these errors match up with like-sounding errors in the Station Status utility in datalogger support software.

# 10.5 Troubleshooting — CRBasic Programs

Analyze data soon after deployment to ensure the CR3000 is measuring and storing data as intended. Most measurement and data-storage problems are a result of one or more CRBasic program bugs.

# 10.5.1 Program Does Not Compile

Although the *CRBasic Editor* compiler states that a program compiles OK, the program may not run or even compile in the CR3000. This is rare, but reasons may include:

• The CR3000 has a different (usually older) operating system that is not fully compatible with the PC compiler. Check the two versions if in

doubt. The PC compiler version is shown on the first line of the compile results.

- The program has large memory requirements for data tables or variables and the CR3000 does not have adequate memory. This normally is flagged at compile time, in the compile results. If this type of error occurs, check the following:
  - Copies of old programs on the CPU: drive. The CR3000 keeps copies of all program files unless they are deleted, the drive is formatted, or a new operating system is loaded with *DevConfig (p. 113)*.
  - O That the USR: drive, if created, is not too large. The USR: drive may be using memory needed for the program.
  - that a memory card (CF) is not available when a program is attempting to access the CRD: drive. This can only be a problem if a TableFile() or CardOut() instruction is included in the program.

# 10.5.2 Program Compiles / Does Not Run Correctly

If the program compiles but does not run correctly, timing discrepancies are often the cause. Neither *CRBasic Editor* nor the CR3000 compiler attempt to check whether the CR3000 is fast enough to do all that the program specifies in the time allocated. If a program is tight on time, look further at the execution times. Check the measurement and processing times in the **Status** table (**MeasureTime**, **ProcessTime**, **MaxProcTime**) for all scans, then try experimenting with the **InstructionTimes()** instruction in the program. Analyzing **InstructionTimes()** results can be difficult due to the multitasking nature of the logger, but it can be a useful tool for fine tuning a program.

### 10.5.3 NAN and ±INF

NAN (not-a-number) and ±INF (infinite) are data words indicating an exceptional occurrence in datalogger function or processing. NAN is a constant that can be used in expressions as shown in the following code snip that sets a CRBasic control feature (a flag) if the wind direction is NAN:

```
If WindDir = NAN Then
  WDFlag = False
Else
  WDFlag = True
EndIf
```

NAN can also be used in conjunction with the disable variable (*DisableVar*) in output processing (data storage) instructions as shown in CRBasic example *Using NAN to Filter Data* (p. 509).

#### 10.5.3.1 Measurements and NAN

A NAN indicates an invalid measurement.

### 10.5.3.1.1 Voltage Measurements

The CR3000 has the following user-selectable voltage ranges:  $\pm 5000$  mV,  $\pm 1000$  mV,  $\pm 200$  mV, and  $\pm 50$  mV. Input signals that exceed these ranges result in an over-range indicated by a NAN for the measured result. With auto range to automatically select the best input range, a NAN indicates that either one or both of the two measurements in the auto-range sequence over ranged. See *Troubleshooting* — *Auto Self-Calibration Errors*.

A voltage input not connected to a sensor is floating and the resulting measured voltage often remains near the voltage of the previous measurement. Floating measurements tend to wander in time, and can mimic a valid measurement. The C (open input detect/common-mode null) range-code option is used to force a NAN result for open (floating) inputs.

#### 10.5.3.1.2 SDI-12 Measurements

**NAN** is loaded into the first **SDI12Recorder()** variable under the following conditions:

- CR3000 is busy with terminal commands
- When the command is an invalid command.
- When the sensor aborts with CR LF and there is no data.
- When 0 is returned for the number of values in response to the M! or C! command.

### 10.5.3.2 Floating-Point Math, NAN, and ±INF

#### Related Topics:

- Floating-Point Arithmetic (p. 170)
- Floating-Point Math, NAN, and ±INF (p. 507)
- TABLE: Data Types in Variable Memory (p. 137)

Table Math Expressions and CRBasic Results (p. 508) lists math expressions, their CRBasic form, and IEEE floating point-math result loaded into variables declared as FLOAT or STRING.

### 10.5.3.3 Data Types, NAN, and ±INF

**NAN** and  $\pm$ **INF** are presented differently depending on the declared-variable data type. Further, they are recorded differently depending on the final-memory data type chosen compounded with the declared-variable data type used as the source (*TABLE*: Variable and FS Data Types with NAN and  $\pm$ INF (p. 508)). For example,

INF, in a variable declared **As LONG**, is represented by the integer – **2147483648**. When that variable is used as the source, the final-memory word when sampled as UINT2 is stored as 0.

TABLE 123: Math Expressions and CRBasic Results			
Expression	CRBasic Expression	Result	
0 / 0	0 / 0	NAN	
$\infty - \infty$	(1 / 0) - (1 / 0)	NAN	
(−1) <sup>∞</sup>	-1 ^ (1 / 0)	NAN	
0 • −∞	0 · (-1 · (1 / 0))	NAN	
±∞ / ±∞	(1 / 0) / (1 / 0)	NAN	
1 <sup>∞</sup>	1 ^ (1 / 0)	NAN	
0 • ∞	0 · (1 / 0)	NAN	
x / 0	1 / 0	INF	
x / -0	1 / -0	INF	
-x / 0	-1 / 0	-INF	
-x / -0	-1 / -0	-INF	
$\infty_0$	(1 / 0) ^ 0	INF	
$0^{\infty}$	0 ^ (1 / 0)	0	
00	0 ^ 0	1	

TABLE 124: Variable and Final-Storage Data Types with NAN and ±INF										
				Final-Storage Data Type & Associated Stored Values						
Variable Type	Test Expressio n	Public / Dim Variables	FP2	IEEE4	UINT2	UNIT4	STRING	BOOL	BOOL8	LONG
As FLOAT	1/0	INF	INF1	INF1	655352	4294967295	+INF	TRUE	TRUE	2,147,483,647
	0 / 0	NAN	NAN	NAN	0	2147483648	NAN	TRUE	TRUE	-2,147,483,648
As LONG	1 / 0	2,147,483,64 7	7999	2.147484E09	65535	2147483647	2147483647	TRUE	TRUE	2,147,483,647
	0 / 0	2,147,483,64 8	-7999	- 2.147484E09	0	2147483648	-2147483648	TRUE	TRUE	-2,147,483,648
As Boolean	1/0	TRUE	-1	-1	65535	4294967295	-1	TRUE	TRUE	-1
	0 / 0	TRUE	-1	-1	65535	4294967295	-1	TRUE	TRUE	-1
As STRING	1/0	+INF	INF	INF	65535	2147483647	+INF	TRUE	TRUE	2147483647
	0 / 0	NAN	NAN	NAN	03	2147483648	NAN	TRUE	TRUE	-2147483648

<sup>&</sup>lt;sup>1</sup> Except Average() outputs NAN

### 10.5.3.4 Output Processing and NAN

When a measurement or process results in NAN, any output process with *DisableVar* = FALSE that includes an NAN measurement. For example,

Average(1,TC\_TempC,FP2,False)

will result in NAN being stored as final-storage data for that interval.

However, if *DisableVar* is set to TRUE each time a measurement results in NAN, only non-NAN measurements will be included in the output process. CRBasic example *Using NAN to Filter Data (p. 509)* demonstrates the use of conditional statements to set *DisableVar* to TRUE as needed to filter NAN from output processes.

**Note** If all measurements result in **NAN**, **NAN** will be stored as final-storage data regardless of the use of *DisableVar*.

<sup>&</sup>lt;sup>2</sup> Except **Average()** outputs **0** 

<sup>&</sup>lt;sup>3</sup> 65535 in operating systems prior to v. 28

```
CRBasic EXAMPLE 79: Using NAN to Filter Data
'This program example demonstrates the use of NAN to filter what data are used in output processing
functions such as
'averages, maxima, and minima.
'Declare Variables and Units
Public TC_RefC
Public TC_TempC
Public DisVar As Boolean
'Define Data Tables
DataTable(TempC_Data,True,-1)
  DataInterval(0,30,Sec,10)
                                              'Output process
  Average(1,TC_TempC,FP2,DisVar)
EndTable
'Main Program
BeginProg
  Scan(1, Sec, 1, 0)
    'Measure Thermocouple Reference Temperature
   PanelTemp(TC_RefC,250)
    'Measure Thermocouple Temperature
   TCDiff(TC_TempC,1,mV20,1,TypeT,TC_RefC,True,0,250,1.0,0)
    'DisVar Filter
    If TC_TempC = NAN Then
      DisVar = True
      DisVar = False
    EndIf
    'Call Data Tables and Store Data
   CallTable(TempC_Data)
 NextScan
EndProg
```

# 10.5.4 Status Table as Debug Resource

#### Related Topics:

- Info Tables and Settings (p. 567)
- Common Uses of the Status Table (p. 569)
- Status Table as Debug Resource (p. 510)

Consult the CR3000 **Status** table when developing a program or when a problem with a program is suspected. Critical **Status** table fields to review include **CompileResults**, **SkippedScan**, **SkippedSlowScan**, **SkippedRecord**, **ProgErrors**, **MemoryFree**, **VarOutOfBounds**, **WatchdogErrors** and **Calibration**.

#### 10.5.4.1 CompileResults

**CompileResults** reports messages generated by the CR3000 at program upload and compile-time. Messages may also added as the program runs. Error

messages may not be obvious because the display is limited. Much of this information is more easily accessed through the *datalogger support software* (p. 91) station status report. The message reports the following:

- program compiled OK
- warnings about possible problems
- run-time errors
- variables that caused out-of-bounds conditions
- watchdog information
- memory errors

Warning messages are posted by the CRBasic compiler to advise that some expected feature may not work. Warnings are different from error messages in that the program will still operate when a warning condition is identified.

A rare error is indicated by **mem3 fail** type messages. These messages can be caused by random internal memory corruption. When seen on a regular basis with a given program, an operating system error is indicated. **Mem3 fail** messages are not caused by user error, and only rarely by a hardware fault. Report any occurrence of this error to a Campbell Scientific support engineer, especially if the problem is reproducible. Any program generating these errors is unlikely to be running correctly.

Examples of some of the more common warning messages are listed in table *Warning Message Examples (p. 511)*.

TABLE 125: Warning Message Examples			
Message	Meaning		
• CPU:DEFAULT.CR1 Compiled in PipelineMode.			
• Error(s) in CPU:NewProg.CR1:	A new program sent to the datalogger failed to compile, and the datalogger reverted to running DEFAULT.cr3.		
• line 13: Undeclared variable Battvolt.			
Warning: Cannot open include file CPU: Filename.cr3	The filename in the Include instruction does not match any file found on the specified drive. Since it was not found, the portion of code referenced by Include will not be executed.		
Warning: Cannot open voice.txt	voice.txt, a file required for use with a COM310 voice phone modem, was not found on the CPU: drive.		
Warning: COM310 word list cannot be a variable.	The <i>Phrases</i> parameter of the <b>VoicePhrases()</b> instruction was assigned a variable name instead of the required string of comma-separated words from the Voice.TXT file.		

TABLE 125: Warning Message Examples			
Message	Meaning		
Warning: Compact Flash Module not detected: CardOut not used.	CardOut() instructions in the program will be ignored because no memory card was detected when the program compiled.		
Warning: EndIf never reached at runtime.	Program will never execute the <b>EndIf</b> instruction. In this case, the cause is a <b>Scan()</b> with a <i>Count</i> parameter of 0, which creates an infinite loop within the program logic.		
Warning: Internal Data Storage Memory was re-initialized.	Sending a new program has caused final-memory to be re-allocated.  Previous data are no longer accessible.		
Warning: Machine self-calibration failed.	Indicates a problem with the analog measurement hardware during the auto self-calibration. An invalid external sensor signal applying a voltage beyond the internal ±8 Vdc supplies on a voltage input can induce this error. Removing the offending signal and powering up the logger will initiate a new auto self-calibration. If the error does not occur on power-up, the problem is corrected. If no invalid external signals are present and / or auto self-calibration fails again on power-up, the CR3000 should be repaired by a qualified technician.		
Warning: Slow Seq 1, Scan 1, will skip scans if running with Scan 1	<b>SlowSequence</b> scan rate is <= main scan rate. This will cause skipped scans on the <b>SlowSequence</b> .		
Warning: Table [tablename] is declared but never called.	No data will be stored in [tablename] because there is no CallTable() instruction in the program that references that table.		
Warning: Units: a_units_name_that_is_more_than _38_chara too long will be truncated to 38 chars.	The label assigned with the <b>Units</b> argument is too long and will be truncated to the maximum allowed length.		
Warning: Voice word TEH is not in Voice.TXT file	The misspelled word TEH in the <b>VoiceSpeak()</b> instruction is not found in Voice.TXT file and will not be spoken by the voice modem.		
Voltage calibration failure!	Loose wire probably of a bridge sensor such as a wind vane or pressure transducer		

## 10.5.4.2 SkippedScan

Skipped scans are caused by long programs with short scan intervals, multiple Scan() / NextScan instructions outside a SubScan() or SlowSequence, frame errors, or by other operations that occupy the processor at scan start time. Occasional skipped scans may be acceptable but should be avoided. Skipped scans may compromise frequency measurements made on terminals configured for pulse input. The error occurs because counts from a scan and subsequent skipped scans are regarded by the CR3000 as having occurred during a single scan. The measured frequency can be much higher than actual. Be careful that

scans that store data are not skipped. If any scan skips repeatedly, optimization of the datalogger program or reduction of on-line processing may be necessary.

Skipped scans in Pipeline Mode indicate an increase in the maximum buffer depth is needed. Try increasing the number of scan buffers (third parameter of the **Scan()** instruction) to a value greater than that shown in the **MaxBuffDepth** register in the **Status** table.

### 10.5.4.3 SkippedSystemScan

The CR3000 automatically runs a slow sequence to update the calibration table. When the calibration slow sequence skips, the CR3000 will try to repeat that step of the calibration process next time around. This simply extends calibration time.

### 10.5.4.4 SkippedRecord

**SkippedRecord** is normally incremented when a write-to-data-table event is skipped, which usually occurs because a scan is skipped. **SkippedRecord** is not incremented by all events that leave gaps in data, including cycling power to the CR3000.

### 10.5.4.5 ProgErrors

Should be **0**. If not, investigate.

### 10.5.4.6 MemoryFree

A number less than 4 kB is too small and may lead to memory-buffer related errors

#### 10.5.4.7 VarOutOfBounds

#### Related Topics:

- Declaring Arrays (p. 144)
- VarOutOfBounds (p. 513)

When programming with variable arrays, care must be taken to match the array size to the demands of the program. For example, if an operation attempts to write to 16 elements in array ExArray(), but ExArray() was declared with 15 elements (for example, Public ExArray(15)), the VarOutOfBound runtime error counter is incremented in the Status table each time the absence of a sixteenth element is encountered.

The CR3000 attempts to catch **VarOutOfBound** errors at compile time (not to be confused with the *CRBasic Editor* pre-compiler, which does not). When a **VarOutOfBound** error is detected at compile time, the CR3000 attempts to document which variable is out of bounds at the end of the **CompileResults** message in the **Status** table. For example, the CR3000 may detect that **ExArray()** is not large enough and write **Warning:Variable ExArray out of bounds** to the **CompileErrors** field.

The CR3000 does not catch all out-of-bounds errors, so take care that all arrays are sized as needed.

### 10.5.4.8 Watchdog Errors

Watchdog errors indicate the CR3000 has crashed and reset itself. A few watchdogs indicate the CR3000 is working as designed and are not a concern.

Following are possible root causes sorted in order of most to least probable:

- Transient voltage
- Running the CRBasic program very fast
- Many PortSet() instructions back-to-back with no delay
- High-speed serial data on multiple ports with very large data packets or bursts of data

If any of the previous are not the apparent cause, contact a Campbell Scientific support engineer for assistance. Causes that require assistance include the following:

- Memory corruption. Check for memory failures with **M** command in *terminal mode (p. 523)*.
- Operating-system problem
- Hardware problem

Watchdog errors may cause comms disruptions, which can make diagnosis and remediation difficult. The CR1000KD Keyboard/Display will often work as a user interface when comms fail. Information on CR3000 crashes may be found in three places.

- WatchdogErrors (p. 593) field in the Status table
- Watchdog.txt file on the *CPU: drive (p. 446)*. Some time may elapse between when the error occurred and the Watchdog.txt file is created. Not all errors cause a file to be created. Any time a watchdog.txt file is created, please consult with a Campbell Scientific support engineer.
- Crash information may be posted at the end of the CompileResults (p. 579) register in the Status table.

## 10.5.4.8.1 Status Table WatchdogErrors

Non-zero indicates the CR3000 has crashed, which can be caused by power or transient-voltage problems, or an operating-system or hardware problem. If power or transient problems are ruled out, the CR3000 probably needs an operating-system update or *repair* (p. 5) by Campbell Scientific.

### 10.5.4.8.2 Watchdoginfo.txt File

A WatchdogInfo.txt file is created on the CPU: drive when the CR3000 experiences a software reset (as opposed to a hardware reset that increment the WatchdogError field in the Status table). Postings of WatchdogInfo.txt files are rare. Please consult with a Campbell Scientific support engineer at any occurrence.

Debugging beyond identifying the source of the watchdog is quite involved. Please contact a Campbell Scientific support engineer for assistance. Key things to look for include the following:

- Are multiple tasks waiting for the same resource? This is always caused by a software bug.
- In newer operating systems, there is information about the memory regions. If anything like ColorX: fail is seen, this means that the memory is corrupted.
- The comms memory information can also be a clue for PakBus and TCP triggered watchdogs. For example, if COM1 is the source of the watchdog, knowing exactly what is connected to the port and at what baud rate and frequency (how often) the port is communicating are valuable pieces of information.

# 10.6 Troubleshooting — Operating Systems

Updating the CR3000 operating system will sometimes fix a problem. Operating systems are available, free of charge, at www.campbellsci.com/downloads.

Operating systems undergo extensive testing prior to release by a professional team of product testers. However, the function of any new component to a data acquisition system should be thoroughly examined and tested by the integrator and end user.

# 10.7 Troubleshooting — Auto Self-Calibration Errors

#### Related Topics

- Auto Self-Calibration Overview (p. 93)
- Auto Self-Calibration Details (p. 373)
- Auto Self-Calibration Errors (p. 515)
- Offset Voltage Compensation (p. 347)
- Factory Calibration (p. 90)
- Factory Calibration or Repair Procedure (p. 500)

Auto-calibration errors are rare. When they do occur, the cause is usually an analog input that exceeds the input limits of the CR3000.

• Check all analog inputs to make sure they are not greater than ±5 Vdc by measuring the voltage between the input and a G terminal. Do this with a *multi-meter* (p. 546).

- Check for condensation, which can sometimes cause leakage from a 12 Vdc source terminal into other places.
- Check for a lose ground wire on a sensor powered from a 12V or SW12 terminal.
- If a multimeter is not available, disconnect sensors, one at a time, that require power from 9 to 16 Vdc. If measurements return to normal, you have found the cause.

# 10.8 Troubleshooting — Communications

### 10.8.1 RS-232

With newer system, USB enumeration can be a big problem. For example, if your PC is supporting three external screens, a keyboard, a mouse, and other USB connections, such as your datalogger connection, on a USB expansion box, the set up is rife with potential for enumeration mishaps. The best way to resolve a USB problem with a datalogger connection is to remove as many USB devices as possible, completely power down the system (disconnect the system from AC power and UPS devices, then power the system back up, then connect the datalogger, check that it is working with the support software, then reconnect all other devices one by one.

On system using nine-pin serial connections, a simple way to test a PC serial port is to physically connect pin 2 on the serial port with pin 3. This connects the transmit to the receive. Using a terminal emulator, you should be able to type a character on the PC keyboard and have it show up on the terminal emulator screen. If it does not show up, you either have the wrong comport selected in the terminal emulator set up, or there may be some other program commandeering the serial port.

Baud rate mis-match between the CR3000 and *datalogger support software* (p. 91) is often the cause of communication problems. By default, CR3000 baud rate auto-adjusts to match that of the software. However, settings changed in the CR3000 to accommodate a specific RS-232 device, such as a smart sensor, display or modem, may confine the RS-232 port to a single baud rate. If the baud rate can be guessed at and entered into support software parameters, communications may be established. Once communications are established, CR3000 baud rate settings can be changed. Clues as to what the baud rate may be set at can be found by analyzing current and previous CR3000 programs for the **SerialOpen()** instruction, since **SerialOpen()** specifies a baud rate. Documentation provided by the manufacturer of the previous RS-232 device may also hint at the baud rate.

# 10.8.2 Communicating with Multiple PCs

The CR3000 can communicate with multiple PCs simultaneously. For example, the CR3000 may be a node of an internet PakBus network communicating with a distant instance of *LoggerNet*. An onsite technician can communicate with the CR3000 using *PC200W* with a serial connection, so long as the PakBus addresses

of the host PCs are different. All Campbell Scientific datalogger support software include an option to change PC PakBus addressing.

See CommMemFree (p. 578).

# 10.8.3 Comms Memory Errors

The status array CommsMemFree() (p. 578, p. 579, p. 579) may indicate when a communication memory error occurs. If any of the three CommsMemFree() array fields are at or near zero, assistance may be required from Campbell Scientific.

# 10.9 Troubleshooting — Power Supplies

#### Related Topics:

- Power Input Terminals Specifications
- Power Supplies Quickstart (p. 39)
- Power Supplies Overview (p. 86)
- Power Supplies Details (p. 98)
- Power Supplies Products (p. 618)
- Power Sources (p. 99)
- Troubleshooting Power Supplies (p. 517)

# 10.9.1 Troubleshooting Power Supplies — Overview

Power-supply systems may include batteries, charging regulators, and a primary power source such as solar panels or ac/ac or ac/dc transformers attached to mains power. All components may need to be checked if the power supply is not functioning properly.

Check connections. Check polarity of connections.

Base diagnostic: connect the datalogger to a new 12 V battery (a small 12 V battery carrying a full charge would be a good thing to carry in your troubleshooting tool kit). Watch the polarity of the connection. + to +, - to -. If the datalogger powers up and works, troubleshoot the datalogger power supply.

Troubleshooting Power Supplies — Procedures (p. 518) includes the following flowcharts for diagnosing or adjusting power equipment supplied by Campbell Scientific:

- Battery-voltage test
- Charging-circuit test (when using an unregulated solar panel)
- Charging-circuit test (when using a transformer)
- Adjusting charging circuit

If power supply components are working properly and the system has peripherals with high current drain, such as a satellite transmitter, verify that the power supply is designed to provide adequate power. Information on power supplies available from Campbell Scientific can be obtained at <a href="https://www.campbellsci.com">www.campbellsci.com</a>. Basic information is available in <a href="https://www.campbellsci.com">Power Supplies — List (p. 618)</a>.

# 10.9.2 Troubleshooting Power Supplies — Examples

#### Symptom:

- o CRBasic program does not execute.
- o Low12VCount of the Status table displays a large number.

#### Possible affected equipment:

- o Batteries
- o Charger/regulators
- o Solar panels
- Transformers

#### Likely causes:

- o Batteries may need to be replaced or recharged.
- Charger/regulators may need to be fixed or re-calibrated.
- o Solar panels or transformers may need to be fixed or replaced.


# 10.9.3 Troubleshooting Power Supplies — Procedures

#### Required Equipment:

- o Voltmeter
- 5 kΩ resistor
- $\circ$  50 Ω, 1 watt resistor for the charging circuit tests and to adjust the charging circuit voltage.

### 10.9.3.1 Battery Test


The procedure outlined in this flow chart tests sealed-rechargeable or alkaline batteries in the PS100 charging regulator, or a sealed-rechargeable battery attached to a CH100 charging regulator. If a need for repair is indicated after following the procedure, see *Assistance* (p. 5) for information on sending items to Campbell Scientific.

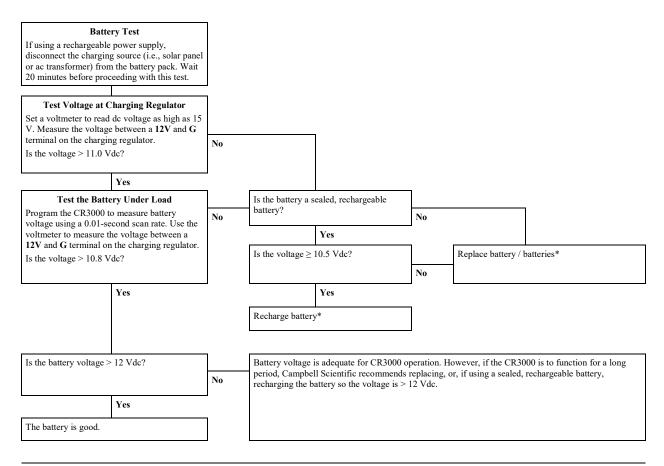

<sup>\*</sup>When using a sealed, rechargeable battery that is recharged with primary power provided by solar panel or ac/ac - ac/dc transformer, testing the charging regulator is recommended. See Charging Regulator with Solar Panel Test (p. 519) or Charging Regulator with Transformer Test (p. 521).


### 10.9.3.2 Charging Regulator with Solar Panel Test

The procedure outlined in this flow chart tests PS100 and CH100 charging regulators that use solar panels as the power source. If a need for repair is indicated after following the procedure, see *Assistance (p. 5)* for information on sending items to Campbell Scientific.

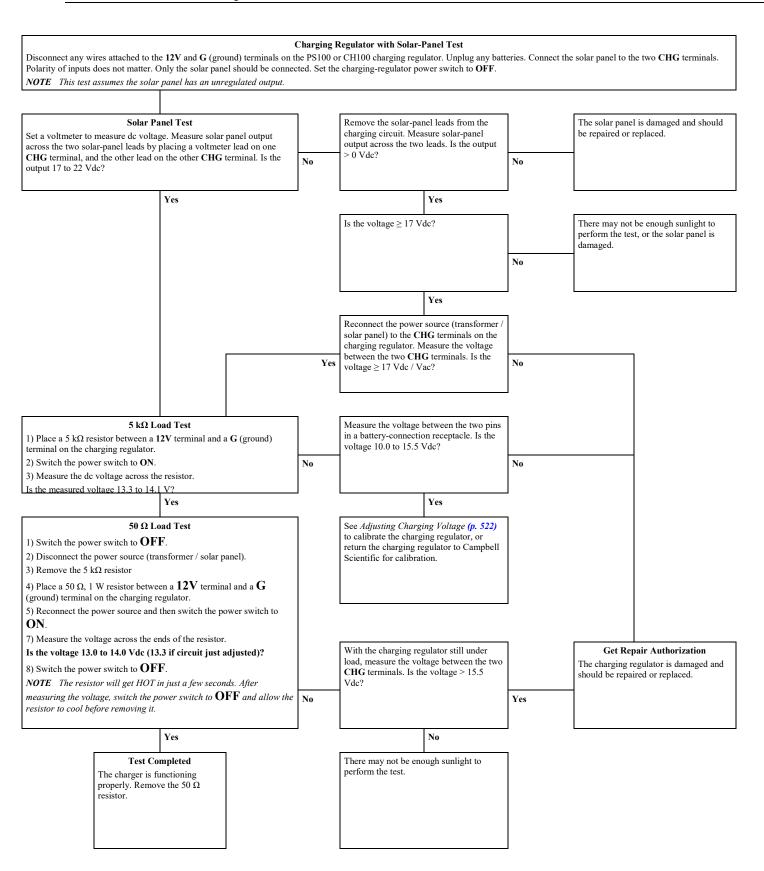

### 10.9.3.3 Charging Regulator with Transformer Test

The procedure outlined in this flow chart tests PS100 and CH100 charging regulators that use ac/ac or ac/dc transformers as power source. If a need for repair is indicated after following the procedure, see *Assistance* (p. 5) for information on sending items to Campbell Scientific.

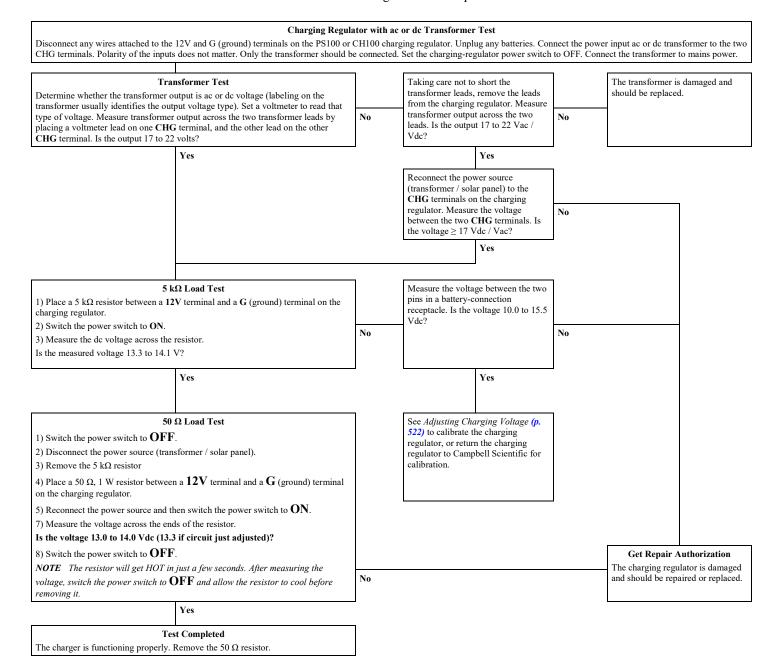

### 10.9.3.4 Adjusting Charging Voltage

**Note** Campbell Scientific recommends that a qualified electronic technician perform the following procedure.

The procedure outlined in this flow chart tests and adjusts PS100 and CH100 charging regulators. If a need for repair or calibration is indicated after following the procedure, see *Assistance* (p. 5) for information on sending items to Campbell Scientific.

### **Adjusting Charging Circuit** 1) Place a 5 k $\Omega$ resistor between a 12V terminal and a G (ground) ground terminal on the charging regulator. Use a voltmeter to measure the voltage across the 5 $k\Omega$ 2) Connect a power source that supplies a voltage >17 V to the input CHG terminals of the charging regulator. 3) Adjust pot R3 (see FIGURE: Potentiometer R3 on PS100 and CH100 Charging Regulators (p. 523) ) so that voltage across the 5 k $\Omega$ resistor is 13.3 Vdc. Can the output voltage be set to 13.3 V? Yes $50~\Omega$ Load Test Get Repair Authorization The charging regulator is damaged and should be repaired 1) Switch the power switch to **OFF**. or replaced. 2) Disconnect the power source (transformer / solar panel). 3) Remove the 5 k $\Omega$ resistor No 4) Place a 50 $\Omega$ , 1 W resistor between a 12V terminal and a G (ground) terminal on the charging regulator. 5) Reconnect the power source and then switch the power switch to **ON**. 7) Measure the voltage across the ends of the resistor. Is the voltage 13.0 to 14.0 Vdc (13.3 if circuit just adjusted)? 8) Switch the power switch to **OFF**. NOTE The resistor will get HOT in just a few seconds. After measuring the voltage, switch the power switch to OFF and allow the resistor to cool before removing it. Yes **Test Completed** The charger is functioning properly. Remove the 50 $\Omega$ resistor.

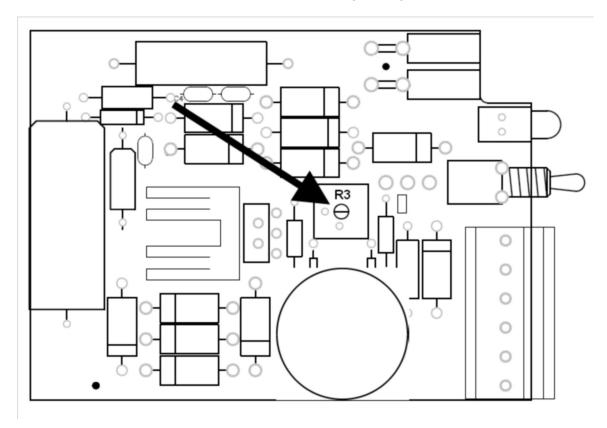


FIGURE 124: Potentiometer R3 on PS100 and CH100 Charger / Regulator

# 10.10 Troubleshooting — Using Terminal Mode

Table CR3000 Terminal Commands (p. 524) lists terminal mode options. With exception of perhaps the C command, terminal options are not necessary to routine CR3000 operations.

To enter terminal mode, connect a PC to the CR3000 with the same hard-wire serial connection used in *What You Will Need (p. 42)*. Open a terminal emulator program. Terminal emulator programs are available in:

- Campbell Scientific *datalogger support software (p. 91) Terminal Emulator (p. 559)* window
- DevConfig (Campbell Scientific Device Configuration Utility Software)
  Terminal tab
- HyperTerminal. Beginning with Windows Vista, HyperTerminal (or another terminal emulator utility) must be acquired and installed separately.


As shown in figure *DevConfig Terminal Tab* (p. 525), after entering a terminal emulator, press **Enter** a few times until the prompt **CR3000**> is returned. Terminal commands consist of a single character and **Enter**. Sending an **H** and **Enter** will return the terminal emulator menu.

**ESC** or a 40 second timeout will terminate on-going commands. Concurrent terminal sessions are not allowed and will result in dropped communications.

<b>TABLE 126:</b>	TABLE 126: CR3000 Terminal Commands			
Command	Description	Use		
0	Scan processing time; real time in seconds	Lists technical data concerning program scans.		
1	Serial FLASH data dump	Campbell Scientific engineering tool		
2	Read clock chip	Lists binary data concerning the CR3000 clock chip.		
3	Status	Lists the CR3000 <b>Status</b> table.		
4	Card status and compile errors	Lists technical data concerning an installed memory card.		
5	Scan information	Technical data regarding the CR3000 scan.		
6	Raw A-to-D values	Technical data regarding analog-to-digital conversions.		
7	VARS	Lists <b>Public</b> table variables.		
8	Suspend / start data output	Outputs all table data. This is not recommended as a means to collect data, especially over comms. Data are dumped as non-error checked ASCII.		
9	Read inloc binary	Lists binary form of <b>Public</b> table.		
A	Operating system copyright	Lists copyright notice and version of operating system.		
В	Task sequencer op codes	Technical data regarding the task sequencer.		
C	Modify constant table	Edit constants defined with ConstTable / EndConstTable. Only active when ConstTable / EndConstTable in the active program.		
D	MTdbg() task monitor	Campbell Scientific engineering tool		
E	Compile errors	Lists compile errors for the current program download attempt.		
F	VARS without names	Campbell Scientific engineering tool		
G	CPU serial flash dump	Campbell Scientific engineering tool		
Н	Terminal emulator menu	Lists main menu.		
I	Calibration data	Lists gains and offsets resulting from internal calibration of analog measurement circuitry.		
J	Download file dump	Sends text of current program including comments.		
K	Unused			
L	Peripheral bus read	Campbell Scientific engineering tool		
M	Memory check	Lists memory-test results		
N	File system information	Lists files in CR3000 memory.		
0	Data table sizes	Lists technical data concerning data-table sizes.		

TABLE 126: CR3000 Terminal Commands			
Command	Description	Use	
P	Serial talk through	Issue commands from keyboard that are passed through the logger serial port to the connected device. Similar in concept to SDI12 Talk Through. No timeout when connected via PakBus.	
REBOOT	Program recompile	Typing "REBOOT" rapidly will recompile the CR3000 program immediately after the last letter, "T", is entered. Table memory is retained. <b>NOTE</b> When typing <b>REBOOT</b> , characters are not echoed (printed on terminal screen).	
SDI12	SDI12 talk through	Issue commands from keyboard that are passed through the CR3000 SDI-12 port to the connected device. Similar in concept to Serial Talk Through.	
T	Unused		
U	Data recovery	Provides the means by which data lost when a new program is loaded may be recovered. See section <i>Troubleshooting</i> — <i>Data Recovery</i> (p. 526) for details.	
V	Low level memory dump	Campbell Scientific engineering tool	
W	Comms Watch (Sniff)	Enables monitoring of CR3000 communication traffic. No timeout when connected via PakBus.	
X	Peripheral bus module identify	Campbell Scientific engineering tool	

### FIGURE 125: DevConfig Terminal Tab

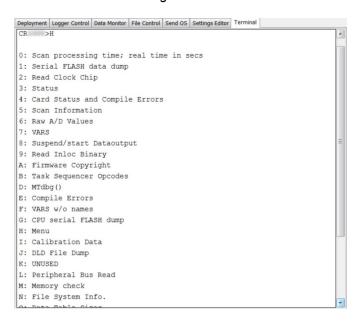

# 10.10.1 Serial Talk Through and Comms Watch

The options do not have a timeout when connected in terminal mode via PakBus. Otherwise **P: Serial Talk** and **W: Comms Watch** ("sniff") modes, the timeout can be changed from the default of 40 seconds to any value ranging from 1 to 86400 seconds (86400 seconds = 1 day).

When using options **P** or **W** in a terminal session, consider the following:

- Concurrent terminal sessions are not allowed by the CR3000.
- Opening a new terminal session will close the current terminal session.
- The CR3000 will attempt to enter a terminal session when it receives non-PakBus characters on the nine-pin RS-232 port or CS I/O port, unless the port is first opened with the SerialOpen() command.

If the CR3000 attempts to enter a terminal session on the nine-pin RS-232 port or CS I/O port because of an incoming non-PakBus character, and that port was not opened using the SerialOpen() command, any currently running terminal function, including the comms watch, will immediately stop. So, in programs that frequently open and close a serial port, the probability is higher that a non-PakBus character will arrive at the closed serial port, thus closing an existing talk-through or comms watch session. If this occurs, the FileManager() setting to send comms watch or sniffer to a file is immune to this problem.

# 10.11 Troubleshooting — Using Logs

Logs are meta data, usually about datalogger or software function. Logs, when enabled, are available at the locations listed in the following table.

TABLE 127: Log Locations			
Software Package	Usual Location of Logs		
LoggerNet	C:\Campbellsci\LoggerNet\Logs		
PC400	C:\Campbellsci\PC400\Logs		
DevConfig	C:\Campbellsci\DevConfig\sys\cora\ Logs		

# 10.12 Troubleshooting — Data Recovery

In rare circumstances, exceptional efforts may be required to recover data that are otherwise lost to conventional data-collection methods. Circumstances may include the following:

- Program control error
  - o A CRBasic program was sent to the CR3000 without specifying that it run on power-up. This is most likely to occur only while using

the Compile, Save and Send feature of older versions of *CRBasic Editor*.

- A new program (even the same program) was inadvertently sent to the CR3000 through the *Connect* client or *Set Up* client in *LoggerNet*.
- O The program was stopped through datalogger support software **File Control** or *LoggerLink* software.
- The CPU: drive was inadvertently formated.
- A network peripheral (NL115, NL120, NL200, or NL240) was added to the CR3000 when there was previously no network peripheral, and so forced the CR3000 to reallocate memory.
- A hardware failure, such as memory corruption, occurred.
- Inserting or removing memory cards will generally do nothing to cause the CR3000 to miss data. These events affect table definitions because they can affect table size allocations, but they will not create a situation where data recovery is necessary.

Data can usually be recovered using the **Datalogger Data Recovery** wizard available in *DevConfig (p. 113)*. Recovery is possible because data in memory is not usually destroyed, only lost track of. So, the wizard recovers "data" from the entire memory, whether or not that memory has been written to, or written to recently.

Once you have run through the recovery procedure, consider the following:

If a CRD: drive (memory card) or a USB: drive (Campbell Scientific mass storage device) has been removed since the data was originally stored, then the **Datalogger Data Recovery** is run, the memory pointer will likely be in the wrong location, so the recovered data will be corrupted. If this is the case, put the CRD: or USB: drive back in place and re-run the **Datalogger Data Recovery** wizard before restarting the CRBasic program.

In any case, even when the recovery runs properly, the result will be that good data is recovered mixed with sections of empty or old junk. With the entire data dump in one file, you can sort through the good and the bad.

# 10.13 Troubleshooting — Miscellaneous Errors

# 10.13.1 Voltage Calibration Error!

An input to an analog channel maybe outside  $\pm 8$  Vdc:

- Use a volt meter to check between each analog input terminal and a ground terminal that analog inputs are not greater than ±5 Vdc.
- Check for condensation which may cause leakage of 12 Vdc into other regions of CR3000 circuitry.

- Check for a loose ground wire on a sensor powered from 12V.
- If a volt meter is not available, disconnect any sensor that is powered from a 12V source to see if the measurements come back to normal. If multiple sensors are power by 12V, disconnect one at a time.

# 10.14 Troubleshooting — Rebooting

Following are ways to reboot the CR3000. Rebooting should be a last resort. Regardless of the method used to reboot, try to collect data from the CR3000 before rebooting as there is a good chance data will be lost during the process. If you can connect using *DevConfig*, try to save CR3000 settings.

- Reboot manually in terminal mode (p. 523): > REBOOT
- Reboot under program control with **Restart** instruction:

```
CRBasic EXAMPLE 80: Reboot under program control with Restart instruction

Public Reboot
BeginProg
Scan()
If Reboot Then
Reboot = false
Restart
EndIf
NextScan
EndProg
```

• Reboot under program control with FileManage() instruction:

```
CRBasic EXAMPLE 81: Reboot under program control with FileManage() instruction:

Public Reboot
BeginProg
Scan()
If Reboot Then
Reboot = false
FileManage("Status.ProgName",6)
EndIf
NextScan
EndProg
```

# 11. Glossary

### **11.1 Terms**

Term: ac

See Vac (p. 561).

Term: accuracy

A measure of the correctness of a measurement. See also the appendix *Accuracy, Precision, and Resolution* (p. 563).

Term: A-to-D

Analog-to-digital conversion. The process that translates analog voltage levels to digital values.

Term: amperes (A)

Base unit for electric current. Used to quantify the capacity of a power source or the requirements of a power-consuming device.

Term: analog

Data presented as continuously variable electrical signals.

Term: argument

Parameter (p. 548): part of a procedure (or command) definition.

Argument (p. 529): part of a procedure call (or command execution). An argument is placed in a parameter. For example, in the CRBasic command **Battery**(dest), dest is a parameter that defines what argument is to be put in its place in a CRBasic program. If a variable named BattV is to hold the result of the battery measurement made by **Battery**(), BattV is the argument placed in dest. In the statement

Battery(BattV)

**BattV** is the argument.

Term: ASCII / ANSI

#### Related Topics:

Term: ASCII / ANSI (p. 530)

ASCII / ANSI table

Abbreviation for American Standard Code for Information Interchange / American National Standards Institute. An encoding scheme in which numbers from 0-127 (ASCII) or 0-255 (ANSI) are used to represent predefined alphanumeric characters. Each number is usually stored and transmitted as 8 binary digits (8 bits), resulting in 1 byte of storage per character of text.

#### Term: asynchronous

The transmission of data between a transmitting and a receiving device occurs as a series of zeros and ones. For the data to be "read" correctly, the receiving device must begin reading at the proper point in the series. In asynchronous communication, this coordination is accomplished by having each character surrounded by one or more start and stop bits which designate the beginning and ending points of the information (see *synchronous (p. 558)*).

Indicates the sending and receiving devices are not synchronized using a clock signal.

#### Term: AWG

AWG ("gauge") is the accepted unit when identifying wire diameters. Larger AWG values indicate smaller cross-sectional diameter wires. Smaller AWG values indicate large-diameter wires. For example, a 14 AWG wire is often used for grounding because it can carry large currents. 22 AWG wire is often used as sensor leads since only small currents are carried when measurements are made.

Term: baud rate

The rate at which data are transmitted.

#### Term: beacon

A signal broadcasted to other devices in a PakBus® network to identify "neighbor" devices. A beacon in a PakBus network ensures that all devices in the network are aware of other devices that are viable. If configured to do so, a clock-set command may be transmitted with the beacon. This function can be used to synchronize the clocks of devices within the PakBus network. See also *PakBus* (p. 548) and *neighbor device* (p. 546).

#### Term: binary

Describes data represented by a series of zeros and ones. Also describes the state of a switch, either being on or off.

Term: BOOL8

A one-byte data type that holds eight bits (0 or 1) of information. BOOL8 uses less space than the 32 bit BOOLEAN data type.

Term: boolean

Name given a function, the result of which is either true or false.

Term: boolean data type

Typically used for flags and to represent conditions or hardware that have only two states (true or false) such as flags and control ports.

Term: burst

Refers to a burst of measurements. Analogous to a burst of light, a burst of measurements is intense, such that it features a series of measurements in rapid succession, and is not continuous.

Term: calibration wizard

The calibration wizard facilitates the use of the CRBasic field calibration instructions **FieldCal()** and **FieldCalStrain()**. It is found in *LoggerNet* (4.0 or higher) or *RTDAQ*.

Term: Callback

A name given to the process by which the CR3000 initiates comms with a PC running appropriate Campbell Scientific *datalogger support software* (p. 615). Also known as "Initiate Comms."

Term: CardConvert software

A utility to retrieve binary final-storage data from memory cards and convert the data to ASCII or other formats.

Term: CDM/CPI

CPI is a proprietary interface for communications between Campbell Scientific dataloggers and Campbell Scientific CDM peripheral devices. It consists of a physical layer definition and a data protocol. CDM devices are similar to Campbell Scientific SDM devices in concept, but the use of the CPI bus enables higher data-throughput rates and use of longer cables. CDM devices require more power to operate in general than do SDM devices.

Term: CF

See CompactFlash (p. 532).

Term: code

A CRBasic program, or a portion of a program.

Term: Collect / Collect Now button

Button or command in datalogger support software that facilitates collection-on-demand of final-data memory. This feature is found in *PC200W*, *PC400*, *LoggerNet*, and *RTDAQ*. software.

Term: COM port

COM is a generic name given to physical and virtual serial communication ports.

Term: CompactFlash

CompactFlash® (CF) is a memory-card technology used in some Campbell Scientific card-storage modules. CompactFlash® is a registered trademark of the CompactFlash® Association.

Term: command

Usually refers to a CRBasic command.

Term: command line

One line in a CRBasic program. Maximum length, even with the line continuation characters <space> <underscore> (\_), is 512 characters. A command line usually consists of one program statement, but it may consist of mulitple program statements separated by a <colon> (:).

#### Term: compile

The software process of converting human-readable program code to binary machine code. CR3000 user programs are compiled internally by the CR3000 operating system.

#### Term: conditioned output

The output of a sensor after scaling factors are applied. See *unconditioned* output (p. 560).

#### Term: connector

A connector is a device that allows one or more electron conduits (wires, traces, leads, etc) to be connected or disconnected as a group. A connector consists of two parts — male and female. For example, a common household ac power receptacle is the female portion of a connector. The plug at the end of a lamp power cord is the male portion of the connector. See *terminal (p. 559)*.

#### Term: constant

A packet of CR3000 memory given an alpha-numeric name and assigned a fixed number.

#### Term: control I/O

C terminals configured for controlling or monitoring a device.

#### Term: CoraScript

CoraScript is a command-line interpreter associated with LoggerNet datalogger support software. Refer to the LoggerNet manual, available at www.campbellsci.com, for more information.

#### Term: CPU

Central processing unit. The brains of the CR3000. Also refers to two the following two memory areas:

- o CPU: memory drive
- o Memory used by the CPU to store table data.

Term: cr

Carriage return

Term: CRBasic Editor

The CRBasic programming editor; supplied as part of *LoggerNet*, *PC400*, and *RTDAQ* software

Term: CRBasic Editor Compile, Save and Send

*CRBasic Editor* menu command that compiles, saves, and sends the program to the datalogger.

Term: CRD

An optional memory drive that resides on a memory card. See *CompactFlash* (p. 532).

Term: CS I/O

Campbell Scientific proprietary input / output port. Also, the proprietary serial communication protocol that occurs over the **CS I/O** port.

Term: CVI

Communication verification interval. The interval at which a PakBus® device verifies the accessibility of neighbors in its neighbor list. If a neighbor does not communicate for a period of time equal to 2.5 times the CVI, the device will send up to four **Hellos**. If no response is received, the neighbor is removed from the neighbor list. See the section *PakBus* — *Overview* (p. 82) for more information.

Term: data cache

The data cache is a set of binary files kept on the hard disk of the computer running the *datalogger support software (p. 535)*. A binary file is created for each table in each datalogger. These files mimic the storage areas in datalogger memory, and by default are two times the size of the datalogger storage area. When the software collects data from a CR3000, the data are stored in the binary file for that CR3000. Various software functions retrieve data from the data cache instead of the CR3000 directly. This allows the simultaneous sharing of data among software functions.

Similar in function to a CR3000 final-storage data tables, the binary files for the data cache are set up by default as *ring memory (p. 552)*.

Term: datalogger support software

Campbell Scientific software that includes at least the following functions:

- Datalogger comms
- Downloading programs
- Clock setting
- o Retrieval of measurement data

See *Datalogger Support Software* — *Overview* (p. 91) and the appendix *Datalogger Support Software* — *List* (p. 615) for more information.

Term: data point

A data value which is sent to *final-storage memory* (p. 539) as the result of a *data-output processing instruction* (p. 535). Strings of data points output at the same time make up a record in a data table.

Term: data table

A concept that describes how data are organized in CR3000 memory, or in files that result from collecting data in CR3000 memory. The fundamental data table is created by the CRBasic program as a result of the **DataTable()** instruction and resides in binary form in main-memory SRAM. See the table *CR3000 Memory Allocation (p. 442)*. The data table structure also resides in the *data cache (p. 534)*, in discrete data files on the CPU:, USR:, CRD:, and USB: memory drives, and in binary or ASCII files that result from collecting final-storage memory with *datalogger support software (p. 535)*.

Term: data output interval

Alias: output interval

The interval between each write of a record (p. 551) to a final-storage memory data table.

Term: data output processing instructions

CRBasic instructions that process data values for eventual output to final-data memory. Examples of output-processing instructions include **Totalize()**, **Maximize()**, **Minimize()**, and **Average()**. Data sources for these instructions are values or strings in variable memory. The results of intermediate calculations are stored in *data output processing memory (p. 536)* to await the output trigger. The ultimate destination of data generated by data output processing instructions is usually final-storage memory, but the CRBasic program can be written to divert to variable memory by the CRBasic program for further processing. The transfer of processed

summaries to final-data memory takes place when the *Trigger* argument in the **DataTable()** instruction is set to **True**.

Term: data output processing memory

SRAM memory automatically allocated for intermediate calculations performed by CRBasic data output processing instructions. Data output processing memory cannot be monitored.

Term: dc

See Vdc (p. 561).

Term: DCE

**D**ata Communication Equipment. While the term has much wider meaning, in the limited context of practical use with the CR3000, it denotes the pin configuration, gender, and function of an RS-232 port. The RS-232 port on the CR3000 is DCE. Interfacing a DCE device to a DCE device requires a null-modem cable. See *DTE* (p. 537).

Term: desiccant

A hygroscopic material that absorbs water vapor from the surrounding air. When placed in a sealed enclosure, such as a datalogger enclosure, it prevents condensation.

Term: DevConfig software

Device Configuration Utility (p. 113), available with LoggerNet, RTDAQ, PC400, or at www.campbellsci.com/downloads.

Term: DHCP

Dynamic Host Configuration Protocol. A TCP/IP application protocol.

Term: differential

A sensor or measurement terminal wherein the analog voltage signal is carried on two leads. The phenomenon measured is proportional to the difference in voltage between the two leads.

Term: Dim

A CRBasic command for declaring and dimensioning variables. Variables declared with **Dim** remain hidden during datalogger operations.

Term: dimension

Verb. To code a CRBasic program for a variable array as shown in the following examples:

- DIM example(3) creates the three variables example(1), example(2), and example(3).
- o **DIM** *example(3,3)* creates nine variables.
- o **DIM** example(3,3,3) creates 27 variables.

Term: DNS

Domain name system. A TCP/IP application protocol.

Term: DTE

**D**ata Terminal Equipment. While the term has much wider meaning, in the limited context of practical use with the CR3000, it denotes the pin configuration, gender, and function of an RS-232 port. The RS-232 port on the CR3000 is DCE. Attachment of a null-modem cable to a DCE device effectively converts it to a DTE device. See *DCE* (p. 536).

Term: duplex

A serial communication protocol. Serial communications can be simplex, half-duplex, or full-duplex.

Reading list: simplex (p. 555), duplex (p. 307), half duplex (p. 541), and full duplex (p. 540).

Term: duty cycle

The percentage of available time a feature is in an active state. For example, if the CR3000 is programmed with 1 second scan interval, but the program completes after only 100 millisecond, the program can be said to have a 10% duty cycle.

Term: earth ground

A grounding rod or other suitable device that electrically ties a system or device to the earth. Earth ground is a sink for electrical transients and

possibly damaging potentials, such as those produced by a nearby lightning strike. Earth ground is the preferred reference potential for analog voltage measurements. Note that most objects have a "an electrical potential" and the potential at different places on the earth — even a few meters away — may be different.

Term: engineering units

Units that explicitly describe phenomena, as opposed to, for example, the CR3000 base analog-measurement unit of milliVolts.

Term: ESD

Electrostatic discharge

Term: ESS

**Environmental Sensor Station** 

Term: excitation

Application of a precise voltage, usually to a resistive bridge circuit.

Term: execution interval

See scan interval (p. 553).

Term: execution time

Time required to execute an instruction or group of instructions. If the execution time of a program exceeds the **Scan()** *Interval*, the program is executed less frequently than programmed and the **Status** table **SkippedScan** (p. 512) field will increment.

Term: expression

A series of words, operators, or numbers that produce a value or result.

Field

Final-storage data tables are made up of records and fields. Each row in a table represents a record and each column represents a field. The number of fields in a record is determined by the number and configuration of output processing instructions that are included as part of the **DataTable()** declaration.

Term: FFT

Fast Fourier Transform. A technique for analyzing frequency-spectrum data

Term: File Control

**File Control** is a feature of *LoggerNet*, *PC400* and *RTDAQ datalogger* support software (p. 91). It provides a view of the CR3000 file system and a menu of file management commands:

**Delete** facilitates deletion of a specified file

**Send** facilitates transfer of a file (typically a CRBasic program file) from PC memory to CR3000 memory.

**Retrieve** facilitates collection of files viewed in **File Control**. *If* collecting a data file from a memory card with **Retrieve**, first stop the CR3000 program or data corruption may result.

**Format** formats the selected CR3000 memory device. All files, including data, on the device will be erased.

Term: File Retrieval tab

A feature of *LoggerNet Setup Screen*. In the *Setup Screen* network map (Entire Network), click on a CR3000 datalogger node. The **File Retieval** tab should be one of several tabs presented at the right of the screen.

Term: fill and stop memory

A memory configuration for data tables forcing a data table to stop accepting data when full.

Term: final-storage memory

The portion of CR3000 SRAM memory allocated for storing data tables with output arrays. Once data are written to final-data memory, they cannot be changed but only overwritten when they become the oldest data. Final-data memory is configured as *ring memory* (p. 552) by default, with new data overwriting the oldest data.

Term: final-storage data

Data that resides in final-data memory.

Term: Flash

A type of memory media that does not require battery backup. Flash memory, however, has a lifetime based on the number of writes to it. The more frequently data are written, the shorter the life expectancy.

Term: FLOAT

Four-byte floating-point data type. Default CR3000 data type for **Public** or **Dim** variables. Same format as IEEE4.

Term: FP2

Two-byte floating-point data type. Default CR3000 data type for stored data. While IEEE four-byte floating point is used for variables and internal calculations, FP2 is adequate for most stored data. FP2 provides three or four significant digits of resolution, and requires half the memory as IEEE4.

Term: FTP

File Transfer Protocol. A TCP/IP application protocol.

Term: full-duplex

A serial communication protocol. Simultaneous bi-directional communications. Communications between a CR3000 serial port and a PC is typically full duplex.

Reading list: simplex (p. 555), duplex (p. 307), half duplex (p. 541), and full duplex (p. 540).

Term: frequency domain

Frequency domain describes data graphed on an X-Y plot with frequency as the X axis. *VSPECT* (p. 562) vibrating wire data are in the frequency domain.

Term: frequency response

Sample rate is how often an instrument reports a result at its output; frequency response is how well an instrument responds to fast fluctuations on its input. By way of example, sampling a large gage thermocouple at 1 kHz will give a high sample rate but does not ensure the measurement has a high frequency response. A fine-wire thermocouple, which changes output quickly with changes in temperature, is more likely to have a high frequency response.

# Term: garbage

The refuse of the data communication world. When data are sent or received incorrectly (there are numerous reasons why this happens), a string of invalid, meaningless characters (garbage) often results. Two common causes are: 1) a baud-rate mismatch and 2) synchronous data being sent to an asynchronous device and vice versa.

# Term: global variable

A variable available for use throughout a CRBasic program. The term is usually used in connection with subroutines, differentiating global variables (those declared using **Public** or **Dim**) from local variables, which are declared in the **Sub()** and **Function()** instructions.

# Term: ground

Being or related to an electrical potential of 0 volts.

### Term: ground currents

Pulling power from the CR3000 wiring panel, as is done when using some comms devices from other manufacturers, or a sensor that requires a lot of power, can cause voltage potential differences between points in CR3000 circuitry that are supposed to be at ground or 0 Volts. This difference in potentials can cause errors when measuring single-ended analog voltages.

#### Term: half-duplex

A serial communication protocol. Bi-directional, but not simultaneous, communications. SDI-12 is a half-duplex protocol.

Reading list: simplex (p. 555), duplex (p. 307), half duplex (p. 541), and full duplex (p. 540).

# Term: handshake, handshaking

The exchange of predetermined information between two devices to assure each that it is connected to the other. When not used as a clock line, the CLK/HS (pin 7) line in the datalogger **CS I/O** port is primarily used to detect the presence or absence of peripherals.

#### Term: hello exchange

The process of verifying a node as a neighbor. See section *PakBus* — *Overview* (p. 82).

Term: hertz (Hz)

SI unit of frequency. Cycles or pulses per second.

Term: HTML

Hypertext Markup Language. Programming language used for the creation of web pages.

Term: HTTP

Hypertext Transfer Protocol. A TCP/IP application protocol.

Term: IEEE4

Four-byte, floating-point data type. IEEE Standard 754. Same format as **Float**.

Term: Include file

a file containing CRBasic code to be included at the end of the current CRBasic program, or it can be run as the default program. See **Include File Name** (p. 582) setting.

Term: INF

A data word indicating the result of a function is infinite or undefined.

Term: initiate comms

A name given to a processes by which the CR3000 initiates comms with a PC running *LoggerNet*. Also known as Callback (p. 531).

Term: input/output instructions

Used to initiate measurements and store the results in input storage or to set or read control/logic ports.

Term: instruction

Usually refers to a CRBasic command.

Term: integer

A number written without a fractional or decimal component. 15 and 7956 are integers; 1.5 and 79.56 are not.

Term: intermediate memory

See data output processing memory (p. 536).

Term: IP

Internet Protocol. A TCP/IP internet protocol.

Term: IP address

A unique address for a device on the internet.

Term: IP trace

Function associated with IP data transmissions. IP trace information was originally accessed through the CRBasic instruction IPTrace() (p. 468) and stored in a string variable. Files Manager setting (p. 581) is now modified to allow for creation of a file on a CR3000 memory drive, such as USR:, to store information in ring memory.

Term: isolation

Hardwire comms devices and cables can serve as alternate paths to earth ground and entry points into the CR3000 for electromagnetic noise. Alternate paths to ground and electromagnetic noise can cause measurement errors. Using opto-couplers in a connecting device allows comms signals to pass, but breaks alternate ground paths and may filter some electromagnetic noise. Campbell Scientific offers optically isolated RS-232 to CS I/O interfaces as a CR3000 accessory for use on the CS I/O port. See the appendix Serial I/O Modules — List (p. 605).

Term: JSON

Java Script Object Notation. A data file format available through the CR3000 or *LoggerNet*.

Term: keep memory

keep memory is non-volatile memory that preserves some settings (p. 567) during a power-up or program start up reset. Examples include PakBus

address, station name, beacon intervals, neighbor lists, routing table, and communication timeouts.

Term: keyboard/display

The CR3000 has an integrated keyboard/display. See appendix *Keyboard/Display* — *List (p. 611)* for other compatible keyboard/displays.

Term: leaf node

A PakBus node at the end of a branch. When in this mode, the CR3000 is not able to forward packets from one of its communication ports to another. It will not maintain a list of neighbors, but it still communicates with other PakBus dataloggers and wireless sensors. It cannot be used as a means of reaching (routing to) other dataloggers.

Term: If

Line feed. Often associated with carriage return (<cr>). <cr><lf>.

Term: local variable

A variable available for use only by the subroutine in which it is declared. The term differentiates local variables, which are declared in the **Sub()** and **Function()** instructions, from global variables, which are declared using **Public** or **Dim**.

Term: LONG

Data type used when declaring integers.

Term: loop

A series of instructions in a CRBasic program that are repeated a the programmed number of times. The loop ends with an **end** instruction.

Term: loop counter

Increments by one with each pass through a loop.

Term: mains power

the national power grid

# Term: manually initiated

Initiated by the user, usually with a CR1000KD Keyboard/Display (p. 611), as opposed to occurring under program control.

Term: mass storage device

USB: "thumb" drive. See Data Storage Devices — List (p. 613).

Term: MD5 digest

16 byte checksum of the TCP/IP VTP configuration.

Term: milli

The SI prefix denoting 1/1000 of a base SI unit.

Term: Modbus

Communication protocol published by Modicon in 1979 for use in programmable logic controllers (PLCs). See section *Modbus* — *Overview* (p. 83).

Term: modem/terminal

Any device that has the following:

- O Ability to raise the CR3000 ring line or be used with an optically isolated interface (see the appendix *CHardwire*, *Single-Connection Comms Devices*—*List (p. 611)* to raise the ring line and put the CR3000 in the comms command state.
- Asynchronous serial communication port that can be configured to communicate with the CR3000.

Term: modulo divide

A math operation. Result equals the remainder after a division.

Term: MSB

Most significant bit (the leading bit). See Endianness (p. 601).

Term: multi-meter

An inexpensive and readily available device useful in troubleshooting data acquisition system faults.

Term: multiplier

A term, often a parameter in a CRBasic measurement instruction, that designates the slope (aka, scaling factor or gain) in a linear function. For example, when converting °C to °F, the equation is °F = °C\*1.8 + 32. The factor **1.8** is the multiplier. See *offset (p. 547)*.

Term: mV

The SI abbreviation for millivolts.

Term: NAN

Not a number. A data word indicating a measurement or processing error. Voltage over-range, SDI-12 sensor error, and undefined mathematical results can produce NAN. See the section *NAN and*  $\pm INF$  (p. 506).

Term: neighbor device

Device in a PakBus network that communicate directly with a device without being routed through an intermediate device. See *PakBus (p. 548)*.

Term: NIST

National Institute of Standards and Technology

Term: node

Devices in a network — usually a PakBus network. The communication server dials through, or communicates with, a node. Nodes are organized as a hierarchy with all nodes accessed by the same device (parent node) entered as child nodes. A node can be both a parent and a child. See *PakBus* — *Overview* (p. 82).

Term: NSEC

Eight-byte data type divided up as four bytes of seconds since 1990 and four bytes of nanoseconds into the second. See *Data Type* (p. 137) tables.

#### Term: null-modem

A device, usually a multi-conductor cable, which converts an RS-232 port from DCE to DTE or from DTE to DCE.

#### Term: Numeric Monitor

A digital monitor in *datalogger support software* (p. 91) or in a keyboard/display (p. 84).

#### Term: offset

A term, often a parameter in a CRBasic measurement instruction, that designates the y-intercept (aka, shifting factor or zeroing factor) in a linear function. For example, when converting °C to °F, the equation is °F = °C\*1.8 + 32. The factor 32 is the offset. See *multiplier (p. 546)*.

#### Term: ohm

The unit of resistance. Symbol is the Greek letter Omega ( $\Omega$ ). 1.0  $\Omega$  equals the ratio of 1.0 volt divided by 1.0 ampere.

# Term: Ohm's Law

Describes the relationship of current and resistance to voltage. Voltage equals the product of current and resistance  $(V = I \cdot R)$ .

### Term: on-line data transfer

Routine transfer of data to a peripheral left on-site. Transfer is controlled by the program entered in the datalogger.

# Term: operating system

The operating system (also known as "firmware") is a set of instructions that controls the basic functions of the CR3000 and enables the use of user written CRBasic programs. The operating system is preloaded into the CR3000 at the factory but can be re-loaded or upgraded by you using *Device Configuration Utility (p. 113)* software. The most recent CR3000 operating system .obj file is available at www.campbellsci.com/downloads.

#### Term: output

A loosely applied term. Denotes a) the information carrier generated by an electronic sensor, b) the transfer of data from variable memory to final-data

memory, or c) the transfer of electric power from the CR3000 or a peripheral to another device.

Term: output array

A string of data values output to final-data memory. Output occurs when the data table output trigger is **True**.

Term: output interval

See data output interval (p. 535).

Term: output processing instructions

See data output processing instructions (p. 535).

Term: output processing memory

See data output processing memory (p. 536).

Term: PakBus

A proprietary comms protocol similar to *IP* (p. 543) protocol developed by Campbell Scientific to facilitate communications between Campbell Scientific instrumentation. See *PakBus* — *Overview* (p. 82) for more information.

Term: PakBusGraph software

Shows the relationship of various nodes in a PakBus network and allows for monitoring and adjustment of some *registers (p. 551)* in each node. A PakBus node is typically a Campbell Scientific datalogger, a PC, or a comms device. See section *Datalogger Support Software* — *Overview (p. 91)*.

Term: parameter

Parameter (p. 548): part of a procedure (or command) definition.

Argument (p. 529): part of a procedure call (or command execution). An argument is placed in a parameter. For example, in the CRBasic command **Battery**(dest), dest is a parameter that defines what argument is to be put in its place in a CRBasic program. If a variable named BattV is to hold the result of the battery measurement made by Battery(), BattV is the argument placed in dest. In the statement

Battery(BattV)

# BattV is the argument.

#### Term: period average

A measurement technique using a high-frequency digital clock to measure time differences between signal transitions. Sensors commonly measured with period average include water-content reflectometers.

#### Term: peripheral

Any device designed for use with the CR3000 (or another Campbell Scientific datalogger). A peripheral requires the CR3000 to operate. Peripherals include *measurement*, *control* (p. 86), and *data retrieval and comms* (p. 610) modules.

#### Term: ping

A software utility that attempts to contact another device in a network. See section *PakBus* — *Overview* (p. 82) and sections Ping (PakBus) and *Ping* (IP) (p. 474).

# Term: pipeline mode

A CRBasic program execution mode wherein instructions are evaluated in groups of like instructions, with a set group prioritization. More information is available in section *Pipeline Mode (p. 161)*. See *sequential mode (p. 554)*.

#### Term: Poisson ratio

A ratio used in strain measurements. Equal to transverse strain divided by extension strain as follows:

```
v = -(\varepsilon_{\text{trans}} / \varepsilon_{\text{axial}}).
```

### Term: ppm (resistor specification)

# Temperature Coefficient of Resistance (TCR)

TCR tells how much the resistance of a resistor changes as the temperature of the resistor changes. The unit of TCR is ppm/°C (parts-per-million per degree Celsius). A positive TCR means that resistance increases as temperature increases. For example, a resistor with a specification of 10 ppm/°C will not increase in resistance by more than 0.000010  $\Omega$  per ohm over a 1 °C increase of the resistor temperature or by more than .00010  $\Omega$  per ohm over a 10 °C increase.

Term: precision

A measure of the repeatability of a measurement. Also see *Accuracy*, *Precision*, *and Resolution* (p. 563).

Term: PreserveVariables

CRBasic instruction that protects **Public** variables from being erased when a program is recompiled.

Term: print device

Any device capable of receiving output over pin 6 (the PE line) in a receiveonly mode. Printers, "dumb" terminals, and computers in a terminal mode fall in this category.

Term: print peripheral

See print device (p. 550).

Term: processing instructions

CRBasic instructions used to further process input-data values and return the result to a variable where it can be accessed for output processing. Arithmetic and transcendental functions are included.

Term: program control instructions

Modify the execution sequence of CRBasic instructions. Also used to set or clear flags. See section *PLC Control* — *Overview* (p. 91).

Term: program statement

A complete program command construct confined to one command line or to multiple command lines merged with the line continuation characters <space><underscore>(\_). A command line, even with line continuation, cannot exceed 512 characters.

Term: Program Send command

**Program Send** is a feature of *datalogger support software* (p. 91). Command wording varies among software according to the following table:

TABLE 128: Program Send Command			
Software	Command	Command Location	
LoggerNet	Send New	Connect screen	
PC400	Send Program	Clock/Program tab	
RTDAQ	Send Program	Clock/Program tab	
PC200W	Send Program	Clock/Program tab	

Term: Public

A CRBasic command for declaring and dimensioning variables. Variables declared with **Public** can be monitored during datalogger operation. See *Dim* (p. 537).

# Term: pulse

An electrical signal characterized by a rapid increase in voltage follow by a short plateau and a rapid voltage decrease.

#### Term: ratiometric

Describes a type of measurement or a type of math. *Ratiometric* usually refers to an aspect of resistive-bridge measurements — either the measurement or the math used to process it. Measuring ratios and using ratio math eliminates several sources of error from the end result.

#### Term: record

A record is a complete line of data in a data table or data file. All data in a record share a common time stamp.

Final-storage data tables are made up of records and fields. Each row in a table represents a record and each column represents a field. The number of fields in a record is determined by the number and configuration of output processing instructions that are included as part of the **DataTable()** declaration.

#### Term: regulator

A setting, a Status table element, or a DataTableInformation table element.

# Term: regulator

A device for conditioning an electrical power source. Campbell Scientific regulators typically condition ac or dc voltages greater than 16 Vdc to about 14 Vdc.

#### Term. Reset Tables command

**Reset Tables** command resets data tables configured for fill and stop.

Location of the command varies among datalogger support software according to the following:

LoggerNet — Connect Screen | Station Status tab | Table Fill Times tab | Reset Tables

PC400 — command sequence: Datalogger | Station Status | Table Fill Times | Reset Tables

RTDAQ — command sequence: Datalogger | Station Status | Table Fill Times | Reset Tables

PC200W — command sequence: Datalogger | Station Status | Table Fill Times | Reset Tables

#### Term: resistance

A feature of an electronic circuit that impedes or redirects the flow of electrons through the circuit.

#### Term: resistor

A device that provides a known quantity of resistance.

# Term: resolution

A measure of the fineness of a measurement. See also *Accuracy*, *Precision*, and *Resolution* (p. 563).

#### Term: ring line

Ring line is pulled high by an external device to notify the CR3000 to commence RS-232 communications. Ring line is pin 3 of a *DCE* (p. 536) RS-232 port.

### Term: ring memory

A memory configuration that allows the oldest data to be overwritten with the newest data. This is the default setting for final-storage data tables.

# Term: ringing

Oscillation of sensor output (voltage or current) that occurs when sensor excitation causes parasitic capacitances and inductances to resonate.

#### Term: RMS

Root-mean square, or quadratic mean. A measure of the magnitude of wave or other varying quantities around zero.

#### Term: router

Device configured as a router is able to forward PakBus packets from one port to another. To perform its routing duties, a CR3000 configured as a router maintains its own list of neighbors and sends this list to other routers in the PakBus network. It also obtains and receives neighbor lists from other routers.

#### Term: RS-232

Recommended Standard 232. A loose standard defining how two computing devices can communicate with each other. The implementation of RS-232 in Campbell Scientific dataloggers to PC communications is quite rigid, but transparent to most users. Features in the CR3000 that implement RS-232 communication with smart sensors are flexible.

### Term: sample rate

The rate at which measurements are made by the CR3000. The measurement sample rate is of interest when considering the effect of time skew, or how close in time are a series of measurements, or how close a time stamp on a measurement is to the true time the phenomenon being measured occurred. A 'maximum sample rate' is the rate at which a measurement can repeatedly be made by a single CRBasic instruction.

Sample rate is how often an instrument reports a result at its output; frequency response is how well an instrument responds to fast fluctuations on its input. By way of example, sampling a large gage thermocouple at 1 kHz will give a high sample rate but does not ensure the measurement has a high frequency response. A fine-wire thermocouple, which changes output quickly with changes in temperature, is more likely to have a high frequency response.

#### Term: scan interval

The time interval between initiating each execution of a given **Scan()** of a CRBasic program. If the **Scan()** *Interval* is evenly divisible into 24 hours (86,400 seconds), it is synchronized with the 24 hour clock, so that the program is executed at midnight and every **Scan()** *Interval* thereafter. The

program is executed for the first time at the first occurrence of the **Scan()** *Interval* after compilation. If the **Scan()** *Interval* does not divide evenly into 24 hours, execution will start on the first even second after compilation.

Term: scan time

When time functions are run inside the **Scan()** / **NextScan** construct, time stamps are based on when the scan was started according to the CR3000 clock. Resolution of scan time is equal to the length of the scan. See *system time (p. 558)*.

Term: SDI-12

Serial Data Interface at 1200 baud. Communication protocol for transferring data between the CR3000 and SDI-12 compatible smart sensors.

Term: SDM

Synchronous **D**evice for **M**easurement. A processor-based peripheral device or sensor that communicates with the CR3000 via hardwire over a short distance using a protocol proprietary to Campbell Scientific.

Term: Seebeck effect

Induces microvolt level thermal electromotive forces (EMF) across junctions of dissimilar metals in the presence of temperature gradients. This is the principle behind thermocouple temperature measurement. It also causes small, correctable voltage offsets in CR3000 measurement circuitry.

Term: sequential mode

A CRBasic program execution mode wherein each statement is evaluated in the order it is listed in the program. More information is available in section *Sequential Mode (p. 162)*. See *pipeline mode (p. 549)*.

Term: semaphore (measurement semaphore)

In sequential mode, when the main scan executes, it locks the resources associated with measurements. In other words, it acquires the measurement semaphore. This is at the scan level, so all subscans within the scan (whether they make measurements or not), will lock out measurements from slow sequences (including the auto self-calibration). Locking measurement resources at the scan level gives non-interrupted measurement execution of the main scan.

#### Term: send

**Send** button in *datalogger support software* (p. 91). Sends a CRBasic program or operating system to a CR3000.

#### Term: serial

A loose term denoting output of a series of ASCII, HEX, or binary characters or numbers in electronic form.

# Term: Settings Editor

An editor for observing and adjusting CR3000 settings. **Settings Editor** is a feature of *LoggerNet* | *Connect*, *PakBusGraph*, and *Device Configuration Utility (DevConfig)*.

#### Term: Short Cut software

A CRBasic program wizard suitable for many CR3000 applications. Knowledge of CRBasic is not required to use *Short Cut*. It is available at no charge at *www.campbellsci.com*.

# Term: SI (Système Internationale)

The uniform international system of metric units. Specifies accepted units of measure.

# Term: signature

A number which is a function of the data and the sequence of data in memory. It is derived using an algorithm that assures a 99.998% probability that if either the data or the data sequence changes, the signature changes. See sections *Security* — *Overview* (p. 88) and *Signatures* (p. 441).

#### Term: simplex

A serial communication protocol. One-direction data only. Serial communications between a serial sensor and the CR3000 may be simplex.

Reading list: simplex (p. 555), duplex (p. 307), half duplex (p. 541), and full duplex (p. 540).

# Term: single-ended

Denotes a sensor or measurement terminal wherein the analog voltage signal is carried on a single lead and measured with respect to ground (0 V).

Term: skipped scans

Occur when the CRBasic program is too long for the scan interval. Skipped scans can cause errors in pulse measurements.

Term: slow sequence

A usually slower secondary scan in the CRBasic program. The main scan has priority over a slow sequence.

Term: SMTP

Simple Mail Transfer Protocol. A TCP/IP application protocol.

Term: SNP

Snapshot file

Term: SP


Space

Term: state

Whether a device is on or off.

Term: Station Status command

A command available in most *datalogger support software* (p. 91). The following figure is a sample of station status output.

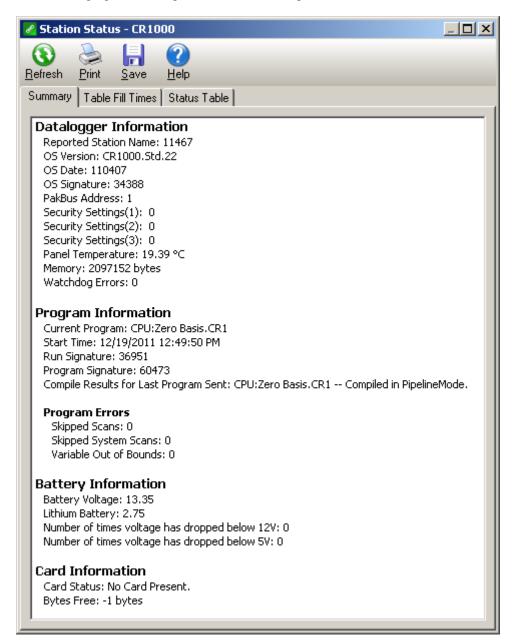

Term: string

A datum or variable consisting of alphanumeric characters.

Term: support software

See datalogger support software (p. 535).

Term: swept frequency

A succession of frequencies from lowest to highest used as the method of wire excitation with *VSPECT* (p. 562) measurements.

Term: synchronous

The transmission of data between a transmitting and a receiving device occurs as a series of zeros and ones. For the data to be "read" correctly, the receiving device must begin reading at the proper point in the series. In synchronous communication, this coordination is accomplished by synchronizing the transmitting and receiving devices to a common clock signal (see *asynchronous* (p. 306)).

Term: system time

When time functions are run outside the **Scan()** / **NextScan** construct, the time registered by the instruction will be based on the system clock, which has a 10 ms resolution. See *scan time* (p. 554).

Term: table

Final-storage data tables are made up of records and fields. Each row in a table represents a record and each column represents a field. The number of fields in a record is determined by the number and configuration of output processing instructions that are included as part of the **DataTable()** declaration.

Term: task

Two definitions:

- Grouping of CRBasic program instructions automatically by the CR3000 compiler. Tasks include measurement, SDM or digital, and processing. Tasks are prioritized when the CRBasic program runs in pipeline mode.
- A user-customized function defined through LoggerNet Task Master.

Term: TCP/IP

Transmission Control Protocol / Internet Protocol.

#### Term: Telnet

A software utility that attempts to contact and interrogate another specific device in a network. Telnet is resident in Windows OSs.

#### Term: terminal

Point at which a wire (or wires) connects to a wiring panel or connector. Wires are usually secured in terminals by screw- or lever-and-spring actuated gates. with small screw- or spring-loaded clamps. See *connector* (p. 533).

#### Term: terminal emulator

A command-line shell that facilitates the issuance of low-level commands to a datalogger or some other compatible device. A terminal emulator is available in most *datalogger support software* (p. 91) available from Campbell Scientific.

#### Term: thermistor

A thermistor is a temperature measurement device with a resistive element that changes in resistance with temperature. The change is wide, stable, and well characterized. The output of a thermistor is usually non-linear, so measurement requires linearization by means of a Steinhart-Hart or polynomial equation. CRBasic instructions **Therm107()**, **Therm108()**, and **Therm109()** use Steinhart-Hart equations.

#### Term: time domain

Time domain describes data graphed on an X-Y plot with time on the X axis. Time series data are in the time domain.

# Term: throughput rate

Rate that a measurement can be taken, scaled to engineering units, and the stored in a final-memory data table. The CR3000 has the ability to scan sensors at a rate exceeding the throughput rate. The primary factor determining throughput rate is the processing programmed into the CRBasic program. In sequential-mode operation, all processing called for by an instruction must be completed before moving on to the next instruction.

# Term: TTL

Transistor-to-Transistor Logic. A serial protocol using 0 Vdc and 5 Vdc as logic signal levels.

Term: TLS

Transport Layer Security. An Internet communication security protocol.

Term: toggle

To reverse the current power state.

Term: UINT2

Data type used for efficient storage of totalized pulse counts, port status (status of 16 ports stored in one variable, for example) or integer values that store binary flags.

Term: unconditioned output

The fundamental output of a sensor, or the output of a sensor before scaling factors are applied. See *conditioned output (p. 533)*.

Term: UPS

Uninterruptible Power Supply. A UPS can be constructed for most datalogger applications using ac line power, an ac/ac or ac/dc wall adapter, a charge controller, and a rechargeable battery. The CR3000 needs and external charge controller.

Term. user program

The CRBasic program written by you in Short Cut program wizard.

Term: USR: drive

A portion of CR3000 memory dedicated to the storage of image or other files.

Term: URI

uniform resource identifier

Term: URL

uniform resource locater

Term: variable

A packet of SRAM given an alphanumeric name. Variables reside in variable memory.

Term: variable memory

That portion of SRAM reserved for storing variables. Variable memory can be, and regularly is, overwritten with new values or strings as directed by the CRBasic program. When variables are declared **As Public**, the memory can be visually monitored.

Term: Vac

Volts alternating current. Also VAC. Two definitions:

- Mains or grid power is high-level Vac, usually 110 Vac or 220 Vac at a fixed frequency of 50 Hz or 60 Hz. High-level Vac can be the primary power source for Campbell Scientific power supplies. Do not connect high-level Vac directly to the CR3000.
- The CR3000 measures varying frequencies of low-level Vac in the range of ±20 Vac. For example, some anemometers output a lowlevel Vac signal.

Term: Vdc

Volts direct current. Also VDC. Two definitions:

- o The CR3000 operates with a nominal 12 Vdc. The CR3000 can supply nominal 12 Vdc, regulated 5 Vdc, regulated 3.3 Vdc, and variable excitation in the ±2.5 Vdc range.
- o The CR3000 measures analog voltage in the  $\pm 5.0$  Vdc range and pulse voltage in the  $\pm 20$  Vdc range.

Term: volt meter

See multi-meter (p. 546).

Term: voltage divider

A circuit of resistors that ratiometrically divides voltage. For example, a simple two-resistor voltage divider can be used to divide a voltage in half. So, when fed through the voltage divider, 1 mV becomes 500  $\mu$ V, 10 mV becomes 5 mV, and so forth. *Resistive-bridge* (p. 72) circuits are voltage dividers.

Term: volts

SI unit for electrical potential.

Term: VSPECT

trademark for Campbell Scientific's proprietary spectral-analysis, frequency domain, vibrating wire measurement technique

Term: watchdog timer

An error-checking system that examines the processor state, software timers, and program-related counters when the CRBasic program is running. See section *Watchdog Errors (p. 514)*. The following will cause watchdog timer resets, which reset the processor and CRBasic program execution.

- Processor bombed
- o Processor neglecting standard system updates
- o Counters are outside the limits
- Voltage surges
- Voltage transients

When a reset occurs, a counter is incremented in the **WatchdogTimer** entry of the **Status** *table* (p. 573). A low number (1 to 10) of watchdog timer resets is of concern, but normally indicates that the situation should just be monitored.

A large number of errors (>10) accumulating over a short period indicates a hardware or software problem. Consult with a Campbell Scientific support engineer.

Term: weather-tight

Describes an instrumentation enclosure impenetrable by common environmental conditions. During extraordinary weather events, however, seals on the enclosure may be breached.

Term: web API

Application Programming Interface.

Term: wild card

a character or expression that substitutes for any other character or expression.

Term: XML

Extensible markup language.

Term: user program

The CRBasic program written by you in *Short Cut* program wizard or *CRBasic Editor*.

# 11.2 Concepts

# 11.2.1 Accuracy, Precision, and Resolution

Three terms often confused are accuracy, precision, and resolution. Accuracy is a measure of the correctness of a single measurement, or the group of measurements in the aggregate. Precision is a measure of the repeatability of a group of measurements. Resolution is a measure of the fineness of a measurement. Together, the three define how well a data acquisition system performs. To understand how the three relate to each other, consider "target practice" as an analogy. Table *Accuracy, Precision, and Resolution (p. 563)* shows four targets. The bull's eye on each target represents the absolute correct measurement. Each shot represents an attempt to make the measurement. The diameter of the projectile represents resolution. The objective of a data acquisition system should be high accuracy, high precision, and to produce data with resolution as high as appropriate for a given application.

FIGURE 126: Relationships of Accuracy, Precision, and Resolution

High Accuracy	High Accuracy
High Precision	Low Precision
Low Accuracy	Low Accuracy
High Precision	Low Precision
<ul> <li>High Resolution</li> </ul>	● Low Resolution

# 12. Attributions

Use of the following trademarks in the *CR3000 Operator's Manual* does not imply endorsement by their respective owners of Campbell Scientific:

- Crydom
- Newark
- Mouser
- MicroSoft
- WordPad
- HyperTerminal
- LI-COR

# Appendix A. Info Tables and Settings

### Related Topics:

- Info Tables and Settings (p. 567)
- Common Uses of the Status Table (p. 569)
- Status Table as Debug Resource (p. 510)

Info tables and settings contain fields, settings, and information essential to setup, programming, and debugging of many advanced CR3000 systems. Info tables and settings are numerous. Note the following:

- All info tables and settings, except a handful, are accessible through a keyword. This discussion is organized around these keywords. Keywords and descriptions are listed alphabetically in sub appendix Info Tables and Settings Descriptions (p. 576).
- Info table fields are mostly read only. Some are resettable.
- Settings are mostly read/write.
- Directories in sub appendix Info Tables and Settings Directories (p. 569) list several groupings of keywords. Each keyword listed in these groups is linked to the relevant description.
- Some info tables and settings have multiple names depending on the interface used to access them. The names are listed with the descriptions.
- No single interface accesses all info tables and settings. Interfaces used for access include the following:

TABLE 129: Info Tables and Settings Interfaces		
Interface Location		
Settings Editor	Device Configuration Utility, LoggerNet Connect screen, PakBus Graph	
Info tables (Status, DataTableInfo, CPIInfo, etc)	View as a data table in a numeric monitor	
Station Status	Menu item in LoggerNet	
<b>Edit Settings</b>	Menu item in PakBusGraph software.	
Keyboard/Display Settings Menu items in Configure, Settings		
status.keyword/settings.keyword	Syntax in CRBasic program	
<sup>1</sup> Information presented in <b>Station Status</b> is not updated automatically. Click		

the **Refresh** button to update.

**Note** Communication and processor bandwidth are consumed when generating the **Status** and and other information tables. If the CR3000 is very tight on processing time, as may occur in very long or complex operations, retrieving these tables repeatedly may cause *skipped scans* (p. 512).

Note that the following settings force the CR3000 program to recompile, which may cause loss of data. Before changing settings, collect your data.

- IP Address
- IP Default Gateway
- Subnet Mask
- PPP Interface
- PPP dial string
- PPP dial response
- Baud rate change on control ports
- Maximum number of TLS server connections
- USR drive size
- PakBus encryption key
- PakBus/TCP server port
- HTTP service port
- FTP service port
- PakBus/TCP service port
- PakBus/TCP Client Connections
- Communication allocation

List of resettable fields:

- WatchdogErrors
- Low12VCount
- Low5VCount
- VarOutOfBound
- SkippedScan

- SkippedSystemScan
- SkippedSlowScan
- MaxProcTime
- MaxBuffDepth
- MaxSystemProcTime
- MaxSlowProcTime
- SkippedRecord

# A.1 Info Tables and Settings Directories

Links in the following tables will help you navigate through the Info Tables and Settings system:

TABLE 130: Info Tables and Settings: Directories			
Frequently Used (p. 569)  Read/Write with Keyboard/Display (p. 572)  By Keyword (p. 570)  Status Table (p. 573)  Settings   Datalogger (p. 572)  Settings   Comports (p. 572)	Auto Self-Calibration (p. 575)  Communications, General (p. 574)  Communications, PakBus (p. 574)  Communications, TCP/IP I (p. 574)  Communications, TCP/IP II (p. 574)	Memory (p. 575) Miscellaneous (p. 575) Obsolete (p. 576) OS and Hardware Versioning (p. 576) Power Monitors (p. 576) Radio (RF407)	
Settings   Ethernet (p. 572) Settings   PPP (p. 572)	Communications, TCP/IP III (p. 574)	RF451 Security (p. 576)	
Settings   CS I/O (p. 572) Settings   Network Services (p. 572) Settings Editor Only (p. 573)	CRBasic Program I (p. 575)  CRBasic Program II (p. 575)  Data (p. 575)  Data Table Information Table (DTI) (p. 575)	Signatures (p. 576)	

# A.1.1.1 Info Tables and Settings: Frequently Used

TABLE 131: Info Tables and Settings: Frequently Used			
Action	Status/Setting/DTI	Table Where Located	
Find the PakBus address of the CR3000	PakBusAddress (p. 586)	Communications, PakBus (p. 574)	
See messages pertaining to compilation of the CRBasic program running in the CR3000	CompileResults (p. 579)	CRBasic Program I (p. 575)	

TABLE 131: Info Tables and Settings: Frequently Used			
Action	Status/Setting/DTI	Table Where Located	
Programming errors	ProgErrors (p. 588)	CRBasic Program II (p. 575)	
	ProgSignature (p. 588)		
	SkippedScan (p. 590)		
	StartUpCode (p. 591)		
Data tables	DataFillDays() (p. 580)	Data (p. 575)	
	SkippedRecord() (p. 590)		
Memory	FullMemReset (p. 581)	Memory (p. 575)	
	MemoryFree (p. 585)		
	MemorySize (p. 585)		
Datalogger auto-resets	WatchdogErrors (p. 593)	Miscellaneous (p. 575)	
Operating system	OSDate (p. 586)	OS and Hardware Versioning (p. 576)	
	OSSignature (p. 586)		
	OSVersion (p. 586)		
Power	Battery (p. 577)	Power Monitors (p. 576)	
	LithiumBattery (p. 584)		
	Low12VCount (p. 584)		

# A.1.1.2 Info Tables and Settings: Keywords

TABLE 132: Info Tables and Settings: Keywords				
B Battery (p. 577) Baudrate() (p. 577) Beacon() (p. 577) BuffDepth (p. 577)	E ErrorCalib (p. 581) EthernetEnable (p. 581) EthernetPower (p. 581)	M MaxBuffDepth (p. 584) MaxPacketSize (p. 584) MaxProcTime (p. 584) MaxSlowProcTime() (p. 584) MaxSystemProcTime (p. 584)	pppIPAddr (p. 588) pppIPMask (p. 588) pppPassword (p. 588) pppUsername (p. 588) ProcessTime (p. 588) ProgErrors (p. 588)	T TCPClientConnections (p. 591) TCPPort (p. 591) TelnetEnabled (p. 591)
C CalDiffOffset() (p. 577) CalGain() (p. 577)  CalSeOffset() (p. 578) CalVolts() (p. 578)	F FilesManager (p. 581) FTPEnabled (p. 581) FTPPassword (p. 581) FTPPort (p. 581) FTPUserName (p. 581) FullMemReset (p. 581)	MeasureOps (p. 585) MeasureTime (p. 585) MemoryFree (p. 585) MemorySize (p. 585) Messages (p. 585)	ProgName (p. 588) ProgSignature (p. 588)	TLS Certificate TLSEnabled TLS Private Key

CAOOffset() (p. 578)	Н	N	R	U
CardBytesFree (p. 578) CardStatus (p. 578)	HTTPEnabled (p. 582) HTTPPort (p. 582)	Neighbors() (p. 585)	RevBoard (p. 589) RouteFilters (p. 589)	UDPBroadcastFilter (p 592)
CentralRouters() (p. 578)			RS232Handshaking (p. 589) RS232Power (p. 589)	USRDriveFree (p. 592) USRDriveSize (p. 592) UTCOffset (p. 592)
CommActive() (p. 578)	I	0	RS232Timeout (p. 589)	V
CommConfig() (p. 578)	IncludeFile (p. 582)	OSDate (p. 586)	RunSignature (p. 589)	VarOutOfBound (p. 592)
CommsMemAlloc (p. 578)	IPAddressCSIO() (p. 582)	OSSignature (p. 586) OSVersion (p. 586)		Verify() (p. 592)
CommsMemFree(1) (p. 578)	IPAddressEth (p. 582)	(		
CommsMemFree(2) (p. 579)	IPGateway (p. 582)			
CommsMemFree(3) (p.	IPGatewayCSIO() (p.	P	S	W
CompileResults (p. 579)	IPInfo (p. 583) IPMaskCSIO() (p. 583)	PakBusAddress (p. 586) PakBusEncryptionKey (p. 586) PakBusPort (p. 586)	SecsPerRecord() (p. 589) Security(1) (p. 589) Security(2) (p. 589)	WatchdogErrors (p. 593)
	IPMaskEth (p. 583)	PakBusRoutes (p. 586)	Security(3) (p. 590) SerialNumber (p. 590)	
	IPTrace (p. 583) IPTraceCode (p. 583)	PakBusTCPClients (p. 587) PakBusTCPEnabled (p.	ServicesEnabled() (p. 590) SkippedRecord() (p. 590)	
	IPTraceComport (p. 583)	587)	SkippedScan (p. 590)	
CPUDriveFree (p. 579) CSIO1netEnable (p. 579)	IsRouter (p. 583) IxResistor (p. 583)	PakBusTCPPassword (p. 587) PanelTemp (p. 587)	SkippedSlowScan() (p. 590)	
CSIO2netEnable (p. 579)		PingEnabled (p. 587)		
D	L	PortConfig() (p. 587)	SkippedSystemScan (p.	
DataFillDays() (p. 580)	LastSlowScan() (p. 583)	PortStatus() (p. 587)	590) SlowProcTime() (p. 590)	
DataRecordSize() (p. 580)	LastSystemScan (p. 583)	nnnDial ( 505)	StartTime (p. 590)	
DataTableName() (p. 580) DeleteCardFilesOnMism	LithiumBattery (p. 584) Low12VCount (p. 584)	pppDial (p. 587) pppDialResponse (p. 587)	StartUpCode (p. 591)	
atch (p. 580)	Low5VCount (p. 584)	pppInterface (p. 587)	StationName (p. 591)	
		FFF	SW12Volts (p. 591)()	
DNS() (p. 580)			SystemProcTime (p. 591)	

# A.1.1.3 Info Tables and Settings: Accessed by Keyboard/Display

# TABLE 133: Info Tables and Settings: KD Settings | Datalogger

 StationName (p. 591)
 PakBusEncryptionKey (p. 586)

 Security(1) (p. 589)
 PakBusTCPPassword (p. 587)

 Security(2) (p. 589)
 CPUDriveFree (p. 579)

 Security(3) (p. 590)
 CardBytesFree (p. 578)

PakBusAddress (p. 586) USRDriveSize (p. 592)

TABLE 134: Info Tables and Settings: KD Settings | Comports

Baudrate() (p. 577) Neighbors() (p. 585) Beacon() (p. 577) Verify() (p. 592)

**TABLE 135:** Info Tables and Settings: KD Settings | Ethernet

EthernetEnable (p. 581)EthernetPower (p. 581)IPMaskEth (p. 583)EthernetInfo (p. 581)IPAddressEth (p. 582)IPGateway (p. 582)

TABLE 136: Info Tables and Settings: KD Settings | PPP

 pppInterface (p. 587)
 pppIPMask (p. 588)
 pppDial (p. 587)

 pppInfo
 pppUsername (p. 588)
 ppp Username (p. 588)

pppIPAddr (p. 588) pppPassword (p. 588) pppDialResponse (p. 587)

TABLE 137: Info Tables and Settings: KD Settings | CS I/O IP

CSIO1netEnable (p. 579) CSIOInfo (p. 579) IPMaskCSIO() (p. 583)
CSIO2netEnable (p. 579) IPAddressCSIO() (p. 582) IPGatewayCSIO() (p. 582)

TABLE 138: Info Tables and Settings: KD Settings (TCP/IP) on CR1000KD Keyboard/Display

 PakBusPort (p. 586)

 FTPEnabled (p. 581)
 FTPPort (p. 581)

 TelnetEnabled (p. 591)
 HTTPPort (p. 582)

 PingEnabled (p. 587)
 FTPUserName (p. 581)

 PakBusTCPEnabled (p. 587)
 FTPPassword (p. 581)

PakBusTCPClients (p. 587)

DNS() (p. 580)

SDCInfo (p. 589)

TABLE 139: Info Tables and Settings: KD Settings | Advanced

UTCOffset (p. 592) RS232Handshaking (p. 589) IPTraceCode (p. 583)

IsRouter (p. 583) RS232Timeout (p. 589) DeleteCardFilesOnMismatch (p. 580)

CommsMemAlloc (p. 578) UDPBroadcastFilter (p. 592)

RouteFilters (p. 589) HTTPHeader (p. 582)

CentralRouters() (p. 578) IPTraceComport (p. 583) SkipPakBusRing (p. 590)

# TABLE 139: Info Tables and Settings: KD Settings | Advanced

USRDriveFree (p. 592) FilesManager (p. 581) IncludeFile (p. 582) MaxPacketSize (p. 584) RS232Power (p. 589)

# TABLE 140: Info Tables and Settings: KD Status Table Fields

TABLE 140: Into Tables and Se	ttings. KD Status Table Fields	
OSVersion (p. 586)	VarOutOfBound (p. 592)	MaxSystemProcTime (p. 584)
OSDate (p. 586)	SkippedScan (p. 590)	MaxSlowProcTime() (p. 584)
OSSignature (p. 586)	SkippedSystemScan (p. 590)	PortStatus() (p. 587)
SerialNumber (p. 590)	SkippedSlowScan() (p. 590)	PortConfig() (p. 587)
RevBoard (p. 589)	ErrorCalib (p. 581)	SW12Volts (p. 591)()
StationName (p. 591)	MemorySize (p. 585)	PakBusRoutes (p. 586)
ProgName (p. 588)	MemoryFree (p. 585)	Messages (p. 585)
StartTime (p. 590)		
RunSignature (p. 589)	CommsMemFree(1) (p. 578)	
ProgSignature (p. 588)	CommsMemFree(2) (p. 579)	
WatchdogErrors (p. 593)	CommsMemFree(3) (p. 579)	
PanelTemp (p. 587)	FullMemReset (p. 581)	
Battery (p. 577)	CardStatus (p. 578)	CalVolts() (p. 578)
LithiumBattery (p. 584)	MeasureOps (p. 585)	CalGain() (p. 577)
	MeasureTime (p. 585)	
	ProcessTime (p. 588)	CalSeOffset() (p. 578)
	MaxProcTime (p. 584)	CalDiffOffset() (p. 577)
Low12VCount (p. 584)	BuffDepth (p. 577)	IxResistor (p. 583)
Low5VCount (p. 584)	MaxBuffDepth (p. 584)	
CompileResults (p. 579)	LastSystemScan (p. 583)	
StartUpCode (p. 591)	LastSlowScan() (p. 583)	
ProgErrors (p. 588)	SystemProcTime (p. 591)	
	SlowProcTime() (p. 590)	

# TABLE 141: Info Tables and Settings: Settings Only in Settings Editor

TLS Certificate TLS Private Key
---------------------------------

# A.1.1.4 Info Tables and Settings: Communications

TABLE 142: Info Tables and Settings: Communications, General			
Baudrate() (p. 577)	CommsMemFree(2) (p. 579)	RS232Handshaking (p. 589)	
CommsMemAlloc (p. 578)	CommsMemFree(3) (p. 579)	RS232Power (p. 589)	
		RS232Timeout (p. 589)	
CommsMemFree(1) (p. 578)			

TABLE 143: Info Tables and Settings: Communications, PakBus		
Beacon() (p. 577)	PakBusAddress (p. 586)	PakBusTCPEnabled (p. 587)
CentralRouters() (p. 578)	PakBusEncryptionKey (p. 586)	PakBusTCPPassword (p. 587)
IsRouter (p. 583)	PakBusPort (p. 586)	RouteFilters (p. 589)
MaxPacketSize (p. 584)	PakBusRoutes (p. 586)	Verify() (p. 592)
Neighbors() (p. 585)	PakBusTCPClients (p. 587)	

TABLE 144: Info Tables and Settings: Communications, TCP_IP I		
CSIO1netEnable (p. 579)	IPGateway (p. 582)	
CSIO2netEnable (p. 579)	IPGatewayCSIO() (p. 582)	IPTrace (p. 583)
DNS() (p. 580)		IPTraceCode (p. 583)
EthernetEnable (p. 581)	IPInfo (p. 583)	IPTraceComport (p. 583)
EthernetPower (p. 581)	IPMaskCSIO() (p. 583)	PingEnabled (p. 587)
IPAddressCSIO() (p. 582)	IPMaskEth (p. 583)	TelnetEnabled (p. 591)
IPAddressEth (p. 582)		

TABLE 145: Info Tables and Set	tings: Communications, TCP_IP II	
FTPEnabled (p. 581)		TLS Private Key
FTPPassword (p. 581)		
FTPPort (p. 581)	TLS Certificate	
FTPUserName (p. 581)		
HTTPEnabled (p. 582)		UDPBroadcastFilter (p. 592)
HTTPPort (p. 582)		

TABLE 146: Info Tables and Settings: Communications, TCP_IP III		
pppDial (p. 587) pppDialResponse (p. 587)	pppIPAddr (p. 588) pppIPMask (p. 588)	pppUsername (p. 588)
pppInterface (p. 587)	pppPassword (p. 588)	

# A.1.1.5 Info Tables and Settings: Programming

TABLE 147: Info Tables and Settings: CRBasic Program I		
BuffDepth (p. 577)	MaxBuffDepth (p. 584)	MeasureTime (p. 585)
CompileResults (p. 579)	MaxProcTime (p. 584)	Messages (p. 585)
IncludeFile (p. 582)	MaxSlowProcTime() (p. 584)	
LastSlowScan() (p. 583)	MeasureOps (p. 585)	

TABLE 148: Info Tables and Settings: CRBasic Program II		
ProcessTime (p. 588)	SkippedScan (p. 590)	StartTime (p. 590)
ProgErrors (p. 588)	SkippedSlowScan() (p. 590)	StartUpCode (p. 591)
ProgName (p. 588)	SlowProcTime() (p. 590)	VarOutOfBound (p. 592)

# A.1.1.6 Info Tables and Settings: Other

TABLE 149: Info Tables and Settings: Auto Self-Calibration		
CalDiffOffset() (p. 577)	CalVolts() (p. 578)	SkippedSystemScan (p. 590)
CalGain() (p. 577)	ErrorCalib (p. 581)	SystemProcTime (p. 591)
	LastSystemScan (p. 583)	
CalSeOffset() (p. 578)	MaxSystemProcTime (p. 584)	

TABLE 150: Info Tables and Settings: Data		
DataFillDays() (p. 580)	DataTableName() (p. 580)	SkippedRecord() (p. 590)
DataRecordSize() (p. 580)	SecsPerRecord() (p. 589)	

TABLE 151: Info Tables and Settings: Data Table Information Table (DTI) Keywords			
DataFillDays() (p. 580)	DataTableName() (p. 580)	SkippedRecord() (p. 590)	
DataRecordSize() (p. 580)	SecsPerRecord() (p. 589)		

TABLE 152: Info Tables and Settings: Memory		
CardBytesFree (p. 578)	FilesManager (p. 581)	USRDriveFree (p. 592)
CardStatus (p. 578)	FullMemReset (p. 581)	USRDriveSize (p. 592)
CPUDriveFree (p. 579)	MemoryFree (p. 585)	
DeleteCardFilesOnMismatch (p. 580)	MemorySize (p. 585)	

TABLE 153: Info Tables and Settings: Miscellaneous		
CAOOffset() (p. 578)	PortStatus() (p. 587)	TimeStamp (p. 591)
IxResistor (p. 583)	RecNum (p. 588)	UTCOffset (p. 592)
PanelTemp (p. 587)	StationName (p. 591)	WatchdogErrors (p. 593)
PortConfig() (p. 587)	SW12Volts (p. 591)()	

TABLE 154: Info Tables and Settings: Obsolete			
<i>IPTrace</i> (p. 583)	TCPClientConnections (p. 591)	TLSEnabled	
PakBusNodes (p. 586)	TCPPort (p. 591)		
ServicesEnabled() (n. 590)			

TABLE 155: Info Tables and Settings: OS and Hardware Versioning				
OSDate (p. 586)	OSVersion (p. 586)	SerialNumber (p. 590)		
OSSignature (p. 586)	RevBoard (p. 589)			

TABLE 156: Info Tables and Settings: Power Monitors			
Battery (p. 577)		Low5VCount (p. 584)	
	LithiumBattery (p. 584)		
	Low12VCount (p. 584)		

TABLE 157: Info Tables and Settings: Security		
PakBusTCPPassword (p. 587)	Security(3) (p. 590)	
Security(1) (p. 589)	TLS Certificate	
Security(2) (p. 589)	TLS Private Key	

TABLE 158: Info Tables and Settings: Signatures				
OSSignature (p. 586)	ProgSignature (p. 588)	RunSignature (p. 589)		

# A.2 Info Tables and Settings Descriptions

The CR3000 has several places where system information and settings are stored or changed:

- Status table an automatically created data table. In general, status fields should not be expected to give an instantaneous update of the value being read. In most cases the values give a reasonable snapshot of the status of the system. For most applications, there is a way to get an instantaneous value directly with a CRBASIC instruction.
- Settings the CR3000 has over 200 settings. Most of these are best accessed using *Device Configuration Utility*, which provides more information about their use.
- **DataTableInfo** table a data table that is automatically created when a program produces other data tables
- **CPIInfo** table a data table that is automatically created when a program includes CPI instructions.

In many cases, the Info Tables and Settings keyword can be used to pull that field into a running CRBasic program. See *Info Tables and Settings* — *Setup Tools (p. 117).* 

Two data types are identified as being associated with Info Tables and Settings. These are Numeric and String. For most applications, the CR3000 operating system will handle the nuances of Numerics, which can end up one of several CRBasic data types.

TABLE 159: Info Tables and Settings: B				
Keyword	Data Type	Read Only	• Where to Find  Description	
Battery	Numeric	Y	<ul> <li>Station Status field: Battery Voltage</li> <li>Status table field: 13</li> <li>Voltage (Vdc) of the battery connected to the POWER IN 12V and G terminals.</li> <li>Measurement is made during auto (background) calibration. This measurement is made with less settling time than the CRBasic Battery() instruction. Updates when auto self-calibration executes (once per minute).</li> </ul>	
Baudrate()	Numeric		Settings Editor: Com Ports Settings: Baud Rate  Array of integers setting baud rates for communication (COM) ports.	
Beacon()	Numeric		• Settings Editor: Com Ports Settings   Beacon Interval Governs the interval at which the CR3000 broadcasts PakBus messages on the selected COM port to discover new neighboring nodes, and it governs the default verification interval if the value of the Verify (p. 592) setting for the selected port is 0.	
BuffDepth	Numeric	Y	• Status table field: ≈35  Shows the current <i>pipeline mode (p. 161)</i> processing buffer depth, which indicates how far the processing task is currently behind the measurement task. Updated at the conclusion of scan processing, prior to waiting for the next scan.	

TABLE 160: Info	TABLE 160: Info Tables and Settings: C				
Keyword	Data Type	Read Only	• Where to Find  Description		
CalDiffOffset() <sup>2</sup>	Numeric	<b>✓</b>	• Status table field: ≈49  Array of integers reporting differential offsets (mV) for each integration / range combination. Updated by auto self-calibration when required. Updated by auto self-calibration.		

CalGain() <sup>2</sup>	Numeric	Y	• Status table field: ≈47  Array of floating-point values reporting calibration gain (mV) for each integration / range combination. Updated by auto self-calibration.
CalSeOffSet <sup>2</sup> ()	Numeric	Y	• Status table field: ≈48  Array of integers reporting single-ended offsets for each integration / range combination.  Updated by auto self-calibration.
CalVolts() <sup>2</sup>	Numeric	Y	• Status table field: ≈47  Array of three floating-point values reporting a factory calibrated correction factor for analog input voltage range ±5000 mV, ±1000 mV, ±200 mV. Updated by auto (background) calibration. Updates at start up calibration.
CAOOffset()	Numeric	Y	• Status table field: ≈52  Offset of each active CAO terminal measured at compile time; used when the CRBasic program sets the CAO to the programmed value. Usual value is near 0.
CardBytesFree	Numeric	Y	Keyboard: Settings (Datalogger)  Number of bytes free on the removable memory card1 means no card.
CardStatus	String	Y	<ul> <li>Station Status field: Card Status</li> <li>Status table field: ≈30</li> <li>Contains a string with the most recent status information for the removable memory card.</li> </ul>
Central Routers()	Numeric		Settings Editor: Advanced   Central Routers  Array of eight PakBus addresses for routers that can act as central routers.
CommActive()			Discontinued in OS 28 of CR800, CR1000, CR3000. Never in CR6. Function is replaced by CRBasic instruction <b>ComPortIsActive()</b> .
CommConfig()			Discontinued
Comms MemAlloc	Numeric		• Settings Editor: Advanced   Communication Allocation Replaces PakBusNodes. Specifies the amount of memory that the CR3000 allocates for maintaining PakBus routing information. Represents roughly the maximum number of PakBus nodes that the CR3000 tracks in its routing tables. Default = 50, which is normally enough. Can probably be reduced in small networks to free memory.

	1		
Comms MemFree(1)	Numeric	Y	• Status table field: ≈27  Succession of two-digit values in a single integer. Each value represents the number of buffers allocated to one of five communication buffer pools: huge(≈18 kB each), large (≈3 kB each), medium (≈530 bytes each), little (≈100 bytes each), and tiny (16 bytes each). When the system requires a buffer, one is taken from the smallest suitably-sized pool that has at least one available. When the communication task is complete, the buffer is returned to the pool. When TLS is active, all five pools are drawn from. When TLS is not active, huge is not used, and fewer buffers are allocated for the remaining pools. Updated when status is queried. Allocations:  TLS active: 2309999160 (huge is left most — 02-30-99-99-160)  TLS not active: 15251505 (large is left most — 15-25-15-05)  Use the following expressions to decode the individual values from CommsMemFree(1): tiny = CommsMemFree(1) / 100) % 100  mid = (CommsMemFree(1) / 1000) % 100  med = (CommsMemFree(1) / 10000000) % 100  lrg = (CommsMemFree(1) / 100000000) % 100
Comms MemFree(2)	Numeric	Y	• Status table field: ≈27  Number of buffers (224 bytes each) free in <i>keep memory (p. 543)</i> for PakBus routing, neighbor lists, communication timeouts, TCP/IP connections, and CommsMemAlloc setting. Each route or neighbor requires one buffer. Doubling CommsMemAlloc from the default of 50 doubles CommsMemFree(2) from ≈300 to ≈600. Updated when status is queried.
Comms MemFree(3)	Numeric	Y	• Status table field: ≈27  An integer specifying four two-digit fields, read from left to right as (1) number of output packets waiting to be sent, (2) number of input packets waiting to be serviced, (3) number of big packets available for TCP/IP comms, and (4) number of little packets available for TCP/IP comms. Value at start up with no TCP/IP comms is 1530 (no output packets, no input packets, 15 big packets, and 30 little packets). As TCP/IP comms commence, the output and input queues increase from 0, big packets decrease from 15, and little packets decrease from 30. These values are reported in IPTraceComport (p. 543) setting every 30 seconds as sendq, recvdq, bigfreeq, and lilfreeq. Updated when status is queried. The following expressions decode the values:  lilfreeq = CommsMemFree(3) % 100 bigfreeq = (CommsMemFree(3) / 1000) % 100 rcvdq = (CommsMemFree(3) / 100000) % 100 sendq = (CommsmemFree(3) / 1000000) % 100
CompileResults	String	Y	Station Status field: Results for Last Program Compiled     Status table field: ≈18 Contains error messages generated at compilation or during runtime. Updated after compile. Also appended to at run time for run time errors such as variable out of bounds.
CPUDriveFree	Numeric	Y	Keyboard: Settings (Datalogger)  Bytes remaining on the CPU: drive.
CSIO1net Enable	Numeric		Settings Editor: CS I/O IP   Enabled #2
CSIO2net Enable	Numeric		Settings Editor: CS I/O IP   Enabled (#1)

CSIOInfo	String		• Settings Editor: CS I/O   {info box}
----------	--------	--	--

<sup>&</sup>lt;sup>2</sup> Order and definitions of auto self-calibration array elements:

- (1) 5000 mV range 250 ms integration
- (2) 1000 mV range 250 ms integration
- (3) 200 mV range 250 ms integration
- (4) 50 mV range 250 ms integration
- (5) 20 mV range 250 ms integration
- (6) 5000 mV range 60 Hz integration
- (7) 1000 mV range 60 Hz integration
- (8) 200 mV range 60 Hz integration
- (9) 50 mV range 60 Hz integration
- (10) 20 mV range 60 Hz integration
- (11) 5000 mV range 50 Hz integration
- (12) 1000 mV range 50 Hz integration
- (13) 200 mV range 50 Hz integration
- (14) 50 mV range 50 Hz integration
- (15) 20 mV range 50 Hz integration

TABLE 161: Info Tables and Settings: D				
Keyword	Data Type	Read Only	• Where to Find  Description	
DataFillDays()	Numeric	Y	DataTableInfo table  Reports the time required to fill a data table. Each table has its own entry in a two-dimensional array. First dimension is for on-board memory. Second dimension is for card memory.	
DataRecord Size()	Numeric	Y	DataTableInfo table  Reports the number of records in a data table.	
DataTable Name()	String	Y	DataTableInfo table  Reports the names of data tables. Array elements are in the order the data tables are declared in the CRBasic program.	
DeleteCardFiles OnMismatch	Numeric		Keyboard: Settings (Advanced)  Defaults to False	
DNS()	String		<ul> <li>Settings Editor: Ethernet, CS I/O IP, PPP, Wi-Fi   DNS Server 1, DNS Server 2</li> <li>Keyboard: Settings (Network Services)</li> <li>Specifies the addresses of two domain name servers that the CR3000 can use to resolve domain names to IP addresses. Note that if DHCP is used to resolve IP information, the addresses obtained via DHCP are appended to this list. Defaults to 0.0.0.0. Form: 0-255.0-255.0-255.0-255</li> </ul>	

TABLE 162: Info Tables and Settings: E				
Volumerd	Data Type	Read Only	Where to Find  Description	
Keyword	Data Type		Description	
ErrorCalib	Numeric	Y	• Status table field: ≈25 Number of erroneous calibration values measured. Erroneous values are discarded. Auto self-calibration runs in a hidden slow-sequence scan. Updated at startup or auto self-calibration.	
EthernetEnable	Numeric		Settings Editor: Ethernet   Ethernet Enable	
EthernetInfo	String		Settings Editor: Ethernet   {info box}	
EthernetPower	UINT2		Settings Editor: Ethernet   Ethernet Power     1 to 4, 4 = always off	

TABLE 163: Info Tables and Settings: F			
Keyword	Data Type	Read Only	• Where to Find  Description
- Neyword	Data Type		Description
FilesManager	String		• Settings Editor: Advanced   Files Manager  Specifies the numbers of files of a designated type that are saved when received from a specified node.
FTPEnabled	Numeric		• Settings Editor: Network Services   FTP Enabled Set to 1 if to enable FTP service. Default is 0.
FTPPassword	String		• Settings Editor: Network Services   FTP Password Specifies the password that is used to log in to the FTP server.
FTPPort	UINT2		• Settings Editor: Network Services   FTP Service Port  Configures the TCP port on which the FTP service is offered. The default value is usually sufficient unless a different value needs to be specified to accommodate port mapping rules in a network address translation firewall. Default = 21.
FTPUserName	String		• Settings Editor: <b>Network Services</b>   <b>FTP User Name</b> Specifies the user name that is used to log in to the FTP server. An empty string or "anonymous" (the default) inactivates the FTP server. Zero to 63 characters.

FullMemReset	Numeric	• Status table field: ≈30 Enter 98765 to start a full-memory reset.

TABLE 164: Info Tables and Settings: H				
Keyword	Data Type	Read Only	• Where to Find  Description	
HTTPEnabled	Numeric		• Settings Editor: Network Services   HTTP Enabled Enables (True) or disables (False) the HTTP service. Default is True.	
HTTPHeader	String		Keyboard: Settings (Advanced)	
HTTPPort	Numeric		• Settings Editor: <b>Network Services</b>   <b>HTTP Service Port</b> Configures the TCP port on which the HTTP (web server) service is offered. Generally, the default value is sufficient unless a different value needs to be specified in order to accommodate port-mapping rules in a network-address translation firewall. Default = 80.	

TABLE 165: Info	TABLE 165: Info Tables and Settings: I				
Keyword	Data Type	Read Only	• Where to Find  Description		
IncludeFile	String		Settings Editor: Advanced   Include File Name  Name of a file to be included at the end of the current CRBasic program, or that can be run as the default program.		
IPAddressCSIO()	String		Settings Editor: CS I/O IP   IP Address		
IPAddressEth	String		• Settings Editor: Ethernet   IP Address  Specifies the IP address for the Ethernet interface. If zero, the address, net mask, and gateway are configured automatically using DHCP. Made available only if an Ethernet link is connected. A change will cause the CRBasic program to recompile.		
IPGateway	String		Settings Editor: Ethernet   IP Gateway  Specifies the address of the IP router to which the CR3000 will forward all non-local IP packets for which it has no route. A change will cause the CRBasic program to recompile.		
IPGateway CSIO()	String		Settings Editor: CS I/O IP   Gateway		

		Specifies the gateway for CS I/O. A change will cause the CRBasic program to recompile.
IPInfo <sup>1</sup>	String	• Settings Editor: Ethernet   {information box} Indicates current parameters for IP connection. IPInfo is a status field but the CR3000 processes it as a setting to minimize bandwidth. It requires about 1.5 KB when all IP interfaces are active. This 1.5 KB is transfered each time it is requested regardless of how many IP interfaces are actually used. See IPInfo() CRBasic instruction. Updates when status is queried.
IPMaskCSIO()	String	Settings Editor: CS I/O IP   Subnet Mask
IPMaskEth	String	Settings Editor: Ethernet   Subnet Mask  Specifies the subnet mask for the Ethernet interface. This setting is made available when an Ethernet link is connected. A change will cause the CRBasic program to recompile.
IPTrace		Discontinued; aliased to IPTraceComport
IPTraceCode	UINT2	• Settings Editor: Advanced   IP Trace Code  Controls what type of information is sent on the port specified by IPTraceComport and via Telnet. Default = 0.
IPTraceComport	Numeric	• Settings Editor: Advanced   IP Trace COM Port  Specifies the port (if any) on which TCP/IP trace information is sent. Information type is controlled by IPTraceCode. Default is 0 = inactive.
IsRouter	Numeric	• Settings Editor: Advanced   Is Router Controls configuration of CR3000 as a router or leaf node. True = router. False (default) = leaf node.
IxResistor	Numeric	• Status table field: ≈51  Y Factory-calibrated correction factor (ohms) applied to resistance measurements. Normal value is near 1000 ohms. Updates at start up.

TABLE 166: Info Tables and Settings: L						
Keyword	Data Type	Read Only	Where to Find  Description			
LastSlowScan()	NUMERI C	Y	• Status table field: ≈37  Reports the last time a SlowSequence scan in the CRBasic program was executed. See MaxSlowProcTime (p. 584), SkippedSlowScan (p. 590), SlowProcTime (p. 590).			

LastSystemScan	NUMERI C	Y	• Status table field: ≈36  Reports the time of the of the last auto (background) calibration, which runs in a hidden slow-sequence type scan. See MaxSystemProcTime (p. 584), SkippedSystemScan (p. 590), and SystemProcTime (p. 591).
LithiumBattery	Numeric	Y	Station Status field: Lithium Battery     Status table field: ≈14  Voltage of the internal lithium battery. Updated only at CR3000 power up. Normal range: 2.7 to 3.6 Vdc. Replace lithium battery if <2.7 Vdc. Updates when auto self-calibration executes (once per minute).
Low12VCount	Numeric		• Station Status field: Number of times voltage has dropped below 12V • Status table field 17 Counts the number of times the primary CR3000 supply voltage drops below ≈10. Updates with each Status table update. Range = 0 to 99. Reset by entering 0. Incremented prior to scan (slow or fast) with measurements if the internal hardware signal is asserted.
Low5VCount	Numeric		<ul> <li>Station Status field: Number of times voltage has dropped below 5V</li> <li>Status table field: 16</li> <li>Counts the number of times the 5 Vdc supply drops below a functional threshold. Range = 0 to 99. Reset by entering 0.</li> </ul>

TABLE 167: Info	TABLE 167: Info Tables and Settings: M				
Keyword	Data Type	Read Only	• Where to Find  Description		
MaxBuffDepth	Numeric		• Status table field: ≈36  Maximum number of buffers the CR3000 will use to process lagged measurements.		
MaxPacketSize	Numeric		• Settings Editor: Advanced   Max Packet Size  Maximum number of bytes per data collection packet. Default = 1000.		
MaxProcTime	Numeric		• Status table field: $\approx 33$ Maximum time ( $\mu$ s) required to run through processing for the current scan. Value is reset when the scan exits. Enter 0 to reset. Updated at the conclusion of scan processing, prior to waiting for the next scan.		
MaxSlowProc Time()	Numeric		• Status table field: ≈41  Maximum time (μs) required to process a SlowSequence scan in the CRBasic program.  Defaults to 0 until a scan runs. Enter 0 to reset.		

MaxSystem ProcTime	Numeric	Y	• Status table field: ≈40  Maximum time (μs) required to process the auto (background) calibration, which runs in a hidden slow-sequence type scan. Displays 0 until an auto self-calibration runs. Enter 0 to reset.
MeasureOps	Numeric	Y	• Status table field: ≈30 Reports the number of task-sequencer opcodes required to do all measurements. Calculated at compile time. Includes opcodes for calibration (compile time), auto (background) calibration (system), and slow sequences. Assumes all measurement instructions run each scan. Updated after compile and before running.
MeasureTime	Numeric	Y	• Status table field: ≈31 Reports the time (µs) needed to make measurements in the current scan. Calculated at compile time. Includes integration and settling time. In pipeline mode, processing occurs concurrent with this time so the sum of MeasureTime and ProcessTime is not equal to the required scan time. Assumes all measurement instructions will run each scan. Updated when a main scan begins.
MemoryFree	Numeric	Y	Station Status field: Memory Free     Status table field: ≈27 Unallocated SRAM memory on the CPU (bytes). All free memory may not be available for data tables. As memory is allocated and freed, holes of unallocated memory, which are unusable for final-storage memory, may be created. Updated after compile completes.
MemorySize	Numeric	Y	Station Status field: Memory     Status table field: ≈26 Total SRAM (bytes) in the CR3000. Updated at startup.
MsgErr	Numeric		CPIInfo table
Messages	String		Status table field: ≈46 Contains a string of manually entered messages.

TABLE 168: Info Tables and Settings: N					
Keyword	Data Type	Read Only	• Where to Find  Description		
Neighbors()	String		Settings Editor: Com Ports Settings   Neighbors Allowed  Array of integers indicating PakBus neighbors allowed for communication ports.		
NoSvc	String		CPIInfo table  Array of integers indicating PakBus neighbors allowed for communication ports.		

TABLE 169: Info	TABLE 169: Info Tables and Settings: O				
Keyword	Data Type	Read Only	• Where to Find  Description		
OSDate	String	Y	<ul> <li>Station Status field: OS Date</li> <li>Status table field: 2</li> <li>Release date of the operating system in the format yymmdd. Updated at startup.</li> </ul>		
OSSignature	Numeric	Y	<ul> <li>Station Status field: OS Signature</li> <li>Status table field: 3</li> <li>Signature of the operating system.</li> </ul>		
OSVersion	String	Y	<ul> <li>Station Status field: OS Version</li> <li>Settings Editor: OS Version</li> <li>Status table field: 1</li> <li>Version of the operating system in the CR3000. Updated at OS startup.</li> </ul>		

TABLE 170: Info Tables and Settings: P				
Keyword	Data Type	Read Only	• Where to Find  Description	
PakBusAddress	Numeric		• Settings Editor: <b>Datalogger</b>   <b>PakBus Address</b> PakBus address for this CR3000. Assign a unique address if this CR3000 is to be placed in a PakBus network. Addresses 1 to 4094 are valid, but those ≥ 4000 are usually reserved for datalogger support software. Default = 1.	
PakBus EncryptionKey	String		Settings Editor: Datalogger   PakBus Encryption Key Encryption key; 0 to 63 characters	
PakBusNodes			Discontinued; aliased to CommsMemAlloc	
PakBusPort	Numeric	Y	• Settings Editor: Network Services   PakBus/TCP Service Port  Specifies the TCP service port for PakBus communications if the PPP service is enabled.  Unless firewall issues exist, this setting probably does not need to be changed from its default value. Default 6785.	

PakBusRoutes	String	Y	<ul> <li>Settings Editor: Advanced   Route Filters</li> <li>Status table field: ≈45</li> <li>Lists routes or router neighbors known to the CR3000 at the time the setting was read. Each route is represented by four components separated by commas and enclosed in parentheses: (port, via neighbor adr, pakbus adr, response time). Default = (1, 4089, 4089, 1000). Updates when routes are added or deleted.</li> </ul>
PakBusTCP Clients	String		Settings Editor: Network Services   PakBus/TCP Clients  Up to four addresses specifying outgoing PakBus/TCP connections for the CR3000 to maintain.
PakBusTCP Enabled	Numeric		Settings Editor: Datalogger   PakBus/TCP Password     Enables (True [default]) or disables (False) the PakBus TCP service.
PakBusTCP Password	String		Settings Editor: Datalogger   PakBus/TCP Password  When active (not blank), a log-in process using an MD5 digest of a random number and this password must take place successfully before PakBus communications can proceed over an IP socket.
PanelTemp	FLOAT	Y	Station Status field: Panel Temperature     Status table field: 12 Current wiring-panel temperature (°C). Measurement is made in auto self-calibration. When auto self-calibration executes (once per minute).
PingEnabled	Numeric		Settings Editor: Network Services   Ping (ICMP) Enabled     Enables (True [default]) or disables (False) the ICMP ping service.
PortConfig()	String	Y	• Status table field: ≈43 Sets up C terminals in numeric order of terminals. Set up for input, output, SDM, SDI-12, COM port. Default = Input. Updates when the port configuration changes.
PortStatus()	Numeric		• Status table field: ≈42  States of C terminals configured for control. On/high (True) or off/low (False). Array elements in numeric order of C terminals. Default = False. Updates when state changes.
pppDial	String		• Settings Editor: PPP   Modem Dial String  Specifies the dial string that follows ATD or a list of AT commands separated by ';' that are used to initialize and dial through a modem before a PPP connection is attempted. A blank string means that dialing is not necessary before a PPP connection is established. CRBasic program will recompile if changed from NULL to not NULL, or from not NULL to NULL.
pppDialResponse	String		Settings Editor: PPP   Modem Dial Response  Specifies the response expected after dialing a modem before a PPP connection can be established. Default is CONNECT. CRBasic program recompiles if changed from NULL to not NULL, or from not NULL to NULL.
pppInfo	String		Settings Editor: PPP   PPP Network Status

pppInterface	Numeric		Settings Editor: PPP   Config/Port Used  Sets the CR3000 PPP port. Warning: if this value is set to CS I/O ME, do not attach other devices to the CS I/O port. A change will cause the CRBasic program to recompile.
pppIPAddr	String		Settings Editor: PPP   IP Address  IP address of the PPP interface. A value of 0.0.0.0 or an empty string indicates that DHCP must be used to resolve this address and the subnet mask.
pppIPMask	String		
pppPassword	String		• Settings Editor: PPP   Password  Specifies the password that is used to log in to the PPP server when the PPP interface setting is set to one of the client selections. Also specifies the password that must be provided by the PPP client when the PPP interface setting is set to one of the server selections.
pppUsername	String		Settings Editor: PPP   User Name Specifies the user name that is used to log in to the PPP server.
ProcessTime	Numeric	Y	• Status table field: ≈32  Processing time (µs) of the last scan. Time is measured from the end of the EndScan instruction (after the measurement event is set) to the beginning of the EndScan (before the wait for the measurement event begins) for the subsequent scan. Calculated on-the-fly. Updated at the conclusion of scan processing, prior to waiting for the next scan.
ProgErrors	Numeric	Y	• Status table field: ≈20 Number of compile or runtime errors for the running program. Updated after compile.
ProgName	String	Y	<ul> <li>Station Status field: Current Program</li> <li>Status table field: 10</li> <li>Name of current (running) program; updates at startup</li> </ul>
ProgSignature	Numeric	Y	<ul> <li>Station Status field: Program Signature</li> <li>Status table field: 10</li> <li>Signature of the running CRBasic program including comments. Does not change with operating-system changes. Updates after parsing the program.</li> </ul>

TABLE 171: Info Tables and Settings: R						
Keyword	Data Type	Read Only	• Where to Find  Description			
RecNum	LONG	Y	Record number increments only when the record is requested by support software. If record number is needed for a CRBasic program operation, use <b>Record</b> in the <b>Public</b> table. When			

			using <b>Public.Record(1,1)</b> , the <b>NextScan</b> that occurs in the MAIN sequence (not in any of the slow sequences) increments the record number. Range = $0$ to $2^{32}$ .
RevBoard	String	Y	• Status table field: 5  Electronics board revision in the form xxx.yyy, where xxx = hardware revision number; yyy = clock chip software revision. Stored in flash memory. Updated at startup.
RouteFilters	String		Settings Editor: Advanced   Route Filters  Restricts routing or processing of some PakBus message types.
RS232 Handshaking	Numeric		• Settings Editor: Advanced   RS232 Hardware Handshaking Buffer Size  If non-zero, hardware handshaking is active on the RS-232 port. This setting specifies the maximum packet size sent between checking for CTS.
RS232Power	Numeric		• Settings Editor: Advanced   RS232 Always On  Controls whether the RS-232 port will remain active even when communication is not taking place. If RS-232 handshaking is enabled (RS232Handshaking is non-zero), this setting must be set to True. Default = False.
RS232Timeout	Numeric		Settings Editor: Advanced   RS232 Hardware Handshaking Timeout  RS-232 hardware handshaking timeout. Specifies the time (tens of ms) that the CR3000 will wait between packets if CTS is not asserted.
RunSignature	Numeric	Y	<ul> <li>Station Status field: Run Signature</li> <li>Status table field: 9</li> <li>Signature of the running binary (compiled) program. Value is independent of comments or non-functional changes. Often changes with operating-system changes. Updates after compiling and before running the program.</li> </ul>

TABLE 172: Info	TABLE 172: Info Tables and Settings: S					
Keyword	Data Type	Read Only	• Where to Find  Description			
	1	3.7				
SDCInfo	String	Y	Settings Editor: Advanced   SDC Baudrate			
SecsPerRecord()	Numeric	Y	DataTableInfo table  Reports the data output interval (s) for a data table.			
Security(1)	Numeric		• Settings Editor: <b>Datalogger</b>   <b>Security Level 1</b> First level in an array of three security codes. Not shown if security is enabled. <b>0</b> disables all security.			

	1			
Security(2)	Numeric		• Settings Editor: <b>Datalogger</b>   <b>Security Level 2</b> Second level in an array of three security codes. Not shown if security is enabled. <b>0</b> disables levels 2 and 3.	
Security(3)	Numeric		• Settings Editor: Datalogger   Security Level 3  Third level in an array of three security codes. Not shown if security is enabled. 0 disables level 3.	
SerialNumber	Numeric	Y	<ul> <li>Settings Editor: Datalogger   Serial Number</li> <li>Status table field: 4</li> <li>CR3000 serial number assigned by the factory. Stored in flash memory. Updated at startup.</li> </ul>	
Services Enabled()			Discontinued; replaced by/aliased to HTTPEnabled, PakBusTCPEnabled, PingEnabled, TelnetEnabled, TLSEnabled	
SkipPakBusRing				
SkippedRecord()	Numeric	Y	<ul> <li>Station Status field: Skipped Records in XXXX</li> <li>DataTableInfo table</li> <li>Reports how many records have been skipped in a data table. Array elements are in the order that data tables are declared in the CRBasic program. Enter 0 to reset.</li> </ul>	
SkippedScan	Numeric	Y	<ul> <li>Station Status field: Skipped Scans</li> <li>Status table field: ≈22</li> <li>Number of skipped program scans (p. 512) that have occurred while running the CRBasic program. Does not include scans intentionally skipped as may occur with the use of ExitScan and Do / Loop instructions. Updated when they occur.</li> </ul>	
SkippedSlow Scan()	Numeric	Y	<ul> <li>Station Status field: Skipped Slow Scans</li> <li>Status table field: ≈24</li> <li>Number of skipped scans for each SlowSequence scan in the CRBasic program. See LastSlowScan (p. 583), MaxSlowProcTime (p. 584), SlowProcTime (p. 590).</li> </ul>	
Skipped SystemScan()	Numeric	Y	<ul> <li>Station Status field: Skipped System Scans</li> <li>Status table field: ≈23</li> <li>Number of scans skipped in the auto (background) calibration. Enter 0 to reset. See LastSystemScan (p. 583), MaxSystemProcTime (p. 584), and SystemProcTime (p. 591).</li> </ul>	
SlowProcTime()	Numeric	Y	• Status table field: ≈39  Time (μs) required to process a SlowSequence scan. See LastSlowScan (p. 583),  MaxSlowProcTime (p. 584), SkippedSlowScan (p. 590). Default is a large number until a SlowSequence runs.	

StartTime	NSEC	Y	Station Status field: Start Time     Status table field: 8  Time (date and time) the CRBasic program started. Updates at beginning of program compile.	
StartUpCode	Numeric	Y	• Status table field: ≈19 Indicates how the running program was compiled. True: program compiled by CR3000 starting from a power-down condition. False: program compiled by either a Program Send, a File Control transaction, or a watchdog reset. Updated at startup.	
StationName			<ul> <li>Settings Editor: Datalogger   Station Name</li> <li>Status table field: 6</li> <li>Station name stored in flash memory. This is not the same name as that is entered into LoggerNet. This station name can be sampled into a data table, but it is not the name that</li> </ul>	
SW12Volts()	Numeric	• Status table field: ≈44 Status of switched, 12 Vdc terminal. True = on. Updates when the state changes.		
SystemProcTime	FLOAT	Y	• Status table field: ≈37  Time (μs) required to process auto (background) calibration. Default is a large number u auto self-calibration runs.	

TABLE 173: Info Tables and Settings: T			
Keyword	Data Type	Read Only	
TCPClient Connections			Discontinued; replaced by / aliased to PakBusTCPClients (p. 587).
TCPPort			Discontinued; replaced by / aliased to PakBusPort (p. 586).
TelnetEnabled	NUMERI C		Settings Editor: Network Services   Telnet Enabled     Enables (True) or disables (False) the Telnet service.
TimeStamp	NSEC	Y	Scan-time that a record was generated.

TABLE 174: Info Tables and Settings: U				
Keyword	Data Type	Read Only	• Where to Find  Description	
UDPBroadcast Filter	UINT2		• Settings Editor: Advanced   IP Broadcast Filtered  Default = 0.	
USRDriveFree	Numeric	Y	• Keyboard: Settings (Advanced)  Bytes remaining on the USR: drive. USR: drive is user-created and normally used to store .jpg and other files. Default = 0.	
USRDriveSize	Numeric		• Settings Editor: Advanced   USR: Drive Size  Sets size (bytes) of the USR: drive. If 0 (default), the drive is removed. If non-zero, the drive is created. A change will cause the CRBasic program to recompile.	
UTCOffset	Numeric		• Settings Editor: Advanced   UTC Offset  Difference (s) between local time (CR3000 clock) and UTC. Used in email, HTML headers,  GPS(), NetworkTimeProtocol(), and DaylightSavingTime(). Default = -1 (disabled).	

TABLE 175: Info Tables and Settings: V			
Keyword	Data Type	Read Only	• Where to Find  Description
VarOutOfBound	Numeric	Y	Status field: Variable Out of Bounds     Status table field: ≈21  Number of attempts to write to an array outside of the declared size. The write does not occur. Indicates a CRBasic program error. If an array is used in a loop or expression, the pre-compiler and compiler do not check to see if an array is accessed out-of-bounds (i.e., accessing an array with a variable index such as arr(index) = arr(index−1), where index is a variable). Updated at run time when the error occurs.
Verify()	Numeric		• Settings Editor: ComPorts Settings   Verify Interval  Array of integers indicating the intervals (s) that are reported as the link verification intervals in PakBus hello transaction messages. Indirectly governs the rate at which the CR3000 attempts to start a hello transaction if no other communication has taken place within the interval.

TABLE 176: Info Tables and Settings: W				
Keyword	Data Type	Read Only	• Where to Find  Description	
WatchdogErrors	Numeric	Y	<ul> <li>Station Status field: Watchdog Errors</li> <li>Status table field: 11</li> <li>Number of watchdog errors that have occurred while running this program. Resets automatically when a new program is compiled. Enter 0 to reset. At startup and at occurrence.</li> </ul>	

# Appendix B. Serial Port Pinouts

## **B.1 CS I/O Communication Port**

Pin configuration for the CR3000 CS I/O port is listed in table *Pinout of CR3000 CS I/O D-Type Connector Port (p. 595)*.

TABLE 177: Pinout of CR3000 CS I/O D-Type Connector Port

TABLE 1//: Pinout of CR3000 CS I/O D-Type Connector Port					
Pin Number	Function	Input (I) Output (O)	Description		
1	5 Vdc	О	5 Vdc: sources 5 Vdc, used to power peripherals.		
2	SG		Signal ground: provides a power return for pin 1 (5V), and is used as a reference for voltage levels.		
3	RING	I	Ring: raised by a peripheral to put the CR3000 in the telecoms mode.		
4	RXD	I	Receive data: derial data transmitted by a peripheral are received on pin 4.		
5	ME	О	Modem enable: raised when the CR3000 determines that a modem raised the ring line.		
6	SDE	O	Synchronous device enable: addresses synchronous devices (SD); used as an enable line for printers.		
7	CLK/HS	I/O	Clock/handshake: with the SDE and TXD lines addresses and transfers data to SDs. When not used as a clock, pin 7 can be used as a handshake line; during printer output, high enables, low disables.		
8	+12 Vdc		Nominal 12 Vdc power. Same power as 12V and SW12 terminals. See <i>TABLE:</i> Current Source and Sink Limits (p. 424).		
9	TXD	О	Transmit data: transmits serial data from CR3000 to peripherals on pin 9; logic-low marking (0V), logic-high spacing (5V), standard-asynchronous ASCII: eight data bits, no parity, one start bit, one stop bit. User selectable baud rates: 300, 1200, 2400, 4800, 9600, 19200, 38400, 115200.		

### **B.2 RS-232 Communication Port**

#### **B.2.1 Pin Outs**

Pin configuration for the CR3000 **RS-232** nine-pin port is listed in table *Pinout of CR3000 RS-232 D-Type Connector Port (p. 596)*. Information for using a null modem with **RS-232** is given in table *Standard Null-Modem Cable Pinout (p. 596)*.

The CR3000 **RS-232** port functions as either a DCE (data communication equipment) or DTE (data terminal equipment) device. For **RS-232** port to function as a DTE device, a null modem cable is required. The most common use of **RS-232** port is as a connection to a computer DTE device. A standard DB9-to-DB9 cable can connect the computer DTE device to the CR3000 DCE device. The following table describes **RS-232** pin function with standard DCE-naming notation.

**Note** Pins 1, 4, 6, and 9 function differently than a standard DCE device. This is to accommodate a connection to a modem or other DCE device via a null modem.

TABLE 178: Pin Out of CR3000 RS-232 D-Type Connector Port

Pin Number	Function	Input (I) Output (O)	Description
11	DTR (tied to pin 6)	О	Data terminal ready
2	TXD	0	Asynchronous data transmit
3	RXD	I	Asynchronous data receive
41	N/A	N/A	Not connected
5	GND	GND	Ground
6 <sup>1</sup>	DTR	0	Data terminal ready
7	CTS	I	Clear to send
8	RTS	0	Request to send
91	RI	I	Ring

<sup>&</sup>lt;sup>1</sup> Different pin function compared to a standard DCE device. This pin out accommodates a connection to modem or other DCE devices over a null-modem cable.

TABLE 179: Standard Null-Modem Cable Pin Out					
Female DB9 Socket		Female DB9 Socket			
1 & 6		4			
2		3			
3		2			
4		1 & 6			
5		5			
7		8			
8		7			
0	most null modems have	0			

<sup>&</sup>lt;sup>1</sup> If the null-modem cable does not connect pin 9 to pin 9, configure the modem to output **RING** (or other characters previous to the DTR being asserted) on the modem TX line to wake the CR3000 and activate the DTR line or enable the modem.

no connection<sup>1</sup>

#### **B.2.2 Power States**

The RS-232 port is powered under the following conditions: 1) when the setting RS232Power is set or 2) when the SerialOpen() for COMRS232 is used in the program. These conditions leave RS-232 on with no timeout. If SerialClose() is used after SerialOpen(), the port is powered down and left in a sleep mode waiting for characters to come in.

Under normal operation, the port is powered down waiting for input. Upon receiving input there is a 40 second software timeout before shutting down. The 40 second timeout is generally circumvented when communicating with *datalogger support software (p. 91)* because it sends information as part of the protocol that lets the CR3000 know it can shut down the port.

When in sleep mode, hardware is configured to detect activity and wake up. Sleep mode has the penalty of losing the first character of the incoming data stream. PakBus takes this into consideration in the "ring packets" that are preceded with extra sync bytes at the start of the packet. **SerialOpen()** leaves the interface powered-up, so no incoming bytes are lost.

When the logger has data to send via **RS-232**, if the data are not a response to a received packet, such as sending a beacon, then it will power up the interface, send the data, and return to sleep mode with no 40 second timeout.

# Appendix C. FP2 Data Format

FP2 data are two-byte big-endian values. See *Endianness (p. 601)*. Representing bits in each byte pair as ABCDEFGH IJKLMNOP, bits are described in table *FP2 Data-Format Bit Descriptions (p. 599)*.

TABLE 180: FP2 Data-Format Bit Descriptions			
Bit	Description		
A	Polarity, 0 = +, 1 = -		
B, C	Decimal locaters as defined in the table FP2 Decimal Locater Bits.		
D - P	13-bit binary value, D being the MSB (p. 307). Largest 13-bit magnitude is 8191, but Campbell Scientific defines the largest-allowable magnitude as 7999		

Decimal locaters can be viewed as a negative base-10 exponent with decimal locations as shown in *TABLE: FP2 Decimal Locater Bits (p. 599)*.

<b>TABLE 181: FP2 Decimal Locater Bits</b>		
В	С	Decimal Location
0	0	XXXX.
0	1	XXX.X
1	0	XX.XX
1	1	X.XXX

# Appendix D. Endianness

#### Synonyms:

- "Byte order" and "endianness"
- "Little endian" and "least-significant byte first"
- "Big endian" and "most-significant byte first"

Endianness lies at the root of an instrument processor. It is determined by the processor manufacturer. A good discussion of endianness can be found at Wikipedia.com. Issues surrounding endianness in an instrument such as the CR3000 datalogger are usually hidden by the operating system. However, the following CR3000 functions bring endianness to the surface and may require some programming to accommodate differences:

- Serial input / output programming (Serial I/O: Capturing Serial Data (p. 303) )
- Modbus programming (Modbus (p. 476))
- MoveBytes() instruction (see CRBasic Editor Help)
- SDMGeneric() instruction (see CRBasic Editor Help)
- Some PakBus instructions, like GetDataRecord (see CRBasic Editor Help)

For example, when the CR1000 datalogger receives data from a CR9000 datalogger, the byte order of a four byte IEEE4 or integer data value has to be reversed before the value shows properly in the CR1000.

TABLE 182: Endianness in Campbell Scientific Instruments		
Little Endian Instruments	Big Endian Instruments	
CR6 datalogger	CR200(X) Series dataloggers	
CR9000X datalogger	CR800 Series dataloggers	
CRVW Series dataloggers	CR1000 datalogger	
CRS451 recording sensor	CR3000 datalogger	
	CR5000 datalogger	

Use of endianness is discussed in the following sections:

- Section Reading Inverse-Format Modbus Registers (p. 480)
- Appendix FP2 Data Format (p. 599)

# Appendix E. Supporting Products — List

Supporting products power and expand the measurement and control capability of the CR3000. Products listed are manufactured by a Campbell Scientific group company unless otherwise noted. Consult product literature at <a href="https://www.campbellsci.com">www.campbellsci.com</a> or a Campbell Scientific sales engineer to determine what products are most suited to particular applications. The following listings are not exhaustive, but are current as of the manual publication date.

## E.1 Dataloggers — List

#### Related Topics:

- Datalogger Quickstart (p. 38)
- Datalogger Overview (p. 58)
- Dataloggers List (p. 603)

Other Campbell Scientific datalogging devices can be used in networks with the CR3000. Data and control signals can pass from device to device with the CR3000 acting as a master, peer, or slave. Dataloggers communicate in a network via PakBus®, Modbus, DNP3, RS-232, SDI-12, or CANbus using the SDM-CAN module.

TABLE 183: Dataloggers		
Model	Description	
CR200X Series Dataloggers	Limited input, not expandable. Suited for a network of stations with a small numbers of specific inputs. Some models have built-in radio transceivers for spread-spectrum communication and various frequency bands.	
CR800-Series Dataloggers	Limited input, but expandable. Suited for a network of stations with small numbers of specific inputs. The CR850 has a built-in keyboard and display.	
CR6 Measurement and Control Datalogger	12 universal input terminals accept analog or pulse inputs. 4 I/O terminals are configurable for control or multiple communication protocols. This instrument is very versatile, expandable, and networkable.	
CR1000 Measurement and Control System	16 analog input terminals, two pulse input terminals, eight control / I/O terminals. Expandable.	

TABLE 183: Dataloggers		
Model	Description	
CR3000 Micrologger	28 analog input terminals, four pulse input terminals, eight control / I/O terminals. Faster than CR1000. Expandable.	
CR9000X-Series Measurement, Control, and I/O Modules	High speed, configurable, modular, expandable	

## E.2 Measurement and Control Peripherals — List

#### Related Topics:

- Measurement and Control Peripherals Overview (p. 86)
- Measurement and Control Peripherals Details (p. 429)
- Measurement and Control Peripherals Lists (p. 604)

## E.3 Sensor-Input Modules — List

Input peripherals expand sensor input capacity of the CR3000, condition sensor signals, or distribute the measurement load.

### E.3.1 Analog Input Modules — List

Analog-input modules increase CR3000capacity. Some multiplexers allow multiplexing of excitation (analog output) terminals.

TABLE 184: Analog Input Modules		
Model	Description	
AM16/32B	64 channels — configurable for many sensor types. Muliplex analog inputs and excitation.	
AM25T	25 channels — multiplexes analog inputs. Designed for thermocouples and differential inputs	

#### E.3.2 Pulse Input Modules — List

#### Related Topics:

- Low-Level Ac Input Modules Overview (p. 431)
- Low-Level Ac Measurements Details (p. 407)
- Pulse Input Modules List (p. 604)

These modules expand and enhance pulse- and frequency-input capacity.

TABLE 185: Pulse Input Modules		
Model	Description	
SDM-INT8	Eight-channel interval timer	
SDM-SW8A	Eight-channel, switch closure module	
LLAC4	Four-channel, low-level ac module	

#### E.3.3 Serial I/O Modules — List

Serial I/O peripherals expand and enhance input capability and condition serial signals.

TABLE 186: Serial I/O Modules List		
Model Description		
SDM-SIO1	One-channel I/O expansion module	
SDM-SIO4	Four-channel I/O expansion module	
SDM-IO16	16-channel I/O expansion module	

## E.3.4 Vibrating Wire Input Modules — List

Vibrating wire input modules improve the measurement of vibrating wire sensors. CDM modules require the SC-CPI interface module to connect to the CR3000 datalogger.

TABLE 187: Vibrating Wire Input Modules		
Model	Description	
CDM-VW300	Two-channel dynamic VSPECT vibrating wire measurement device	
CDM-VW305	Eight-channel dynamic VSPECT vibrating wire measurement device	
AVW200 Series	Two-channel static VSPECT vibrating wire measurement device	

## E.3.5 Passive Signal Conditioners — List

Signal conditioners modify the output of a sensor to be compatible with the CR3000.

#### E.3.5.1 Resistive-Bridge TIM Modules — List

TABLE 188: Resistive Bridge TIM <sup>1</sup> Modules		
Model	Description	
4WFBS120	120 $\Omega$ , four-wire, full-bridge TIM module	
4WFBS350	350 $\Omega$ , four-wire, full-bridge TIM module	
4WFBS1K	1 k $\Omega$ , four-wire, full-bridge TIM module	
3WHB10K	10 kΩ, three-wire, half-bridge TIM module	
4WHB10K	10 kΩ, four-wire, half-bridge TIM module	
4WPB100	100 Ω, four-wire, PRT-bridge TIM module	
4WPB1K	1 kΩ, four-wire, PRT-bridge TIM module	
<sup>1</sup> Teriminal Input Module		

### E.3.5.2 Voltage Divider Modules — List

TABLE 189: Voltage Divider Modules		
Model Description		
VDIV10:1	10:1 voltage divider	
VDIV2:1	2:1 voltage divider	
CVD20	Six-channel 20:1 voltage divider	

#### E.3.5.3 Current-Shunt Modules — List

TABLE 190: Current-Shunt Modules	
Model	Description
CURS100	100 ohm current-shunt module

### E.3.5.4 Transient Voltage Suppressors — List

TABLE 191: Transient Voltage Suppressors	
Model	Description
16980	Surge-suppressor kit for UHF/VHF radios
14462	Surge-suppressor kit for RF401 radio & CR206 datalogger
16982	Surge-suppressor kit for RF416 radio & CR216 datalogger

TABLE 191: Transient Voltage Suppressors		
Model	Description	
16981	Surge-suppressor kit for GOES transmitters	
6536	4-wire surge protector for SRM-5A	
4330	2-wire surge protector for land-line telephone modems	
SVP48	General purpose, multi-line surge protector	

### E.3.6 Terminal Strip Covers — List

Terminal strips cover and insulate input terminals to improve thermocouple measurements.

TABLE 192: Terminal-Strip Covers	
Datalogger	Terminal-Strip Cover Part Number
CR6	No cover available
CR800	No cover available
CR1000	17324
CR3000	18359

### E.4 PLC Control Modules — Lists

#### Related Topics:

- PLC Control Overview (p. 91)
- PLC Control Modules Overview (p. 430)
- PLC Control Modules Lists (p. 607)
- Switched Voltage Output Specifications
- Switched Voltage Output Overview (p. 62)
- Switched Voltage Output Details (p. 424)
- Current Source and Sink Limits (p. 424)

### E.4.1 Digital-I/O Modules — List

Digital I/O expansion modules expand the number of channels for reading or outputting or 5 Vdc logic signals.

TABLE 193: Digital I/O Modules	
Model	Description
SDM-IO16	16-channel I/O expansion module

### E.4.2 Continuous-Analog Output (CAO) Modules — List

CAO modules enable the CR3000 to output continuous, adjustable voltages that may be required for strip charts and variable-control applications. The CR3000 has

built-in CAO channels. Expansion modules are required only if additional capacity is needed.

TABLE 194: Continuous-Analog Output (CAO) Modules	
Model	Description
SDM-AO4A	Four-channel, continuous analog voltage output
SDM-CVO4	Four-channel, continuous voltage and current analog output

## E.4.3 Relay-Drivers — List

Relay drivers enable the CR3000 to control large voltages.

TABLE 195: Relay-Drivers — Products	
Model	Description
A21REL-12	Four relays driven by four control ports
A6REL-12	Six relays driven by six control ports / manual override
LR4	Four-channel latching relay
SDM-CD8S	Eight-channel dc relay controller
SDM-CD16AC	16-channel ac relay controller
SDM-CD16S	16-channel dc relay controller
SDM-CD16D	16-channel 0 or 5 Vdc output module
SW12V	One-channel 12 Vdc control circuit

### E.4.4 Current-Excitation Modules — List

Current excitation modules are usually used with the 229-L soil matric potential blocks.

TABLE 196: Current-Excitation Modules	
Model	Description
CE4	Four-channel current excitation module
CE8	Eight-channel current excitation module

## E.5 Sensors — Lists

#### Related Topics:

- Sensors Quickstart (p. 37)
- Measurements Overview (p. 67)
- Measurements Details (p. 335)
- Sensors Lists (p. 609)

Most electronic sensors, regardless of manufacturer, will interface with the CR3000. Some sensors require external signal conditioning. The performance of some sensors is enhanced with specialized input modules.

## E.5.1 Wired-Sensor Types — List

The following wired-sensor types are available from Campbell Scientific for integration into CR3000 systems.

TABLE 197: Wired Sensor Types	
Air temperature	Pressure
	Roadbed water content
Relative humidity	Snow depth
Barometric pressure	Snow water equivalent
Conductivity	Soil heat flux
Digital camera	Soil temperature
Dissolved oxygen	Soil volumetric water content
Distance	Soil volumetric water content profile
	Soil water potential
Electrical current	Solar radiation
Electric field (Lightning)	Strain
Evaporation	Surface temperature
Freezing rain and ice	Turbidity
Fuel moisture and temperature	Visibility
Geographic position (GPS)	Water level and stage
Heat, vapor, and CO <sub>2</sub> flux	Water flow
Leaf wetness Net radiation	Water quality
ORP / pH	Water sampler
Precipitation	Water temperature
Present weather	Wind speed / wind direction

#### E.5.2 Wireless-Network Sensors — List

Wireless sensors use the Campbell wireless sensor (CWS) spread-spectrum radio technology. The following wireless sensor devices are available.

TABLE 198: Wireless Sensor Modules	
Model	Description
CWB100 Series	Radio-base module for datalogger.
CWS220 Series	Infrared radiometer
CWS655 Series	Near-surface volumetric soil water- content sensor
CWS900 Series	Configurable, remote sensor-input module

TABLE 199: Sensors Types Available for Connection to CWS900		
Air temperature	Relative humidity	
Dissolved oxygen	Soil heat flux	
Infrared surface temperature	Soil temperature	
Leaf wetness	Solar radiation	
Pressure	Surface temperature	
Quantum sensor	Wind speed / wind direction	
Rain		

## E.6 Cameras — List

A camera can be an effective data gathering device. Campbell Scientific cameras are rugged-built for reliable performance at environmental extremes. Images can be stored automatically to a Campbell Scientific datalogger and transmitted over a variety of Campbell Scientific comms devices.

TABLE 200: Cameras	
Model	Description
CC640	Digital camera

## E.7 Data Retrieval and Comms Peripherals — List

#### Related Topics:

- Data Retrieval and Comms Quickstart (p. 40)
- Data Retrieval and Comms Overview (p. 80)
- Data Retrieval and Comms Details (p. 466)
- Data Retrieval and Comms Peripherals Lists (p. 610)

Many comms devices are available for use with the CR3000 datalogger.

### E.7.1 Keyboard/Display — List

#### Related Topics:

- Keyboard/Display Overview (p. 84)
- Keyboard/Display Details (p. 483)
- Keyboard/Display List (p. 611)
- Custom Menus Overview (p. 85)

TABLE 201: Datalogger Keyboard/Displays <sup>1</sup>	
Datalogger Model	Compatible Keyboard Displays
CR6	CR1000KD <sup>2</sup> , CD100, CD295
CR800	CR1000KD <sup>2</sup> , CD100, CD295
CR850	Integrated keyboard display, CR1000KD <sup>2</sup> , CD100, CD295
CR1000	CR1000KD <sup>2</sup> , CD100, CD295
CR3000	Integrated keyboard display, CR1000KD <sup>2</sup> (requires special OS), CD100 (requires special OS),CD295

<sup>&</sup>lt;sup>1</sup> Keyboard displays are either integrated into the datalogger or communicate through the **CS I/O** port.

### E.7.2 Hardwire, Single-Connection Comms Devices — List

TABLE 202: Hardwire, Single-Connection Comms Devices	
Model	Description
SC32B	Optically isolated <b>CS I/O</b> to PC RS-232 interface (requires PC RS-232 cable)
SC929	CS I/O to PC RS-232 interface cable
SC-USB	Optically isolated <b>RS-232</b> to PC USB cable
17394	RS-232 to PC USB cable (not optically isolated)
10873	RS-232 to RS-232 cable, nine-pin female to nine-pin male
SRM-5A with SC932A	CS I/O to RS-232 short-haul telephone modems
SDM-CAN	Datalogger-to-CANbus Interface

 $<sup>^2</sup>$  The CR1000KD can be mounted to a surface by way of the two #4-40 x 0.187 screw holes at the back.

TABLE 202: Hardwire, Single-Connection Comms Devices	
Model	Description
	Fiber optic modem. Two required in most installations.

## E.7.3 Hardwire, Networking Devices — List

TABLE 203: Hardwire, Networking Devices	
Model	Description
MD485	RS-485 multidrop interface

### E.7.4 TCP/IP Links — List

TABLE 204: TCP/IP Links — List	
Model	Description
RavenX Series	Wireless, cellular, connects to <b>RS-232</b> port, PPP/IP key must be enabled to use CR3000 IP stack.
NL240	Wireless network link interface, connects to <b>CS I/O</b> port.
NL201	Network link interface, connects to CS I/O port.

Connects to <b>Peripheral</b> port. Uses the CR3000 IP stack. Includes CF card slot.
Connects to <b>Peripheral</b> port. Uses the CR3000 IP stack. No CF card slot.

## E.7.5 Telephone Modems — List

TABLE 205: Telephone Modems	
Model	Description
COM220	9600 baud
COM320	9600 baud, synthesized voice
RAVENX Series	Cellular network link

### E.7.6 Private-Network Radios — List

TABLE 206: Private-Network Radios		
Model	Description	
RF401 Series	Spread-spectrum, 100 mW, CS I/O connection to remote CR3000 datalogger. Compatible with RF430.	
RF430 Series	Spread-spectrum, 100 mW, USB connection to base PC. Compatible with RF400.	
RF450	Spread-spectrum, 1 W	
RF300 Series	VHF / UHF, 5 W, licensed, single-frequency	

### E.7.7 Satellite Transceivers — List

TABLE 207: Satellite Transceivers	
Model	Description
ST-21	Argos transmitter
TX320	HDR GOES transmitter
DCP200	GOES data collection platform

# E.8 Data Storage Devices — List

### Related Topics:

- Memory Overview (p. 93)
- Memory Details (p. 442)
- Data Storage Devices List (p. 613)
- TABLE: Info Tables and Settings: Memory (p. 575)

Data-storage devices allow you to collect data on-site with a small device and carry it back to the PC ("sneaker net").

Campbell Scientific mass-storage devices attach to the CR3000 CS I/O port.

TABLE 208: Mass-Storage Devices	
Model	Description
SC115	2 GB flash memory drive (thumb drive)

CF card storage-modules attach to the CR3000 peripheral port. Use only industrial-grade CF cards  $16~\mathrm{GB}$  or smaller.

TABLE 209: CF Card Storage Module	
Model Description	
CFM100	CF card slot only
NL115	Network link with CF card slot

## E.9 Datalogger Support Software — List

### Related Topics:

- Datalogger Support Software Quickstart (p. 41)
- Datalogger Support Software Overview (p. 91)
- Datalogger Support Software Details (p. 432)
- Datalogger Support Software Lists (p. 614)

Software products are available from Campbell Scientific to facilitate CR3000 programming, maintenance, data retrieval, and data presentation. Starter software (table Starter Software (p. 614)) are those products designed for novice integrators. Datalogger support software products (table Datalogger Support Software (p. 614)) integrate CR3000 programming, comms, and data retrieval into a single package. LoggerNet clients (table LoggerNet Clients (p. 616)) are available for extended applications of LoggerNet. Software-development kits (table Software-Development Kits (p. 617)) are available to address applications not directly satisfied by standard software products. Limited support software for iOS, Android, and Linux applications are also available.

**Note** More information about software available from Campbell Scientific can be found at *www.campbellsci.com*.

### E.9.1 Starter Software — List

Short Cut, PC200W, and VisualWeather are designed for novice integrators but still have features useful in advanced applications.

TABLE 210: Starter Software		
Model	Description	
Short Cut	Easy-to-use CRBasic-programming wizard, graphical user interface; PC, Windows® compatible.	
PC200W Starter Software	Easy-to-use, basic datalogger support software (p. 535) for direct comms connections, PC, Windows® compatible.	
VisualWeather	Easy-to use datalogger support software specialized for weather and agricultural applications, PC, Windows® compatible.	

## E.9.2 Datalogger Support Software — List

PC200W, PC400, RTDAQ, and LoggerNet provide increasing levels of power required for integration, programming, data retrieval and comms applications. Datalogger support software (p. 91) for iOS, Android, and Linux applications are also available.

TABLE 211: Datalogger Support Software		
Software	Compatibility	Description
PC200W Starter Software	PC, Windows	Basic datalogger support software for direct connect.
PC400	PC, Windows	Mid-level datalogger support software. Supports single dataloggers over most comms options.
LoggerNet	PC, Windows	Top-level datalogger support software. Supports datalogger networks.
LoggerNet Admin	PC, Windows	Advanced <i>LoggerNet</i> for large datalogger networks.
LoggerNet Linux	Linux	Includes LoggerNet Server for use in a Linux environments and LoggerNet Remote for managing the server from a Windows environment.
RTDAQ	PC, Windows	Datalogger support software for industrial and real time applications.
VisualWeather	PC, Windows	Datalogger support software specialized for weather and agricultural applications.
LoggerLink	iOS and Android	Datalogger support software for iOS and Android devices. IP connection to datalogger only.

### E.9.2.1 LoggerNet Suite — List

The *LoggerNet* suite features a client-server architecture that facilitates a wide range of applications and enables tailoring software acquisition to specific requirements.

TABLE 212: LoggerNet Suite — List <sup>1,2</sup>		
Software	Description	
LoggerNetAdmin	Admin datalogger support software	
LNLinux	Linux based LoggerNet server	
LoggerNetRem	Enables administering to LoggerNetAdmin via TCP/IP from a remote PC.	
LNDB	LoggerNet database software	
LoggerNetData	Generates displays of real-time or historical data, post-processes data files, and generates reports. It includes <i>Split</i> , <i>RTMC</i> , <i>View Pro</i> , and <i>Data Filer</i> .	
PC-OPC	Campbell Scientific OPC Server. Feeds datalogger data into third-party, OPC-compatible graphics packages.	
PakBus Graph	Bundled with <i>LoggerNet</i> . Maps and provides access to the settings of a PakBus network.	
RTMCPro	An enhanced version of <i>RTMC</i> . <i>RTMC Pro</i> provides additional capabilities and more flexibility, including multi-state alarms, email-on-alarm conditions, hyperlinks, and FTP file transfer.	
RTMCRT	Allows viewing and printing multi-tab displays of real-time data. Displays are created in <i>RTMC</i> or <i>RTMC Pro</i> .	
RTMC Web Server	Converts real-time data displays into HTML files, allowing the displays to be shared via an Internet browser.	
CSIWEBS	Web server. Converts RTMC and RTMC Pro displays into HTML.	
CSIWEBSL	Web server for Linux. Converts RTMC and RTMC Pro displays into HTML	

TABLE 212: LoggerNet Suite — List <sup>1,2</sup>		
Software	Description	

<sup>1</sup>Clients require that *LoggerNet* — purchased separately — be running on the PC.

### E.9.3 Software Tools — List

TABLE 213: Software Tools		
Software	Compatibility	Description
Network Planner	PC, Windows	Available as part of the LoggerNet suite. Assists in design of networks and configuration of network elements.
Device Configuration Utility (DevConfig)	PC, Windows	Bundled with PC400, LoggerNet, and RTDAQ. Also availble at no cost at www.campbellsci.com. Used to configure settings and update operating systems for Campbell Scientific devices.

## E.9.4 Software Development Kits — List

Software	Compatibility	Description
LoggerNet-SDK	PC, Windows	Allows software developers to create custom client applications that communicate through a LoggerNet server with any datalogger supported by LoggerNet. Requires LoggerNet.

<sup>&</sup>lt;sup>2</sup>RTMC-based clients require that *LoggerNet* or *RTDAQ* — purchased separately — be running on the PC.

TABLE 214: Software Development Kits		
Software	Compatibility	Description
LoggerNetS-SDK	PC, Windows	LoggerNet Server SDK. Allows software developers to create custom client applications that communicate through a LoggerNet server with any datalogger supported by LoggerNet. Includes the complete LoggerNet Server DLL, which can be distributed with the custom client applications.
JAVA-SDK	PC, Windows	Allows software developers to write Java applications to communicate with dataloggers.
TDRSDK	PC, Windows	Software developer kit for PC and Windows for communication with the TDR100 Time Domain Reflectometer.

# E.10 Power Supplies — List

### Related Topics:

- Power Input Terminals Specifications
- Power Supplies Quickstart (p. 39)
- Power Supplies Overview (p. 86)
- Power Supplies Details (p. 98)
- Power Supplies Products (p. 618)
- Power Sources (p. 99)
- Troubleshooting Power Supplies (p. 517)

Several power supplies are available from Campbell Scientific to power the CR3000.

## E.10.1 Battery / Regulator Combinations — List

**Read More** Information on matching power supplies to particular applications can be found in the Campbell Scientific Application Note "Power Supplies", available at <a href="https://www.campbellsci.com">www.campbellsci.com</a>.

TABLE 215: Battery / Regulator Combinations	
Model	Description
PS100	12 Ahr, rechargeable battery and regulator (requires primary source).
PS200	Smart 12 Ahr, rechargeable battery, and regulator (requires primary source).
PS24	24 Ahr, rechargeable battery, regulator, and enclosure (requires primary source).
PS84	84 Ahr, rechargeable battery, Sunsaver regulator, and enclosure (requires primary source).

### E.10.2 Batteries — List

TABLE 216: Batteries	
Model	Description
BPALK	D-cell, 12 Vdc alkaline battery pack
BP7	7 Ahr, sealed-rechargeable battery (requires regulator & primary source). Includes mounting bracket for Campbell Scientific enclosures.
BP12	12 Ahr, sealed-rechargeable battery (requires regulator & primary source). Includes mounting bracket for Campbell Scientific enclosures.
BP24	24 Ahr, sealed-rechargeable battery (requires regulator & primary source). Includes mounting bracket for Campbell Scientific enclosures.
BP84	84 Ahr, sealed-rechargeable battery (requires regulator & primary source). Includes mounting bracket for Campbell Scientific enclosures.

## E.10.2.1CR3000 Battery Bases — List

The CR3000 is supplied with a base option. Battery base options include either alkaline batteries or sealed rechargeable batteries. A third option is a simple protective base and the CR3000 is supplied power from an external source.

TABLE 217: CR3000 Battery Bases		
Model	Description	
10695 (-NB)	Base with no battery. An external 12 Vdc power supply must be used.	
10519 (-ALK)	Base with ten alkaline D-cell batteries.	
10518 (-RC)	Rechargeable base with two 6 Vdc, 7 Ahr, sealed-rechargeable batteries. Must be trickle charged with a primary source.	

# E.10.3 Regulators — List

TABLE 218: Regulators	
Model	Description
CH100	12 Vdc charging regulator (requires primary source)
CH200	12 Vdc charging regulator (requires primary source)

# E.10.4 Primary Power Sources — List

TABLE 219: Primary Power Sources		
Model	Description	
29796	24 Vdc 1.67 A output, 100 to 240 Vac 1 A input, 5 ft cable	
SP5-L	5 watt solar panel (requires regulator)	
SP10	10 watt solar panel (requires regulator)	
SP10R	10 watt solar panel (includes regulator)	
SP20	20 watt solar panel (requires regulator)	
SP20R	20 watt solar panel (includes regulator)	
SP50-L	50 watt solar panel (requires regulator)	
SP90-L	90 watt solar panel (requires regulator)	
DCDC18R	12 Vdc to 18 Vdc boost regulator (allows automotive supply voltages to recharge sealed, rechargeable batteries)	

## E.10.5 24 Vdc Power Supply Kits — List

TABLE 220: 24 Vdc Power Supply Kits	
Model	Description
28370	24 Vdc, 3.8 A NEC Class-2 (battery not included)
28371	24 Vdc, 10 A (battery not included)
28372	24 Vdc, 20 A (battery not included)

# E.11 Enclosures — List

TABLE 221: Enclosures — Products		
Model	Description	
ENC10/12	10 inch x 12 inch weather-tight enclosure (will not house CR3000)	
ENC12/14	12 inch x 14 inch weather-tight enclosure. Pre-wired version available.	
ENC14/16	14 inch x 16 inch weather-tight enclosure. Pre-wired version available.	
ENC16/18	16 inch x 18 inch weather-tight enclosure. Pre-wired version available.	
ENC24/30	24 inch x 30 inch weather-tight enclosure	
ENC24/30S	Stainless steel 24 inch x 30 inch weather-tight enclosure	

TABLE 222: Prewired Enclosures		
Model	Description	
PWENC12/14	Pre-wired 12 inch x 14 inch weathertight enclosure.	
PWENC14/16	Pre-wired 14 inch x 16 inch weathertight enclosure.	
PWENC16/18	Pre-wired 16 inch x 18 inch weathertight enclosure.	

# E.12 Tripods, Towers, and Mounts — List

TABLE 223: Tripods, Towers, and Mounts		
Model	Description	
CM106B	3 meter (10 ft) tripod tower, galvanized steel	
CM110	3 meter (10 ft) tripod tower, stainless steel	
CM115	4.5 meter (15 ft) tripod tower, stainless steel	
CM120	6 meter (20 ft) tripod tower, stainless steel	
UT10	3 meter (10 ft) free-standing tower, aluminum	
UT20	6 meter (20 ft) free-standing tower, aluminum, guying is an option	
UT30	10 meter (30 ft) free-standing tower, aluminum, guying is an option	
CM375	10 meter (30 ft) mast, galvanized and stainless steel, requires guying.	
CM300	0.58 meter (23 in) mast, stainless steel, free standing, tripod, and guyed options	
CM305	1.2 meter (47 in) mast, stainless steel, free standing, tripod, and guyed options	
CM310	1.42 meter (56 in) mast, stainless steel, free standing, tripod, and guyed options	

# **E.13** Protection from Moisture — List

TABLE 224: Protection from Moisture — Products		
Model	Description	
6714	Desiccant 4 Unit Bag (Qty 20). Usually used in ENC enclosures to protect the CR3000.	
A150-L	Single Sensor Terminal Case, Vented w/Desiccant.	
4091	Desiccant 0.75g Bag. Normally used with Sentek water content probes.	

25366	CS450, CS451, CS455, and CS456 Replacement Desiccant Tube. Normally used with CS4xx sensors.
10525	Desiccant and Document Holder, User Installed. Normally use with ENC enclosures.
3885	Desiccant 1/2 Unit Bag (Qty 50).
CS210	Enclosure Humidity Sensor 11 Inch Cable.

# Index

	Alternate Comms Protocols	468
•	Alternate Comms Protocols — Overview	
.csipasswd440	Alternate Start Concurrent Measurement	02
.csipasswa440	Command	263
1	Amperage	
1	Amperes (Amps)	
12 Volt Supply426	Analog	
12V Terminal		
,	Analog Input	
2	Analog Input Expansion	
2	Analog Input Modules	
24 Vdc Power Supply Kits — List621	Analog Input Modules — List	
	Analog Input Range	
5	Analog Measurement	
5 X 1, D' 505	Analog Measurements — Details	
5 Volt Pin	Analog Measurements — Overview	
5 Volt Supply	Analog Outnut	
50 Hz Rejection	Analog Output Modules	
5V Terminal	Analog Sensor	
5VoltLow567	Analog Sensor Cabling	
	Analog-to-Digital Conversion	
6		380, 529
60 Hz Rejection98, 340	AND Operator	206
00 112 1ejection	Anemometer	76
7	ANSI	530
1	API	88, 475
7999138	Argument Types	168
	Arithmatic	170
9	Arithmetic Operations	171
	Array	135, 144,
9 Pin Connectors305, 59	96	171, 548
	Assistance	5
A	Asynchronous Communication	62, 306
Abbreviations178	A-to-D	351, 367,
		380, 529
Ac	Attributes	
Ac Noise Rejection	Authoris	
<u> </u>	Auto Self-Calibration	162, 347,
Ac Sine Wave		351, 373,
529, 56	63	567
See 50 Hz Rejection	Auto Self-Calibration — Details	
Accuracy — Resistance Measurements371	Auto Self-Calibration — Overview	
Accuracy, Precision, and Resolution563	Auto Self-Calibration Process	
Address	Automatic Calibration	
Address — Modbus	Automatic Calibration Sequence	
Address — PakBus	Automobile Power	
Address — FakBus	AutoRange	380, 381
Addressing (ModbusAddr)479		
Adjusting Charging Voltage	В	
Adjusting Charging Voltage	D1 D-44-	40.00
Advanced Programming Techniques181	Backup Battery	
Alkaline-Battery Base102	Basics — Network Planner	
Alkanne-Dattery Dase102	Batteries — List	019

Battery / Regulator Combinations — List		Cameras — List	. 610
Battery Backup		CAO	,
Battery Connection		Capturing CRBasic Code	. 32
Battery Test	518	Capturing Events	
Baud		Card Bytes Free	
Baud Rate	306, 308,	Card Status	. 567
	567	Care	. 89, 497
Beacon	530, 567	CE Compliance	. 95
Beginner Software	44, 46	Character Set	. 85, 483
Big Endian	306, 307,	Charging Circuit	. 521, 522
	601	Charging Regulator with Solar Panel Test	. 519
Binary	531	Charging Regulator with Transformer Test.	. 521
Binary Control	428	Circuit	. 368, 419,
Binary Format			431
Binary Runtime Signature		Clients	. 616
Bit Shift Operators		CLK/HS Pin	. 595
Bitwise Comparison		Clock Accuracy	
Board Revision Number	567	Clock Synchronization	
BOOL8		Closed Interval	
	206, 531	Code	
Bool8 Data Type	,	Coil	
Boolean		Collecting Data	
5001 <b>04</b> 11	507, 531	COM Port Connection	
BOOLEAN Data Type	/	Commands - SDI-12	
Bridge		Comment	
Bridge — Quarter-Bridge Shunt		Common Mode	
Bridge Measurement		Common Mode Null	
Buffer Depth		Comms	
Buffer Size		Commis	82, 466
Burst Mode		Comms Hardware — Overview	
Byte Translation		Comms Memory Errors	
Byte Translation	313	Comms Protocols	
C			
C		Communicating with Multiple PCs	
Cable Length	342 421	Communication	
Cabling Effects — Details		C	466, 516
Cabling Effects — Overview		Communication Encryption	
CAL Files		communication Ports	
Calculating Power Consumption		Communication Ports — Overview	
Calculations		Communications Memory Errors	
Calibration		Communications Memory Free	
Cantitation	230, 347,	CompactFlash	
	230, 347, 373	~ " =	492
Calibration Daglaraund		Compile Errors	
Calibration — Background Calibration — Error			513
		Compile Program	
Calibration — Field		Compile Results	
Calibration — Field - Example		CompileResults	
Calibration — Field - Offset		Compiling: Conditional Code	
Calibration — Field - Slope / Offset		Component-Built Relays	
Calibration — Field - Zero		Compression	. 123, 433
Calibration — Field Calibration Slope Only		Concatenation	. 329
Calibration — Manual Field Calibration		Concepts	. 563
Calibration — One-Point Field Calibration		Conditional Compile	
Calibration Two-Point Field Calibration.		Conditional Output	
Callback		Conditioning Circuit	
	531, 542	Configure Display	

Configure HyperTerminal	316	CS I/O Communication Port	595
Connect Comms	44	CS I/O Port	64, 65, 534,
Connect External Power Supply	43		595
Connect Internal Power Supply	43	Current	424
Connection	38, 42, 59	Current Excitation	73
Conserving Bandwidth	466	Current Excitation Cabling	421
Conserving Program Memory		Current Loop Sensor	66, 72, 380
Constant	135, 147,	Current Measurements — Details	380
	148, 533	Current Measurements — Overview	72
Constant — Predefined	148	Current Sourcing Limit	426, 428
Constant Conversion	173	Current-Excitation Modules — List	
Continuous Analog Out	426, 430	Current-Shunt Modules — List	606
Continuous-Analog Out (CAO Terminal)	426	Custom Display	486
Continuous-Analog Output (CAO)		Custom HTTP Web Server	
Modules — List	607	Custom Menu	85, 86
Continuous-Regulated (5V Terminal)	426	Custom Menus — Overview	85
Continuous-Unregulated Voltage (12V		CVI	534
Terminal)	426		
Control	62, 426, 430	D	
Control I/O	95, 533		
Control Instructions	550	Data Acquisition System — Sensor	
Control Output Expansion	430	Data Acquisition Systems — Quickstart	
Control Peripheral		Data bits	
Control Port		Data Collection	
Conversion	173	Data Display	
Converting Modbus 16-Bit to 32-Bit Long	gs482	Data File Formats	
Converting TOB3 Files with CardConvert		Data File Formats in CR3000 Memory	
CPI Port and CDM Devices — Details		Data Fill Days	
CPI Port and CDM Devices — Overview		Data Format	
CPU	446, 533;	Data Format on Computer	
Drive	446	Data Input: Array-Assigned Expression	
CPU Drive Free	567	Loading Large Data Sets	
cr	307	Data Monitoring	
CR1000KD	58, 86, 222,	Data Output: Calculating Running Average	
	483, 611;	Triggers and Omitting Samples	
PakBus Settings		Two Intervals in One Data Table	,
Set Time / Date	494	Using Data Type Bool8	
CR10X	156, 319	Using Data Type NSEC	
CR23X	319	Wind Vector	211;
CR3000 Battery Bases — List	619	Writing High-Frequency Data to	
CR3000 Module	38	Memory Cards	
CR3000 Power Requirement	99	Data Point	
CR3000 Setup — Details	112	Data Preservation	
CR3000 Setup — Overview		Data Record Size	
CR510		Data Recovery	
CRBasic Editor	132	Data Retrieval	
CRBasic Instructions (Modbus)	478	Data Retrieval and Comms — Details	
CRBasic Program		Data Retrieval and Comms — Overview	
CRBasic Program — Setup Tools		Data Retrieval and Comms — Quickstart	40
CRBasic Programming — Details		Data Retrieval and Comms Peripherals —	
CRBasic Programming — Overview		List	
CRD: Drive		Data Storage	
	534	Data Storage — Trigger	
Create Send-Text File	319	Data Storage Devices — List	
Create Text-Capture File		Data Table	
Creating and Editing Powerup ini			153, 177,

	201, 453,	Digital I/O	62, 67, 95,
	488	-	428
Data Table Header	. 174	Digital Register	477
Data Table Name	. 135, 567	Digital-I/O Modules — List	
Data Table SRAM	•	Dimension	
Data Type		Dimensioning Numeric Variables	
2 1 J P	171, 172,	Dimensioning String Variables	
	206	Diode OR Circuit	
Data Type — Bool8		Direct with Adapter to PC	
		Disable Variable	
Data Type — LONG		Disable variable	
Data Type — NSEC		DisableVar	202, 506
Data Type Format			
Data Types, NAN, and ±INF		Display	
Datalogger — Overview		Display — Custom	
Datalogger — Quickstart		Displaying Data: Custom Menus — Details.	
Datalogger Support Software		DNP3	
Datalogger Support Software — Details		DNP3 — Details	
Datalogger Support Software — List		DNP3 — Overview	
Datalogger Support Software — Overview.	. 90	DNS	
Datalogger Support Software — Quickstart	. 41	Documentation	133
Dataloggers — List	. 603	Drive USR	567
DataType — UINT2		DTE	64, 536, 537
Date			547
dc	. 536	Duplex	307
de Excitation	. 425	Durable Setting	
DCE		5	-
2 0 2	547	E	
Debugging		L	
Declaration		Earth Ground	66, 106, 537
Declaration — Modbus		Edge Counting	
		Edge Timing	
Declarations (Modbus Programming)		Edit File	
Declaring Aliases and Units		Edit Program	
Declaring Arrays		Editor	
Declaring Constants		Editor Short Cut	
Declaring Data Tables		Email	
Declaring Data Types		EMF	
Declaring Flag Variables			
Declaring Incidental Sequences		Enclosures Dataile	
Declaring Local and Global Variables		Enclosures — Details	
Declaring Subroutines		Enclosures — List	
Declaring Variables		Encryption	
Default HTTP Web Server	. 470	Endianness	
Default.CR1	. 119		601
Default.cr3 File	. 119	Engineering Units	
Desiccant	. 89, 112, 536	Environmental Enclosures	
DevConfig	. 113, 114,	Erase Memory	567
S	536	Error	337, 343,
DevConfig — Setup Tools	. 113		358, 359,
Device Setup			367, 507,
DHCP			517
Diagnosis — Power Supply		Error — Analog Measurement	109, 110,
Dial Sequence		<b>.</b>	507
Dial String		Error — Programming	505, 506
Differential		Error — Soil Temperature Thermocouple	
Differential Measurements — Overview		Error — Thermocouple	
Differential inteasurements — Overview	. / 1	<u>r</u>	360, 363,
			, ,

	364, 365,	FAT	445
	366	Field	538
ESD	66, 537, 538,	Field Calibration	79, 229
	562	Field Calibration — Details	229
ESD Protection	107, 108	Field Calibration — Overview	79, 420
ESS	538	Field Calibration CAL Files	229
Ethernet Port	66	Field Calibration Examples	232
Ethernet Settings		Field Calibration Numeric Monitor	
Example		Procedures	230
100 Ω PRT in Four-Wire Basic	, ,	Field Calibration Programming	
Circuit (PT100 / Basic		Field Calibration Strain Examples	
Resistance())	290:	Field Calibration Wizard Overview	
100 Ω PRT in Four-Wire Full	, ,	FieldCal — Multiplier	
Bridge with Current Excitati	on	FieldCal — Multiplier Only	
(PT100 / Full-Bridge		FieldCal — Offset	
Resistance())	296.	FieldCal — Zero	
100 Ω PRT in Four-Wire Full	250,	FieldCal() Offset (Opt 1) Example	
Bridge with Voltage Excitati	on	FieldCal() Slope (Opt 3) Example	
(PT100 / BrFull())		FieldCal() Slope and Offset (Opt 2)	210
$100 \Omega$ PRT in Four-Wire Half	203,	Example	238
Bridge with Voltage Excitati	on	FieldCal() Zero Basis (Opt 4) Example	236
(PT100 / BrHalf4W())		8 10 30	243
$100 \Omega$ PRT in Three-Wire Half	277,	FieldCal() Zero or Tare (Opt 0) Example	
Bridge with Voltage Excitati	on	FieldCalStrain() Quarter-Bridge Shunt	233
(PT100 / BrHalf3W())		Example	246
		•	
Example Program	320	FieldCalStrain() Quarter-Bridge Zero FieldCalStrain() Shunt Calibration	247
Excitation			242
Excitation Reversal		Concepts	243
		FieldCalStrain() Shunt Calibration	244
Executable Code Signatures		Example	244
Executable CPU: Files — Setup Tools		FIGURE: Ac power line noise rejection	240, 200
Executable File Run Priorities		techniques 8 10 30	
Execution		File Attributes	
Execution and Task Priority		File Compression	
Execution Interval		File Control	
Execution Time		File Display	
Execution Timing		File Edit	
Expression		File Encryption	
	171, 172,	File Management	
	175, 538	File Management in CR3000 Memory	
Expression — Logical		File Management Q & A	
Expression — String		File Names	
Expressions in Arguments		File System Errors	
Expressions with Numeric Data Types		Files Manager	
Extended Commands — SDI-12		Fill and Stop Memory	
External Alkaline Power Supply		Final-Storage Data	
External Power Supply		Final-Storage Memory	
External Power Supply Installation		Firmware	
External Signal Conditioner	110	Fixed Voltage Range	381
		Flag	142, 143,
F			478
	00	Floating Point	
Factory Calibration — Overview		Floating-Point Arithmetic	170
Factory Calibration or Repair Procedure		Floating-Point Math, NAN, and ±INF	507
Factory Defaults — Installation		Format — Numerical	
False	174	Formatting Drives	456

Forward	31	Hidden Files	88
FP2 Data Format	599	Hiding Files	441
Fragmentation	445	High-Frequency Measurements	408
Frequency	75, 404	Holding Register	477
Frequency Measurement Q & A	410	HTML	472, 542
Frequency Resolution	409	HTTP	470, 542
FTP	540	HTTP Settings	567
FTP Client	470	HTTP Web Server	
FTP Server	469	Humidity	89, 112
FTP Settings	567		
Full Duplex	540	I	
Full Memory Reset	455		
Full-Bridge	367	I/O Port	
Full-Memory Reset		I/O Ports	
Function Codes — Modbus		IEEE4	137, 542
Functions (with a capital F)		Include File	
1 /		INF	
G		Infinite	506
G		Info Tables and Settings	567;
Garbage	541	Accessed by Keyboard/Display	572;
Gas-discharge Tubes	107	Communications	574;
General Procedure (PRT)	275	Frequently Used	569;
Generator		Keywords	
global variable		Other	
Glossary		Programming	
Glossary of Modbus Terms		Info Tables and Settings — Setup Tools	
Glossary of Serial I/O Terms		Info Tables and Settings Descriptions	
Gradient		Info Tables and Settings Directories	
Graphs		Information Services	
Ground		Initial Inspection	
	108, 382,	Initialize	
	541	Initializing Variables	
Ground Loop	*	Initiate Comms	
Ground Looping in Ionic Measurements			542
Ground Potential Differences		Initiating Comms (Callback)	·
Ground Potential Error		Input Channel	
Ground Reference Offset		Input Error Examples: Type K	07
Grounding — Details		Thermocouple @ 1300°C	362.
Grounding — Overview		Type T Thermocouple @ 45°C	
Groundwater Pump Test		Input Expansion Module	
Groundwater Fump Test		Input Filters and Signal Attenuation	
Gzip Compression		Input Limits	
Ozip Compression	123	Input Range	
TT			
Н		Input Register	
Half Bridge	367	Input Reversal	
Half Duplex		Input/Output Instructions	
Handshake, Handshaking		Inserting Comments into Program	
Hardware Setup		Inserting String Characters	
Hardwire, Networking Devices — List		Installation	
Hardwire, Single-Connection Comms	012	Instruction	
Devices — List	611	Instrumentation Amplifier	
HELLO		Integer	
Hello Exchange		Integrated Batteries	
Hertz		Integrated Keyboard/Display	
		Integration	
Hexadecimal	1 <del>4</del> 7	Intermediate Memory	156

Intermediate Storage	536	Low 12-V Counter	567
Internal Battery	40, 90	Low Profile (No Battery) Base	106
Internal Battery — Details	497	Low-Level Ac	407, 431
Internal Battery — Overview		Low-Level Ac Input Modules — Overview	w431
Internal Battery — Quickstart	40	Low-Level Ac Measurements — Details	407
Interrupt	62	LSB	306, 307,
Interval	535		601
Introduction	31, 304		
Inverse Format Registers - Modbus		M	
Ionic Sensor		112	
IP	468, 473,	Maintenance	,
	543, 567	Maintenance — Details	
IP - Modbus		Maintenance — Overview	89
IP Address		Manage Files	
IP Gateway		Manual Data-Table Reset	455
IP Information		Manual Organization	31
		Manually Initiated	545
J		Marks and Spaces	307
U		Mass Storage Device	122, 447,
Junction Box	367	-	460, 545,
			613
K		Mass-Storage Device	80
		Math	
Keyboard/Display	84, 86, 222,	Mathematical Operation	•
	483	MD5 digest	
Keyboard/Display — Details	483	ME Pin	
Keyboard/Display — List	611	MeasOff	
Keyboard/Display — Overview	84	Measured Raw Data	
		Measurement	
$\mathbf{L}$		Excite, Delay, Measure	
		Fast Analog Voltage	
Lapse		RTD, PRT, PT100, PT1000	
Large Program		Measurement — Error	
Lead		Measurement — Instruction	
Lead Length		Measurement — Op Codes	
lf		Measurement — Peripheral	
Lightning	38, 89, 107,	Measurement — Sequence	
	537	Measurement — Synchronizing	
Lightning Protection	108	Measurement — Time	
Lightning Rod	108	Measurement — Timing	
Line Continuation	135	Measurement Accuracy Example	
Line, Maximum length 512 characters	135	Measurement and Control Peripherals —	334, 403
Linear Sensor	79	Details	420
Lithium Battery	40, 498, 567		429
Little Endian	306, 307,	Measurement and Control Peripherals —	604
	601	List	604
Local Variable	146, 544	Measurement and Control Peripherals —	0.6
Lock		Overview	
LoggerNet		Measurement and Data Storage Processing	
LoggerNet Suite — List		Measurement Theory (PRT)	
Logic		Measurements — Details	
Logical Expression		Measurements — Overview	
Logical Expressions		Measurements and NAN	
Long Lead		Memory	
Loop		Memory — Details	
Loop Counter		Memory — Free	
Loop Counter		Memory — Overview	93

Memory — Size	567	NIST	546
Memory Card 10 30	81, 154, 217,	Node	546, 567
	460, 492,	Noise	98, 337, 339
	532		340, 341,
Memory Card (CRD: Drive)	447;		363
Drive) — Overview	81	Nominal Power	86
Memory Cards and Record Numbers	453	Not-A-Number	506
Memory Conservation		NSEC Data Type	137, 208,
•	171, 314	••	546
Memory Drives — On-Board	445	NSEC Options	208
Memory Q & A		NULL Character	
Memory Reset		Null Modem	
MemoryFree			547
Menu — Custom		Numbers of Records	158
Messages		Numerical Format	
Micro-Serial Server	473	Numerical Formats	
Milli		Trainerreal Formats	1 17
Millivoltage Measurement		0	
Miscellaneous Features		O	
Modbus		Ohm	547
Wiodous	478, 545	Ohms Law	547
Modbus — Details		OID	
Modbus — Overview		One Statement on Multiple Lines	
Modbus over IP		One-Point Calibrations (Zero or Offset)	
Modbus Over RS-232 7/E/1		On-line Data Transfer	
		Op Codes	
Modbus Security Modbus TCP/IP		Open Input Detect	
		Open Inputs	
Modbus Terminology	4/0	Operating System	
Modem Hangup Sequence		Operating System (OS) — Details	
Modem/Terminal		Operation	
Moisture	·	OR Diode Circuit	
Monitoring Data		OR Operator	
Mounting		OS Date	
MSB			
	601	OS Signature	
Multi-meter		OS Update with DevConfig Send OS Tab	124
Multiple Lines		OS Update with External Memory and	127
Multiple Statements		PowerUp.ini File	
Multiple Statements on One Line		OS Update with File Control	
Multiplexers		OS Update with Send Program Command.	
Multi-Statement Declarations	150	OS Version	
mV	546	FYIs — OS2	
		Output	
N		Output Array	
		Output Processing and NAN	
Name		OutputOpt	
Names in Arguments		OutputOpt Parameters	
NAN		Overrange	
	381, 382,	Overrun	
	506, 546	Overview	
NAN and ±INF		Overview — Network Planner	
Neighbor		Overview — Power Supply	517
Neighbor Device			
Network Planner	114	P	
Network Planner — Setup Tools	114		
Nine-Pin Connectors	305 596	Packet Size	567

PakBus	82, 548	Power Consumption	99
PakBus Address	567	Power In Terminals	63
PakBus Comms — Overview	82	Power Out Terminals	63
PakBus Information	567	Power Sources	99
PakBus Instructions	440	Power States	597
PakBus Over TCP/IP and Callback	474	Power Supplies — Details	98
Panel Temperature	356, 358,	Power Supplies — List	618
•	359, 365,	Power Supplies — Overview	
	367, 567	Power Supplies — Quickstart	
Parameter	·	Power Terminals	
Parameter Type	168	Powering Sensor	
Pass-Code Lockout		Power-up	
Passive Signal Conditioners — List		Powerup.ini File — Details	
Password		PPP	
Passwords		PPP — Dial Response	
Pay Attention to Specifications		PPP — Settings	
PC Program		PPP — Username	
PC Support Software		PPP Information	
PC200W		PPP Interface	
PC200W Software Setup	*	PPP IP Address	
PC400		PPP Password	
PCCard (Memory Card) Management		Precautions	
PCM		Precision	
PDA Support		Predefined Constant	
PDM		Predefined Constants	
Period Average		Preserve Data	
r criod Average	419, 549	Preserve Settings	
Period Averaging — Details	,	Preserving Data at Program Send	
Period Averaging — Details Period Averaging — Overview		Pressure Transducer	
PeripheralPeripheral		Primary Power Sources — List	
Peripheral Port		Primer	
Piezometer		Print Device	
Pin Out		Print Device	
Pin Outs		Priority	
Ping		D'- 4 N 4 1-D 1' I'- 4	165
D' (ID)	567	Private-Network Radios — List	
Ping (IP)		Probe	
Pipeline Mode		Procedure: (PC200W Step 1)	
Platinum Resistance Thermometer		(PC200W Step 5)	
PLC		(PC200W Step 6)	
PLC Control — Details		(PC200W Steps 11 to 12)	
PLC Control — Overview		(PC200W Steps 13 to 14)	
PLC Control Modules — Lists		(PC200W Steps 2 to 4)	
PLC Control Modules — Overview		(PC200W Steps 7 to 10)	
Poisson Ratio		(Short Cut Step 8)	
Polar Sensor		(Short Cut Steps 1 to 5)	
Polarity		(Short Cut Steps 13 to 14)	
Polarity Reversal	350	(Short Cut Steps 6 to 7)	
Polarized Sensor		(Short Cut Steps 9 to 12)	
Polynomial — Thermocouple		Process Time	
Port		Processing — Output	
Port Status and Status Table		Processing — Wind Vector	
Power	43, 44, 63,	Processing Instructions	
	95, 100, 424,	Processing Instructions — Output	535
	426	Processor	95
Power Budget	99, 270, 271	ProgErrors	

Program		87	Programming — Capturing Events	. 181
Program —	- Alias	148	Programming — Conditional Output	. 182
	- Array		Programming — Groundwater Pump Test	. 183
Program —	Compile Errors	505, 511,	Programming — Multiple Scans	. 191
	-	513	Programming — Running Average	. 197
Program —	Constant	147	Programming — Scaling Array	
Program —	Data Storage Processing		Programming Access to Data Tables	. 177
Instruc	tion	167	Programming Expression Types	
Program —	Data Table	151	Programming for Modbus	
Program —	Data Type	137	Programming Instructions	. 167
Program —	DataInterval() Instruction	155	Programming Resource Library	. 181
Program —	DataTable() Instruction	154	Programming Syntax	
Program —	Declaration	135, 150	Programming to Use Signatures	. 179
Program —	Dimension	141	Protection	
Program —	Documenting	134	Protection from Moisture — Details	. 112, 497
Program —	Execution	160	Protection from Moisture — List	. 622
	Expression		Protection from Moisture — Overview	. 89
Program —	Field Calibration	229	Protection from Voltage Transients —	
Program —	Floating Point Arithmetic	170	Overview	. 89
Program —	Large	466	Protocols	. 306, 466
Program —	Mathematical Operation	171	Protocols Supported	. 95
Program —	Measurement Instruction	167	PRT Callendar-Van Dusen Coefficients	. 300
Program —	- Modbus	477	PTemp	. 356
Program —	Name in Parameter	168	Pulse	. 67, 551
Program —	Output Processing	157	Pulse Count	
Program —	Overrun	510, 567	Pulse Count Reset	. 188
Program —	Parameter Type	168	Pulse Input	. 75, 76
Program —	Pipeline Mode	161	Pulse Input Channels	. 75
Program —	Resource Library	229	Pulse Input Expansion	. 431
Program —	Runtime Errors	506, 511,	Pulse Input Modules	. 431
		513	Pulse Input Modules — List	. 604
Program —	- Scan	163	Pulse Measurement Terminals	. 407
Program —	- Scan Priority	165	Pulse Measurement Tips	
	- Sequential Mode		Pulse Measurements — Details	. 404
Program —	Slow Sequence	164	Pulse Measurements — Overview	. 74
Program —	- Structure	129, 130	Pulse Sensor	
	- Subroutine		Pulse Sensor Cabling	. 421
	- SubScan		Pulse Sensor Wiring	. 75
	Task Priority		PulseCountReset Instruction	
	Timing		Pulse-Duration Modulation	
	· Unit		Pulses Measured	
	- Variable		Pulse-Width Modulation	
	d OS File Compression Q and A	A 433	PWM	. 62, 428
	ompiles / Does Not Run			
	tly		Q	
	oes Not Compile		_	242 267
Program Ed	litor	46	Quarter-Bridge	
Program Er	rors	511, 513,	Quarter-Bridge Shunt	
		567	Quarter-Bridge Zero	
_	and Reset		Quickstart	
	gnature		Quickstart Tutorial	. 37
	atements			
	ructure		R	
	d Settings		Rain Gage	421
Programmi	ng		Range Limit	
		133	range Limit	. 13/

Ratiometric	371		516, 553,
RC Resistor Shunt	245		567
Read Only Variables	442	RS-232 — Overview	78
Reading Inverse Format Modbus Register		RS-232 and TTL — Details	419
Reading Smart Sensors — Details		RS-232 Communication Port	596
Reading Smart Sensors — Overview		RS-232 Pin Out	596
Real-Time Custom		RS-232 Port	64
Real-Time Tables and Graphs		RS-232 Ports	
Record Number		RS-232 Power States	597
Reference Junction		RS-232 Recording	
Reference Temperature	,	RS-232 Sensor	
1	359, 364,	RS-232 Sensor Cabling	
	365, 366,	RTDAQ	
	367	RTU	
Reference Voltage		Run/Stop Program	
RefTemp		Running Average	
<b>T</b>	359, 365,	Runtime Errors	
	366, 367		513
Regulator		Runtime Signatures	
Regulators — List		RX	
Relay		RX Pin	
Relay Driver		IVI I III	
Relay-Drivers — List		S	
Relays and Relay Drivers		S	
Reliable Power		Sample Rate	553
Requirement — Power		Satellite Transceivers — List	613
Reset		Saving and Restoring Configurations —	
Resetting the CR3000		Installation	128
Resistance		SCADA	
Resistance Measurements — Details		Scaling Array	189
Resistance Measurements — Overview		Scan	
Resistive Bridge		Scan (execution interval)	
Resistive-Bridge TIM Modules — List		Scan Interval	
Resistor		Scan Priorities in Sequential Mode	
Resolution		Scan Time	
Resolution — Concept		Scan() / NextScan	•
-		Scientific Notation	
Resolution — Data Type	563	SDE Pin	
Resolution — Definition		SDI-12	
Resolution — Definition	563	551 1 <b>2</b>	554
Desclution Edge Timing		SDI-12 Command	
Resolution — Edge Timing		SDI-12 Extended Command	
		SDI-12 Extended Command Support	
Resolution — Thermocouple		SDI-12 Measurement	
Retrieving Data		SDI-12 Measurements	
Reverse Polarity		SDI-12 Ports	
•		SDI-12 Power Considerations	
RevEx		SDI-12 Recorder Mode	
Ring Line (Pin 3)		SDI-12 Recording	
Ring Memory		SDI-12 Sensor	
RING Pin		SDI-12 Sensor Cabling	
Ringing		SDI-12 Sensor Caomig	
RMS		SDI-12 Sensor Support — Details	
Route Filter		SDI-12 Sensor Support — Overview	
Router		SDI-12 Sensor Support — Overview	
RS-232			
	78, 95, 308,	SDI-12 Transparent Mode Commands	256

SDM	62, 67, 554	Server	616
SDM Port	66	Set Time and Date	494
Sealed Rechargeable-Battery Base	103	Setting	493
Security		Setting — PakBus	494
Security — Details	436	Setting — Via CRBasic	118
Security — Overview		Settings	493
Seebeck Effect	554	Settings — Passwords	441
Self-Heating and Resolution	303	Settings — Resident Files	118
Semaphore		Settling Error	
Send		Settling Time	
Send Program and Collect Data	49	S	343, 344,
Sending CRBasic Programs			346, 421
Sensor		Setup	
Sensor — Analog		Setup Tasks	
Sensor — Bridge		Short Cut	
Sensor — Thermocouple		Short Cut Programming Wizard	
Sensor — Voltage		Shunt Calibration	
Sensor Power		Shunt Zero	
Sensor Support		Shut Down Sequence	
Sensor-Input Modules — List		SI Système Internationale	
Sensors — Quickstart		Signal Conditioner	
Sensors — Lists		Signal Settling Time	
Sequence		Signatured Packet	
Sequence — Dial		Signatures	
Sequence — Incidental		Example Programs	
Sequence — Modem Hangup		Signatures — Program	
Sequence — Shut Down		Signatures — Runtime	
Sequence — Shut Down		Signatures — System	
		Sine Wave	
Sequential Mode Serial			
		Single-Ended Measurement	
Serial — Comms Sniffer Mode		Cin-1- Fr. 1-1 M D-f	555
Serial — I/O		Single-Ended Measurement Reference	
Serial — Input		Single-Ended Measurements — Overview.	
Serial — Input Expansion		Single-Statement Declarations	
Serial — Number		Skipped Records	
Serial — Port		Skipped Scan	
Serial — Port Connection			556, 567
Serial — Sensor		Skipped Slow Scan	
Serial — Server		Skipped System Scan	
Serial — Talk Through Mode		SkippedRecord	
Serial I/O: Capturing Serial Data		SkippedScan	
SDI-12 Sensor Support — Details		SkippedSystemScan	
Serial I/O Application Testing		SlowSequence / EndSequence	
Serial I/O CRBasic Programming		SMTP	
Serial I/O Example I		SNMP	
Serial I/O Example II		SNP	
Serial I/O Input Programming Basics	311	Software	
Serial I/O Memory Considerations		Software — Beginner	44, 46
Serial I/O Modules — Details		Software Development Kits — List	617
Serial I/O Modules — List		Software Tools — List	
Serial I/O Output Programming Basics	312	Soil Temperature Thermocouple	110
Serial I/O Programming Basics	309	Solar Panel	519
Serial I/O Q & A		SP	308
Serial I/O Translating Bytes		Spark Gap	107
Serial Port Pinouts		Specifications	
Serial Talk Through and Comms Watch		Square Wave	

SRAM	442, 446	Synchronizing Measurements — Overvie	ew79
Standard Deviation	216	Synchronizing Measurements in a	
Star 4 (*4) Parameter Entry Table	550	Datalogger Network — Details	422
Start Bit	308	Synchronizing Measurements in a	
Start Time	567	Datalogger Network — Overview	80
Start Up Code	567	Synchronizing Measurements in the	
Starter Software		CR3000 — Overview	80
Starter Software — List	614	Synchronous	558
State	62, 556, 597	System Time	
State Measurement	62	Système Internationale	555
Statement Aggregation		•	
Status		T	
Status Table	569		
Status Table as Debug Resource	510	Table	
Status Table WatchdogErrors		Table — Data Header	174
Stop bits		Table Overrun	
Storage Media		TableFile() with Option 64	218
Strain		TableFile() with Option 64 Programming	219
Strain Calculation		TableFile() with Option 64 Q & A	220
Strain Measurements — Details		TableFile() with Option 64 Replaces	
Strain Measurements — Overview		CardOut()	218
String Concatenation		Task	161, 558
String Expression		Task Priority	160
String Expressions		TCP	468, 473
String NULL Character		TCP Information	567
String Operation		TCP Port	
String Operations		TCP Settings	
String Operators		TCP/IP	
Structure — Program		TCP/IP — Details	
Subroutine		TCP/IP — Overview	
Subroutines		TCP/IP Information	
SubScan		TCP/IP Instructions	
SubScan() / NextSubScan		TCP/IP Links — List	
*		Telephone Modems — List	
Supply		Telnet	
	99, 270, 517, 518	Telnet Settings	
Crymmant Caftryana		Term: ac	
Support Software		accuracy	-
Supported Modbus Function Codes		amperes (A)	
Supporting Products — List		analog	
Surge Protection		argument	
SW-12 Port		ASCII / ANSI	
	567	asynchronous	
Switch Closure and Open-Collector	410	A-to-D	
Measurements		AWG	
Switched 12 Vdc (SW12) Port		baud rate	
	567		
Switched Voltage Output — Overview	62	beacon	
Switched-Current Excitation (IX		big endian	
Terminals)	425	binary	
Switched-Unregulated Voltage (SW12		BOOL8	
Terminal)		boolean	
Switched-Voltage Excitation		boolean data type	
Switched-Voltage Output — Details	424	burst	
Synchronizing Measurement in the		calibration wizard	
CR3000 — Details		Callback	
Synchronizing Measurements — Details	422	CardConvert software	531;

CDM/CPI	532;	final-storage data	. 539;
CF	532;	final-storage memory	. 539;
code	532;	Flash	. 540;
coils (00001 to 09999)	477;	FLOAT	. 540;
Collect / Collect Now button	532;	FP2	. 540;
COM port	532;	frequency domain	. 540;
command		frequency response	
command line		FTP	
CompactFlash		full-duplex	,
compile		garbage	
conditioned output		global variable	
connector		ground	
constant		ground currents	
control I/O	-	half-duplex	
CoraScript		handshake, handshaking	
CPU			
	-	hello exchange	
CDD pain Editor		hertz (Hz)	
CRBasic Editor	334;	holding registers 40001 to 49999	
CRBasic Editor Compile, Save	52.4	HTML	
and Send		HTTP	
CRD		IEEE4	
CS I/O		Include file	,
CVI	· · · · · · · · · · · · · · · · · · ·	INF	
data bits		initiate comms	
data cache		input registers 30001 to 39999	
data output interval		input/output instructions	
data output processing instructions	3. 535;	instruction	
data output processing memory	536;	integer	. 543;
data point	535;	intermediate memory	. 543;
data table	535;	IP	. 543;
datalogger support software	535;	IP address	. 543;
dc	536;	IP trace	. 543;
DCE	536;	isolation	. 543;
desiccant	536;	JSON	. 543;
DevConfig software	536;	keep memory	. 543;
DHCP		keyboard/display	
differential		leaf node	
digital registers 10001 to 19999	· · · · · · · · · · · · · · · · · · ·	lf	
Dim		little endian	
dimension	-	local variable	
DNS		LONG	
DTE		loop	
duplex		loop counter	
duty cycle		LSB	
earth ground		mains power	
engineering units		manually initiated	
ESD		marks and spaces	
ESS	*		
	· · · · · · · · · · · · · · · · · · ·	mass storage device	
excitation		MD5 digest	
execution interval		milli	
execution time		Modbus	
expression		modem/terminal	
FFT		modulo divide	
File Control		MSB	
File Retrieval tab		multi-meter	
fill and stop memory	539;	multiplier	. 546;

mV	546;	SDM	554;
NAN	546;	Seebeck effect	554;
neighbor device	546;	semaphore (measurement	•
NIST		semaphore)	554;
node		send	
NSEC	546;	sequential mode	
null-modem		serial	
Numeric Monitor		Settings Editor	
offset	•	Short Cut software	
ohm	•	SI (Système Internationale)	
Ohm's Law	-	signature	
on-line data transfer	-	simplex	
operating system	•	single-ended	
output		skipped scans	
output array		slow sequence	
output interval		SMTP	
output processing instructions.		SNP	
output processing memory		SP	
PakBus		start bit	
PakBusGraph software		state	
parameter		Station Status command	
period average		stop bit	
peripheral		string	
ping		support software	
pipeline mode		1.1	
		swept frequency	
Poisson ratio		synchronous	
ppm (resistor specification)		system time	
precision		table	
Preserve Variables	-	task	
print device		TCP/IP	
print peripheral		Telnet	
processing instructions		terminal	
program control instructions		terminal emulator	
Program Send command		thermistor	
program statement	-	throughput rate	
Public	·	time domain	
pulse		TLS	
ratiometric		toggle	
record	,	TTL	
regulator		TX	
resistance		UINT2	
resistor	•	unconditioned output	
resolution	·	UPS	
ring line		URI	-
ring memory		URL	
ringing	553;	user program	
RMS	553;	USR; drive	560;
router	,	Vac	
RS-232		variable	
RS-232C		variable memory	561;
RTU / PLC		Vdc	
RX	308;	volt meter	561;
sample rate		voltage divider	561;
scan interval	553;	volts	
scan time	554;	VSPECT	562;
SDI-12	554;	watchdog timer	

weather-tight		Troubleshooting — Auto Self-Calibration	
web API	562;	Errors	
wild card	563;	Troubleshooting — Basic Procedure	503
XML	563	Troubleshooting — Communications	516
Гегт. Reset Tables command	552	Troubleshooting — CRBasic Programs	
Гегт. user program	560	Troubleshooting — Data Recovery	
Ferminal Emulator		Troubleshooting — Error Sources	
Ferminal Emulator Menu		Troubleshooting — Essential Tools	
Ferminal Input Module		Troubleshooting — Miscellaneous Errors	
Γerminal Strip Covers — List		Troubleshooting — Operating Systems	
Ferminal-Input Modules		Troubleshooting — Power Supplies	
Γerminals Configured for Control		Troubleshooting — Power Supply	
Fermination Character		Troubleshooting — Rebooting	
Ferms		Troubleshooting — SDI-12	
Fext Signature		Troubleshooting — Solar Panel	
Thermistor		Troubleshooting — Status Table	
Thermstor Thermocouple		Troubleshooting — Using Logs	
i nermocoupie	360, 361,	Troubleshooting — Using Terminal Mode.	
	364, 366,		
	367 367	Troubleshooting (Modbus)	400
Chammananan la Erman Analysis		Troubleshooting Power Supplies —	510
Thermocouple Error Analysis		Examples	310
Гhermocouple Measurement		Troubleshooting Power Supplies —	£17
	356, 359,	Overview	31/
Γ11- M	360	Troubleshooting Power Supplies —	£10
Thermocouple Measurements — Details		Procedures	
Гhroughput		True	
Γime		TTL	
Fime Keeping — Details		TTL logic	
Γime Keeping — Overview		TTL Recording	
Γime Skew		Tutorial	
E: G.	553	Measuring a Thermocouple	
Γime Stamps		Tutorial Exercise	
Fime Zone		TVS	
Γime-Domain Measurement		Two-Point Calibrations (gain and offset)	
Γimer Input on I/O NAN Conditions		TX	
Γimestamp		TX Pin	
n	567	Typography	32
Γiming			
ΓΙΜs		$\mathbf{U}$	
Γips — Fast Analog Voltage		UINT2	137 560
Гoggle			
Γools — Setup		Uninterruptable Power Supply (UPS)	
Гransducer		UPS	
Γransformer		LICD. Duive	560
Γransient		USB: Drive	
	510, 537,		460, 545,
	562	II CE-4 1D C I- 4'	613
Гransient Voltage Suppressors — List	606	Use of External Reference Junction	
Гransparent Mode — SDI-12		Use of Multiple Scans	
Гrigger — Output		User Program	
Гrigger Variable		Using Variable Pointers	
Triggers		USR	
ГrigVar		Drive	
Гripods, Towers, and Mounts — List		USR Drive	
Troubleshooting	503, 567	USR Drive Free	
		UTC Offset	56/

V	
Vac	561
Variable	
v dildole	171, 561
Variable Array	,
Variable Initialization	.146
Variable Out of Bounds	
VarOutOfBounds	
Vdc	
Vector	.214, 215
Vehicle Power Connection	
Vehicle Power Connections	
Verify Interval	
Vibrating Wire Input Module	.432
Vibrating Wire Input Modules — List Vibrating Wire Measurements — Details	.605
Vibrating Wire Measurements — Details	.417
Vibrating Wire Measurements —	
Overview	.77
Vibrating Wire Modules	.432
Viewing Data	.44, 49
Visual Weather	.615
Volt Meter	.561
Voltage and Current Excitation —	
Overview	
Voltage Calibration Error!	
Voltage Divider Modules — List	
Voltage Excitation	
Voltage Measurement	
Voltage Measurement Limitations	
Voltage Measurement Mechanics	
Voltage Measurement Quality	
Voltage Measurements	.507
Voltage Measurements — Details	.380
Voltage Measurements — Overview	
Volts	
Vulnerabilities	.437
w	
W	
Warning Message	.511
Warranty	
Watchdog Errors	
C	510, 514,
	517, 562,
	567, 569
Watchdog Timer	.562
Watchdoginfo.txt File	.515
Water Conductivity	
Weather Tight	
Web API	
Web API — Details	
Web Page Sequence	
Web Server	
What You Will Need	
Wheatstone Bridge	367

Wind Vector	212, 214,
	215
Wind Vector Processing	212
Wired-Sensor Types — List	
Wireless-Network Sensors — List	
Wiring	
6	421
Wiring Panel	.38. 39. 42.
	59, 356
Wiring Panel — Overview	,
Wiring Panel — Quickstart	
Write CRBasic Program with Short Cut	
Writing and Editing Programs	
Writing Program	
X	
XML	563
Z	
Zero	247
Zero Basis	
Zero Basis Point Calibration	

### **Campbell Scientific Companies**

#### Campbell Scientific, Inc.

815 West 1800 North Logan, Utah 84321 UNITED STATES

www.campbellsci.com • info@campbellsci.com

#### Campbell Scientific Africa Pty. Ltd.

PO Box 2450 Somerset West 7129 SOUTH AFRICA

www.campbellsci.co.za • cleroux@csafrica.co.za

#### Campbell Scientific Southeast Asia Co., Ltd.

877/22 Nirvana@Work, Rama 9 Road Suan Luang Subdistrict, Suan Luang District Bangkok 10250 THAILAND www.campbellsci.asia • info@campbellsci.asia

### Campbell Scientific Australia Pty. Ltd.

PO Box 8108 Garbutt Post Shop QLD 4814 AUSTRALIA

www.campbellsci.com.au • info@campbellsci.com.au

#### Campbell Scientific (Beijing) Co., Ltd.

8B16, Floor 8 Tower B, Hanwei Plaza 7 Guanghua Road Chaoyang, Beijing 100004 P.R. CHINA

www.campbellsci.com • info@campbellsci.com.cn

#### Campbell Scientific do Brasil Ltda.

Rua Apinagés, nbr. 2018 — Perdizes CEP: 01258-00 — São Paulo — SP BRASIL

www.campbellsci.com.br • vendas@campbellsci.com.br

#### Campbell Scientific Canada Corp.

14532 – 131 Avenue NW Edmonton AB T5L 4X4 CANADA

www.campbellsci.ca • dataloggers@campbellsci.ca

#### Campbell Scientific Centro Caribe S.A.

300 N Cementerio, Edificio Breller Santo Domingo, Heredia 40305 COSTA RICA

www.campbellsci.cc • info@campbellsci.cc

#### Campbell Scientific Ltd.

Campbell Park
80 Hathern Road
Shepshed, Loughborough LE12 9GX
UNITED KINGDOM
www.campbellsci.co.uk • sales@campbellsci.co.uk

#### Campbell Scientific Ltd.

3 Avenue de la Division Leclerc 92160 ANTONY FRANCE

www.campbellsci.fr • info@campbellsci.fr

#### Campbell Scientific Ltd.

Fahrenheitstraße 13 28359 Bremen GERMANY

www.campbellsci.de • info@campbellsci.de

#### Campbell Scientific Spain, S. L.

Avda. Pompeu Fabra 7-9, local 1 08024 Barcelona SPAIN

www.campbellsci.es • info@campbellsci.es

Please visit www.campbellsci.com to obtain contact information for your local US or international representative.