

INSTRUCTION MANUAL



LI200X-LC Pyranometer for MetData1

4/97

Copyright (c) 1994-1997
Campbell Scientific, Inc.

Warranty and Assistance

The **LI200X-LC PYRANOMETER FOR METDATA1** is warranted by CAMPBELL SCIENTIFIC, INC. to be free from defects in materials and workmanship under normal use and service for twelve (12) months from date of shipment unless specified otherwise. Batteries have no warranty. CAMPBELL SCIENTIFIC, INC.'s obligation under this warranty is limited to repairing or replacing (at CAMPBELL SCIENTIFIC, INC.'s option) defective products. The customer shall assume all costs of removing, reinstalling, and shipping defective products to CAMPBELL SCIENTIFIC, INC. CAMPBELL SCIENTIFIC, INC. will return such products by surface carrier prepaid. This warranty shall not apply to any CAMPBELL SCIENTIFIC, INC. products which have been subjected to modification, misuse, neglect, accidents of nature, or shipping damage. This warranty is in lieu of all other warranties, expressed or implied, including warranties of merchantability or fitness for a particular purpose. CAMPBELL SCIENTIFIC, INC. is not liable for special, indirect, incidental, or consequential damages.

Products may not be returned without prior authorization. The following contact information is for US and International customers residing in countries served by Campbell Scientific, Inc. directly. Affiliate companies handle repairs for customers within their territories. Please visit www.campbellsci.com to determine which Campbell Scientific company serves your country. To obtain a Returned Materials Authorization (RMA), contact CAMPBELL SCIENTIFIC, INC., phone (435) 753-2342. After an applications engineer determines the nature of the problem, an RMA number will be issued. Please write this number clearly on the outside of the shipping container. CAMPBELL SCIENTIFIC's shipping address is:

CAMPBELL SCIENTIFIC, INC.

RMA#_____

815 West 1800 North

Logan, Utah 84321-1784

CAMPBELL SCIENTIFIC, INC. does not accept collect calls.

LI200X-LC PYRANOMETER FOR METDATA1

1. GENERAL

The LI200X measures incoming solar radiation with a silicon photovoltaic detector mounted in cosine-corrected head. The detector outputs current; a shunt resistor in the sensor cable converts the signal from current to voltage, allowing the LI200X to be measured directly by Campbell Scientific dataloggers. The LI200X is calibrated against an Eppley Precision Spectral Pyranometer to accurately measure sun plus sky radiation. Do not use the LI200X under vegetation or artificial lights, because it is calibrated for the daylight spectrum (400 to 1100 nm).

During the night the LI200X may read slightly negative incoming solar radiation. This negative signal is caused by RF noise. Negative values may be set to zero in the datalogger program.

For more theoretical information on the silicon photovoltaic detector see Kerr, J. P., G. W. Thurtell, and C. B. Tanner: An integrating pyranometer for climatological observer stations and mesoscale networks. *J. Appl. Meteor.*, **6**, 688-694.

1.1 SPECIFICATIONS

Stability:	< ±2% change over a 1 year period
Response Time:	10 µs
Cosine Correction:	Cosine corrected up to 80°
Operating Temperature:	-40 to +65 °C
Temperature Dependence:	0.15% per °C
Relative Humidity:	0 to 100%
Detector:	High stability silicon photovoltaic detector (blue enhanced)
Sensor Housing:	Weatherproof anodized aluminum case with acrylic diffuser and stainless steel hardware
Size:	0.94" dia x 1.00" H (2.38 cm dia x 2.54 cm H)

Weight:	1 oz. (28 g)
Accuracy:	Absolute error in natural daylight is ±5% maximum; ±3% typical
Sensitivity:	0.2 kW m ⁻² mV ⁻¹
Linearity:	Maximum deviation of 1% up to 3000 W m ⁻²
Shunt Resistor:	Adjustable, 40.2 to 90.2 Ω, factory set to give the above sensitivity
Light Spectrum Waveband:	400 to 1100 nm

NOTE: The black outer jacket of the cable is Santoprene® rubber. This compound was chosen for its resistance to temperature extremes, moisture, and UV degradation. However, this jacket will support combustion in air. It is rated as slow burning when tested according to U.L. 94 H.B. and will pass FMVSS302. Local fire codes may preclude its use inside buildings.

2. INSTALLATION

To ensure accurate measurements, the LI200X should be mounted using LI2003S base/leveling fixture. This base incorporates a bubble level and three adjustment screws. The LI200X and base/leveling fixture are attached to a tripod or tower using one of three mounting configurations (see Figure 2-1 through 2-3).

The LI200X should be mounted such that it is never shaded by the tripod/tower or other sensors.

NOTE: Remove the red cap after installing the sensor. Save this cap for shipping or storing the sensor.

LI200X-LC PYRANOMETER FOR METDATA1

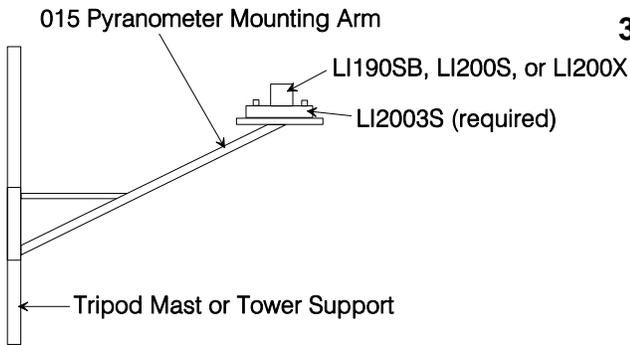


FIGURE 2-1. 015 Pyranometer Mounting Arm

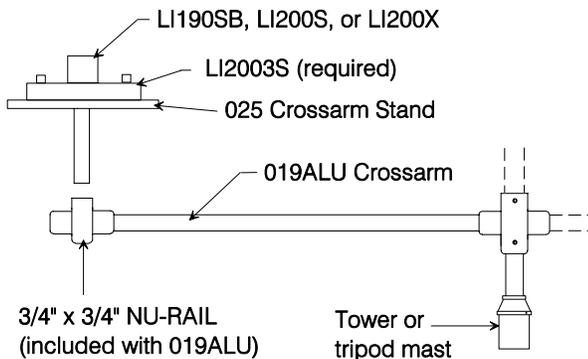


FIGURE 2-2. 025 Crossarm Stand and 019ALU Crossarm

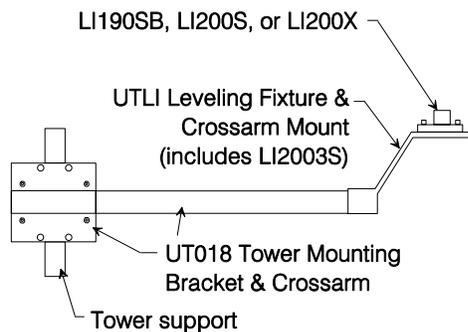


FIGURE 2-3. UTLI Leveling Fixture and Crossarm Mount and UT018 Tower Mounting Bracket and Crossarm

3. CONNECTION

The LI200X-LC is attached to the MetData1 connector #3. Open the MetData1 internal jumpers #2 and #3 as indicated in Figure 3-1.

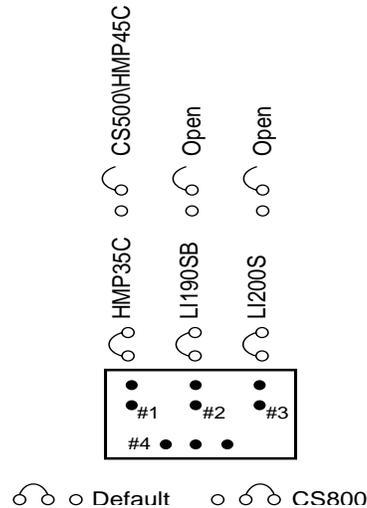


FIGURE 3-1. MetData1 Jumper Configuration

4. PROGRAMMING

NOTE: Information in this section is not necessary when programming the MetData1 with the Short Cut Program Builder software.

Solar radiation can be reported as an average flux density ($W m^{-2}$) or daily total flux density ($MJ m^{-2}$). The appropriate multipliers are listed in Table 4-1. Programming examples are given for both average and daily total solar radiation.

The output from the LI200X is $0.2 kW m^{-2} mV^{-1}$.

4.1 AVERAGE SOLAR RADIATION

Example 1 shows the program instructions used to measure the signal from the LI200X. A thirty minute average is calculated and stored in final storage.

TABLE 4-1. Multipliers Required for Average Flux and Total Flux Density in SI and English Units

<u>UNITS</u>	<u>MULTIPLIER</u>	<u>PROCESS</u>
W m ⁻²	200	Average
MJ m ⁻²	t * 0.0002	Total
kJ m ⁻²	t * 0.2	Total
cal cm ⁻² min ⁻¹	0.2 * (1.4333)	Average
cal cm ⁻²	t * 0.2 * (0.02389)	Total

t = datalogger execution interval in seconds

EXAMPLE 1. Sample Instructions used to Measure an Average Flux

```

;{CR10X}
;
*Table 1 Program
01:      10      Execution Interval (seconds)

01:  Volt (Diff) (P2)
    1:      1      Reps
    2:     22      ± 7.5 mV 60 Hz Rejection Range
    3:      3      DIFF Channel
    4:     1*      Loc [ W_m2   ]
    5:   200***    Mult
    6:      0      Offset

;Set negative values to zero.
;
02:  If (X<=>F) (P89)
    1:     1*      X Loc [ W_m2   ]
    2:      4      <
    3:      0      F
    4:     30      Then Do

03:  Z=F (P30)
    1:      0      F
    2:      0      Exponent of 10
    3:     1*      Z Loc [ W_m2   ]

04:  End (P95)

05:  If time is (P92)
    1:      0      Minutes (Seconds --) into a
    2:     30      Interval (same units as above)
    3:     10      Set Output Flag High (Flag 0)

06:  Real Time (P77)
    1:   0110      Day,Hour/Minute
    
```

LI200X-LC PYRANOMETER FOR METDATA1

07: Average (P71)
1: 1 Repts
2: 1* Loc [W_m2]

-Input Locations-
1 W_m2

* Proper entries will vary with program.

*** See Table 4-1 for alternative multipliers.

4.2 TOTAL SOLAR RADIATION

In Example 2 a daily total flux density is found. This total flux density is in $\text{MJ m}^{-2} \text{ day}^{-1}$. Negative values are set to zero before they are added to the running total.

4.2.1 Output Format Considerations

If the solar radiation is totalized in units of kJ m^{-2} , there is a possibility of overranging the output limits. The largest number that the datalogger can output to final storage is 6999 in low resolution and 99999 in high resolution (Instruction 78, Set Resolution).

Assume that the daily total flux density is desired in kJ m^{-2} . Assume an irradiance of 0.5 kW m^{-2} , the maximum low resolution output limit will be exceeded in just under four hours. This value was found by taking the maximum flux density the datalogger can record in low resolution and dividing by the total hourly flux density.

$$3.9 \text{ hr} = \frac{6999 \text{ kJ m}^{-2}}{(0.5 \text{ kJ m}^{-2} \text{ s}^{-1})(3600 \text{ s hr}^{-1})} \quad (1)$$

To circumvent this limitation, record an average flux (see Example 1). Then, during post processing, multiply the average flux by the number of seconds in the output interval to arrive at a output interval flux density. Sum the output interval totals over a day to find a daily total flux density.

Another alternative is to record total flux using the high resolution format (Instruction 78, see Datalogger manuals for details). The disadvantage of the high resolution format is that it requires four bytes of memory per data point, consuming twice as much memory as low resolution.

EXAMPLE 2. Sample Instructions used to Measure a Daily Total Flux Density with a CR10(X)/21X

```

;{CR10X}
;
*Table 1 Program
01:      10      Execution Interval (seconds)

01: Volt (Diff) (P2)
   1:      1      Reps
   2:     22      ± 7.5 mV 60 Hz Rejection Range
   3:      3      DIFF Channel
   4:     1*     Loc [ MJ_m2  ]
   5:     .002** Mult
   6:      0      Offset

;Set negative values to zero.
;
02: If (X<=>F) (P89)
   1:     1*     X Loc [ MJ_m2  ]
   2:      4      <
   3:      0      F
   4:     30     Then Do

03: Z=F (P30)
   1:      0      F
   2:      0      Exponent of 10
   3:     1*     Z Loc [ MJ_m2  ]

04: End (P95)

05: If time is (P92)
   1:      0      Minutes (Seconds --) into a
   2:    1440     Interval (same units as above)
   3:     10     Set Output Flag High (Flag 0)

06: Real Time (P77)
   1:    0110     Day,Hour/Minute

07: Totalize (P72)
   1:      1      Reps
   2:     1*     Loc [ MJ_m2  ]

```

-Input Locations-
1 MJ_m2

* Proper entries will vary with program.

** See Table 4-1 for alternative multipliers.

5. MAINTENANCE

On a monthly basis the level of the pyranometer should be checked. Any dust or debris on the sensor head should be removed. The debris can be removed with a blast of compressed air or with a soft bristle, camel hair brush. Check that the drain hole next to the surface of the sensor is free of debris.

CAUTION: Handle the sensor carefully when cleaning. Be careful not to scratch the surface of the sensor.

Recalibrate the LI200X every two years. Obtain an RMA number before returning the LI200X to Campbell Scientific, Inc. for recalibration.

6. CALIBRATION

LI200X pyranometers output a current that is proportional to the incoming solar radiation. Each LI200X has a unique calibration factor. A variable shunt resistor in the cable converts the current to the voltage measured by the datalogger. Campbell Scientific sets the shunt resistor so that the pyranometer outputs 5 mV kW⁻¹ m².

The resistor value is found using Ohms law. The resistance is found by dividing the desired output voltage by the calibrated current output. For example, a pyranometer with a calibration of 92 μA kW⁻¹ m², will have the resistor set to:

$$54.35 \Omega = 5 \text{ mV kW}^{-1} \text{ m}^2 / 0.092 \text{ mA kW}^{-1} \text{ m}^2.$$

Campbell Scientific Companies

Campbell Scientific, Inc. (CSI)

815 West 1800 North
Logan, Utah 84321
UNITED STATES
www.campbellsci.com
info@campbellsci.com

Campbell Scientific Africa Pty. Ltd. (CSAf)

PO Box 2450
Somerset West 7129
SOUTH AFRICA
www.csafrica.co.za
sales@csafrica.co.za

Campbell Scientific Australia Pty. Ltd. (CSA)

PO Box 444
Thuringowa Central
QLD 4812 AUSTRALIA
www.campbellsci.com.au
info@campbellsci.com.au

Campbell Scientific do Brazil Ltda. (CSB)

Rua Luisa Crapsi Orsi, 15 Butantã
CEP: 005543-000 São Paulo SP BRAZIL
www.campbellsci.com.br
suporte@campbellsci.com.br

Campbell Scientific Canada Corp. (CSC)

11564 - 149th Street NW
Edmonton, Alberta T5M 1W7
CANADA
www.campbellsci.ca
dataloggers@campbellsci.ca

Campbell Scientific Ltd. (CSL)

Campbell Park
80 Hathern Road
Shepshed, Loughborough LE12 9GX
UNITED KINGDOM
www.campbellsci.co.uk
sales@campbellsci.co.uk

Campbell Scientific Ltd. (France)

Miniparc du Verger - Bat. H
1, rue de Terre Neuve - Les Ulis
91967 COURTABOEUF CEDEX
FRANCE
www.campbellsci.fr
campbell.scientific@wanadoo.fr

Campbell Scientific Spain, S. L.

Psg. Font 14, local 8
08013 Barcelona
SPAIN
www.campbellsci.es
info@campbellsci.es